

DEKRA's commission No. : PKOL(W)/LODZ/33757/25/05/12
commission/ damage No. : 24/008703
Date of commission: 12-05-2025

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (NEW)
DEKRA Polska - współpraca O/Warszawa
mgr inż. Andrzej Szymkowiak
DEKRA Polska - O. Wrocław

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	jeeps
EC code (Eurotax)	0125119
Manufacturer	JEEP
Model	Grand Cherokee 16-20
Type / version	Gr. Cherokee 3.0 CRD Overland
Body type	KOM
Number of doors / seats	5/5
Curb weight [kg]	2328
Gross vehicle weight [kg]	2949
Wheelbase 1/2	2915
Engine type	Automatic ignition
Supercompression	turbocompressor with intercooler
Pollution reduction system	DPF
Emission standard	EURO 6
Engine capacity [ccm]	2987
Engine Power [hp/kW]	250/184
Gearbox	automatic 8- gear
Registration /record No.	CB141RJ
VIN / serial number	1C4RJFBM0GC460940
Date of first registration	10-01-2017
Date of next. tech. test	07-06-2025
Year of manufacture	2016 (year has been verified with the manufacturer's base)
Readout [km]	117 687 (read)
Body color / type of coating	black/METALIK

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	Pirelli, SCORPION VERDE A/S	265/50 R20 107V	3,0 mm
	left	Pirelli, SCORPION VERDE A/S	265/50 R20 107V	4,0 mm
back	right	Pirelli, SCORPION VERDE A/S	265/50 R20 107V	3,0 mm

left	Pirelli, SCORPION VERDE A/S	265/50 R20 107V	3,0 mm
------	--------------------------------	-----------------	--------

Standard equipment by Eurotax

- | | |
|---|---|
| 1. Adaptive Cruise Control | 42. Leather/wooden steering wheel |
| 2. Adjustable suspension, Air suspension | 43. Light Alloy wheels 20" |
| 3. Alarm | 44. Limited slip differential: other |
| 4. Antilock-Brake-System (ABS) | 45. Lumbar adjust driver electric, Lumbar adjust passenger electric |
| 5. Automated High-beam assist | 46. Other |
| 6. Automatic climate control | 47. Other |
| 7. Automatic headlight elevation control | 48. Other |
| 8. Bi-Xenon Head lamps | 49. Other |
| 9. Blind spot warning | 50. Other |
| 10. Bluetooth interface, Hands-free system, Voice control for audiosystem, Voice control for navigation system, Voice control for telephone | 51. Other |
| 11. Bord communication: other | 52. Other |
| 12. Bord entertainment: other accessories, Radio preparation | 53. Other |
| 13. CD-player, DAB radio, Navigation system, Radio | 54. Other, Rear-view mirror autodimming |
| 14. Child seat fixation | 55. Park Assistant |
| 15. Collision Warning System | 56. Park Assistant |
| 16. Door mirror with memory, Memory seat | 57. Power assisted brakes |
| 17. Door mirror(s) electrically adjustable in general, Door mirrors autodimming, Door mirrors electrically foldable, Door mirrors heated | 58. Power assisted brakes |
| 18. Double slide sunroof electric | 59. Power windows front, Power windows rear |
| 19. Driver airbag, Head airbags front, Head airbags rear, Passenger airbag, Side airbag driver, Side airbag driver and passenger | 60. Pre-Crash System |
| 20. Driver knee airbag | 61. Rain sensor |
| 21. Driver seat electrically adjustable, Memory seat, Passenger seat electrically adjustable | 62. Rear bench foldable in two separate parts |
| 22. ESP (Electronical Stabilizing Program) | 63. Rear seat heating |
| 23. Electric tailgate | 64. Rear view camera |
| 24. Exterior design: other | 65. Roof railing |
| 25. Exterior design: other | 66. Selectable driveline characteristics, Traction control |
| 26. Exterior design: other | 67. Servotronic |
| 27. Exterior thermometer, On board computer, Other | 68. Sport suspension |
| 28. Extra power outlet | 69. Steering wheel electrically adjustable |
| 29. Floor mat | 70. Steering wheel heated |
| 30. Fog lamps | 71. Steering wheel with gear-switches |
| 31. Full size spare wheel | 72. Telematic |
| 32. Headlamp wash | 73. Tinted rear windows |
| 33. Heated seat driver, Heated seat passenger | 74. Tyre pressure control (RDC) |
| 34. Hill descent control | 75. USB in |
| 35. Hill holder | 76. USB in |
| 36. Keyless go | 77. Uni-Lackierung |
| 37. LED Daytime running lights | 78. Vehicle immobilizer |
| 38. LED rear lights | 79. Ventilated front seat |
| 39. Lane control assistant | 80. Whiplash-protection-system |
| 40. Leather finish dashboard | 81. {TSC - system stabilizacji toru jazdy przyczepy} |
| 41. Leather upholstery | |

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

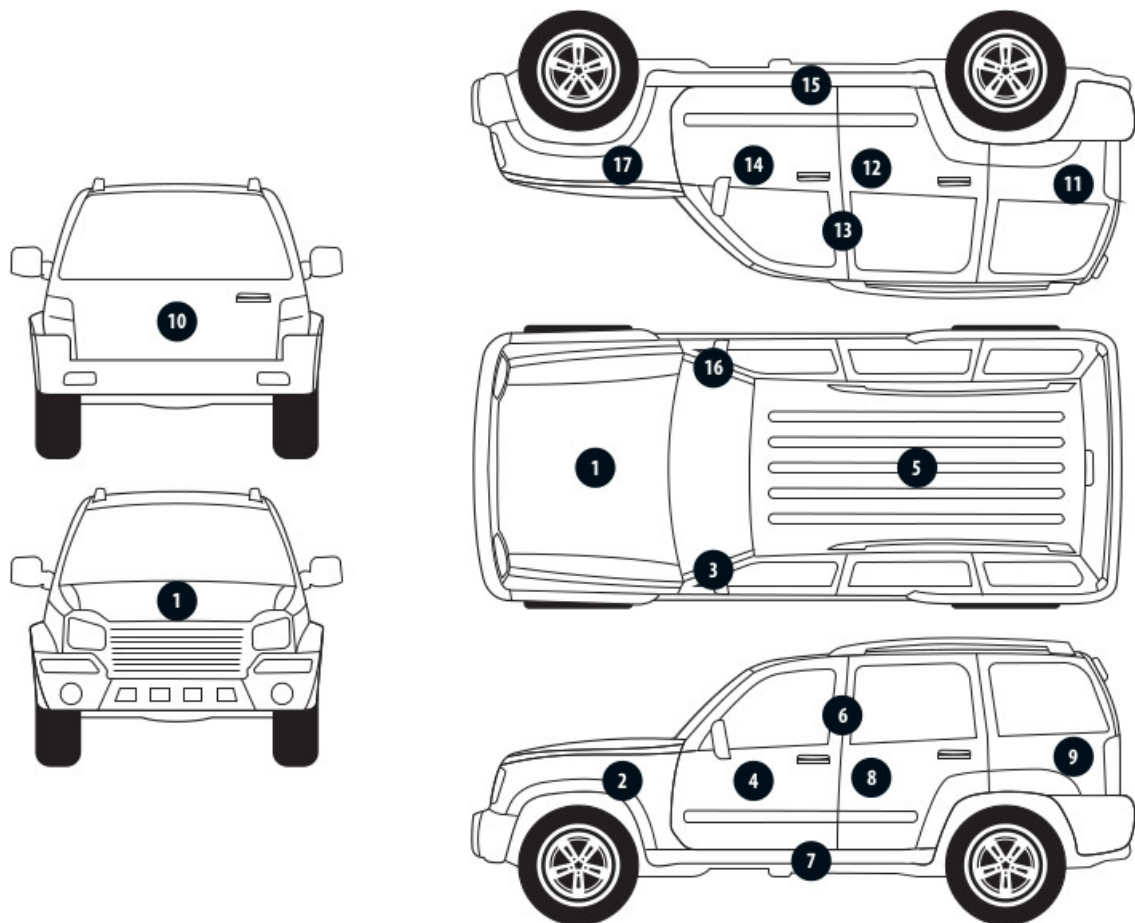
CorrectionsFirst registrationTyresOtherpodwyższona grubość powłoki lakierniczej/wcześniejsze naprawy -
stwierdzone braki, uszkodzenia (szacunkowo) -

Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 05-2025 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - due to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 19-05-2025

DEKRA's expert:
Kacper Sosnowski (NEW)
mgr inż. Andrzej Szymkowiak**Document issued electronically valid without signature.**

Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [µm]
1	Front cover	150 - 500
2	Left front fender	150 - 500
3	Left front pillar	150 - 500
4	Left front wall	150 - 500
5	Roof	150 - 500
6	Left middle pillar	150 - 300
7	Left side sill	150 - 300
8	Left rear wall	150 - 500
9	Left side wall	150 - 500
10	Cover/tailgate	150 - 500
11	Side right wall	150 - 500
12	Rear right door	150 - 500
13	Middle right pillar	150 - 200
14	Front right door	150 - 500
15	Right side sill	150 - 200
16	Right front pillar	150 - 500
17	Right front fender	150 - 500

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book was presented and its number is given below:

pusta książka serwisowa

Information concerning the origin of the vehicle

The vehicle purchased domestically from an authorized representative of the brand.

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below:

pojazd udostępniono w warunkach parkingowych

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

Anti-theft protection

fabryczne

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.
- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation**Kluczyki**

TAK

2

Expert comments - regarding valuation

Niesprawne przyciski funkcyjne w jednym z kluczyków, grot prawidłowy. Rysy na samochodzie. Pojazd posiada hak. Głośna praca drzwi tylnych prawych. Odpryski na szybie czołowej.

Baza danych CEP:

- 06.2023 Powstanie szkody istotnej

Rzeczoznawca dokonał oględzin pojazdu w warunkach parkingowych, co mogło ograniczyć pełną ocenę jego stanu technicznego. Dodatkowo, jeżeli jazda próbna została przeprowadzona (informacje w treści raportu), to wykonano ją w warunkach parkingowych, z niewielką prędkością, co może nie odzwierciedlać pełnych warunków eksploatacyjnych. Istnieje możliwość, że w innych okolicznościach ujawnią się dodatkowe uszkodzenia lub usterki, których nie można było wykryć podczas obecnych oględzin. Zalecamy zatem skorzystanie z możliwości oględzin pojazdu we własnym zakresie lub w Autoryzowanej Stacji Obsługi danej marki, co pozwoli na pełniejszą weryfikację stanu technicznego pojazdu przed udziałem w aukcji.

Restrictive disclaimer - regarding valuation

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.

Bok prawy z tyłu



Photo 6.

Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.

Próg lewy (widok od przodu)



Photo 12.

Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.

Spód pojazdu przód



Photo 14.

Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika



Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION



Photo 23.

Tabliczka znamionowa



Photo 24.

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe



Photo 28.

Widok z tylnej kanapy na deskę rozd.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.
Konsola środkowa

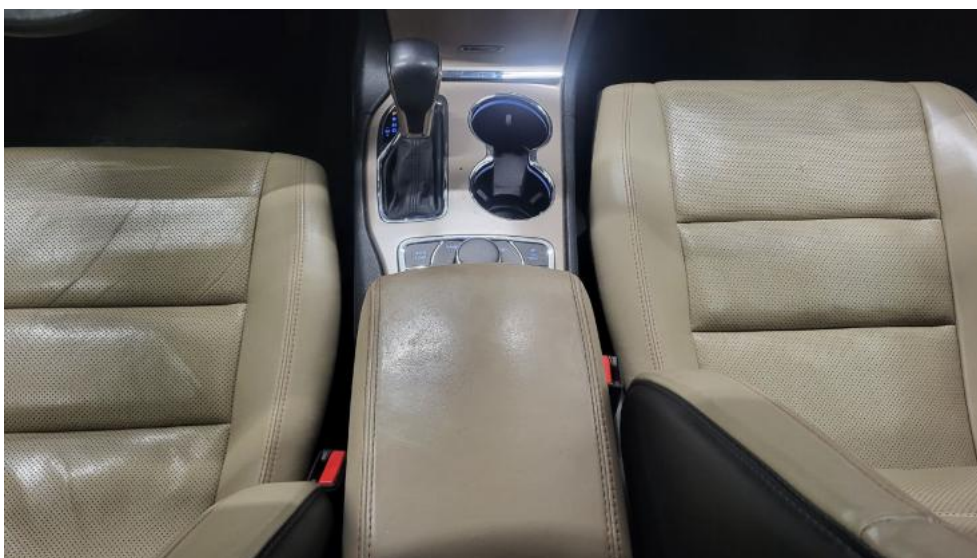


Photo 30.
Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION



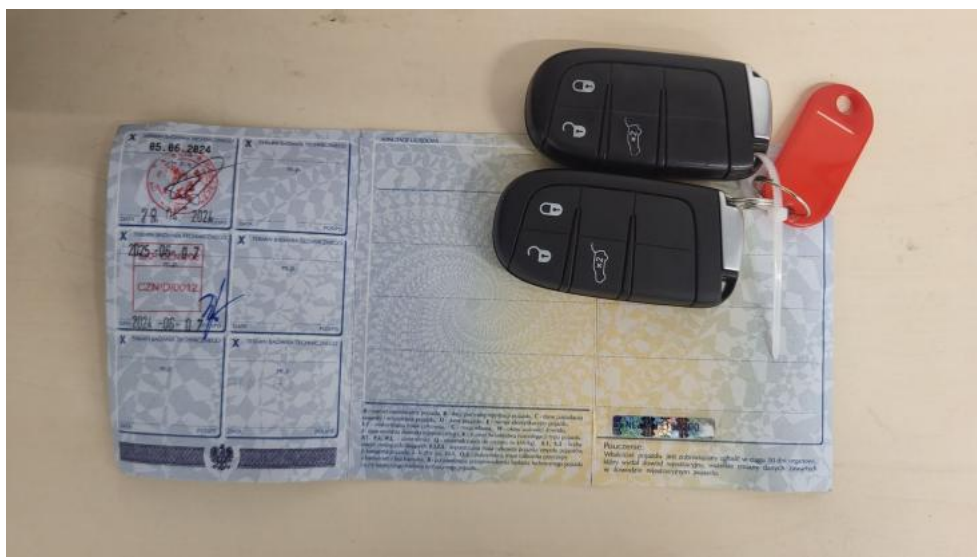
Photo 31.

Kierownica (na wprost)

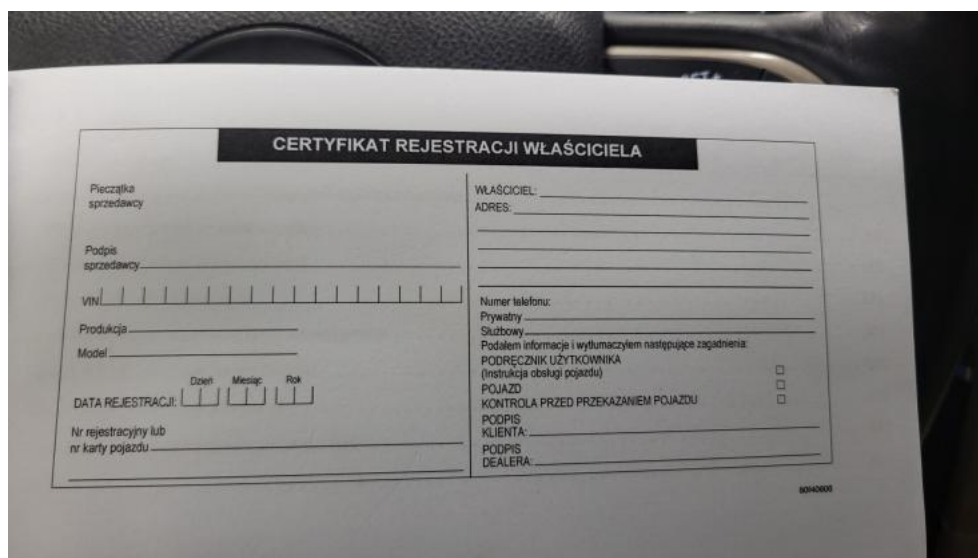


Photo 32.

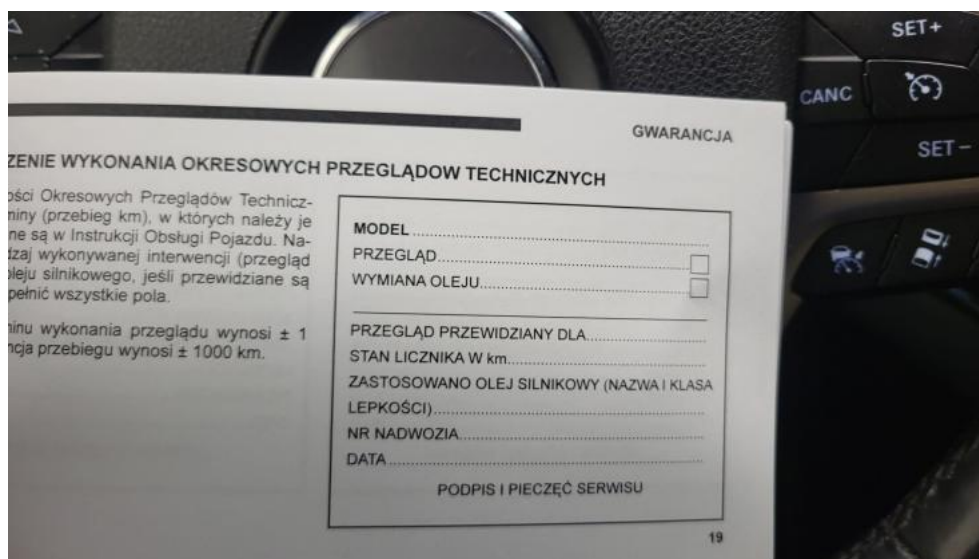
Dowód rej. Str. 1

PHOTOGRAPHIC DOCUMENTATION**Photo 33.**

Dow. Rej. Str.2 i klucze


 A photograph of a 'CERTYFIKAT REJESTRACJI WŁAŚCICIELA' (Owner Registration Certificate) form. The form is divided into two main sections. The left section contains fields for 'Pieczęćka sprzedawcy', 'Podpis sprzedawcy', 'VIN', 'Produkcja', 'Model', 'DATA REJESTRACJI' (with sub-fields for Day, Month, and Year), and 'Nr rejestracyjny lub nr karty pojazdu'. The right section contains fields for 'WŁAŚCICIEL: ADRES:', 'Numer telefonu:', 'Prywatny / Służbowy', and checkboxes for 'Podam informacje i wytłumaczę następujące zagadnienia: PODRĘCZNIK UŻYTKOWNIKA (instrukcja obsługi pojazdu)', 'POJAZD', and 'KONTROLA PRZED PRZEKAZANIEM POJAZDU'. There are also checkboxes for 'PODPIS KLIENTA:' and 'PODPIS DEALERA:'.
Photo 34.

Książka serwisowa – dane

PHOTOGRAPHIC DOCUMENTATION**Photo 35.**

Książka serwisowa – ostatni przegląd

**Photo 36.**

Instrukcje

PHOTOGRAPHIC DOCUMENTATION



Photo 37.

Zdjęcie do protokołu



Photo 38.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Zdjęcie do protokołu



Photo 40.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION

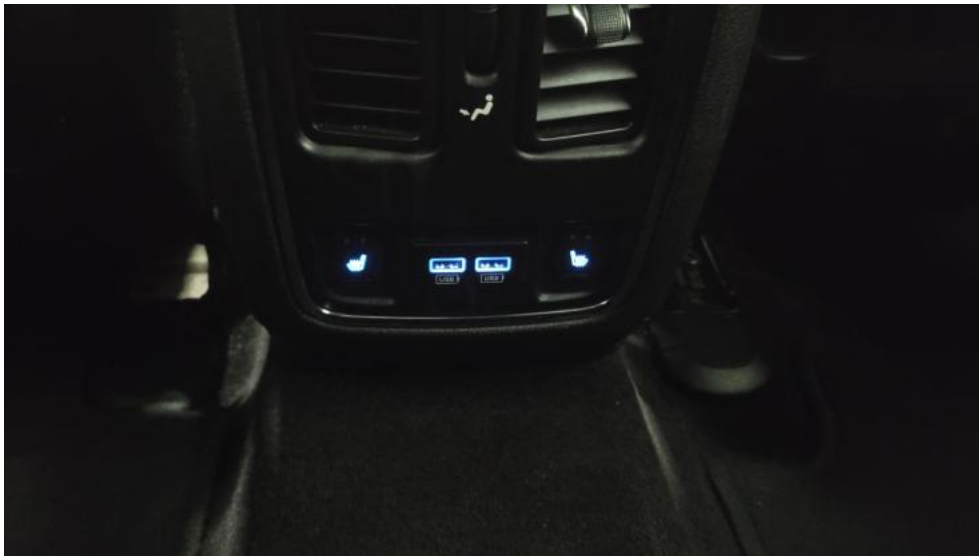


Photo 41.

Zdjęcie do protokołu



Photo 42.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Pokrywa komory silnika - Inne 1



Photo 44.

Zderzak - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Błotnik przedni P - Wgniecenie/odkształcenie 1



Photo 46.

Błotnik przedni P - Wgniecenie/odkształcenie 2

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Listwa błotnika przedniego P - Rysa/odprysk 1



Photo 48.

Próg P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1



Photo 50.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 2

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Pokrywy bagażnika - Rysa/odprysk 1



Photo 52.

Pokrywy bagażnika - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Zderzak tylny - Rysa/odprysk 1



Photo 54.

Drzwi przed L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Drzwi tylne L - Wgniecenie/odkształcenie 1



Photo 56.

Drzwi tylne L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Listwa drzwi tylnych L - Wgniecenie/odkształcenie 1



Photo 58.

Próg L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Słupek środkowy L - Wgniecenie/odkształcenie 1



Photo 60.

Listwa błotnika przedniego L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Koło kierownicy - Inne 1



Photo 62.

Konsola tunelu śr. - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Podłokietnik środkowy przedni - Inne 1



Photo 64.

Fotel prz. lew. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Fotel prz. praw. - Rysa/odprysk 1



Photo 66.

Fotel prz. praw. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 67.

Fotel prz. praw. - Inne 2



Photo 68.

Fotel prz. praw.() - Inne 3

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Kanapa tyl. - Inne 1



Photo 70.

Tapicerka drzwi przednich L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Uszczelka drzwi przednich P - Pęknięcie/rozerwanie 1