

DEKRA's commission No. : PKOL(W)/LODZ/95213/26/10/12
commission/ damage No. : 22/038660
Date of commission: 12-10-2026

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (WSP)
DEKRA Polska - współpraca O/Warszawa
mgr inż. Michał Świątek
DEKRA Polska - Centrala

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	jeeps
EC code (Eurotax)	0155679
Manufacturer	KGM / SSANGYONG
Model	Musso Grand 19-23
Type / version	Musso Grand 2.2 e-XDi Sapphire 4WD aut
Body type	PIC
Number of doors / seats	4/5
Curb weight [kg]	2120
Gross vehicle weight [kg]	2990
Wheelbase 1/2	3210
Engine type	Automatic ignition
Supercompression	turbocompressor with intercooler
Pollution reduction system	KSC
Emission standard	EURO 6
Engine capacity [ccm]	2157
Engine Power [hp/kW]	202/149
Gearbox	automatic 6- gear
Registration /record No.	BI933GU
VIN / serial number	KPAX61EESNP182372
Date of first registration	23-12-2022
Date of next. tech. test	23-12-2027
Year of manufacture	2022 (year has been verified with the manufacturer's base)
Readout [km]	111 082 (read)
Body color / type of coating	grafitowy/double-layered, metallized

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	Kumho, CRUGEN PREMIUM SUV KL33	235/70 R17 107H	3,0 mm
	left	Kumho, CRUGEN PREMIUM SUV KL33	235/70 R17 107H	3,5 mm
back	right	Kumho, CRUGEN PREMIUM SUV KL33	235/70 R17 107H	3,0 mm

left Kumho, CRUGEN PREMIUM 235/70 R17 107H
SUV KL33

2,5 mm

Standard equipment by Eurotax

- | | |
|--|---|
| 1. Active Emergency Brake Assist | 39. Leather upholstery |
| 2. Alarm | 40. Light alloy wheels from 17" |
| 3. Android Auto, Apple CarPlay | 41. Lumbar adjust driver |
| 4. Antilock-Brake-System (ABS) | 42. Mobile Tire System |
| 5. Armrest (s) front | 43. Navigation system, On board monitor |
| 6. Armrest (s) rear | 44. On board computer, On board monitor, Touchscreen monitor |
| 7. Automated High-beam assist | 45. Other |
| 8. Automatic dimlight activation | 46. Other |
| 9. Automatic dimlight activation | 47. Other |
| 10. Blind spot warning | 48. Other |
| 11. Bluetooth interface | 49. Other |
| 12. Child seat fixation | 50. Park Distance Control front, Park Distance Control rear |
| 13. Collision Warning System, Power assisted brakes | 51. Power windows front, Power windows rear |
| 14. Cruise control | 52. Radio |
| 15. Distance control | 53. Rain sensor |
| 16. Distribution of braking force electronically | 54. Rear Cross Traffic Alert |
| 17. Door lights | 55. Rear seat heating |
| 18. Door mirror(s) electrically adjustable in general, Door mirrors electrically foldable | 56. Rear view camera |
| 19. Driver airbag, Head airbags front, Head airbags rear, Passenger airbag, Side airbag driver and passenger | 57. Rear-view mirror autodimming |
| 20. Driver conditioning monitoring | 58. Remote controlled central locking |
| 21. Driver seat electrically adjustable, Passenger seat electrically adjustable | 59. Roof railing |
| 22. Driver seat height adjustable | 60. Servotronic |
| 23. Dualzone automatic climate control | 61. Side indicators |
| 24. ESP (Electronical Stabilizing Program) | 62. Soundsystem |
| 25. Exterior design: other | 63. Steering wheel heated |
| 26. Follow me home | 64. Steering wheel manually adjustable |
| 27. Headrests front | 65. Steering wheel with radio operation |
| 28. Heat reflecting windows | 66. Steering: other |
| 29. Heated seat driver, Heated seat passenger | 67. Traction control |
| 30. Hill descent control | 68. Traffic sign recognition |
| 31. Hill holder | 69. Tyre pressure control (RDC) |
| 32. Interior decoration: other | 70. USB in |
| 33. Keyless entry, Keyless go | 71. Uni-Lackierung |
| 34. LED Daytime running lights | 72. Vehicle immobilizer |
| 35. LED Fog Lamps | 73. Ventilated front seat |
| 36. Lane control assistant | 74. Windscreen heating |
| 37. Leather gearshifter/switch | 75. Xenon-light |
| 38. Leather steering wheel | 76. {System ostrzegania o niezamierzonej zmianie pasa ruchu LDWS} |

Dealer's equipment (selected items)

- | | |
|------------------------------|---|
| 1. Metallic paint | - |
| 2. Off road suspension | - |

Additional equipment

- | | |
|-------------------------------|---|
| 1. Hak holowniczy stały | - |
|-------------------------------|---|

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

CorrectionsFirst registrationMileageEquipmentTyresOther

Braki i uszkodzenia -


Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 10-2026 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 14-10-2026

DEKRA's expert:
Kacper Sosnowski (WSP)
mgr inż. Michał Świątek**Document issued electronically valid without signature.**

Measurement of thickness of the vehicle lacquer coating

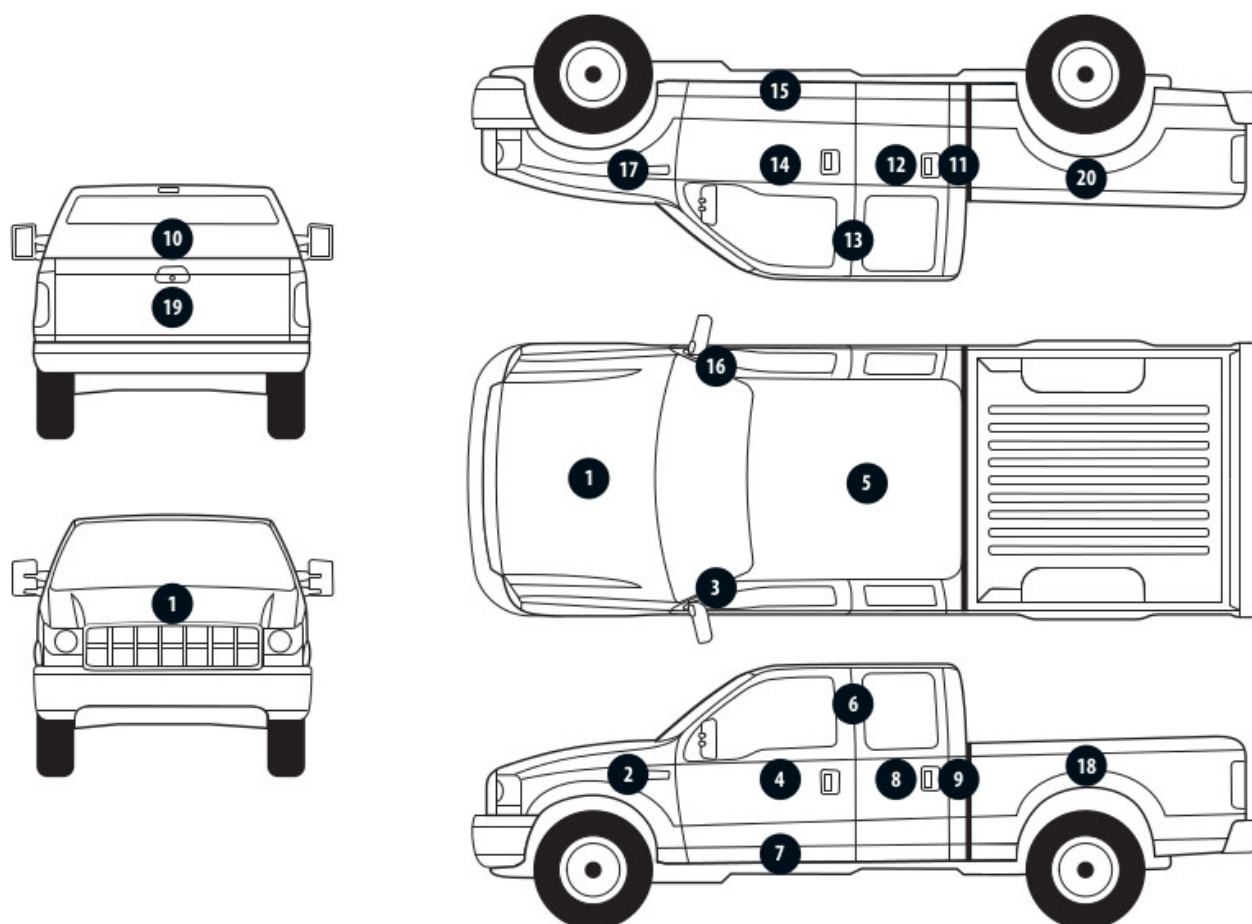

No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Left front fender	to 150
3	Left front pillar	to 150
4	Left front door	to 150
5	Roof	to 150
6	Left middle pillar	to 150
7	Left side sill	to 150
8	Rear left door	to 150
9	Left side wall	to 150
10	Rearwall	to 150
11	Right sidewall	to 150
12	Right reardoor	to 150
13	Right middle pillar	to 150
14	Right front door	to 150
15	Right side sill	to 150
16	Right front pillar	to 150
17	Right front fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book was presented and its number is given below:

b/n

Information concerning the origin of the vehicle

The vehicle purchased domestically from an authorized representative of the brand.

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below:

.

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

Anti-theft protection

immobiliser

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.
- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation**Kluczyki**

TAK

2

Expert comments - regarding valuation

Nadwozie zabrudzone lub/i mokre - brak możliwości dokładnego zweryfikowania ewentualnych uszkodzeń powłoki lakierniczej.

Restrictive disclaimer - regarding valuation

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.
Próg lewy (widok od przodu)



Photo 12.
Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód

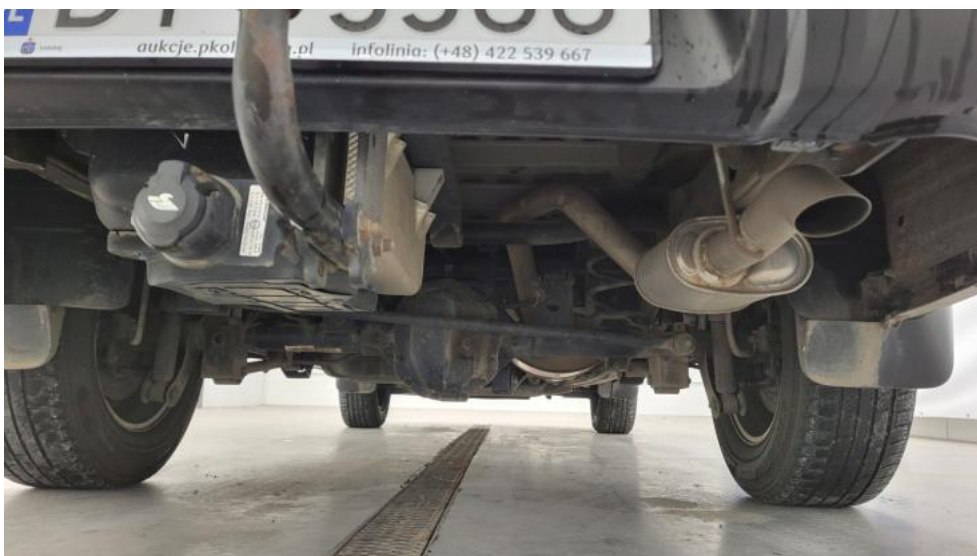


Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa

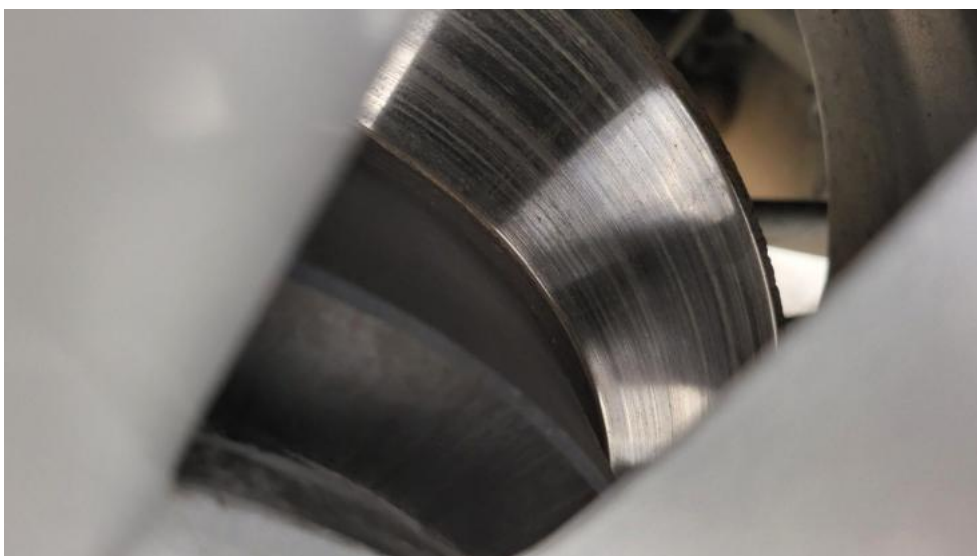


Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Komora silnika

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Numer identyfikacyjny



Photo 22.
Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION**Photo 23.**

Tabliczka znamionowa

**Photo 24.**

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Zestaw wskaźników - serwis



Photo 26.

Widok przez otwarte drzwi przednie lewe

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Kierownica z lewej strony



Photo 28.

Widok przez otwarte drzwi tylne lewe

PHOTOGRAPHIC DOCUMENTATION



Photo 29.

Zdjęcie do protokołu



Photo 30.

Widok z tylnej kanapy na deskę rozd.

PHOTOGRAPHIC DOCUMENTATION



Photo 31.
Konsola środkowa



Photo 32.
Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION



Photo 33.
Kierownica (na wprost)



Photo 34.
Dowód rej. Str. 1

PHOTOGRAPHIC DOCUMENTATION

DANE WŁAŚCICIELA

Model: MUSSO GRAND

Numer nadwozia (VIN): KPAXG1EESNP182372

Numer silnika: -

Kolor nadwozia: SZARY

Początek biegu gwarancji: 23.12.2022

Częstotliwość przeglądów (km lub m-cie): 15000 km
1 Rok

Wydane przez

1. Użytkownik
Adres
Numer telefonu
Numer e-mail

2. Użytkownik
Adres
Numer telefonu
Numer e-mail

Photo 35.

Książka serwisowa – dane

PRZEGŁĄD PRZEDSPRZEDAŻOWY

Niniejszym potwierdzamy wydanie samochodu w prawidłowym stanie po wykonaniu przeglądu PDI zgodnie z wymaganiami producenta.

Przebieg: 10 Km

Numer rejestracyjny: B1933 GU

Model: MUSSO GRAND Typ: PICK-UP

Numer silnika: -

Numer nadwozia (VIN): KPAXG1EESNP182372

Niniejszym zaświadczam, że otrzymałem samochód w pełni sprawny z kompletem narzędzi, kluczykami, instrukcją użytkownika i z pakietem dokumentów serwisowych.

Zapoznałem się również z warunkami gwarancji

Nazwa dealera: SSANGYONG Biscione

DEKRA

Photo 36.

Książka serwisowa – ostatni przegląd

PHOTOGRAPHIC DOCUMENTATION**Photo 37.**

Dow. Rej. Str. 2

**Photo 38.**

Zestaw naprawczy koła

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Kluczyki



Photo 40.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Zdjęcie do protokołu



Photo 42.

Atrapa przednia - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Pokrywa komory silnika - Rysa/odprysk 1



Photo 44.

Zderzak - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Zderzak - Wgniecenie/odkształcenie 2



Photo 46.

Zderzak - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Zderzak - Inne 1



Photo 48.

Ślotnik przedni P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION

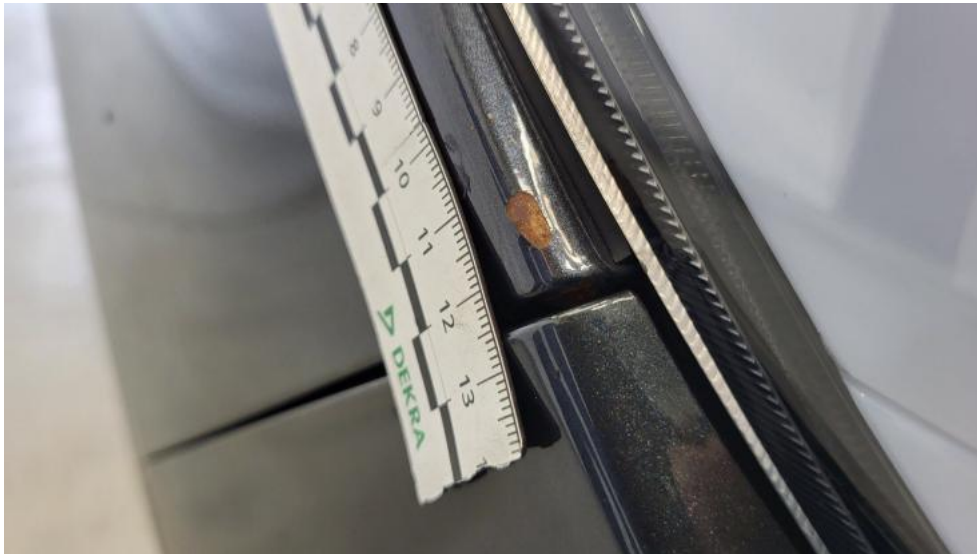


Photo 49.

Błotnik przedni P - Inne 1



Photo 50.

Drzwi przednie P - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Drzwi przednie P - Rysa/odprysk 1



Photo 52.

Drzwi przednie P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Drzwi tylne P - Wgniecenie/odkształcenie 1



Photo 54.

Ścianka tylna P / Ścianka boczna P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1



Photo 56.

Pokrywy bagażnika - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Pokrywy bagażnika - Wgniecenie/odkształcenie 1



Photo 58.

Pokrywy bagażnika - Wgniecenie/odkształcenie 2

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Zderzak tylny - Rysa/odprysk 1



Photo 60.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION

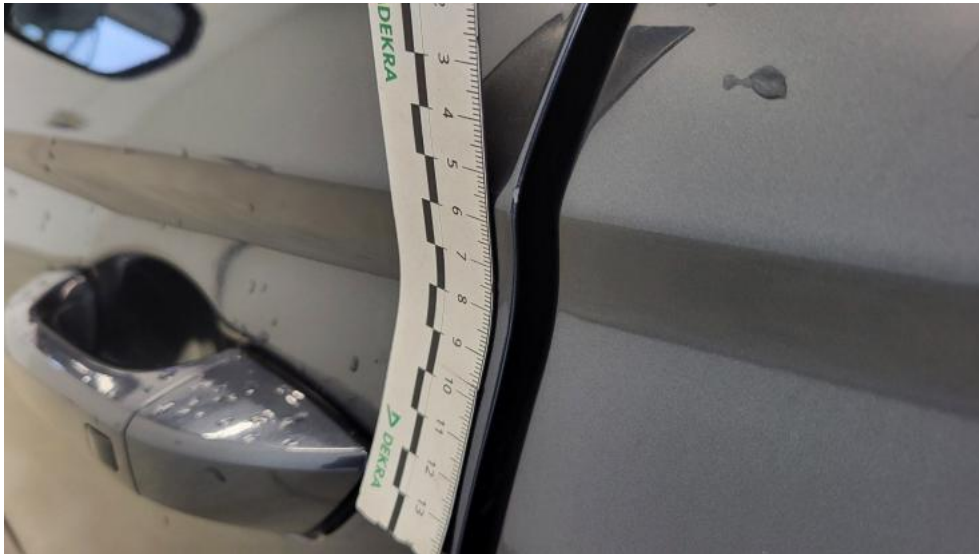


Photo 61.

Drzwi przed L - Rysa/odprysk 1



Photo 62.

Drzwi tylne L - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Drzwi tylne L - Rysa/odprysk 1



Photo 64.

Drzwi tylne L - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION

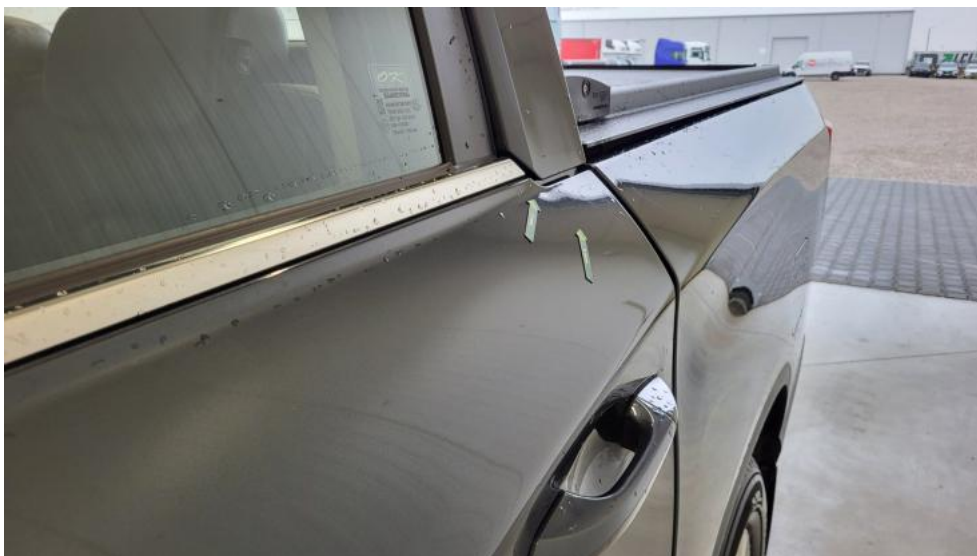


Photo 65.

Drzwi tylne L - Wgniecenie/odkształcenie 1



Photo 66.

Felga Aluminiowa przednia L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 67.

Fotel prz. lew. - zdjęcie pogładowe 1



Photo 68.

Fotel prz. lew. - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Fotel prz. lew. - Pęknięcie/rozerwanie 1



Photo 70.

Fotel prz. praw. - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Tapicerka drzwi przednich L - Rysa/odprysk 1



Photo 72.

Osłona p/słoneczna lewa - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 73.

Osłona p/słoneczna prawa - Inne 1



Photo 74.

Wykładzina(y) słupka przedniego L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 75.

Wykładzina(y) słupka środkowego P - Rysa/odprysk 1