

DEKRA's commission No. : PKOL(W)/LODZ/14695/25/02/26
 commission/ damage No. : 24/009168
 Date of commission: 26-02-2025

DEKRA Poland - Headquarters
 02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
 Świętokrzyska 36
 00-116 Warszawa

Expert:

Kacper Sosnowski (NEW)
 DEKRA Polska - współpraca O/Warszawa
Andrzej Sosnowski
 DEKRA Polska - Centrala

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	jeeps
EC code (Eurotax)	0135379
Manufacturer	VOLVO
Model	XC90 14-19
Type / version	XC90 D5 SCR AWD R-Design 70s
Body type	KOM
Number of doors / seats	5/7
Curb weight [kg]	2071
Gross vehicle weight [kg]	2750
Wheelbase 1/2	2984
Engine type	Automatic ignition
Pollution reduction system	KSC
Engine capacity [ccm]	1969
Engine Power [hp/kW]	235/173
Gearbox	automatic
Registration /record No.	ST5164W
VIN / serial number	YV1LF68UCK1514943
Date of first registration	24-05-2019
Date of next. tech. test	23-05-2025
Year of manufacture	2019
Readout [km]	176 932 (read)
Body color / type of coating	black/double-layered, metallized

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	BRIDGESTONE, TURANZA 6 ENLITEN	275/45 20 110Y	1,5 mm
	left	BRIDGESTONE, TURANZA 6 ENLITEN	275/45 20 110Y	1,5 mm
back	right	BRIDGESTONE, TURANZA 6 ENLITEN	275/45 20 110Y	2,5 mm
	left	BRIDGESTONE, TURANZA 6 ENLITEN	275/45 20 110Y	3,0 mm

Standard equipment by Eurotax

- | | |
|---|---|
| 1. Adaptive Cruise Control | 45. Luggage compartment cover |
| 2. Airbag: other | 46. Lumbar adjust driver electric, Lumbar adjust passenger electric |
| 3. Alarm | 47. Lumbar adjust driver, Lumbar adjust passenger |
| 4. Antilock-Brake-System (ABS) | 48. Memory seat |
| 5. Armrest (s) front | 49. Metal finish |
| 6. Armrest (s) rear | 50. On board computer |
| 7. Automatic climate control | 51. On board monitor |
| 8. Bluetooth interface, CD-player, On board monitor, Radio, USB in | 52. Other |
| 9. Bluetooth interface, Hands-free system, Internet access | 53. Other |
| 10. Bord climate: other | 54. Other |
| 11. Bord climate: other | 55. Other |
| 12. Child seat fixation | 56. Other |
| 13. Colored glass | 57. Other |
| 14. Distance control | 58. Other |
| 15. Distribution of braking force electronically | 59. Other |
| 16. Door mirror(s) electrically adjustable in general, Door mirrors heated | 60. Other |
| 17. Door mirrors electrically foldable | 61. Other |
| 18. Driver airbag, Head airbags front, Passenger airbag, Side airbag driver, Side airbag driver and passenger | 62. Other |
| 19. Driver knee airbag | 63. Other |
| 20. Driver seat electrically adjustable, Memory seat | 64. Other, Seats: other |
| 21. ESP (Electronical Stabilizing Program) | 65. Park Distance Control rear |
| 22. Exterior design: other | 66. Passenger seat electrically adjustable |
| 23. Exterior design: other | 67. Power assisted brakes |
| 24. Exterior design: other | 68. Power assisted brakes |
| 25. Exterior thermometer | 69. Rain sensor |
| 26. Extra power outlet | 70. Rear seat-backs foldable in two separate parts |
| 27. Floor mat | 71. Rear-view mirror autodimming |
| 28. Fog lamps | 72. Remote controlled central locking |
| 29. Hill holder | 73. Roof railing |
| 30. Interior lights: other accessories | 74. Seatbelt pretensioner front, Seatbelt pretensioner rear |
| 31. Interior lights: other accessories, Interior: other | 75. Seatbelts vertically adjustable front, Seatbelts vertically adjustable rear |
| 32. Interior: other | 76. Seats: other |
| 33. Interior: other | 77. Selectable driveline characteristics |
| 34. Interior: other | 78. Sport seats front, Upholstery with leather inserts |
| 35. Internet access | 79. Storage facilities in general |
| 36. LED Daytime running lights | 80. Sunblind rear side door manual |
| 37. LED front dim light | 81. Traction control |
| 38. Lane control assistant | 82. Traffic sign recognition |
| 39. Lane control assistant | 83. Tyre pressure control (RDC) |
| 40. Leather finish dashbord | 84. Uni-Lackierung |
| 41. Leather gearshifter/switch | 85. Vehicle immobilizer |
| 42. Leather gearshifter/switch, Leather steering wheel, Sports steering wheel | 86. Whiplash-protection-system |
| 43. Leather steering wheel, Multi functional steering wheel | 87. {System stabilizacji pojazdu w czasie holowania przyczepy (TSA)} |
| 44. Light Alloy wheels 20" | |

Dealer's equipment (selected items)

- 1. Metallic paint -
- 2. Navigation system, Other, Park Assistant -
 Nawigacja Sensus
 Asystent parkowania równoległego i prostopadłego (zaw. przednie i tylne czujniki parkowania)
 Android Auto i Apple Carplay
- 3. Park Distance Control front, Park Distance Control rear -

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

CorrectionsMileageEquipmentTyresOtherEarlier repairs -
Uszkodzenia, stan, weryfikacja serwisowa -


Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 03-2025 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 05-03-2025

DEKRA's expert:
Kacper Sosnowski (NEW)
Andrzej Sosnowski**Document issued electronically valid without signature.**

Measurement of thickness of the vehicle lacquer coating

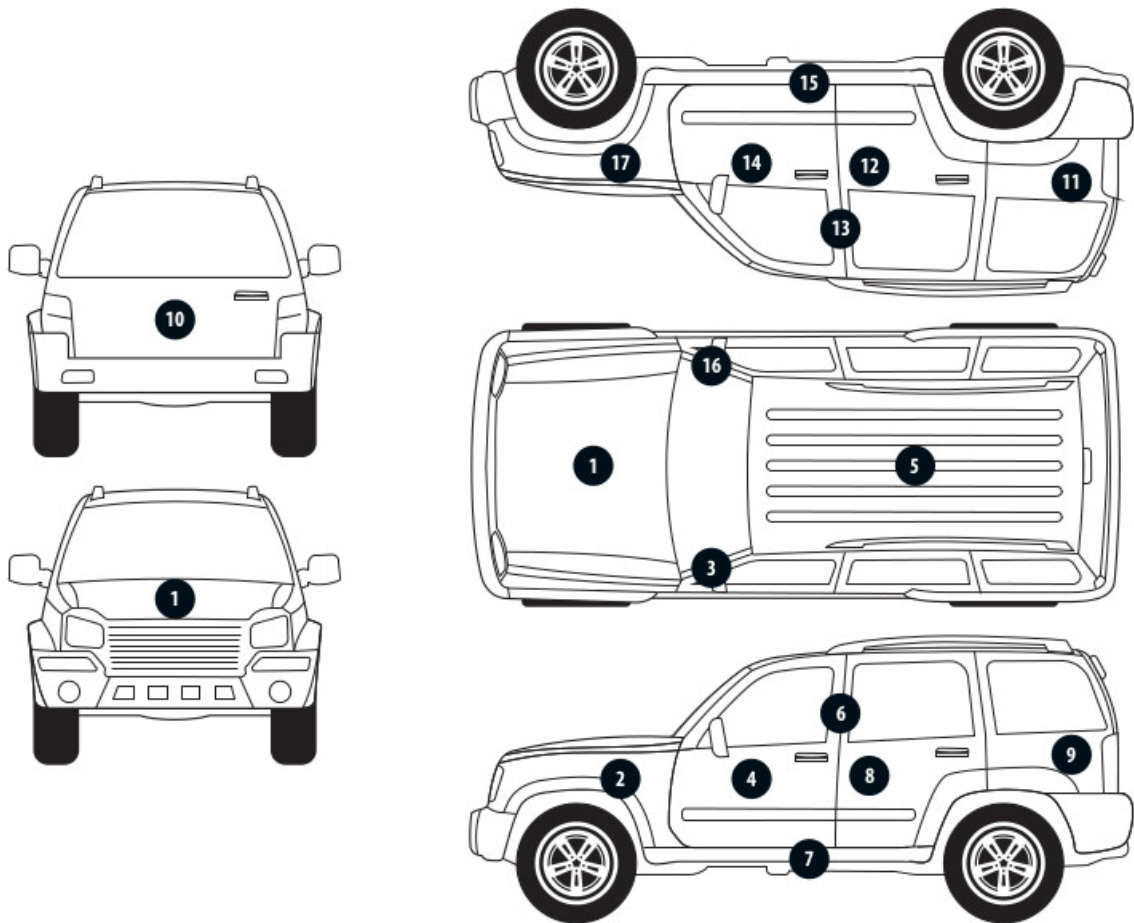

No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Left front fender	to 150
3	Left front pillar	to 150
4	Left front wall	to 150
5	Roof	to 150
6	Left middle pillar	to 150
7	Left side sill	to 150
8	Left rear wall	to 150
9	Left side wall	to 150
10	Cover/tailgate	150 - 500
11	Side right wall	to 150
12	Rear right door	to 150
13	Middle right pillar	to 150
14	Front right door	to 150
15	Right side sill	to 150
16	Right front pillar	to 150
17	Right front fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

Presented the following documents of the vehicle:

ksero pozwolenia czasowego

During the inspection the service book was presented and its number is given below:
elektroniczna

Information concerning the origin of the vehicle

Lack of reliable data.

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below:
ograniczenia placowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

Anti-theft protection

fabryczne

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.
- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation**Kluczyki**

TAK

2

Expert comments - regarding valuation

Rysy na samochodzie. Dostarczone ksero pozwolenia czasowego. Niesprawne przyciski funkcyjne w jednym z kluczyków, grot prawidłowy. Ślady polerowania. Brak półki bagażnika. Odpryski na szybie czołowej.

Rzeczoznawca dokonał oględzin pojazdu w warunkach parkingowych, co mogło ograniczyć pełną ocenę jego stanu technicznego. Dodatkowo, jeżeli jazda próbna została przeprowadzona (informacje w treści raportu), to wykonano ją w warunkach parkingowych, z niewielką prędkością, co może nie odzwierciedlać pełnych warunków eksploatacyjnych. Istnieje możliwość, że w innych okolicznościach ujawnią się dodatkowe uszkodzenia lub usterki, których nie można było wykryć podczas obecnych oględzin. Zalecamy zatem skorzystanie z możliwości oględzin pojazdu we własnym zakresie lub w Autoryzowanej Stacji Obsługi danej marki, co pozwoli na pełniejszą weryfikację stanu technicznego pojazdu przed udziałem w aukcji."

Restrictive disclaimer - regarding valuation

Nie weryfikowano szczegółowo stanu układu napędowego, zawieszenia, kierowniczego, hamulcowego oraz wydechowego. Ocena została wykonana bez użycia podnośnika i specjalistycznego sprzętu diagnostycznego, nie dokonywano demontażu osłon i innych elementów. Ocena określa ogólny stan pojazdu na dzień oględzin w miejscu jego udostępnienia, nie może być zatem traktowana jako kompleksowa ocena stanu technicznego. Specyfikacja wg. programu operacyjnego w zakresie wyposażenia standardowego i dodatkowego nie gwarantuje zgodności ze stanem faktycznym w zakresie możliwym do ustalenia przez rzeczoznawcę podczas oględzin pojazdu.

Pomiar grubości powłoki lakierowej wykonano w miejscach możliwych do ich wykonania pomiary nie gwarantują oryginalności poszczególnych elementów poddanych ocenie.

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.
Przekątna przednia prawa



Photo 4.
Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.
Tyl



Photo 8.
Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.
Bok lewy z tyłu



Photo 10.
Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.
Próg lewy (widok od przodu)



Photo 12.
Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika



Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION



Photo 23.
Tabliczka znamionowa



Photo 24.
Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe



Photo 28.

Widok z tylnej kanapy na deskę rozdź.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.
Konsola środkowa

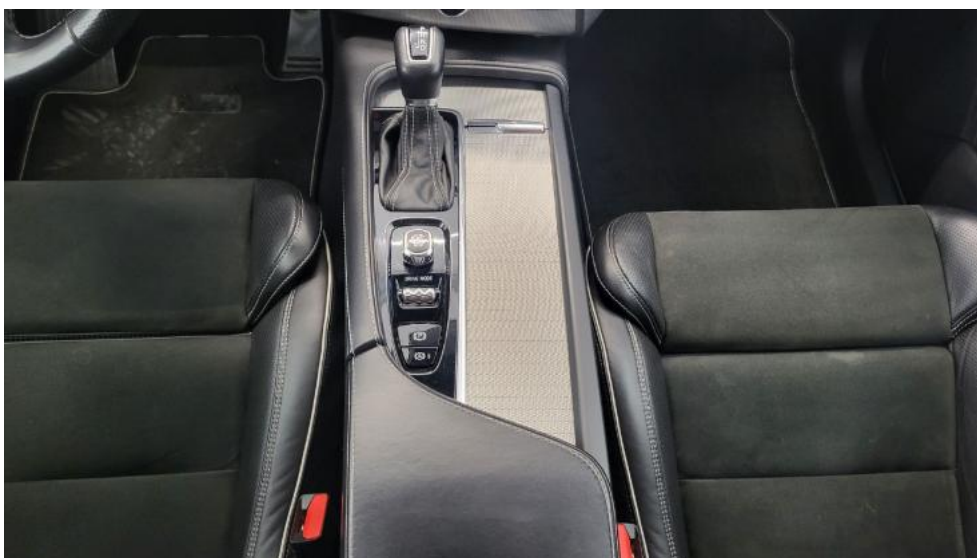


Photo 30.
Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION



Photo 31.
Kierownica (na wprost)



Photo 32.
Książka serwisowa – dane

PHOTOGRAPHIC DOCUMENTATION



Photo 33.
Książka serwisowa – ostatni przegląd

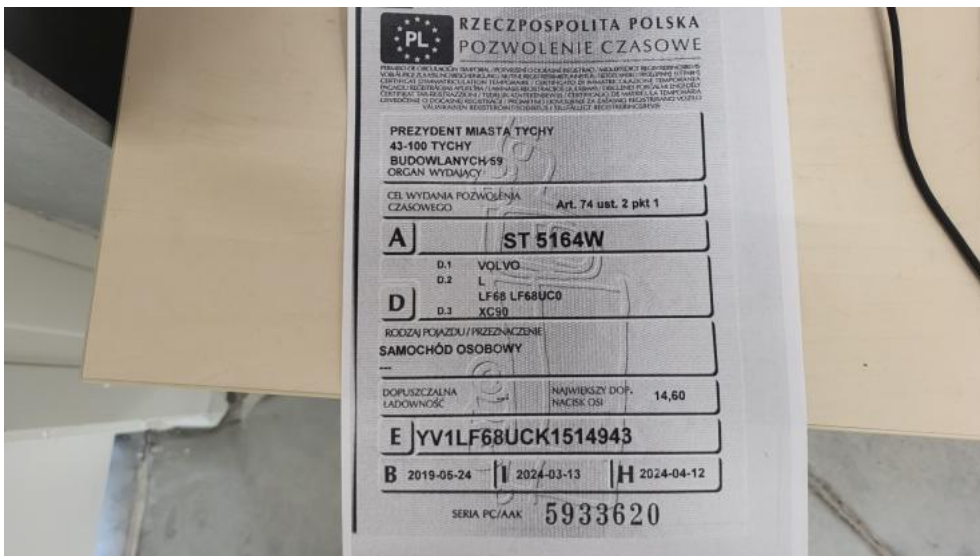


Photo 34.
Dow. rej. ksero Str. 1

PHOTOGRAPHIC DOCUMENTATION

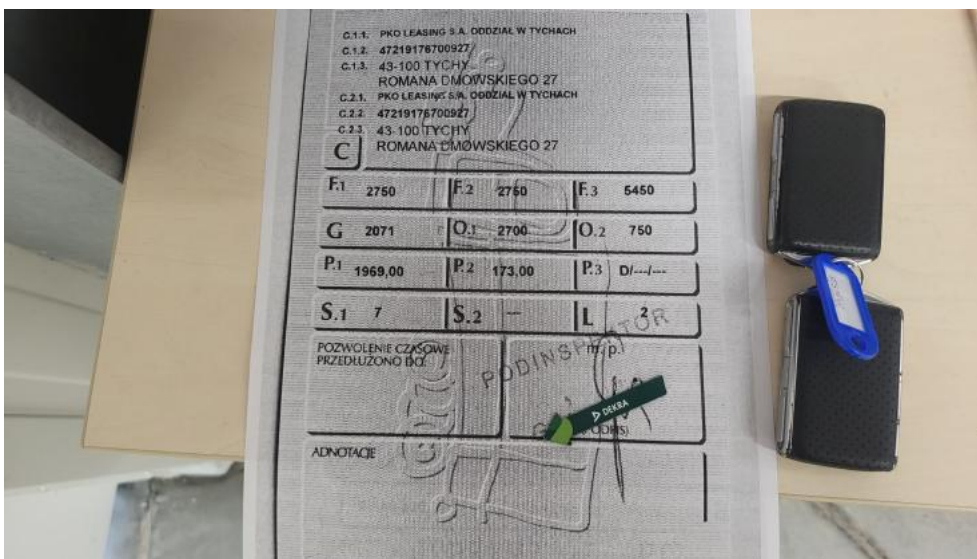


Photo 35.
Dow. Rej. ksero Str.2 i klucze



Photo 36.
Zestaw naprawczy koła

PHOTOGRAPHIC DOCUMENTATION



Photo 37.
Zdjęcie do protokołu



Photo 38.
Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 39.
Zdjęcie do protokołu



Photo 40.
Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 41.
Zdjęcie do protokołu



Photo 42.
Krata zderzaka prz. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 43.
Kratka/zaślepka halogenu L - Rysa/odprysk 1



Photo 44.
Pokrywa komory silnika - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.
Pokrywa komory silnika - Wgniecenie/odkształcenie 1



Photo 46.
Zderzak - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Zderzak przedni cz dolna - Rysa/odprysk 1



Photo 48.

Zderzak przedni cz dolna - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.
Felga aluminiowa przednia P - Rysa/odprysk 1



Photo 50.
Drzwi tylne P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.
Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1



Photo 52.
Zderzak tylny - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 53.
Zderzak tylny - Rysa/odprysk 2



Photo 54.
Zderzak tylny - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.
Zderzak tylny - Wgniecenie/odkształcenie 2



Photo 56.
Zderzak tylny() - Wgniecenie/odkształcenie 3

PHOTOGRAPHIC DOCUMENTATION

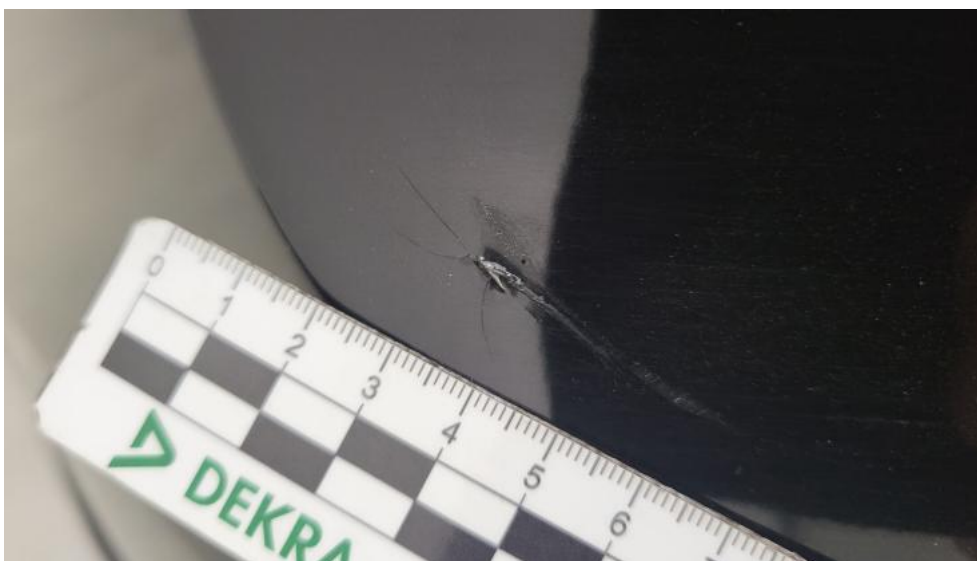


Photo 57.
Zderzak tylny - Pęknięcie/rozerwanie 1



Photo 58.
Zderzak tylny - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.
Błotnik tylny L / Ściana boczna L - Rysa/odprysk 1



Photo 60.
Felga aluminiowa tylna L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Drzwi przed L - Rysa/odprysk 1



Photo 62.

Drzwi przed L - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 63.
Błotnik przedni L - Rysa/odprysk 1



Photo 64.
Błotnik przedni L - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Listwa błotnika przedniego L - Rysa/odprysk 1



Photo 66.

Koło kierownicy - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 67.
Fotel prz. lew. - Inne 1



Photo 68.
Kanapa tyl. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 69.
Kanapa tyl. - Inne 2



Photo 70.
Tapicerka drzwi przednich L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Półka/roleta tylna - Inne 1