

DEKRA's commission No. : PKOL(W)/LODZ/77426/25/10/09
commission/ damage No. : 21/035102
Date of commission: 09-10-2025

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (NEW)
DEKRA Polska - współpraca O/Warszawa
Tomasz Ziemniak (NEW)
DEKRA Polska - współpraca O/Konin

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0108550
Manufacturer	FORD
Model	Mondeo Kombi 14-19
Type / version	Mondeo 2.0 TDCi Titanium
Body type	KOM
Number of doors / seats	5/5
Curb weight [kg]	1522
Gross vehicle weight [kg]	2330
Wheelbase 1/2	2850
Engine type	Automatic ignition
Pollution reduction system	DPF
Engine capacity [ccm]	1997
Engine Power [hp/kW]	150/110
Gearbox	manual 6- gear
Registration /record No.	WOT83602
VIN / serial number	WF0FXXWPCFGY03888
Date of first registration	06-04-2017
Date of next. tech. test	10-05-2025
Year of manufacture	2016 (year has been verified with the manufacturer's base)
Readout [km]	229 973 (read)
Body color / type of coating	grafitowy/METALIK

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	WESTLAKE, ZUPERECO Z-107	245/55 17 98W	5,0 mm
	left	WESTLAKE, ZUPERECO Z-107	245/55 17 98W	5,0 mm
back	right	WESTLAKE, ZUPERECO Z-107	245/55 17 98W	5,0 mm
	left	WESTLAKE, ZUPERECO Z-107	245/55 17 98W	5,0 mm

Standard equipment by Eurotax

- | | |
|---|--|
| 1. Antilock-Brake-System (ABS) | 34. Leather gearshifter/switch, Leather steering wheel |
| 2. Armrest (s) front, Storage facilities in general | 35. Leather steering wheel, Steering wheel manually adjustable |
| 3. Automated High-beam assist | 36. Light alloy wheels from 17" |
| 4. Automatic dimlight activation | 37. Luggage compartment cover |
| 5. Bluetooth interface, CD-player, iPod Interface, On board monitor, Radio, USB in | 38. Lumbar adjust driver |
| 6. Bumpers: other, Exterior design: other | 39. Lumbar adjust driver |
| 7. Child seat fixation | 40. Lumbar adjust passenger |
| 8. Cornering Headlights, Fog lamps | 41. Lumbar adjust passenger |
| 9. Cruise control, Leather gearshifter/switch, Leather steering wheel | 42. On board monitor |
| 10. Diminished spare wheel | 43. On board monitor |
| 11. Distribution of braking force electronically | 44. Other |
| 12. Distribution of braking force electronically, ESP (Electronical Stabilizing Program), Power assisted brakes | 45. Other |
| 13. Door lights, Door mirrors electrically foldable | 46. Other |
| 14. Door mirror(s) electrically adjustable in general, Door mirrors heated | 47. Other |
| 15. Driver airbag, Head airbags front, Passenger airbag, Side airbag driver and passenger | 48. Other |
| 16. Driver knee airbag | 49. Passenger seat height adjustable |
| 17. Driver seat electrically adjustable, Driver seat height adjustable | 50. Power steering |
| 18. Dualzone automatic climate control | 51. Power windows front, Power windows rear |
| 19. Electric parking brake | 52. Pre-Crash System |
| 20. Exterior design: other | 53. Rain sensor |
| 21. Exterior design: other | 54. Rear seat-backs foldable in two separate parts |
| 22. Exterior design: other | 55. Rear-view mirror autodimming |
| 23. Exterior design: other | 56. Remote controlled central locking |
| 24. Floor mat | 57. Roof railing |
| 25. Heated seat driver, Heated seat passenger | 58. Sport seats front |
| 26. Hill holder | 59. Sport seats front, Textile upholstery |
| 27. Interior lights: other accessories | 60. Start/Stop system |
| 28. Interior: other | 61. Traffic sign recognition |
| 29. Keyless go | 62. Tyre pressure control (RDC) |
| 30. Keyless go, Remote controlled central locking | 63. Uni-Lackierung |
| 31. LED Daytime running lights | 64. Vehicle immobilizer |
| 32. LED rear lights | 65. Windscreen heating, Windscreen wash-nozzle heated |
| 33. Lane control assistant | |

Dealer's equipment (selected items)

- | | |
|--|---|
| 1. Floor mat | - |
| 2. Park Distance Control front, Park Distance Control rear | - |
| 3. Tinted rear windows | - |

Base value of the vehicle

Base value of the vehicle by Eurotax (net)

CorrectionsFirst registrationMileageEquipmentTyresOther

The validity of the technical examination -
State of the vehicle -

Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 10-2025 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 28-10-2025

DEKRA's expert:
Kacper Sosnowski (NEW)
Tomasz Ziemniak (NEW)

Document issued electronically valid without signature.

Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Front left fender	150 - 200
3	Left front pillar	to 150
4	Front left door	150 - 200
5	Roof	to 150
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	150 - 200
9	Rear left fender	to 150
10	Cover/lid	to 150
11	Right rear fender	to 150
12	Right rear door	to 150
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	150 - 300
16	Right front pillar	to 150
17	Front right fender	150 - 200

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book of the vehicle was not provided.

Information concerning the origin of the vehicle

The vehicle purchased domestically from an authorized representative of the brand.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

The test drive has been conducted on a distance and in time enabling rough estimation of the technical condition of the vehicle.

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the

page 5/51

assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

1

Expert comments - regarding valuation

Brak aktualnych badań technicznych. Nieprzyjemny zapach w samochodzie. Rysy na samochodzie. Głośna praca silnika. Informacja awaria kontroli tylnego pasa.

Restrictive disclaimer - regarding valuation

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.

Próg lewy (widok od przodu)

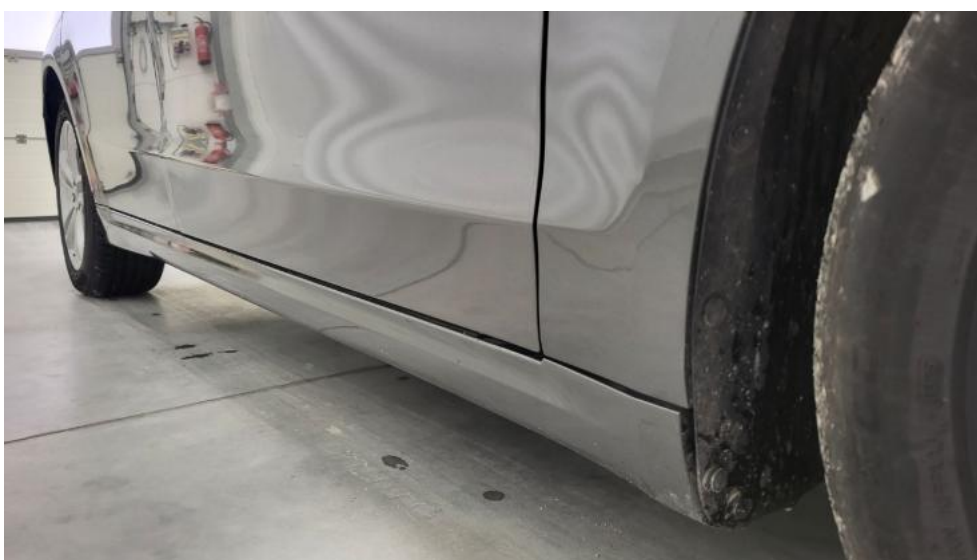


Photo 12.

Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION

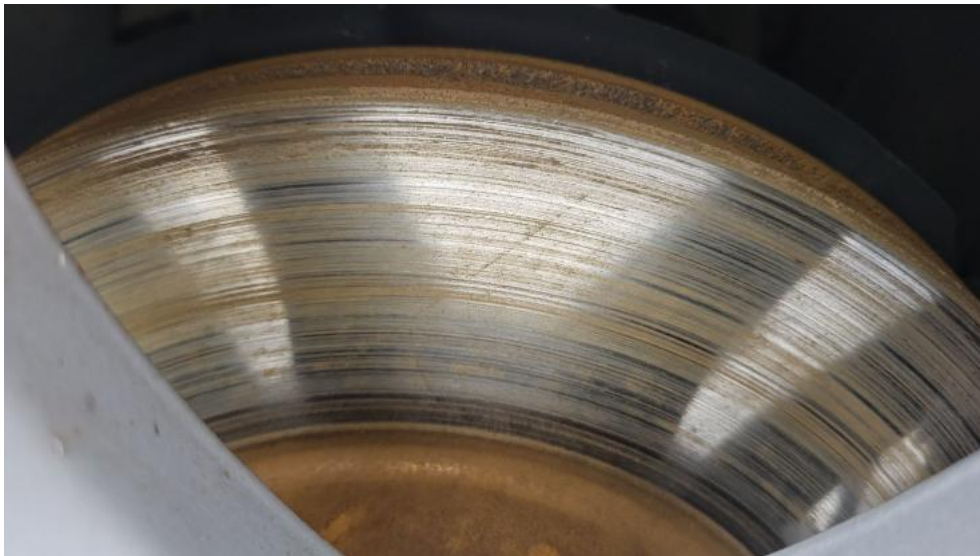


Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION

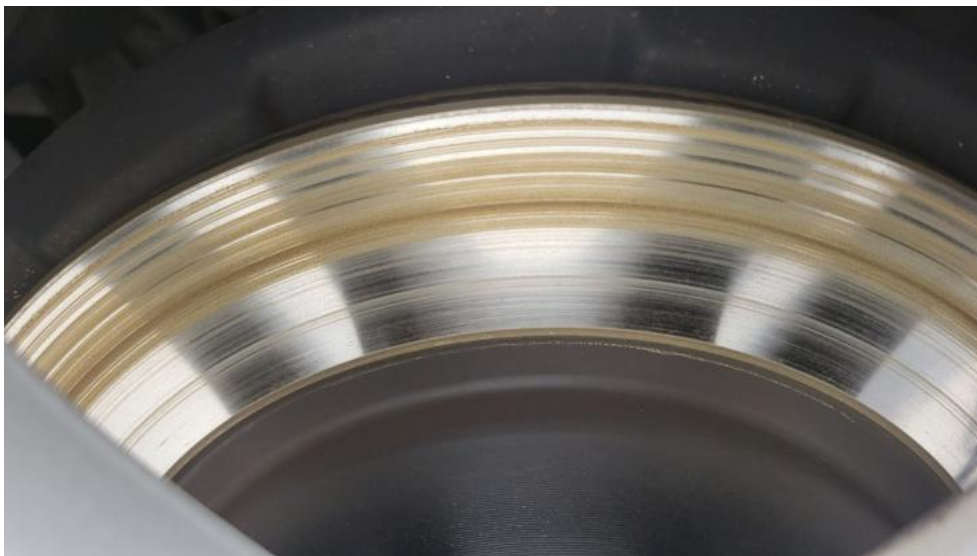


Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika



Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION

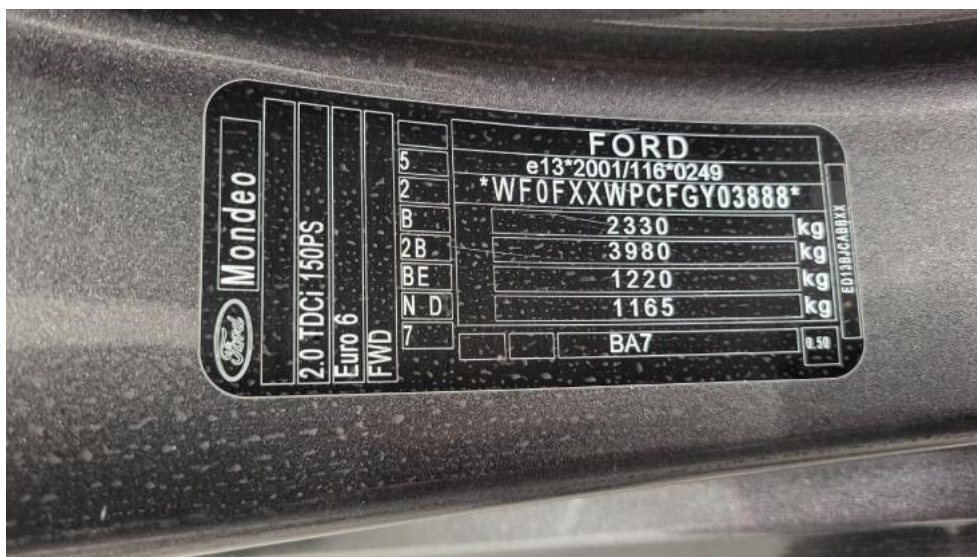


Photo 23.

Tabliczka znamionowa



Photo 24.

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe



Photo 28.

Widok z tylnej kanapy na deskę rozdz.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.

Konsola środkowa



Photo 30.

Tunel środkowy

A photograph of the interior of a Ford Focus. The steering wheel is black with silver accents and the Ford logo in the center. Behind the steering wheel is a digital instrument cluster displaying speed and RPM. To the right of the steering wheel is a large infotainment screen showing 'VOX FM' and various controls. Below the screen are physical buttons for climate and other functions. The dashboard and door panels are dark-colored.

[illegible]

DEKRA Polska Sp. z o.o.
02-673 Warszawa, ul. Konstruktorska 12A
www.dekra.pl

PHOTOGRAPHIC DOCUMENTATION



Photo 33.

Dow. Rej. Str.2 i klucze



Photo 34.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION

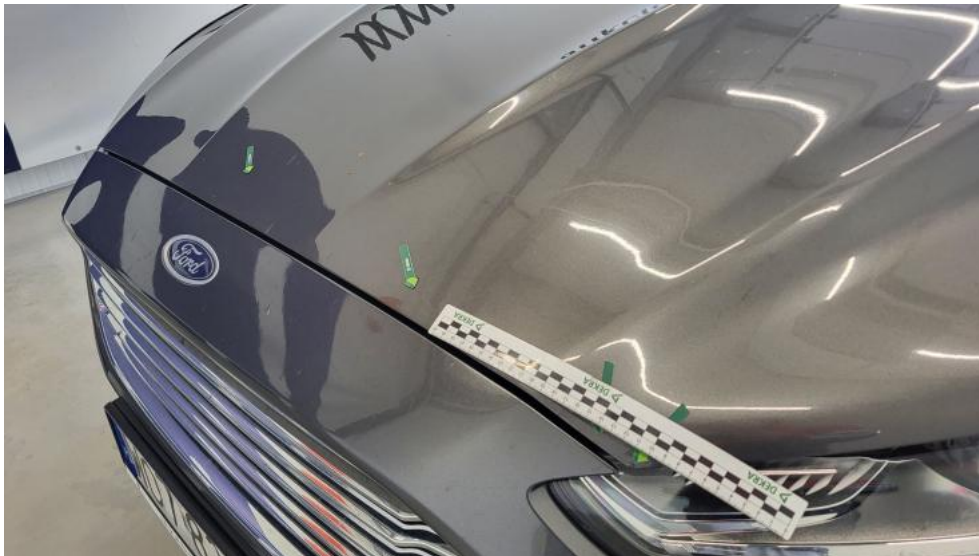


Photo 35.

Pokrywa komory silnika - zdjęcie poglądowe 1



Photo 36.

Pokrywa komory silnika - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION

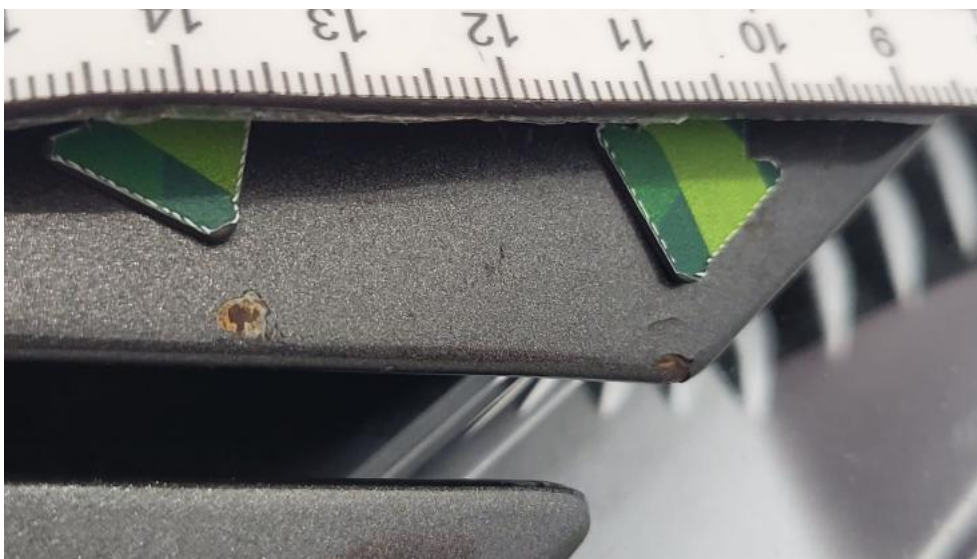


Photo 37.

Pokrywa komory silnika - Inne 1



Photo 38.

Zderzak - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Zderzak - Pęknięcie/rozerwanie 1



Photo 40.

Zderzak - Pęknięcie/rozerwanie 2

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Zderzak() - Pęknięcie/rozerwanie 3



Photo 42.

Felga aluminiowa przednia P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Drzwi przednie P - Wgniecenie/odkształcenie 1



Photo 44.

Drzwi tylne P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Próg P - Rysa/odprysk 1



Photo 46.

Próg P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Próg P - Inne 1



Photo 48.

Ścianka tylna P / Ścianka boczna P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 2



Photo 50.

Felga aluminiowa tylna P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Listwa śr zderzaka tylnego - Wgniecenie/odkształcenie 1



Photo 52.

Szyba tylna - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Zderzak tylny - Rysa/odprysk 1



Photo 54.

Zderzak tylny - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Zderzak tylny - Inne 1



Photo 56.

Zderzak tylny cz dolna - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Zderzak tylny cz dolna - Inne 1



Photo 58.

Dach - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Dach - Wgniecenie/odkształcenie 1

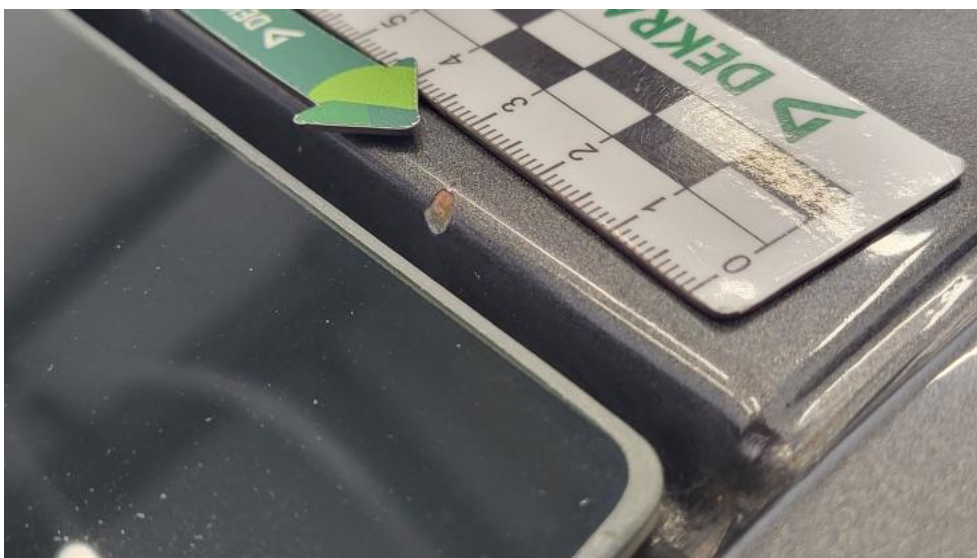


Photo 60.

Dach - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1



Photo 62.

Drzwi przed L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Drzwi przed L - Wgniecenie/odkształcenie 1



Photo 64.

Drzwi tylne L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Próg L - Wgniecenie/odkształcenie 1



Photo 66.

Słupek przedni L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION

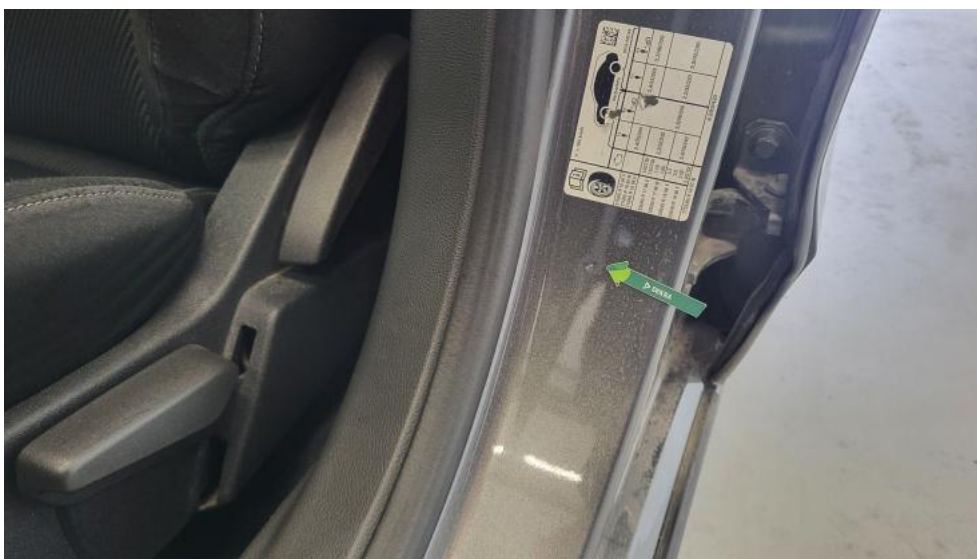


Photo 67.

Słupiek środkowy L - Wgniecenie/odkształcenie 1



Photo 68.

Łotnik przedni L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Felga Aluminiowa przednia L - Rysa/odprysk 1



Photo 70.

Gałka dźwigni zmiany biegów - Inne 1

PHOTOGRAPHIC DOCUMENTATION

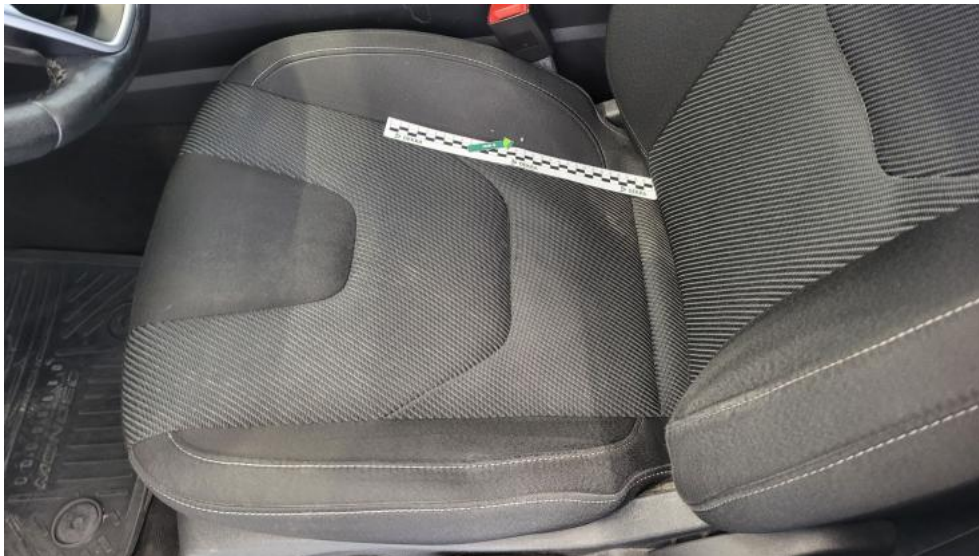


Photo 71.

Fotel prz. lew. - zdjęcie poglądowe 1



Photo 72.

Fotel prz. lew. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 73.

Fotel prz. praw. - Inne 1

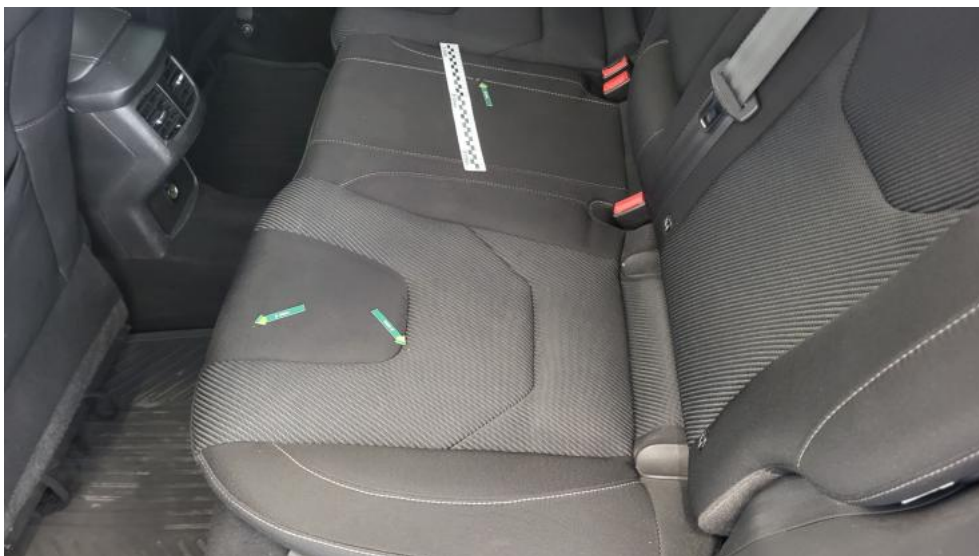


Photo 74.

Kanapa tyl. - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 75.
Kanapa tyl. - Inne 1



Photo 76.
Kanapa tyl. - Inne 2

PHOTOGRAPHIC DOCUMENTATION

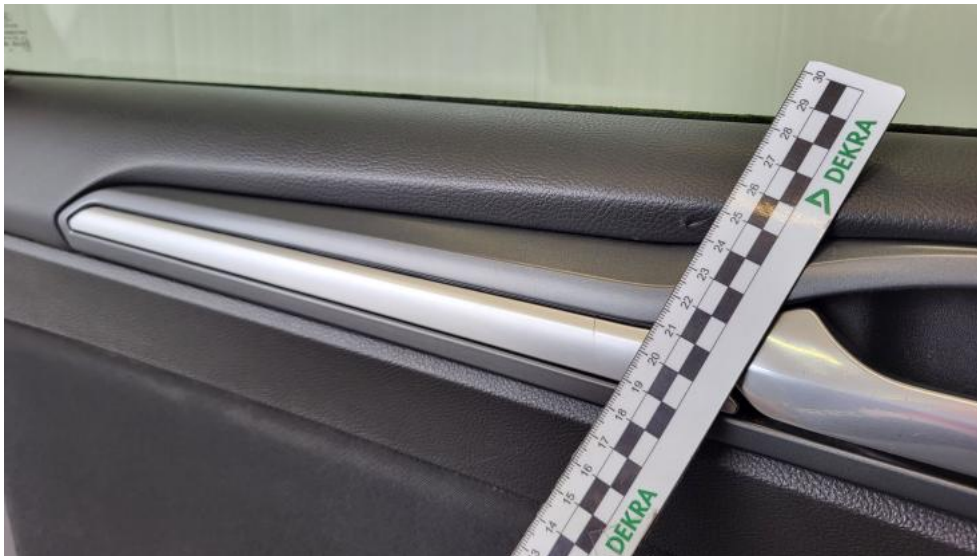


Photo 77.

Tapicerka drzwi przednich L - Pęknięcie/rozerwanie 1



Photo 78.

Tapicerka drzwi przednich P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 79.

Tapicerka drzwi tylnych P - Rysa/odprysk 1



Photo 80.

Osłona p/słoneczna lewa - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 81.

Osłona p/słoneczna prawa - Inne 1



Photo 82.

Podsufitka - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 83.
Podsufitka - Inne 2



Photo 84.
Wykładzina(y) słupka przedniego L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 85.

Wykładzina(y) słupka tylnego L - Inne 1



Photo 86.

Wykładzina podłogi - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 87.

Wykładzina podłogi - Inne 2



Photo 88.

Wykładzina podłogi bagażnika - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 89.

Wykładzina pokrywy tylnej - Rysa/odprysk 1