

DEKRA's commission No. : PKOL(W)/LODZ/88562/26/09/21
commission/ damage No. : 23/032489
Date of commission: 21-09-2026

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (WSP)
DEKRA Polska - współpraca O/Warszawa
inż. Józef Orłowski
TU - Włocławek

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	jeeps
EC code (Eurotax)	0132755
Manufacturer	HYUNDAI
Model	Tucson 18-21
Type / version	Tucson 1.6 T-GDi Premium 4WD DCT
Body type	KOM
Number of doors / seats	5/5
Curb weight [kg]	1665
Gross vehicle weight [kg]	2200
Wheelbase 1/2	2670
Engine type	spark ignition
Pollution reduction system	GPF
Engine capacity [ccm]	1591
Engine Power [hp/kW]	177/130
Gearbox	automatic 7- gear
Registration /record No.	GD7K629
VIN / serial number	TMAJ3812HLJ930445
Date of first registration	10-08-2019
Date of next. tech. test	01-09-2026
Year of manufacture	2019 (year has been verified with the manufacturer's base)
Readout [km]	138 155 (read)
Body color / type of coating	grafitowy/METALIK

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	MAZZINI, CROSS ALLSEASON AS8	245/45 19 102Y	4,5 mm
	left	MAZZINI, CROSS ALLSEASON AS8	245/45 19 102Y	4,0 mm
back	right	FIREMAX, FM805 +	245/45 19 102V	5,0 mm
	left	FIREMAX, FM805 +	245/45 19 102V	4,0 mm

Standard equipment by Eurotax

- | | |
|---|---|
| 1. 2 layers varnish, Uni-Lackierung | 38. LED rear lights |
| 2. 360 view camera | 39. Lane control assistant |
| 3. Adaptive Cruise Control | 40. Leather finish dashbord |
| 4. Additional gauges | 41. Leather gearshifter/switch, Leather steering wheel |
| 5. Antilock-Brake-System (ABS) | 42. Leather upholstery |
| 6. Automatic climate control | 43. Light Alloy wheels 19" |
| 7. Automatic dimlight activation | 44. Luggage compartment cover |
| 8. Blind spot warning | 45. Lumbar adjust driver |
| 9. Bord communication: other, USB in | 46. Mobile phone preparation, Navigation system, On board monitor, Rear view camera |
| 10. Bord entertainment: other accessories, Radio preparation | 47. Other |
| 11. Brake Assist | 48. Other |
| 12. Cornering Headlights | 49. Other |
| 13. Cruise control | 50. Other |
| 14. Diminished spare wheel | 51. Other |
| 15. Door lights | 52. Other |
| 16. Door mirror(s) electrically adjustable in general | 53. Park Distance Control front |
| 17. Door mirrors electrically foldable | 54. Park Distance Control rear |
| 18. Door mirrors heated | 55. Passenger seat electrically adjustable |
| 19. Driver airbag, Head airbags front, Passenger airbag, Side airbag driver, Side airbag driver and passenger | 56. Power steering, Steering: other |
| 20. Driver conditioning monitoring | 57. Power windows front, Power windows rear |
| 21. ESP (Electronical Stabilizing Program) | 58. Rain sensor |
| 22. Electric tailgate | 59. Rear Cross Traffic Alert |
| 23. Electrical sunroof General | 60. Rear seat heating |
| 24. Exterior design: other | 61. Rear-view mirror autodimming |
| 25. Exterior design: other | 62. Roof railing |
| 26. Exterior design: other | 63. Selectable driveline characteristics |
| 27. Exterior design: other | 64. Side indicators |
| 28. Exterior design: other | 65. Soundsystem |
| 29. Exterior lighting: other | 66. Steering wheel heated |
| 30. Fog lamps | 67. Steering wheel with radio operation |
| 31. Heated seat driver, Heated seat passenger | 68. Storage facilities in general |
| 32. Hill descent control | 69. Storage facilities in general |
| 33. Hill holder | 70. Tinted rear windows |
| 34. Interior lights: other accessories | 71. Traffic sign recognition |
| 35. Keyless go | 72. Tyre pressure control (RDC) |
| 36. LED Daytime running lights | 73. Ventilated front seat |
| 37. LED front dim light | |

Dealer's equipment (selected items)

1. Metallic paint -

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

CorrectionsFirst registrationEquipmentTyresOther

stwierdzone braki i uszkodzenia -
brak badania techn. -


Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 09-2026 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 28-09-2026

DEKRA's expert:
Kacper Sosnowski (WSP)
inż. Józef Orłowski

Document issued electronically valid without signature.

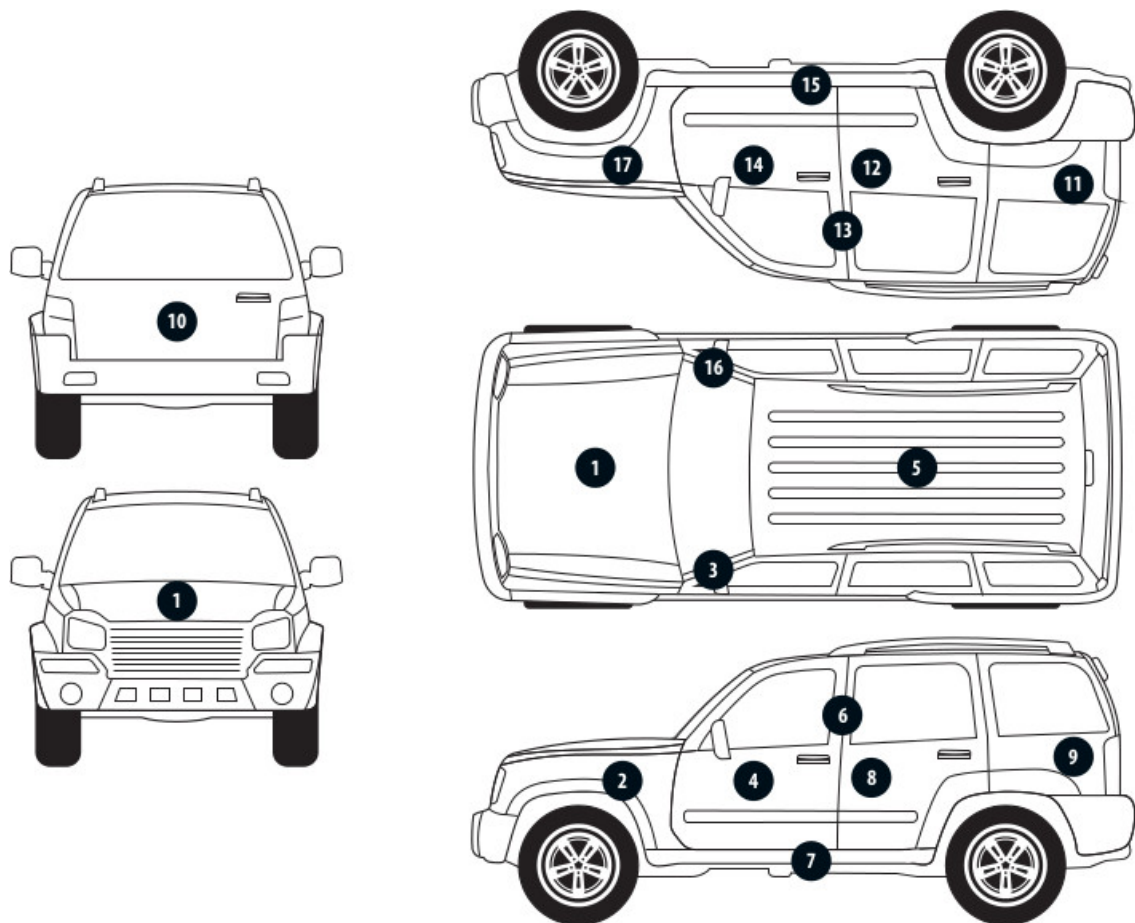Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Left front fender	to 150
3	Left front pillar	to 150
4	Left front wall	to 150
6	Left middle pillar	to 150
7	Left side sill	to 150
8	Left rear wall	to 150
9	Left side wall	to 150
10	Cover/tailgate	to 150
11	Side right wall	to 150
12	Rear right door	to 150
13	Middle right pillar	to 150
14	Front right door	to 150
15	Right side sill	to 150
16	Right front pillar	to 150
17	Right front fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book was presented and its number is given below:

.

Information concerning the origin of the vehicle

The vehicle purchased domestically from an authorized representative of the brand.

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below:
ograniczenia parkingowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

Anti-theft protection

immobilizer

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.
- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

2

Expert comments - regarding valuation

Rysy na samochodzie. Brak aktualnych badań technicznych. Aktywna kontrolka silnika. Niesprawny akumulator. Poziom płynu układu chłodniczego poniżej minimum. Odpryski na szybie czołowej. Widoczne ślady wycieków.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.

Próg lewy (widok od przodu)



Photo 12.

Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika



Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION



Photo 23.
Tabliczka znamionowa



Photo 24.
Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Zestaw wskaźników - serwis



Photo 26.

Widok przez otwarte drzwi przednie lewe

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Kierownica z lewej strony



Photo 28.

Widok przez otwarte drzwi tylne lewe

PHOTOGRAPHIC DOCUMENTATION



Photo 29.

Widok z tylnej kanapy na deskę rozd.



Photo 30.

Konsola środkowa

PHOTOGRAPHIC DOCUMENTATION



Photo 31.
Tunel środkowy



Photo 32.
Kierownica (na wprost)

PHOTOGRAPHIC DOCUMENTATION



Photo 33.

Dowód rej. Str. 1

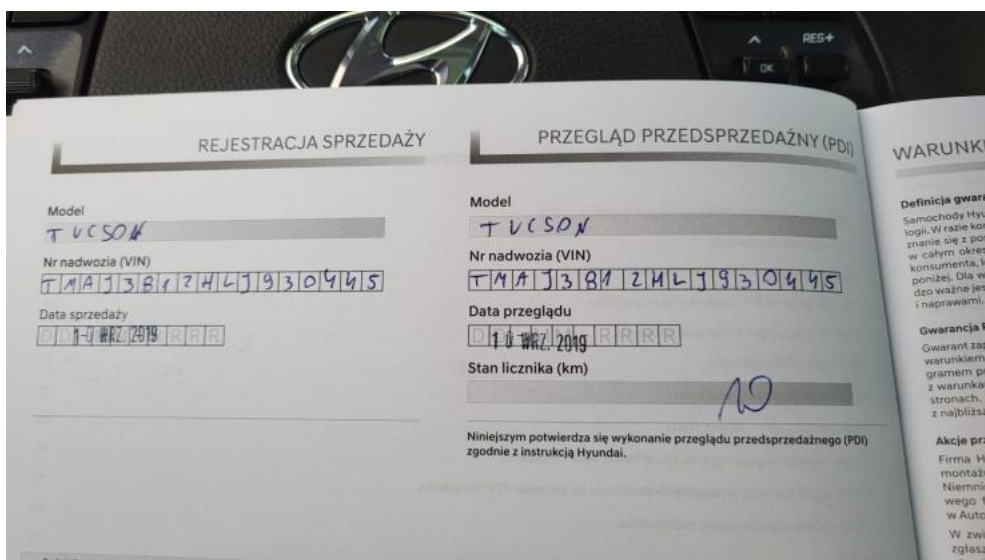


Photo 34.

Książka serwisowa – dane

PHOTOGRAPHIC DOCUMENTATION

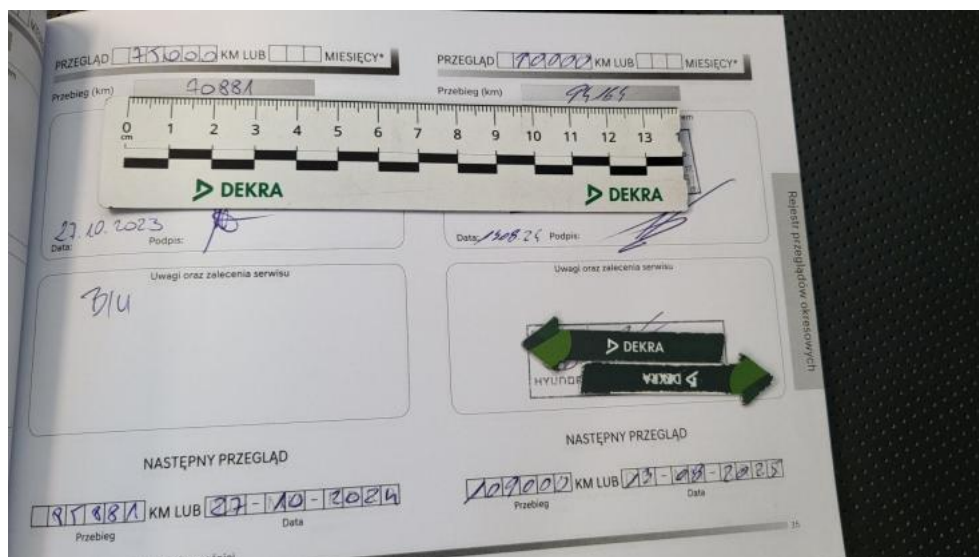


Photo 35.

Książka serwisowa – ostatni przegląd



Photo 36.

Dow. Rej. Str. 2

PHOTOGRAPHIC DOCUMENTATION



Photo 37.
Instrukcje



Photo 38.
Kluczyki

PHOTOGRAPHIC DOCUMENTATION



Photo 39.
Zdjęcie do protokołu



Photo 40.
Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Zdjęcie do protokołu



Photo 42.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Zdjęcie do protokołu



Photo 44.

Pokrywa komory silnika - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Zderzak - Rysa/odprysk 1



Photo 46.

Błotnik przedni P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Błotnik przedni P - Wgniecenie/odkształcenie 1



Photo 48.

Felga aluminiowa przednia P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Listwa krawędzi błotnika prz P - Rysa/odprysk 1



Photo 50.

Nadkole przednie P - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Drzwi przednie P - Rysa/odprysk 1



Photo 52.

Drzwi przednie P - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Drzwi przednie P - Wgniecenie/odkształcenie 1



Photo 54.

Drzwi tylne P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Drzwi tylne P - Rysa/odprysk 2



Photo 56.

Drzwi tylne P() - Rysa/odprysk 3

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Listwa drzwi przednich P - Rysa/odprysk 1



Photo 58.

Listwa drzwi tylnych P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Słupek przedni P - zdjęcie poglądowe 1

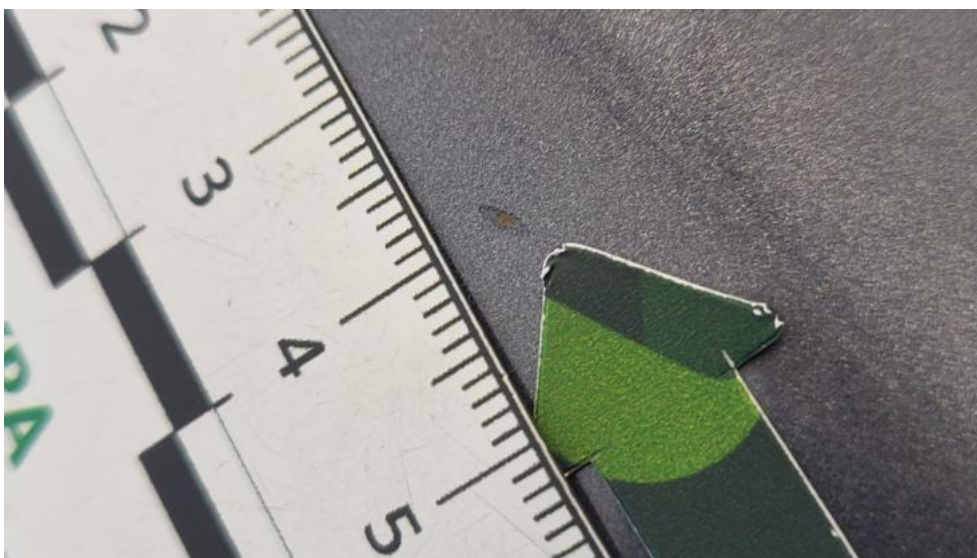


Photo 60.

Słupek przedni P - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Słupek środkowy P - Wgniecenie/odkształcenie 1



Photo 62.

Łotnik tylny P / Ściana boczna P - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Błotnik tylny P / Ściana boczna P - Rysa/odprysk 1



Photo 64.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Felga aluminiowa tylna P - Rysa/odprysk 1



Photo 66.

Listwa zderzaka tylnego P - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 67.

Pokrywy bagażnika - Rysa/odprysk 1



Photo 68.

Pokrywy bagażnika - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Pokrywy bagażnika - Wgniecenie/odkształcenie 1

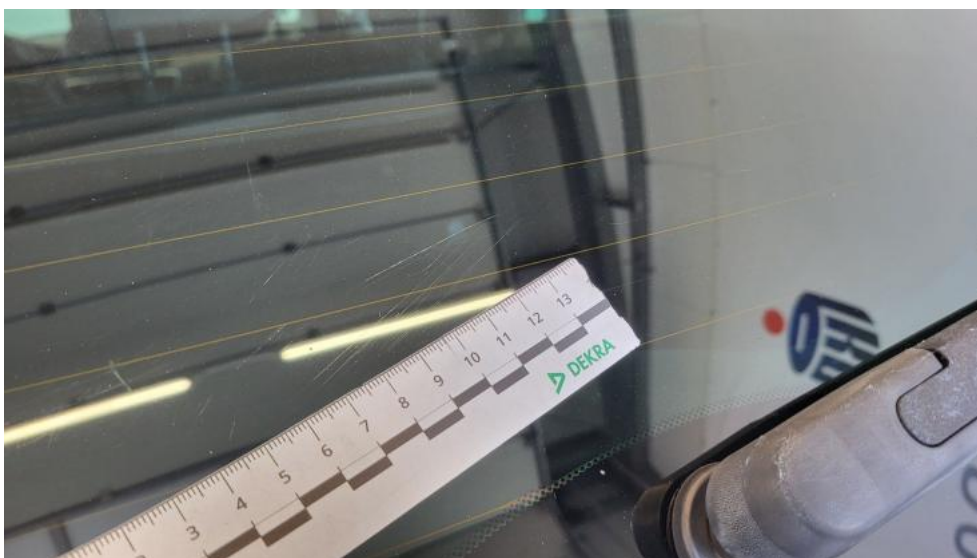


Photo 70.

Szyba tylna - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Zderzak tylny - Rysa/odprysk 1



Photo 72.

Zderzak tylny - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 73.

Zderzak tylny - Wgniecenie/odkształcenie 1



Photo 74.

Zderzak tylny - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 75.

Zderzak tylny cz dolna - Rysa/odprysk 1



Photo 76.

Łotnik tylny L / Ściana boczna L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 77.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1



Photo 78.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 2

PHOTOGRAPHIC DOCUMENTATION



Photo 79.

Felga aluminiowa tylna L - Rysa/odprysk 1



Photo 80.

Opona tylna L - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 81.

Drzwi przed L - Rysa/odprysk 1



Photo 82.

Drzwi przed L - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 83.

Drzwi przed L() - Rysa/odprysk 3



Photo 84.

Drzwi przed L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 85.

Drzwi tylne L - Rysa/odprysk 1



Photo 86.

Drzwi tylne L - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 87.

Drzwi tylne L - Wgniecenie/odkształcenie 1



Photo 88.

Drzwi tylne L - Wgniecenie/odkształcenie 2

PHOTOGRAPHIC DOCUMENTATION



Photo 89.

Listwa drzwi przednich L - Rysa/odprysk 1



Photo 90.

Felga Aluminiowa przednia L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 91.

Deska rozdzielcza - Rysa/odprysk 1



Photo 92.

Koło kierownicy - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 93.

Fotel prz. lew. - Rysa/odprysk 1



Photo 94.

Fotel prz. lew. - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 95.

Tapicerka drzwi przednich P - Rysa/odprysk 1



Photo 96.

Tapicerka drzwi tylnych L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 97.

Tapicerka drzwi tylnych P - Wgniecenie/odkształcenie 1



Photo 98.

Osłona p/słoneczna lewa - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 99.

Osłona p/słoneczna prawa - Inne 1



Photo 100.

Podsufitka - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 101.

Wykładzina pokrywy tylnej - Rysa/odprysk 1



Photo 102.

Wykładzina przestrzeni bagażowej - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 103.

Wykładzina przestrzeni bagażowej - Rysa/odprysk 2