

DEKRA's commission No. : PKOL(W)/LODZ/33455/25/05/09
 commission/ damage No. : 23/021318
 Date of commission: 09-05-2025

DEKRA Poland - Headquarters
 02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
 Świętokrzyska 36
 00-116 Warszawa

Expert:

Kacper Sosnowski (NEW)
 DEKRA Polska - współpraca O/Warszawa
mgr inż. Andrzej Szymkowiak
 DEKRA Polska - O. Wrocław

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0137374
Manufacturer	JAGUAR
Model	XE 19-24
Type / version	XE 2.0 D180 R-Dynamic SE aut
Body type	sedan
Number of doors / seats	4/5
Curb weight [kg]	1714
Gross vehicle weight [kg]	2190
Wheelbase 1/2	2835
Engine type	Automatic ignition
Supercompression	turbocompressor with intercooler
Pollution reduction system	DPF
Emission standard	EURO 6
Engine capacity [ccm]	1999
Engine Power [hp/kW]	180/132
Gearbox	automatic 8- gear
Registration /record No.	EL8HK21
VIN / serial number	SAJAB4BN8LCP57120
Date of first registration	05-11-2019
Date of next. tech. test	03-11-2024
Year of manufacture	2019 (year has been verified with the manufacturer's base)
Readout [km]	124 098 (read)
Body color / type of coating	black/METALIK

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	Mirage, MR 182	225/45 R18 95W	4,0 mm
	left	Mirage, MR 182	225/45 R18 95W	4,0 mm
back	right	Mirage, MR 182	225/45 R18 95W	4,0 mm
	left	Mirage, MR 182	225/45 R18 95W	4,0 mm

Standard equipment by Eurotax

- | | |
|---|---|
| 1. Blind spot warning | 23. On board monitor |
| 2. Bluetooth interface | 24. On board monitor |
| 3. Bord communication: other | 25. Other |
| 4. Bord communication: other | 26. Other |
| 5. Bord entertainment: other accessories, Soundsystem | 27. Other |
| 6. Child seat fixation | 28. Other |
| 7. Cruise control | 29. Other |
| 8. DAB radio | 30. Other |
| 9. Door mirrors autodimming, Door mirrors electrically foldable | 31. Other |
| 10. Driver seat electrically adjustable, Driver seat height adjustable, Driver seat with adjustable inclination, Passenger seat electrically adjustable, Passenger seat height adjustable, Passenger seat with adjustable inclination | 32. Other |
| 11. Dualzone automatic climate control | 33. Park Assistant |
| 12. Floor mat | 34. Park Distance Control front, Park Distance Control rear |
| 13. Hill holder | 35. Rear view camera |
| 14. Interior lights: other accessories | 36. Rear window heating |
| 15. Interior: other | 37. Rear-view mirror autodimming |
| 16. Interior: other | 38. Standard equipment to be completed when available |
| 17. LED front dim light | 39. Traffic sign recognition |
| 18. Lane control assistant | 40. Tyre pressure control (RDC) |
| 19. Leather steering wheel | 41. Uni-Lackierung |
| 20. Leather upholstery, Sport seats front | 42. Windscreenwiper: other |
| 21. Light Alloy wheels 18" | 43. {1. Wyposażenie opcjonalne, w trakcie edycji} |
| 22. Navigation system | |

Dealer's equipment (selected items)

- | | |
|---|---|
| 1. Bord entertainment: other accessories, Soundsystem | - |
| 2. Diminished spare wheel | - |
| 3. Driver seat electrically adjustable, Driver seat height adjustable, Driver seat with adjustable inclination, Heated seat driver, Heated seat passenger, Passenger seat electrically adjustable, Passenger seat height adjustable, Passenger seat with adjustable inclination | - |
| 4. Electric tailgate | - |
| 5. Glass sunroof fixed | - |
| 6. Headlamp wash, Steering wheel heated, Windscreen wash-nozzle heated | - |
| Szyba przednia ogrzewana | |
| Spryskiwacze reflektorów | |
| Kierownica podgrzewana | |
| 7. Interior: other | - |
| 8. Light Alloy wheels 18" | - |
| 9. Metallic paint | - |

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

CorrectionsFirst registrationEquipmentTyresOther

The validity of the technical examination	-
State of the vehicle	-
Current market situation	-
Earlier repairs	-
Stwierdzone braki, uszkodzenia (szacunkowo)	-

Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 05-2025 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - due to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 16-05-2025

DEKRA's expert:
Kacper Sosnowski (NEW)
mgr inż. Andrzej Szymkowiak

Document issued electronically valid without signature.

The image contains three line drawings of a car with numbered callouts 1 through 17, representing different views:

- Front View (Left):** Shows the front of the car. Callout 1 points to the front grille.
- Top View (Middle):** Shows the car from above. Callouts include:
 - 1: Front left corner.
 - 3: Front right corner.
 - 5: Center of the roof.
 - 10: Rear right corner.
 - 16: Rear left corner.
- Side View (Bottom):** Shows the side profile of the car. Callouts include:
 - 2: Front wheel.
 - 4: Front door.
 - 6: Rear door.
 - 8: Rear door.
 - 9: Rear wheel.
 - 7: Bottom center of the car.
- Rear View (Top):** Shows the rear of the car. Callouts include:
 - 11: Rear right corner.
 - 12: Rear right side.
 - 13: Center of the rear window.
 - 14: Center of the rear window.
 - 15: Rear left side.
 - 17: Rear left corner.

No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Front left fender	to 150
3	Left front pillar	to 150
4	Front left door	150 - 300
5	Roof	to 150
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	to 150
9	Rear left fender	to 150
10	Cover/lid	to 150
11	Right rear fender	to 150
12	Right rear door	to 150
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	to 150
16	Right front pillar	to 150
17	Front right fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book of the vehicle was not provided.

Information concerning the origin of the vehicle

The vehicle purchased domestically from an authorized representative of the brand.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below: pojazd udostępniono w warunkach parkingowych

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the

assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

2

Expert comments - regarding valuation

Niesprawne przyciski funkcyjne w jednym z kluczyków, grot prawidłowy. Rysy na samochodzie. Brak aktualnych badań technicznych. Informacja o zużytych klockach hamulcowych. Aktywna kontrolka klocków hamulcowych.

Rzeczoznawca dokonał oględzin pojazdu w warunkach parkingowych, co mogło ograniczyć pełną ocenę jego stanu technicznego. Dodatkowo, jeżeli jazda próbna została przeprowadzona (informacje w treści raportu), to wykonano ją w warunkach parkingowych, z niewielką prędkością, co może nie odzwierciedlać pełnych warunków eksploatacyjnych. Istnieje możliwość, że w innych okolicznościach ujawnią się dodatkowe uszkodzenia lub usterki, których nie można było wykryć podczas obecnych oględzin. Zalecamy zatem skorzystanie z możliwości oględzin pojazdu we własnym zakresie lub w Autoryzowanej Stacji Obsługi danej marki, co pozwoli na pełniejszą weryfikację stanu technicznego pojazdu przed udziałem w aukcji.

Restrictive disclaimer - regarding valuation

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.

Przekątna przednia lewa



Photo 2.

Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.

Próg lewy (widok od przodu)



Photo 12.

Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika



Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION



Photo 23.

Tabliczka znamionowa



Photo 24.

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe

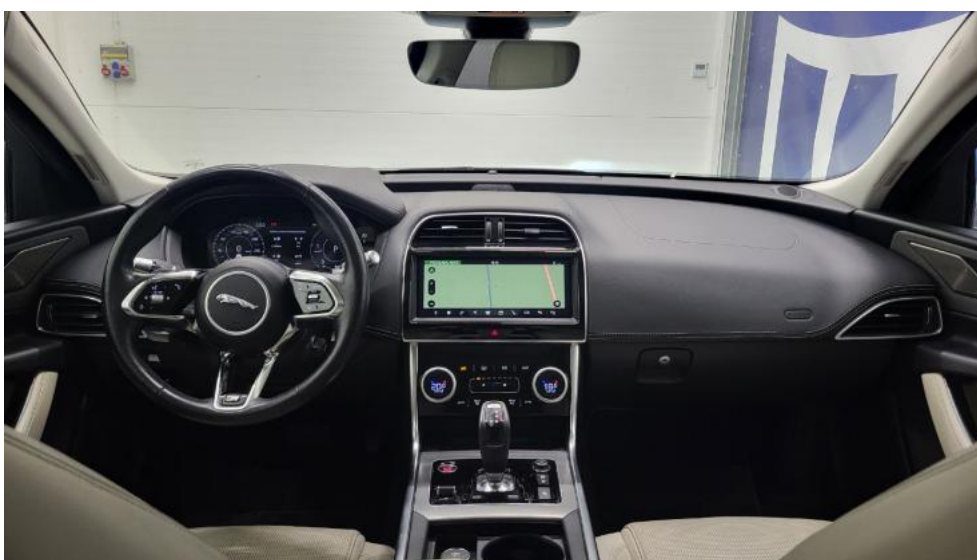


Photo 28.

Widok z tylnej kanapy na deskę rozdź.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.
Konsola środkowa



Photo 30.
Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION



Photo 31.

Kierownica (na wprost)



Photo 32.

Dowód rej. Str. 1

PHOTOGRAPHIC DOCUMENTATION



Photo 33.

Dow. Rej. Str.2 i klucze



Photo 34.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 35.

Zdjęcie do protokołu



Photo 36.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION

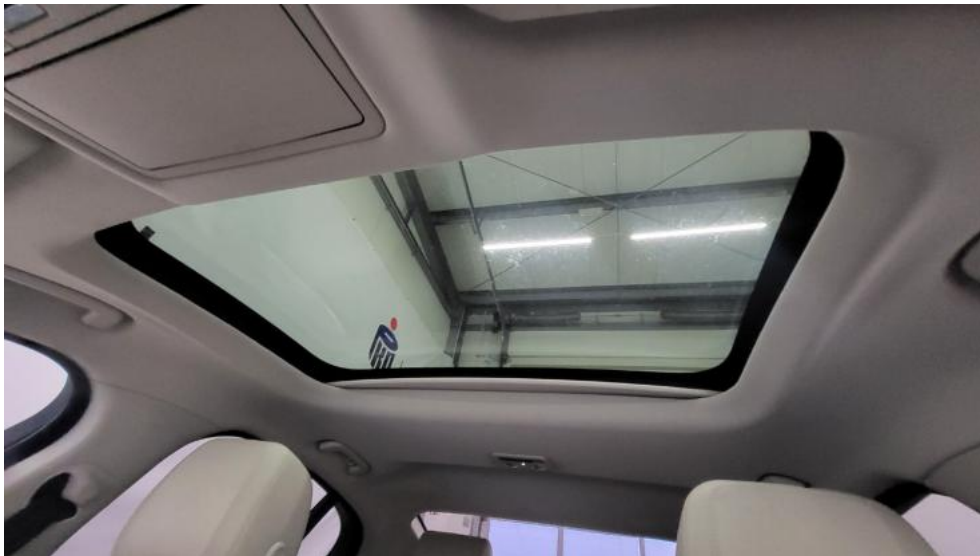


Photo 37.

Zdjęcie do protokołu



Photo 38.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Atrapa przednia - Pęknięcie/rozerwanie 1

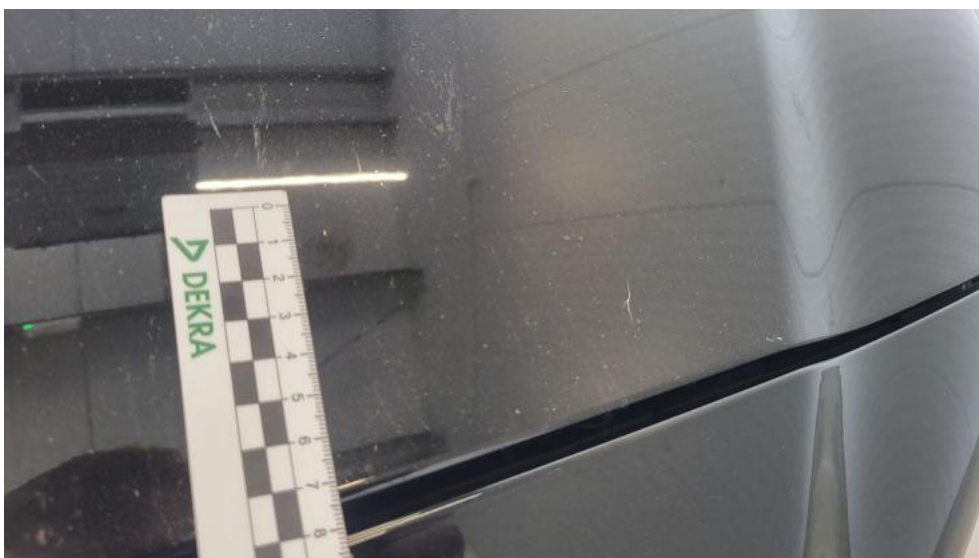


Photo 40.

Pokrywa komory silnika - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Szyba czołowa - zdjęcie poglądowe 1

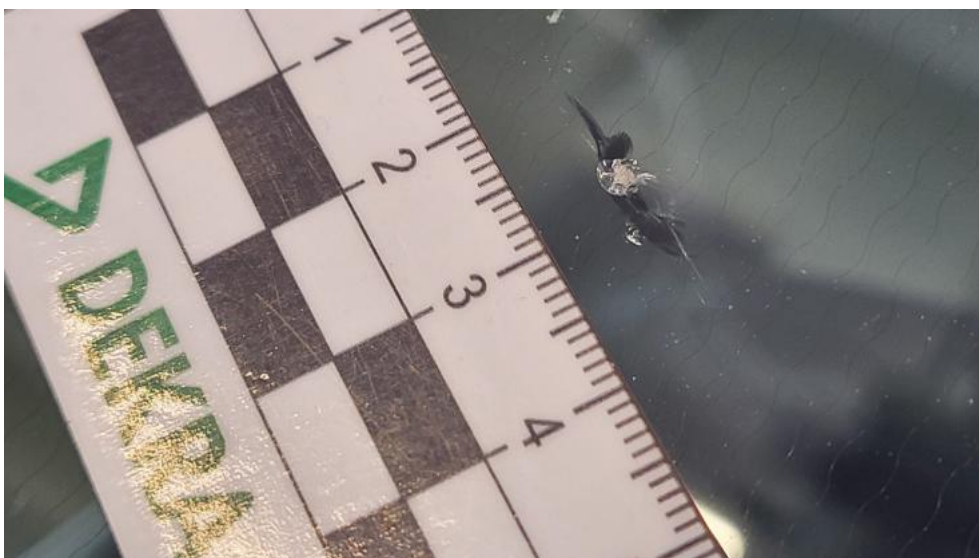


Photo 42.

Szyba czołowa - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Zderzak - Rysa/odprysk 1



Photo 44.

Zderzak - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Zderzak - Wgniecenie/odkształcenie 1



Photo 46.

Zderzak - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Zderzak - Pęknięcie/rozerwanie 2



Photo 48.

Felga aluminiowa przednia P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Nadkole przednie P - Inne 1



Photo 50.

Opona przednia P - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Drzwi przednie P - Rysa/odprysk 1



Photo 52.

Drzwi przednie P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Drzwi tylne P - Rysa/odprysk 1



Photo 54.

Drzwi tylne P - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Drzwi tylne P - Wgniecenie/odkształcenie 1



Photo 56.

Lusterko zew P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Próg P - Pęknięcie/rozerwanie 1



Photo 58.

Próg P - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Błotnik tylny P / Ściana boczna P - Rysa/odprysk 1



Photo 60.

Błotnik tylny P / Ściana boczna P - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Błotnik tylny P / Ściana boczna P() - Rysa/odprysk 3



Photo 62.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Felga aluminiowa tylna P - Rysa/odprysk 1



Photo 64.

Zderzak tylny - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Dach - Wgniecenie/odkształcenie 1



Photo 66.

Łotnik tylny L / Ściana boczna L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 67.

Błotnik tylny L / Ściana boczna L - Rysa/odprysk 2



Photo 68.

Felga aluminiowa tylna L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Drzwi przed L - Rysa/odprysk 1



Photo 70.

Drzwi przed L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Drzwi tylne L - Rysa/odprysk 1



Photo 72.

Drzwi tylne L - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 73.

Drzwi tylne L() - Rysa/odprysk 3



Photo 74.

Próg L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 75.

Felga Aluminiowa przednia L - Rysa/odprysk 1



Photo 76.

Fotel prz. lew. - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 77.

Fotel prz. lew. - Pęknięcie/rozerwanie 1



Photo 78.

Fotel prz. lew. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 79.

Fotel prz. praw. - Pęknięcie/rozerwanie 1



Photo 80.

Kanapa tyl. - zdjęcie pogładowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 81.

Kanapa tyl. - Pęknięcie/rozerwanie 1



Photo 82.

Kanapa tyl. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 83.

Tapicerka drzwi przednich P - zdjęcie poglądowe 1



Photo 84.

Tapicerka drzwi przednich P - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 85.

Osłona p/słoneczna prawa - Inne 1



Photo 86.

Podsufitka - Inne 1