

DEKRA's commission No. : PKOL(W)/LODZ/84709/26/09/09
commission/ damage No. : 25/038160
Date of commission: 09-09-2026

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (WSP)
DEKRA Polska - współpraca O/Warszawa
Ivan Halaburda (WSP)
DEKRA Polska - współpraca O/Białystok

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	jeeps
EC code (Eurotax)	0103316
Manufacturer	BMW
Model	X5 [F15/F85] 13-18
Type / version	X5 xDrive40d
Body type	KOM
Number of doors / seats	5/5
Curb weight [kg]	2110
Gross vehicle weight [kg]	2820
Wheelbase 1/2	2933
Engine type	Automatic ignition
Pollution reduction system	DPF
Engine capacity [ccm]	2993
Engine Power [hp/kW]	313/230
Gearbox	automatic 8- gear
Registration /record No.	EL9NM03
VIN / serial number	WBAKS610200C50652
Date of first registration	11-03-2014
Date of next. tech. test	04-07-2027
Year of manufacture	2014 (year has been verified with the manufacturer's base)
Readout [km]	273 152 (read)
Body color / type of coating	black/METALIK

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	PIRELLI, PZERO	275/45 20 110Y	3,0 mm
	left	PIRELLI, PZERO	275/45 20 110Y	3,0 mm
back	right	PIRELLI, PZERO	305/40 20 112Y	5,0 mm
	left	PIRELLI, PZERO	305/40 20 112Y	4,0 mm

Standard equipment by Eurotax

- | | |
|---|--|
| 1. 8-Speed automatic transmission | 26. Free service 4 years or more, more than 60000 km |
| 2. Antilock-Brake-System (ABS) | 27. Headlamp wash |
| 3. Armrest (s) front, Storage facilities in general | 28. Hill descent control |
| 4. Armrest (s) rear | 29. Interior lights: other accessories |
| 5. Automatic dimlight activation, Rain sensor | 30. Interior lights: other accessories |
| 6. Bi-Xenon Head lamps | 31. Light Alloy wheels 18" |
| 7. Bluetooth interface, Mobile phone preparation, USB in | 32. Metal finish |
| 8. Bord entertainment: other accessories | 33. Multi functional steering wheel |
| 9. CD-player, Radio | 34. Other |
| 10. Check-Control-System | 35. Other |
| 11. Child seat fixation | 36. Other |
| 12. Cruise control, Distance control | 37. Other |
| 13. Driver airbag, Head airbags front, Passenger airbag, Side airbag driver and passenger | 38. Power assisted brakes |
| 14. Driver seat height adjustable, Passenger seat height adjustable | 39. Power windows front, Power windows rear |
| 15. Dualzone automatic climate control | 40. Rear seat-backs foldable in two separate parts |
| 16. ESP (Electronical Stabilizing Program) | 41. Servotronic |
| 17. Electric tailgate | 42. Soundsystem |
| 18. Exterior design: other | 43. Steering wheel manually adjustabe |
| 19. Exterior design: other | 44. Textile upholstery |
| 20. Exterior lighting: other | 45. Traction control |
| 21. Exterior lighting: other | 46. Tyre pressure control (RDC) |
| 22. Fire protection system | 47. Uni-Lackierung |
| 23. Floor mat | 48. Vehicle immobilizer |
| 24. Fog lamps | 49. Whiplash-protection-system |
| 25. Follow me home | |

Dealer's equipment (selected items)

- | | |
|--|---|
| 1. 8-Speed automatic transmission, Steering wheel with gear-switches | - |
| 2. Aerodynamics package, Exterior design: other, Interior: other, Leather upholstery, Light Alloy wheels 20", Roof railing, Sport seats front, Sports steering wheel, Uni-Lackierung | - |
| 3. Alarm | - |
| 4. Automated High-beam assist | - |
| 5. Colored glass | - |
| 6. Colour stripe in windscreen | - |
| 7. Cornering Headlights, LED front dim light | - |
| 8. Driver seat electrically adjustable, Memory seat, Passenger seat electrically adjustable | - |
| 9. Exterior design: other | - |
| 10. Hatch/skibag in rear bench | - |
| 11. Heated seat driver, Heated seat passenger | - |
| 12. Interior: other | - |
| 13. LED Fog Lamps | - |
| 14. Metallic paint | - |
| 15. Other | - |
| 16. Other | - |
| 17. Park Distance Control front, Park Distance Control rear | - |
| 18. Roof railing | - |
| 19. Soundsystem | - |
| 20. Sport seats front | - |
| 21. Sports steering wheel | - |

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -


CorrectionsFirst registrationMileageEquipmentTyresOtherStan dbałości o pojazd -
Weryfikacja serwisowa -

Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 09-2026 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 17-09-2026

DEKRA's expert:
Kacper Sosnowski (WSP)
Ivan Halaburda (WSP)**Document issued electronically valid without signature.**

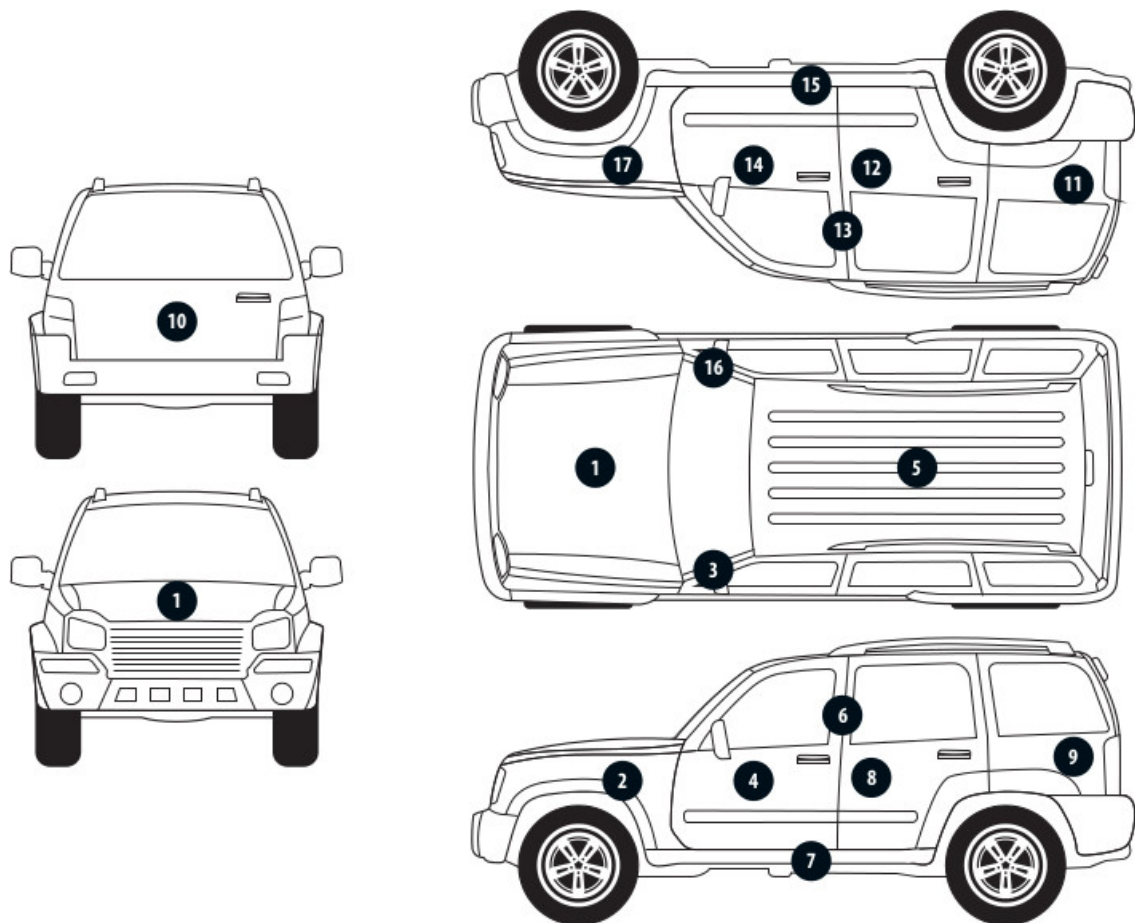Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
3	Left front pillar	to 150
4	Left front wall	to 150
5	Roof	to 150
6	Left middle pillar	to 150
7	Left side sill	to 150
8	Left rear wall	to 150
9	Left side wall	to 150
10	Cover/tailgate	to 150
11	Side right wall	to 150
12	Rear right door	to 150
13	Middle right pillar	to 150
14	Front right door	to 150
15	Right side sill	to 150
16	Right front pillar	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book of the vehicle was not provided.

Information concerning the origin of the vehicle

The vehicle purchased domestically from an authorized representative of the brand.

Additional comments on the car:

Not applicable.

Test drive

The test drive has been conducted on a distance and in time enabling rough estimation of the technical condition of the vehicle.

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted (with the exception of the year of production) - adopted according to the documents presented and indicated sources.

Anti-theft protection

immobilizer

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.
- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation**Kluczyki**

TAK

1

Expert comments - regarding valuation

Rysy na samochodzie. Brak półki bagażnika. Informacja termin przeglądu minął 2000km temu. Aktywna kontrolka ciśnienia w kołach. Wymagana wymiana oleju silnikowego od 2000km.

Restrictive disclaimer - regarding valuation

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.
Bok lewy z tyłu



Photo 10.
Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.
Próg lewy (widok od przodu)



Photo 12.
Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Komora silnika

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Numer identyfikacyjny



Photo 22.
Tabliczka znamionowa

PHOTOGRAPHIC DOCUMENTATION



Photo 23.

Zestaw wskaźników - przebieg



Photo 24.

Zestaw wskaźników - serwis

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe



Photo 28.

Widok z tylnej kanapy na deskę rozd.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.
Konsola środkowa



Photo 30.
Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION



Photo 31.
Kierownica (na wprost)



Photo 32.
Dowód rej. Str. 1

PHOTOGRAPHIC DOCUMENTATION



Photo 33.

Książka serwisowa – dane



Photo 34.

Książka serwisowa – ostatni przegląd

PHOTOGRAPHIC DOCUMENTATION**Photo 35.**

Dow. Rej. Str. 2

**Photo 36.**

Kluczyki

PHOTOGRAPHIC DOCUMENTATION



Photo 37.
Zdjęcie do protokołu



Photo 38.
Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Pokrywa komory silnika - Rysa/odprysk 1



Photo 40.

Pokrywa komory silnika - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Szyba czołowa - zdjęcie poglądowe 1

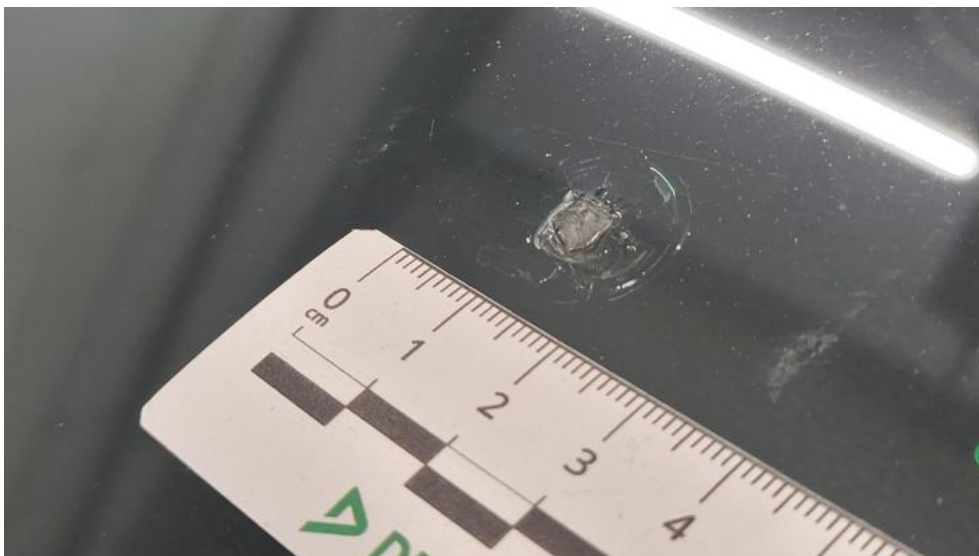


Photo 42.

Szyba czołowa - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Zderzak - Rysa/odprysk 1



Photo 44.

Błotnik przedni P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Felga aluminiowa przednia P - Rysa/odprysk 1



Photo 46.

Opona przednia P - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Drzwi przednie P - Rysa/odprysk 1



Photo 48.

Drzwi tylne P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Drzwi tylne P - Wgniecenie/odkształcenie 1



Photo 50.

Próg P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Słupek przedni P - zdjęcie poglądowe 1



Photo 52.

Słupek przedni P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION

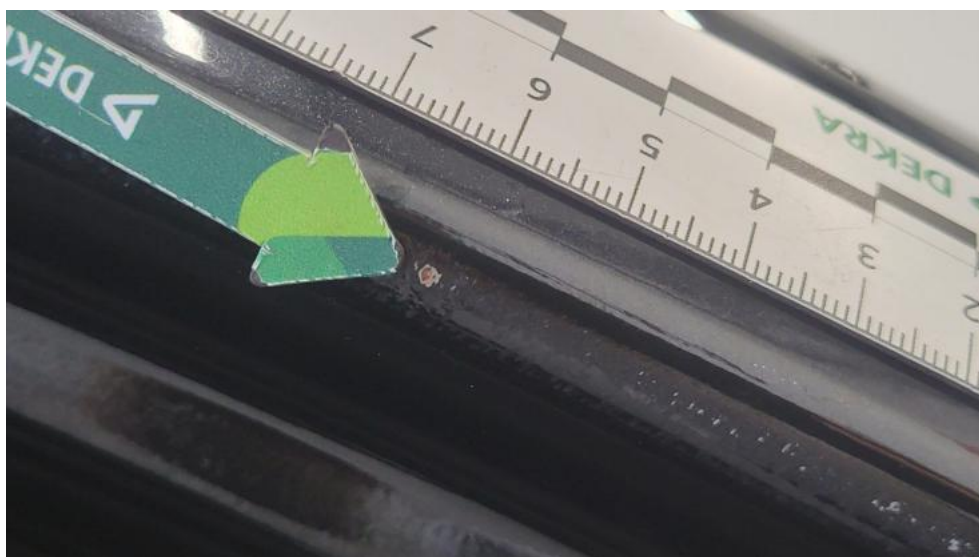


Photo 53.

Słupek przedni P - Inne 1



Photo 54.

Słupek środkowy P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1



Photo 56.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 2

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Felga aluminiowa tylna P - Rysa/odprysk 1



Photo 58.

Lampa tylna zew P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Opona tylna P - Pęknięcie/rozerwanie 1



Photo 60.

Pokrywy bagażnika - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Pokrywy bagażnika - Wgniecenie/odkształcenie 1



Photo 62.

Szyba tylna - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Zderzak tylny - Rysa/odprysk 1



Photo 64.

Zderzak tylny - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Zderzak tylny - Wgniecenie/odkształcenie 2



Photo 66.

Zderzak tylny - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 67.

Zderzak tylny - Pęknięcie/rozerwanie 2



Photo 68.

Zderzak tylny - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Dach - zdjęcie poglądowe 1



Photo 70.

Dach - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1



Photo 72.

Drzwi przed L - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 73.

Drzwi przed L - Rysa/odprysk 1



Photo 74.

Drzwi przed L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 75.

Drzwi tylne L - zdjęcie poglądowe 1



Photo 76.

Drzwi tylne L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 77.

Drzwi tylne L - Wgniecenie/odkształcenie 1



Photo 78.

Drzwi tylne L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 79.

Próg L - Rysa/odprysk 1



Photo 80.

Słupek środkowy L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 81.

Felga Aluminiowa przednia L - Rysa/odprysk 1



Photo 82.

Koło kierownicy - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 83.

Konsola środkowa - Rysa/odprysk 1



Photo 84.

Konsola środkowa - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 85.

Fotel prz. lew. - zdjęcie pogładowe 1



Photo 86.

Fotel prz. lew. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 87.

Fotel prz. lew. - Inne 2



Photo 88.

Fotel prz. praw. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 89.

Tapicerka drzwi przednich L - Rysa/odprysk 1



Photo 90.

Tapicerka drzwi przednich L - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 91.

Tapicerka drzwi przednich P - Rysa/odprysk 1



Photo 92.

Tapicerka drzwi przednich P - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 93.

Tapicerka drzwi tylnych L - Pęknięcie/rozerwanie 1



Photo 94.

Osłona p/słoneczna prawa - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 95.

Listwy progowe lew. - Wgniecenie/odkształcenie 1



Photo 96.

Listwy progowe praw. - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION

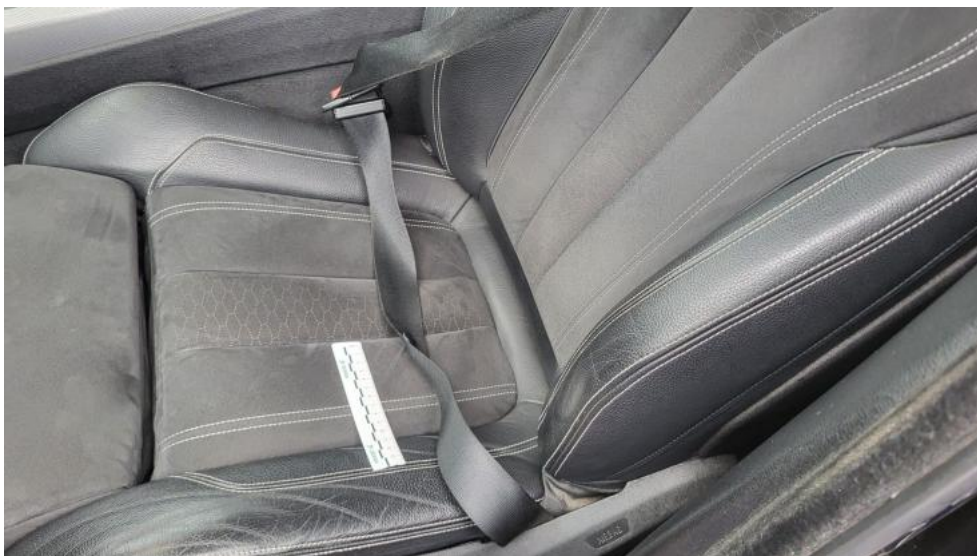


Photo 97.

Pas bezpieczeństwa przedni lewy - Inne 1



Photo 98.

Półka/roleta tylna - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 99.

Wykładzina podłogi bagażnika - Inne 1