

DEKRA's commission No. : PKOL(W)/LODZ/26412/25/04/10
commission/ damage No. : FUTURA
Date of commission: 10-04-2025

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (NEW)
DEKRA Polska - współpraca O/Warszawa
mgr inż. Andrzej Szymkowiak
DEKRA Polska - O. Wrocław

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0150571
Manufacturer	SEAT
Model	Ibiza 21-
Type / version	Ibiza 1.0 MPI EVO Reference S&S
Body type	hatchback
Number of doors / seats	5/5
Curb weight [kg]	1064
Gross vehicle weight [kg]	1565
Wheelbase 1/2	2564
Engine type	spark ignition
Pollution reduction system	GPF
Emission standard	EURO 6
Engine capacity [ccm]	999
Engine Power [hp/kW]	80/59
Gearbox	manual 5- gear
Registration /record No.	WD9355S
VIN / serial number	VSSZZZKJ5PR012351
Date of first registration	26-08-2022
Date of next. tech. test	26-08-2025
Year of manufacture	2022 (year has been verified with the manufacturer's base)
Readout [km]	54 169 (read)
Body color / type of coating	grafitowy/METALIK

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	Dębica, NAVIGATOR 3	185/65 R15 88H	2,0 mm
	left	Dębica, NAVIGATOR 3	185/65 R15 88H	2,0 mm
back	right	Dębica, NAVIGATOR 3	185/65 R15 88H	4,0 mm
	left	Dębica, NAVIGATOR 3	185/65 R15 88H	4,0 mm

Standard equipment by Eurotax

- | | |
|---|--|
| 1. Active Emergency Brake Assist, Pedestrian Emergency Brake Assist | 27. On board computer |
| 2. Air conditioning | 28. Osłony przeciwsłoneczne dla kierowcy i pasażera (dla kierowcy ze schowkiem na karty) |
| 3. Antilock-Brake-System (ABS) | 29. Other |
| 4. Body-coloured bumpers | 30. Other |
| 5. Bord communication: other | 31. Other |
| 6. Bord entertainment: other accessories, Radio, USB in | 32. Other |
| 7. Child seat fixation | 33. Other |
| 8. Comfort suspension | 34. Other |
| 9. DAB radio | 35. Power assisted brakes |
| 10. Door mirror(s) electrically adjustable in general | 36. Power assisted brakes |
| 11. Driver airbag, Head airbags front, Passenger airbag, Side airbag driver, Side airbag driver and passenger | 37. Power windows front |
| 12. Driver seat height adjustable | 38. Rear bench/seats foldable |
| 13. ESP (Electronical Stabilizing Program) | 39. Remote controlled central locking |
| 14. Exterior design: other | 40. Schowki w panelach drzwi przednich i tylnych |
| 15. Exterior design: other | 41. Składana tylna kanapa |
| 16. Exterior design: other | 42. Steel rims |
| 17. Floor mat | 43. Steering wheel manually adjustable |
| 18. Full Link przez USB dla Media System + | 44. Storage facilities in general |
| 19. Gniazdo 12V z przodu | 45. Textile upholstery |
| 20. Hill holder | 46. Traction control |
| 21. Interior lights: other accessories | 47. Tyre pressure control (RDC) |
| 22. Interior: other | 48. Uni-Lackierung |
| 23. LED Daytime running lights | 49. Vehicle immobilizer |
| 24. LED front dim light | 50. Warranty: 4 years or more |
| 25. Lane control assistant | 51. Wirtualny kokpit: cyfrowa tablica przyrządów z kolorowym ekranem TFT 8" |
| 26. Multi functional steering wheel | 52. Zagłówki z regulacją wysokości w przednich fotelach i na tylnej kanapie |

Dealer's equipment (selected items)

- | | |
|--|---|
| 1. Diminished spare wheel, Full size spare wheel | - |
| 2. Metallic paint | - |

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

CorrectionsFirst registrationMileageEquipment

TyresOther

State of the vehicle -
Earlier repairs -
The specific type of the operation -
Stwierdzone braki, uszkodzenia (szacunkowo) -


Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 04-2025 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 15-04-2025

DEKRA's expert:
Kacper Sosnowski (NEW)
mgr inż. Andrzej Szymkowiak

Document issued electronically valid without signature.

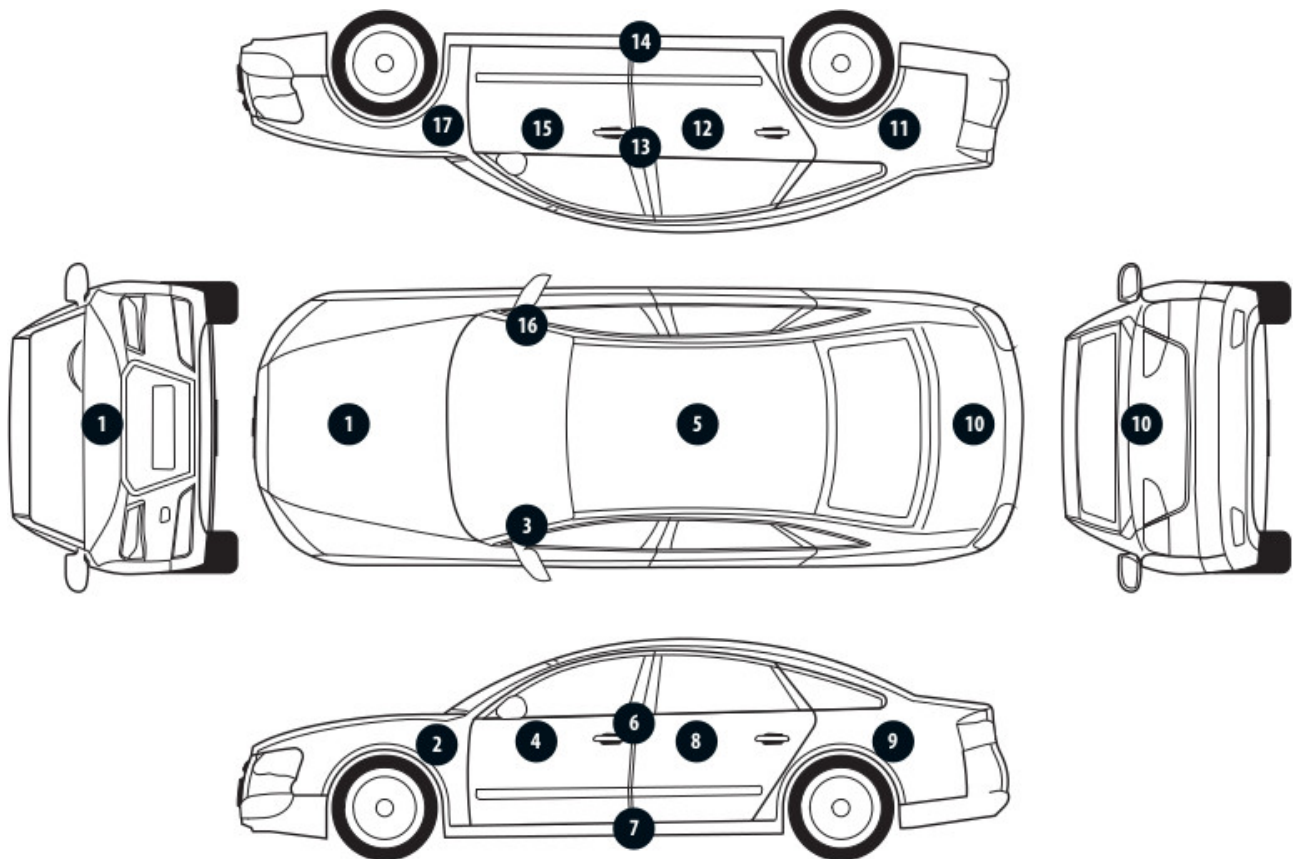Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Front left fender	to 150
3	Left front pillar	to 150
4	Front left door	to 150
5	Roof	to 150
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	to 150
9	Rear left fender	150 - 200
10	Cover/lid	to 150
11	Right rear fender	to 150
12	Right rear door	to 150
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	to 150
16	Right front pillar	to 150
17	Front right fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book of the vehicle was not provided.

Information concerning the origin of the vehicle

The vehicle purchased domestically from an authorized representative of the brand.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below: pojazd udostępniono w warunkach parkingowych

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted (with the exception of the year of production) - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of

the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

2

Expert comments - regarding valuation

Rysy na samochodzie. Odpryski na szybie czołowej.

Restrictive disclaimer - regarding valuation

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.

Próg lewy (widok od przodu)

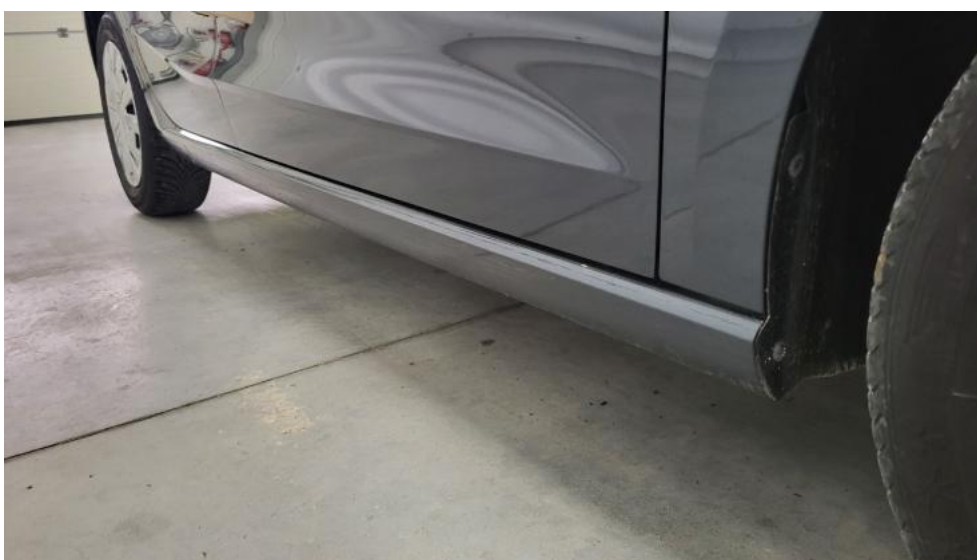


Photo 12.

Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód

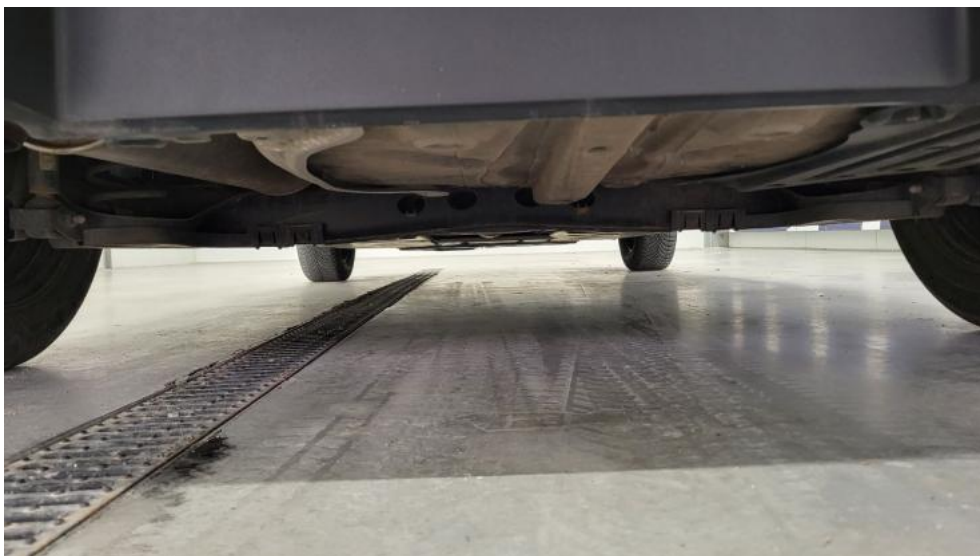


Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.
Bagażnik



Photo 16.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 17.
Komora silnika

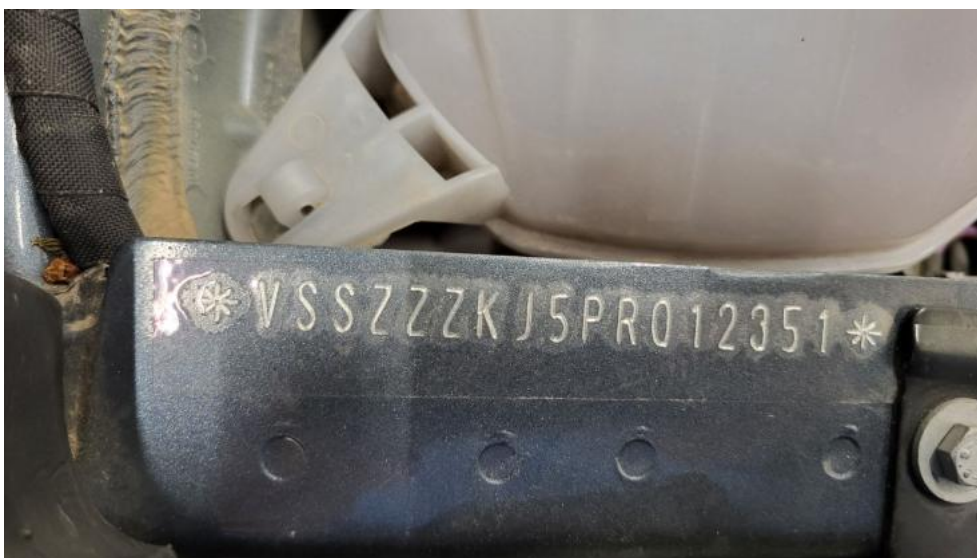


Photo 18.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION



Photo 19.

Tabliczka znamionowa



Photo 20.

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 21.

Widok przez otwarte drzwi przednie lewe



Photo 22.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 23.

Widok przez otwarte drzwi tylne lewe



Photo 24.

Widok z tylnej kanapy na deskę rozdz.

PHOTOGRAPHIC DOCUMENTATION



Photo 25.
Konsola środkowa



Photo 26.
Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Kierownica (na wprost)



Photo 28.

Dowód rej. Str. 1

PHOTOGRAPHIC DOCUMENTATION



Photo 29.

Dow. Rej. Str.2 i klucze

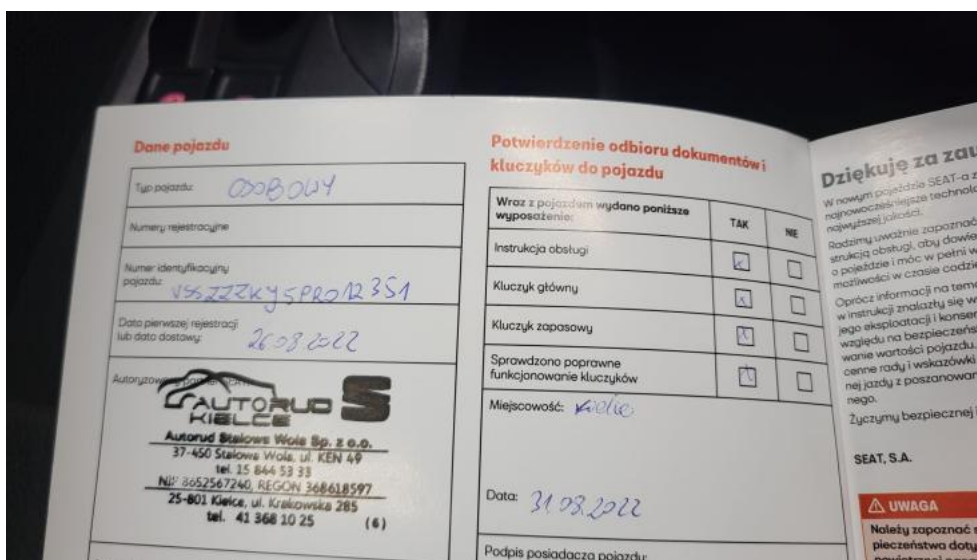


Photo 30.

Książka serwisowa – dane

PHOTOGRAPHIC DOCUMENTATION



Photo 31.

Książka serwisowa – ostatni przegląd



Photo 32.

Instrukcje

PHOTOGRAPHIC DOCUMENTATION



Photo 33.

Pokrywa komory silnika - Rysa/odprysk 1



Photo 34.

Zderzak - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 35.

Zderzak - Wgniecenie/odkształcenie 1



Photo 36.

Błotnik przedni P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 37.

Drzwi tylne P - Rysa/odprysk 1



Photo 38.

Próg P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Błotnik tylny P / Ściana boczna P - Rysa/odprysk 1



Photo 40.

Błotnik tylny P / Ściana boczna P - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1



Photo 42.

Zderzak tylny - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Drzwi przed L - Rysa/odprysk 1



Photo 44.

Drzwi przed L - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Drzwi przed L - Wgniecenie/odkształcenie 1



Photo 46.

Drzwi tylne L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Klamka drzwi prz L - Rysa/odprysk 1



Photo 48.

Deska rozdzielcza - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Kanapa tyl. - Inne 1