

DEKRA's commission No. : PKOL(W)/LODZ/32881/25/05/07
commission/ damage No. : 21/023151
Date of commission: 07-05-2025

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (NEW)
DEKRA Polska - współpraca O/Warszawa
Andrzej Sosnowski
DEKRA Polska - Centrala

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0135110
Manufacturer	TOYOTA
Model	Corolla Sedan 18-22
Type / version	Corolla 1.8 Hybrid Comfort
Body type	sedan
Number of doors / seats	4/5
Curb weight [kg]	1370
Gross vehicle weight [kg]	1835
Wheelbase 1/2	2700
Engine type	spark ignition
Pollution reduction system	three-way catalytic converter
Engine capacity [ccm]	1798
Engine Power [hp/kW]	98/72
Gearbox	automatic
Registration /record No.	WOT82510
VIN / serial number	NMTBZ3BE80R043554
Date of first registration	04-03-2020
Date of next. tech. test	12-03-2025
Year of manufacture	2020 (year has been verified with the manufacturer's base)
Readout [km]	294 323 (read)
Body color / type of coating	black/double-layered, metallized

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	NOKIAN, WR A4	205/55 16 91H	4,0 mm
	left	NOKIAN, WR A4	205/55 16 91H	4,0 mm
back	right	KORMORAN, ALLSEASON	205/55 16 91H	5,5 mm
	left	KORMORAN, ALLSEASON	205/55 16 91H	5,0 mm

Standard equipment by Eurotax

- | | |
|--|--|
| 1. Adaptive Cruise Control | 36. Interior decoration: other |
| 2. Additional gauges | 37. Interior lights: other accessories |
| 3. Android Auto, Apple CarPlay | 38. Interior: other |
| 4. Antilock-Brake-System (ABS) | 39. Interior: other |
| 5. Armrest (s) front | 40. Keyless go |
| 6. Armrest (s) rear | 41. LED Daytime running lights |
| 7. Automated High-beam assist | 42. Lane control assistant, Other |
| 8. Automatic Emergency Call | 43. Leather gearshifter/switch, Leather steering wheel |
| 9. Automatic antenna/ window-antenna | 44. Light Alloy wheels 16'' |
| 10. Automatic climate control | 45. Mobile Tire System |
| 11. Automatic dimlight activation | 46. Multi functional steering wheel |
| 12. Bluetooth interface | 47. On board computer |
| 13. Bord climate: other | 48. On board monitor |
| 14. Bord communication: other | 49. Other |
| 15. Bord entertainment: other accessories | 50. Other |
| 16. Child lock manually | 51. Other |
| 17. Child seat fixation | 52. Other |
| 18. Cornering Headlights | 53. Other |
| 19. Distribution of braking force electronically | 54. Power assisted brakes |
| 20. Door mirror(s) electrically adjustable in general | 55. Power windows front, Power windows rear |
| 21. Door mirrors heated | 56. Pre-Crash System |
| 22. Driver airbag, Passenger airbag | 57. Radio |
| 23. Driver knee airbag | 58. Rear bench foldable in two separate parts |
| 24. Driver seat height adjustable | 59. Rear view camera |
| 25. ESP (Electronical Stabilizing Program) | 60. Remote controlled central locking |
| 26. ESP (Electronical Stabilizing Program), Traction control | 61. Rev counter |
| 27. Exterior design: other | 62. Seats: other |
| 28. Exterior design: other | 63. Side airbag driver and passenger |
| 29. Exterior lighting: other | 64. Steering wheel electrically adjustable |
| 30. Exterior lighting: other | 65. Textile upholstery |
| 31. Extra power outlet | 66. Traffic sign recognition |
| 32. Fog lamps | 67. Tyre pressure control (RDC) |
| 33. Head airbags front | 68. USB in |
| 34. Hill holder | 69. Uni-Lackierung |
| 35. Interior decoration: other | 70. Vehicle immobilizer |

Dealer's equipment (selected items)

1. Metallic paint -

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

CorrectionsFirst registrationMileage

EquipmentTyresOther

The validity of the technical examination -
Earlier repairs -
The specific type of the operation -
Braki, uszkodzenia stan, weryfikacja serwisowa -

Gas-fittings

Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 05-2025 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 11-05-2025

DEKRA's expert:
Kacper Sosnowski (NEW)
Andrzej Sosnowski

Document issued electronically valid without signature.

Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	150 - 1000
2	Front left fender	150 - 1000
3	Left front pillar	to 150
4	Front left door	to 150
5	Roof	to 150
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	to 150
9	Rear left fender	150 - 2000
10	Cover/lid	to 150
11	Right rear fender	150 - 2000
12	Right rear door	150 - 300
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	150 - 2000
16	Right front pillar	150 - 200
17	Front right fender	150 - 300

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book of the vehicle was not provided.

Information concerning the origin of the vehicle

Lack of reliable data.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below: ograniczenia placowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the

page 5/59

assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

2

Expert comments - regarding valuation

Rysy na samochodzie. Odpryski na szybie czołowej. Niesprawne przyciski funkcyjne w jednym z kluczyków, grot prawidłowy. Pojazd zasilany gazem. Pojazd TAXI, brak informacji w dowodzie. Odpryski na szybie czołowej. Widoczne ślady po grafice reklamowej. Brak aktualnych badań technicznych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.

Przekątna przednia lewa



Photo 2.

Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.

Próg lewy (widok od przodu)



Photo 12.

Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik

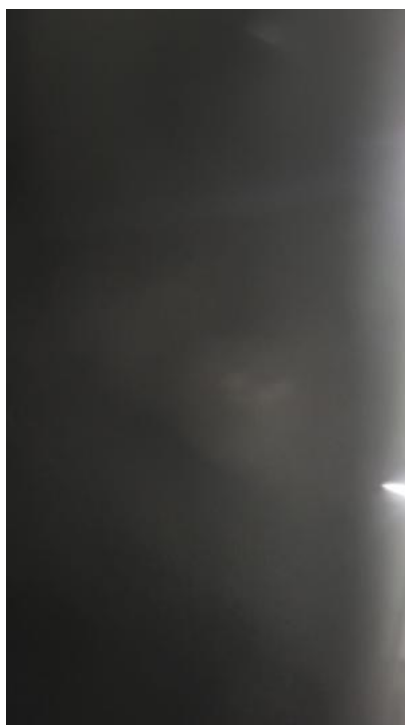


Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika



Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION

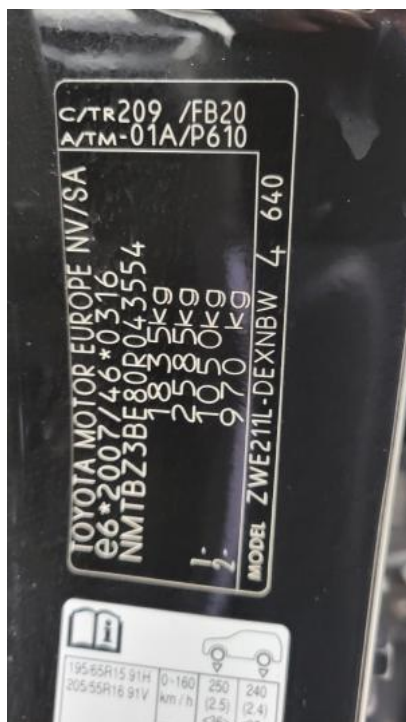


Photo 23.

Tabliczka znamionowa



Photo 24.

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe



Photo 28.

Widok z tylnej kanapy na deskę rozdziel.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.
Konsola środkowa



Photo 30.
Tunel środkowy

A detailed view of the driver's side interior of a Toyota Auris. The steering wheel is black with a silver Toyota emblem in the center and features multiple control buttons. Behind the wheel is a digital instrument cluster displaying speed, RPM, and other vehicle metrics. To the right, a large infotainment screen shows a navigation map and various menu options. The dashboard and center console are finished with dark materials and silver accents.

[illegible]

DEKRA Polska Sp. z o.o.
02-673 Warszawa, ul. Konstruktorska 12A
www.dekra.pl

PHOTOGRAPHIC DOCUMENTATION



Photo 33.

Dow. Rej. Str.2 i klucze

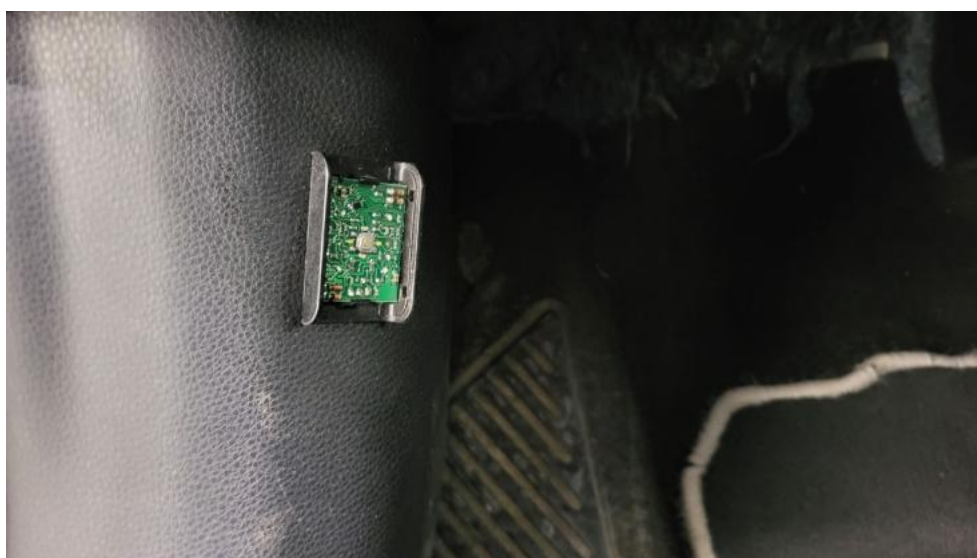
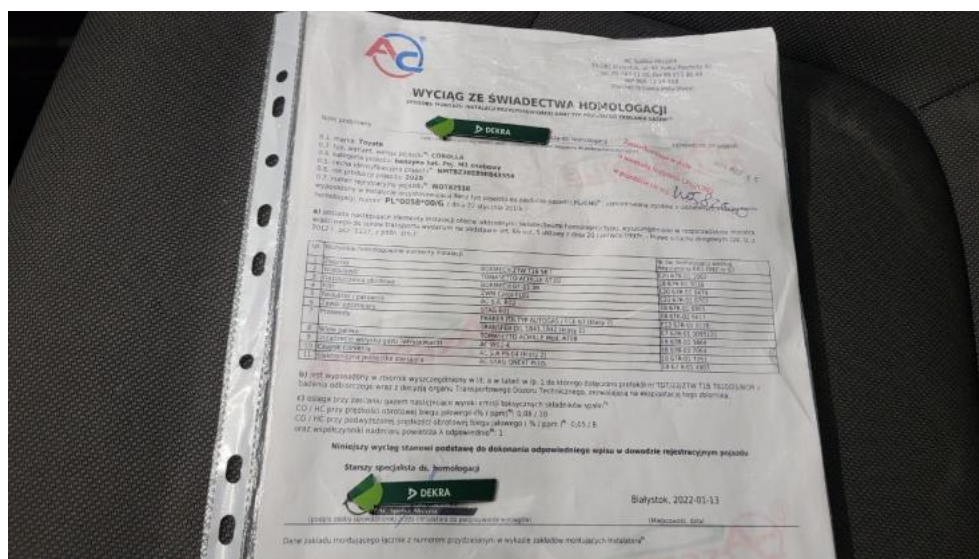
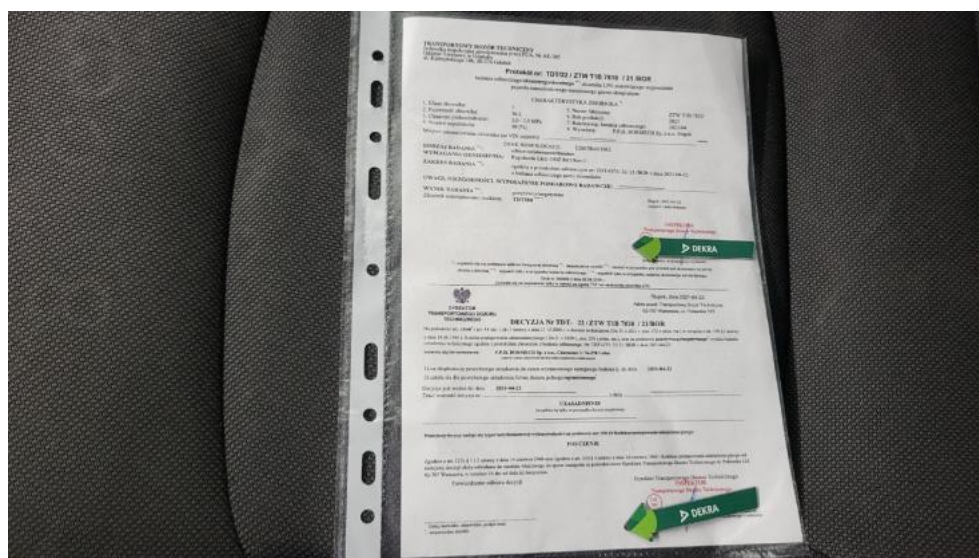


Photo 34.


Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION**Photo 35.**

Zdjęcie do protokołu

**Photo 36.**

Zdjęcie do protokołu

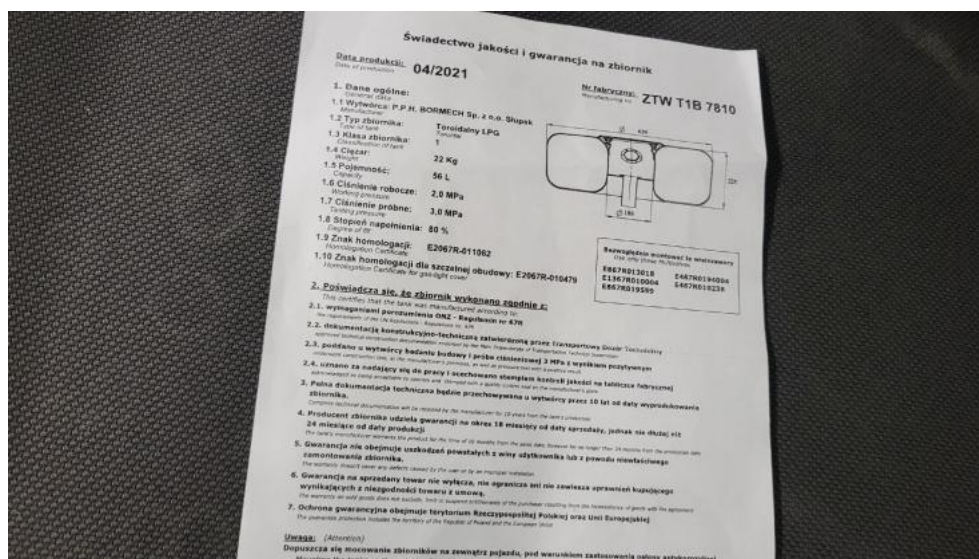PHOTOGRAPHIC DOCUMENTATION**Photo 37.**

Zdjęcie do protokołu

**Photo 38.**

Pokrywa komory silnika - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Pokrywa komory silnika - Wgniecenie/odkształcenie 1



Photo 40.

Pokrywa komory silnika - Wgniecenie/odkształcenie 2

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Zderzak - Wgniecenie/odkształcenie 1



Photo 42.

Zderzak - Wgniecenie/odkształcenie 2

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Zderzak() - Wgniecenie/odkształcenie 3



Photo 44.

Zderzak - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Zderzak - Pęknięcie/rozerwanie 2

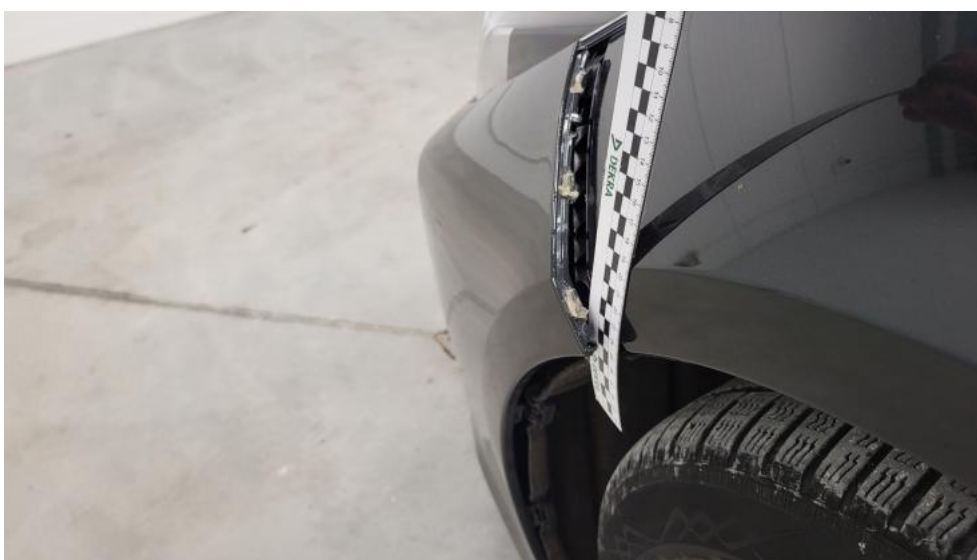


Photo 46.

Zderzak - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Błotnik przedni P - Wgniecenie/odkształcenie 1



Photo 48.

Felga aluminiowa przednia P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.
Reflektor P - Inne 1



Photo 50.
Drzwi przednie P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Drzwi przednie P - Wgniecenie/odkształcenie 1



Photo 52.

Drzwi przednie P - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Drzwi przednie P - Inne 2



Photo 54.

Drzwi tylne P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Drzwi tylne P - Inne 1



Photo 56.

Listwa drzwi przednich P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Listwa drzwi tylnych P - Wgniecenie/odkształcenie 1



Photo 58.

Lusterko zew P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Próg P - Rysa/odprysk 1



Photo 60.

Słupek przedni P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1



Photo 62.

Błotnik tylny P / Ściana boczna P - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Felga aluminiowa tylna P - Rysa/odprysk 1



Photo 64.

Pokrywy bagażnika - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Pokrywy bagażnika - Rysa/odprysk 2



Photo 66.

Pokrywy bagażnika - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION

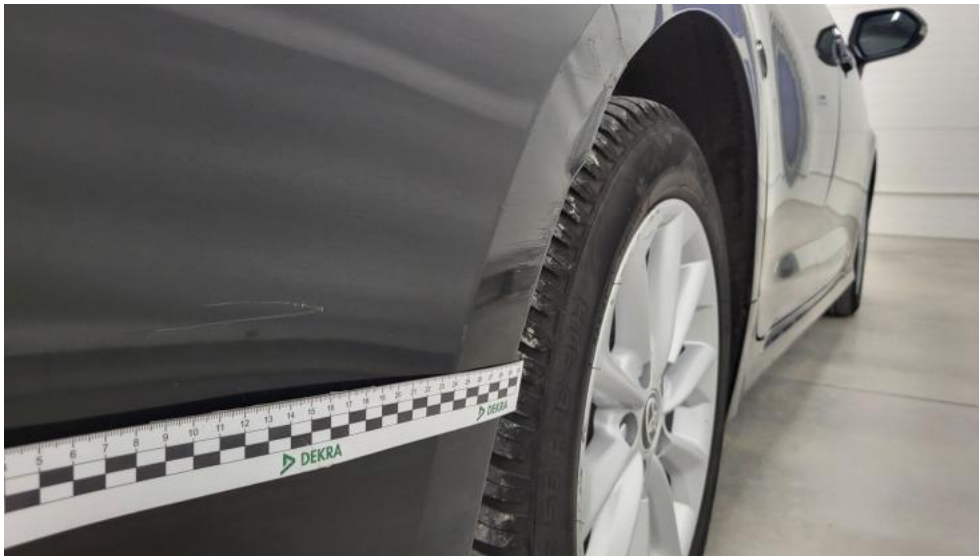


Photo 67.

Zderzak tylny - Rysa/odprysk 1



Photo 68.

Zderzak tylny - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Zderzak tylny - Wgniecenie/odkształcenie 1



Photo 70.

Dach - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Dach - Wgniecenie/odkształcenie 2

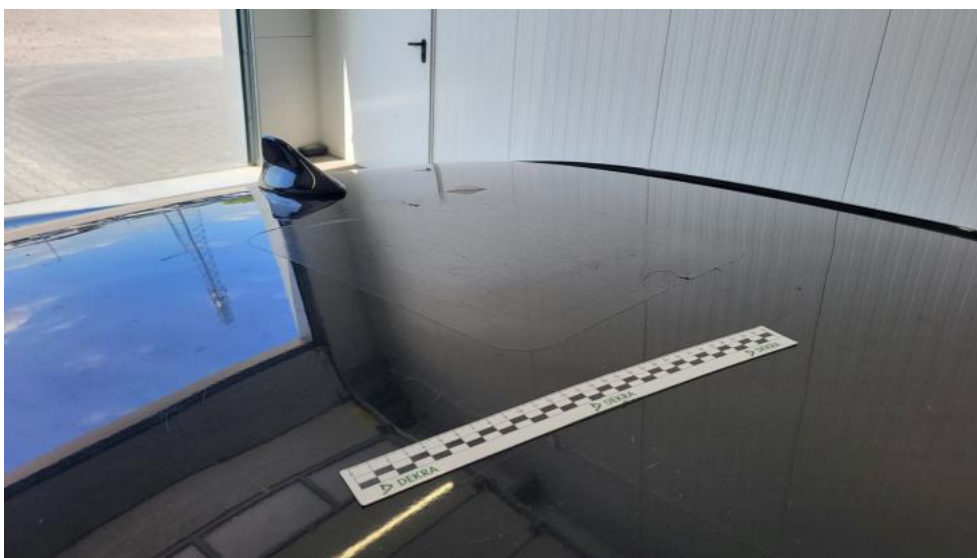


Photo 72.

Dach - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 73.

Błotnik tylny L / Ściana boczna L - Rysa/odprysk 1

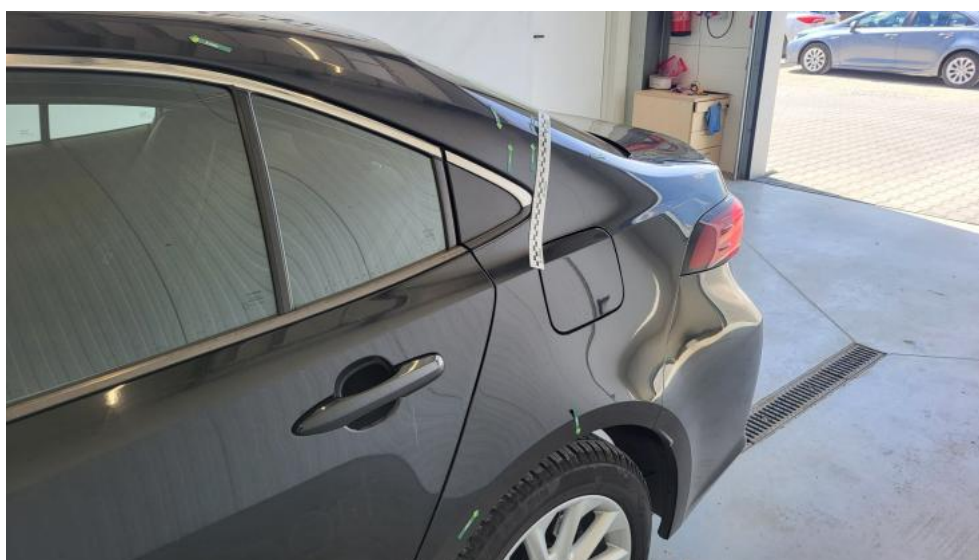


Photo 74.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 75.

Błotnik tylny L / Ściana boczna L - Inne 1



Photo 76.

Felga aluminiowa tylna L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 77.

Drzwi przed L - Rysa/odprysk 1



Photo 78.

Drzwi przed L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 79.

Drzwi przed L - Inne 1



Photo 80.

Drzwi tylne L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 81.

Drzwi tylne L - Wgniecenie/odkształcenie 1



Photo 82.

Drzwi tylne L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 83.

Listwa drzwi przednich L - Rysa/odprysk 1



Photo 84.

Listwa drzwi przednich L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 85.

Próg L - Rysa/odprysk 1



Photo 86.

Próg L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 87.

Próg L - Wgniecenie/odkształcenie 2



Photo 88.

Próg L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 89.

Błotnik przedni L - Rysa/odprysk 1



Photo 90.

Błotnik przedni L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 91.

Felga Aluminiowa przednia L - Rysa/odprysk 1



Photo 92.

Gałka dźwigni zmiany biegów - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 93.

Koło kierownicy - Inne 1



Photo 94.

Podłokietnik środkowy przedni - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 95.

Fotel prz. lew. - Inne 1



Photo 96.

Fotel prz. praw. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 97.
Kanapa tyl. - Inne 1

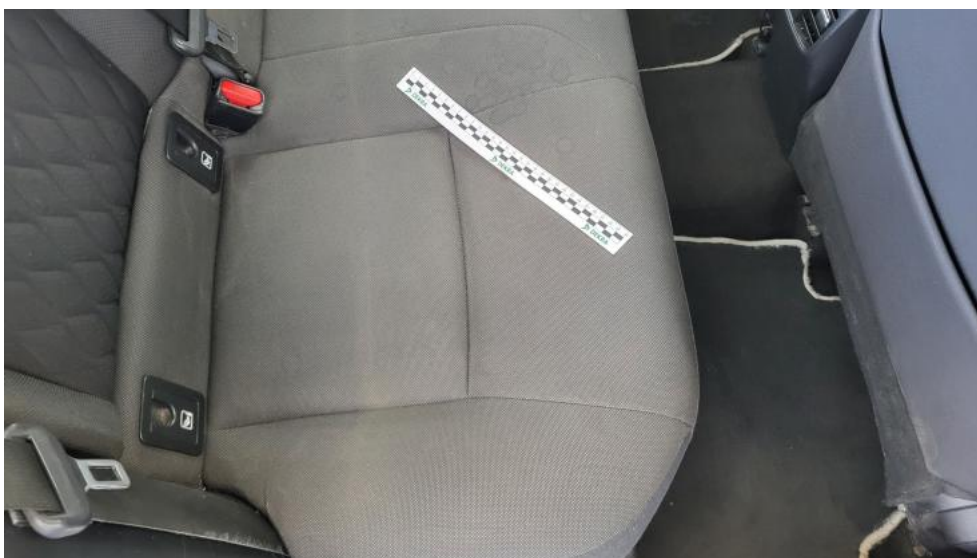


Photo 98.
Kanapa tyl. - Inne 2

PHOTOGRAPHIC DOCUMENTATION



Photo 99.

Tapicerka drzwi przednich L - Inne 1



Photo 100.

Tapicerka drzwi tylnych L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 101.

Tapicerka drzwi tylnych P - Inne 1



Photo 102.

Uszczelka drzwi tylnych P - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 103.

Osłona p/słoneczna lewa - Inne 1



Photo 104.

Podsufitka - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 105.

Podsufitka - Inne 2



Photo 106.

Wykładzina(y) słupka tylnego L - Rysa/odprysk 1