

DEKRA's commission No. : PKOL(W)/LODZ/25808/25/04/08
commission/ damage No. : Futura
Date of commission: 08-04-2025

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (NEW)
DEKRA Polska - współpraca O/Warszawa
Andrzej Sosnowski
DEKRA Polska - Centrala

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0138288
Manufacturer	VOLKSWAGEN
Model	Passat Variant [B8] 19-24
Type / version	Passat 2.0 TSI Elegance DSG
Body type	KOM
Number of doors / seats	5/5
Curb weight [kg]	1560
Gross vehicle weight [kg]	2150
Wheelbase 1/2	2786
Engine type	spark ignition
Pollution reduction system	GPF
Engine capacity [ccm]	1984
Engine Power [hp/kW]	190/140
Gearbox	automatic
Registration /record No.	WD2652S
VIN / serial number	WVWZZZ3CZNE022196
Date of first registration	07-12-2021
Date of next. tech. test	06-12-2026
Year of manufacture	2021 (year has been verified with the manufacturer's base)
Readout [km]	110 053 (read)
Body color / type of coating	black/double-layered, metallized

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	BRIDGESTONE, BLIZZAK LM005	215/55 17 98H	3,5 mm
	left	BRIDGESTONE, BLIZZAK LM005	215/55 17 98H	4,0 mm
back	right	GOODYEAR, ULTRAGRIP PERFORMANCE	215/55 17 98V	6,5 mm
	left	GOODYEAR, ULTRAGRIP PERFORMANCE	215/55 17 98V	7,0 mm

Standard equipment by Eurotax

- | | |
|--|--|
| 1. Active Emergency Brake Assist, Adaptive Cruise Control, Brake Assist | 38. LED Daytime running lights, LED front dim light |
| 2. Antilock-Brake-System (ABS), Brake Assist, ESP (Electronical Stabilizing Program), Other, Traction control | 39. LED rear lights |
| 3. Armrest (s) front, Storage facilities in general | 40. Lane control assistant |
| 4. Automatic climate control | 41. Leather gearshifter/switch, Leather steering wheel, Multi functional steering wheel, Steering wheel with gear-switches |
| 5. Automatic dimlight activation, Follow me home | 42. Leather upholstery, Textile upholstery |
| 6. Bluetooth interface, Bord entertainment: other accessories, mp3 Player, Radio, Soundsystem, Touchscreen monitor, USB in | 43. Light alloy wheels from 17" |
| 7. Body-coloured bumpers, Exterior design: other | 44. Luggage compartment cover |
| 8. Brake Assist | 45. Lumbar adjust driver electric |
| 9. Child seat fixation | 46. Metal finish |
| 10. Colored glass | 47. Mobile phone |
| 11. Colored glass | 48. On board computer |
| 12. Comfort driver seat, Comfort passenger seat | 49. Other |
| 13. Cornering Headlights, Fog lamps | 50. Other |
| 14. DAB radio | 51. Other |
| 15. Door lights | 52. Other |
| 16. Door mirror(s) electrically adjustable in general, Door mirrors heated | 53. Other |
| 17. Door mirrors autodimming | 54. Other |
| 18. Door mirrors autodimming, Door mirrors electrically foldable, Mirror: others | 55. Other |
| 19. Driver airbag, Head airbags front, Passenger airbag, Side airbag driver, Side airbag driver and passenger | 56. Other, Storage facilities in general |
| 20. Driver knee airbag | 57. Park Distance Control front, Park Distance Control rear |
| 21. Driver seat height adjustable, Passenger seat height adjustable | 58. Power windows front |
| 22. Exterior design: other | 59. Pre-Crash System |
| 23. Exterior design: other | 60. Rain sensor |
| 24. Exterior design: other | 61. Rear seat-backs foldable in two separate parts |
| 25. Exterior lighting: other | 62. Rear-view mirror autodimming |
| 26. Extra power outlet | 63. Remote controlled central locking |
| 27. Extra power outlet | 64. Roof railing |
| 28. Floor mat | 65. Selectable driveline characteristics |
| 29. Head airbags front, Head airbags rear | 66. Servotronic |
| 30. Heated seat driver, Heated seat passenger | 67. Side indicators |
| 31. Interior decoration: other | 68. Start/Stop system |
| 32. Interior lights: other accessories | 69. Steering wheel manually adjustable |
| 33. Interior lights: other accessories | 70. Storage facilities in general |
| 34. Interior lights: other accessories, Other | 71. Tyre pressure control (RDC) |
| 35. Interior: other | 72. Uni-Lackierung |
| 36. Interior: other | 73. Vehicle immobilizer |
| 37. Keyless go | 74. Windscreen wash-nozzle heated |

Dealer's equipment (selected items)

1. Alarm, Electric tailgate, Internet access, Keyless go, Navigation system, On board monitor, Traffic sign recognition -
- Alarm z niezależnym zasilaniem, f. dozoru wnętrza i czujnikiem przechyłu
- System Easy open / Easy close, sterowanie bagażnikiem i roletą, bezkluczykowy dostęp do samochodu
- System nawigacji Discover Media (8,0 cali) FM/MP3/WMA/Mapy Europy/Sign Assist/WeConnect/WeConnectPlus

2. Automated High-beam assist, Automatic headlight elevation control, Blind spot warning, Cornering Headlights, Fog lamps, Heat reflecting windows, LED front dim light, LED rear lights, Mobile phone preparation, On board monitor, Park Assistant, Pedestrian Emergency Brake Assist, Windscreen heating, Wireless device charging	-
Szyba przednia odbijająca promienie słoneczne, podgrzewana	
Active Info Display - aktywny wyświetlacz wielofunkcyjny na tablicy zegarów	
Instalacja telefoniczna Comfort z funkcją ładowania indukcyjnego, wzmacnienie sygnału LTE	
IQ. Light LED Matrix	
Pakiet Travel Assist High	
3. Full size spare wheel	-
4. Keyless go	-
5. Metallic paint, Pearl effect paint	-
6. Park Assistant, Rear view camera	-
Kamera parkowania - rear assist	
System wspomagający parkowanie - Park Assist 3.0	
7. Side airbags rear	-
8. Soundsystem	-
9. Tinted rear windows	-
10. Tyre pressure control (RDC)	-

Base value of the vehicle

Base value of the vehicle by Eurotax (net)	-
--	---

Corrections

First registration

Mileage

Equipment

Tyres


Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 04-2025 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - due to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 14-04-2025

DEKRA's expert:
Kacper Sosnowski (NEW)
Andrzej Sosnowski

Document issued electronically valid without signature.

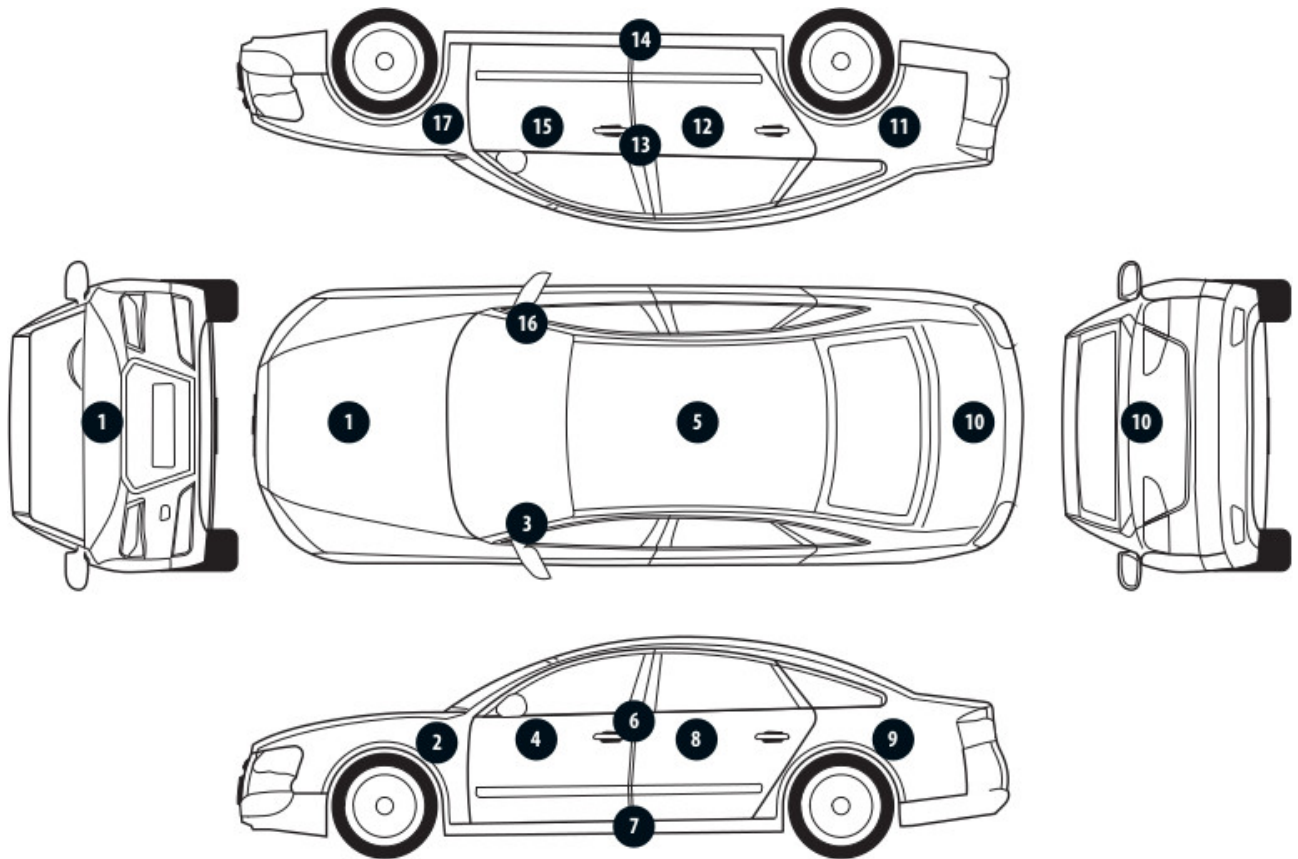Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [µm]
1	Front cover	to 150
2	Front left fender	to 150
3	Left front pillar	to 150
4	Front left door	to 150
5	Roof	to 150
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	to 150
9	Rear left fender	to 150
10	Cover/lid	to 150
11	Right rear fender	to 150
12	Right rear door	to 150
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	to 150
16	Right front pillar	to 150
17	Front right fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book was presented and its number is given below:
elektroniczna

Information concerning the origin of the vehicle

Lack of reliable data.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below:
ograniczenia placowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of

page 5/33

the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

2

Expert comments - regarding valuation

Rysy na samochodzie. Informacja o wymianie baterii w kluczyku. Odpryski na szybie czołowej.

Rzeczoznawca dokonał oględzin pojazdu w warunkach parkingowych, co mogło ograniczyć pełną ocenę jego stanu technicznego. Dodatkowo, jeżeli jazda próbna została przeprowadzona (informacje w treści raportu), to wykonano ją w warunkach parkingowych, z niewielką prędkością, co może nie odzwierciedlać pełnych warunków eksploatacyjnych. Istnieje możliwość, że w innych okolicznościach ujawnią się dodatkowe uszkodzenia lub usterki, których nie można było wykryć podczas obecnych oględzin. Zalecamy zatem skorzystanie z możliwości oględzin pojazdu we własnym zakresie lub w Autoryzowanej Stacji Obsługi danej marki, co pozwoli na pełniejszą weryfikację stanu technicznego pojazdu przed udziałem w aukcji."

Restrictive disclaimer - regarding valuation

Nie weryfikowano szczegółowo stanu układu napędowego, zawieszenia, kierowniczego, hamulcowego oraz wydechowego. Ocena została wykonana bez użycia podnośnika i specjalistycznego sprzętu diagnostycznego, nie dokonywano demontażu osłon i innych elementów. Ocena określa ogólny stan pojazdu na dzień oględzin w miejscu jego udostępnienia, nie może być zatem traktowana jako kompleksowa ocena stanu technicznego. Specyfikacja wg. programu operacyjnego w zakresie wyposażenia standardowego i dodatkowego nie gwarantuje zgodności ze stanem faktycznym w zakresie możliwym do ustalenia przez rzeczoznawcę podczas oględzin pojazdu.

Pomiar grubości powłoki lakierowej wykonano w miejscach możliwych do ich wykonania pomiary nie gwarantują oryginalności poszczególnych elementów poddanych ocenie.

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.

- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.

Przekątna przednia lewa



Photo 2.

Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.

Próg lewy (widok od przodu)



Photo 12.

Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika



Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION

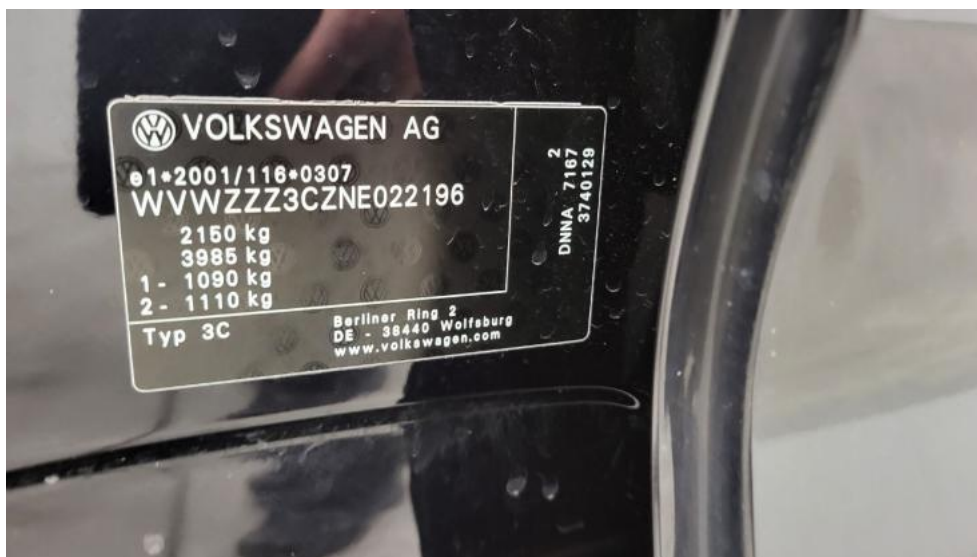


Photo 23.

Tabliczka znamionowa



Photo 24.

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe



Photo 28.

Widok z tylnej kanapy na deskę rozd.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.
Konsola środkowa



Photo 30.
Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION**Photo 31.**

Kierownica (na wprost)

**Photo 32.**

Dowód rej. Str. 1

PHOTOGRAPHIC DOCUMENTATION**Photo 33.**

Dow. Rej. Str.2 i klucze

Poniżej można wpisać indywidualne dane pojazdu:

Numer identyfikacyjny samochodu

W V G W Z 2 Z 3 C Z N E 0 2 2 1 3 6

Dane pojazdu

Moc silnika (kW)

Kod silnika

Kod skrzyni biegów

Numer lakieru

Zalecany olej silnikowy

Nr PR

Rodzaj serwisowania pojazdu

Notatki

Bardzo dziękujemy za o

Wraz z tym modelem Volkswagen otrzymuje... towarzyszącym wyposażeniem, które z pewnością w... Przed pierwszym użyciem należy przeczytać... obsługi, aby szybko i w szerokim zakresie... stw grozących użytkownikowi i innym. Jeżeli macie Państwo dalsze pytania dotyczące... niepełny, prosimy zwrócić się do partnera... nia i uwagi. Życzymy zadowolenia z samochodu i zawi...

OSTRZEŻENIE

Należy stosować się do ważnych wskaz... czeństwa dla dzieci na przednim siedzeniu

Photo 34.

Książka serwisowa – dane

PHOTOGRAPHIC DOCUMENTATION

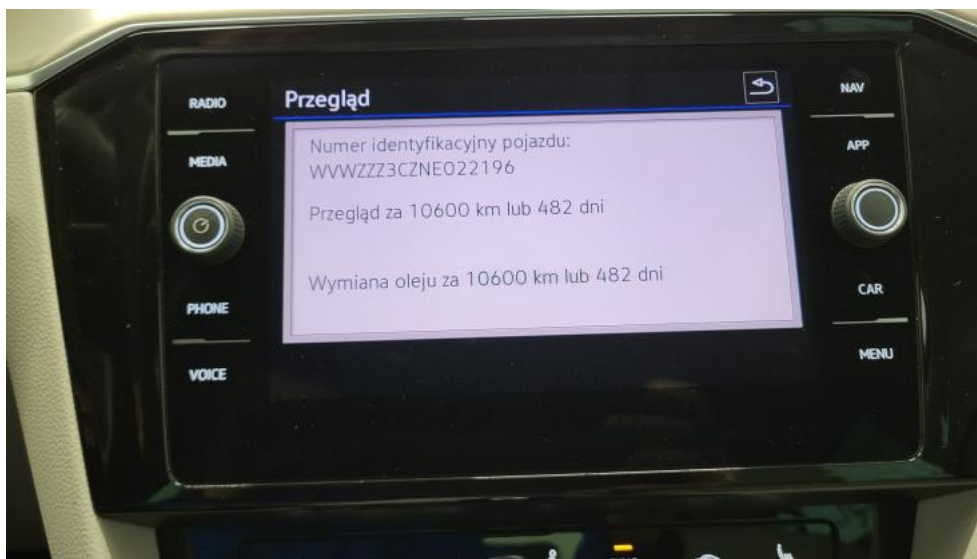


Photo 35.

Książka serwisowa – ostatni przegląd

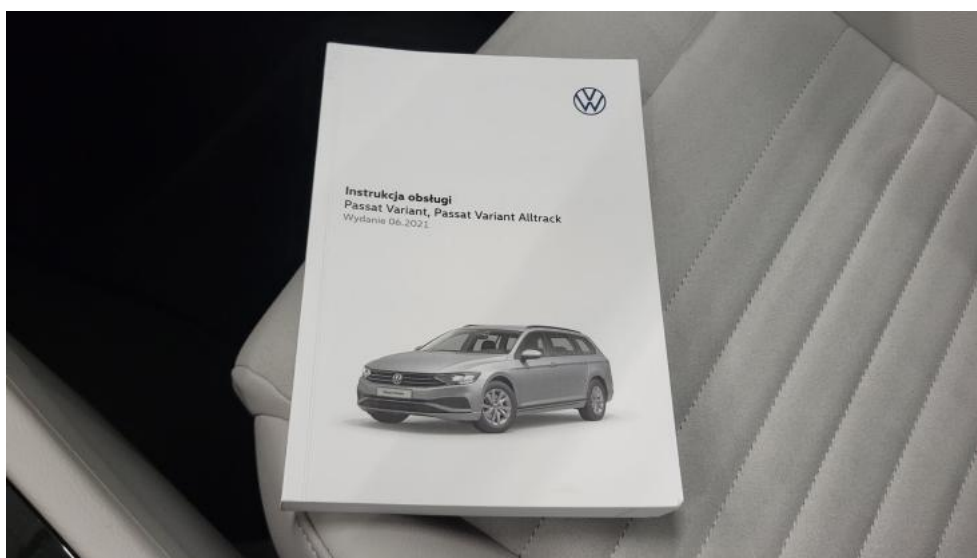


Photo 36.

Instrukcje

PHOTOGRAPHIC DOCUMENTATION



Photo 37.

Zdjęcie do protokołu

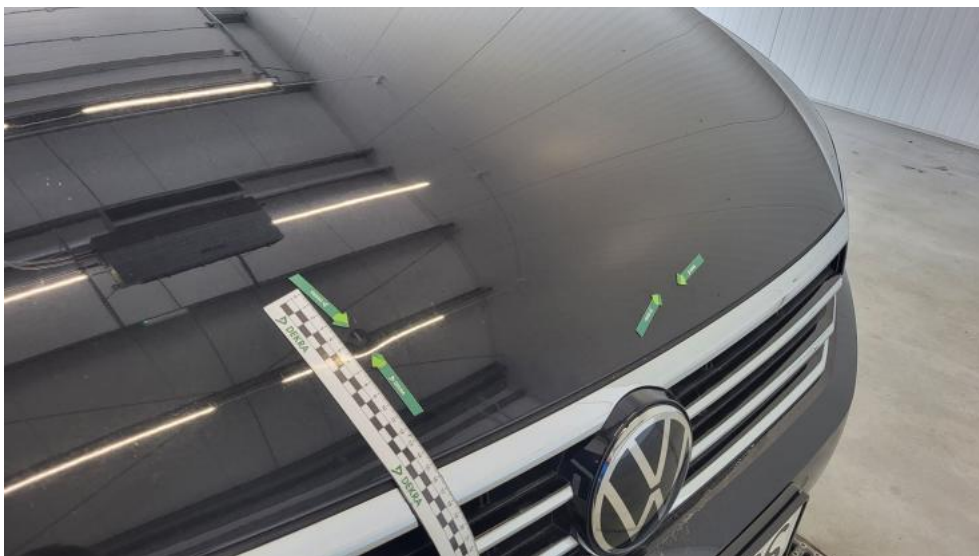


Photo 38.

Pokrywa komory silnika - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Drzwi przednie P - Rysa/odprysk 1



Photo 40.

Drzwi tylne P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Drzwi tylne P - Rysa/odprysk 2



Photo 42.

Łotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Pokrywy bagażnika - Rysa/odprysk 1



Photo 44.

Pokrywy bagażnika - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Zderzak tylny - Rysa/odprysk 1



Photo 46.

Zderzak tylny - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Błotnik tylny L / Ściana boczna L - Rysa/odprysk 1

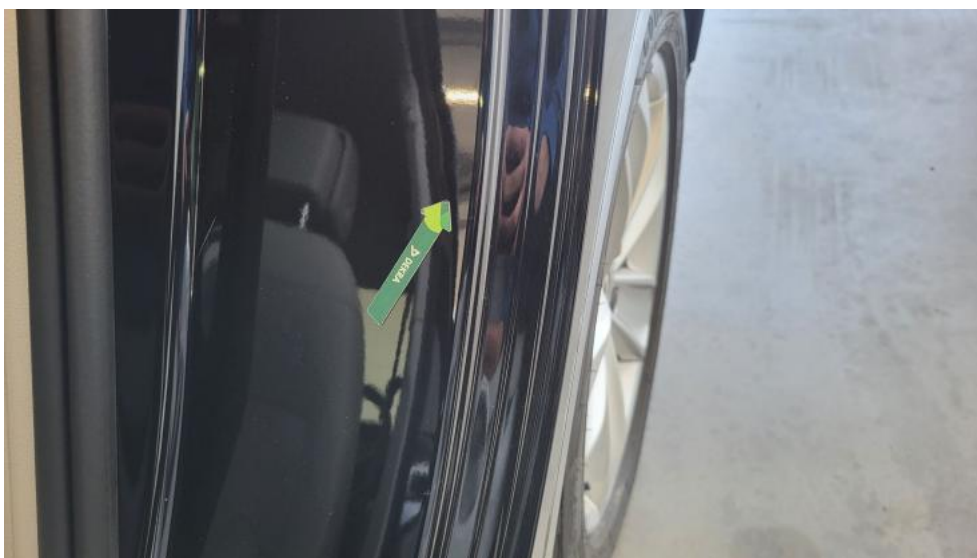


Photo 48.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Drzwi przed L - Rysa/odprysk 1



Photo 50.

Drzwi tylne L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Próg L - Rysa/odprysk 1



Photo 52.

Tapicerka drzwi przednich L - Rysa/odprysk 1