

DEKRA's commission No. : PKOL(W)/LODZ/26418/25/04/10
commission/ damage No. : Futura
Date of commission: 10-04-2025

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (NEW)
DEKRA Polska - współpraca O/Warszawa
inż. Józef Orłowski
TU - Włocławek

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0130549
Manufacturer	PEUGEOT
Model	308 SW 17-21
Type / version	308 SW 1.2 PureTech GPF Allure S&S EAT8
Body type	KOM
Number of doors / seats	5/5
Curb weight [kg]	1333
Gross vehicle weight [kg]	1750
Wheelbase 1/2	2730
Engine type	spark ignition
Pollution reduction system	GPF
Engine capacity [ccm]	1199
Engine Power [hp/kW]	130/96
Gearbox	automatic 8- gear
Registration /record No.	WD9726P
VIN / serial number	VF3LRHNSKMS193300
Date of first registration	07-09-2021
Date of next. tech. test	06-09-2026
Year of manufacture	2021 (year has been verified with the manufacturer's base)
Readout [km]	71 034 (read)
Body color / type of coating	black/METALIK

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	GOODYEAR, ULTRAGRIP 9+	205/55 16 91H	5,0 mm
	left	GOODYEAR, ULTRAGRIP 9+	205/55 16 91H	5,0 mm
back	right	GOODYEAR, ULTRAGRIP 9+	205/55 16 91H	5,5 mm
	left	GOODYEAR, ULTRAGRIP 9+	205/55 16 91H	6,0 mm

Standard equipment by Eurotax

- | | |
|--|---|
| 1. Antilock-Brake-System (ABS) | 30. Luggage compartment cover |
| 2. Armrest (s) front, Other | 31. Lumbar adjust driver |
| 3. Armrest (s) rear | 32. Mobile Tire System |
| 4. Automated High-beam assist | 33. On board monitor |
| 5. Automatic climate control | 34. Other |
| 6. Brake Assist | 35. Other |
| 7. Brake Assist | 36. Other |
| 8. CD-player, Navigation system | 37. Other |
| 9. Child lock electric | 38. Other |
| 10. Cruise control | 39. Park Distance Control front, Park Distance Control rear |
| 11. Daytime running lights | 40. Power assisted brakes |
| 12. Door lights, Door mirrors electrically foldable | 41. Power assisted brakes |
| 13. Door mirror(s) electrically adjustable in general, Door mirrors heated | 42. Power steering |
| 14. Driver airbag, Head airbags front, Passenger airbag, Side airbag driver, Side airbag driver and passenger | 43. Power windows front, Power windows rear |
| 15. Driver seat height adjustable, Driver seat with adjustable inclination, Passenger seat height adjustable, Passenger seat with adjustable inclination | 44. Rain sensor |
| 16. ESP (Electronical Stabilizing Program) | 45. Rain sensor |
| 17. Electric parking brake | 46. Rear seat-backs foldable in two separate parts |
| 18. Exterior design: other | 47. Rear view camera |
| 19. Exterior design: other, Mirror: others | 48. Rear-view mirror autodimming |
| 20. Exterior lighting: other | 49. Roof railing |
| 21. Extra power outlet | 50. Steering wheel manually adjustable |
| 22. Fog lamps | 51. Storage facilities in general |
| 23. Hands-free system, Multi functional steering wheel, On board monitor, Radio, USB in | 52. Textile upholstery |
| 24. Hill holder | 53. Tinted rear windows |
| 25. Interior: other | 54. Traction control |
| 26. Interior: other | 55. Transport/loading: other |
| 27. Lane control assistant | 56. Uni-Lackierung |
| 28. Leather steering wheel | 57. Windows: other |
| 29. Light Alloy wheels 16" | |

Dealer's equipment (selected items)

1. Metallic paint -

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

CorrectionsFirst registrationMileage

Equipment

Tyres

Other

stwierdzone braki i uszkodzenia -


Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 04-2025 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 16-04-2025

DEKRA's expert:
Kacper Sosnowski (NEW)
inż. Józef Orłowski

Document issued electronically valid without signature.

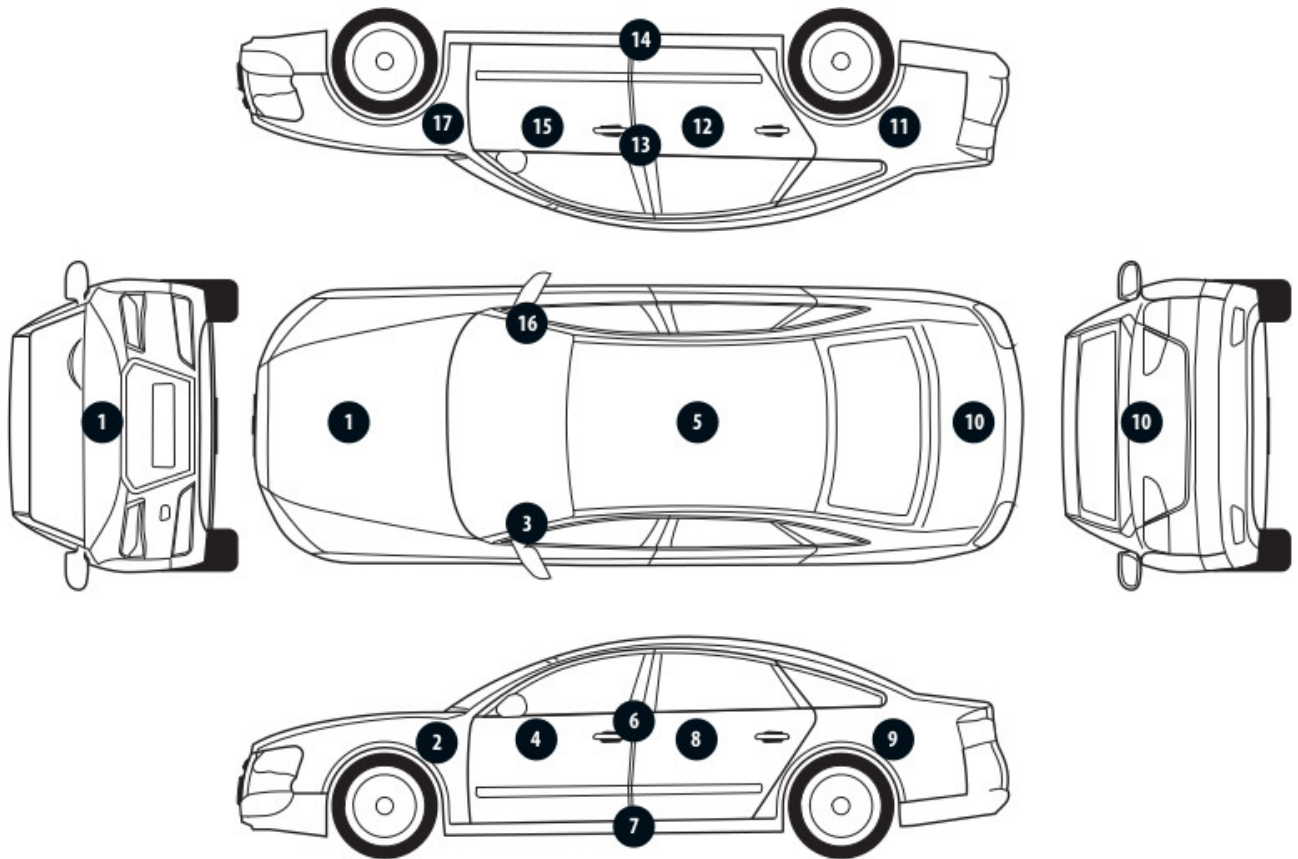Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Front left fender	to 150
3	Left front pillar	to 150
4	Front left door	to 150
5	Roof	to 150
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	to 150
9	Rear left fender	to 150
11	Right rear fender	to 150
12	Right rear door	to 150
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	to 150
16	Right front pillar	to 150
17	Front right fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book was presented and its number is given below:

.

Information concerning the origin of the vehicle

The vehicle purchased domestically from an authorized representative of the brand.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below:
ograniczenia parkingowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of

the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

2

Expert comments - regarding valuation

Rysy na samochodzie. Odpryski na szybie czołowej.

Restrictive disclaimer - regarding valuation

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.

Przekątna przednia lewa



Photo 2.

Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.
Próg lewy (widok od przodu)

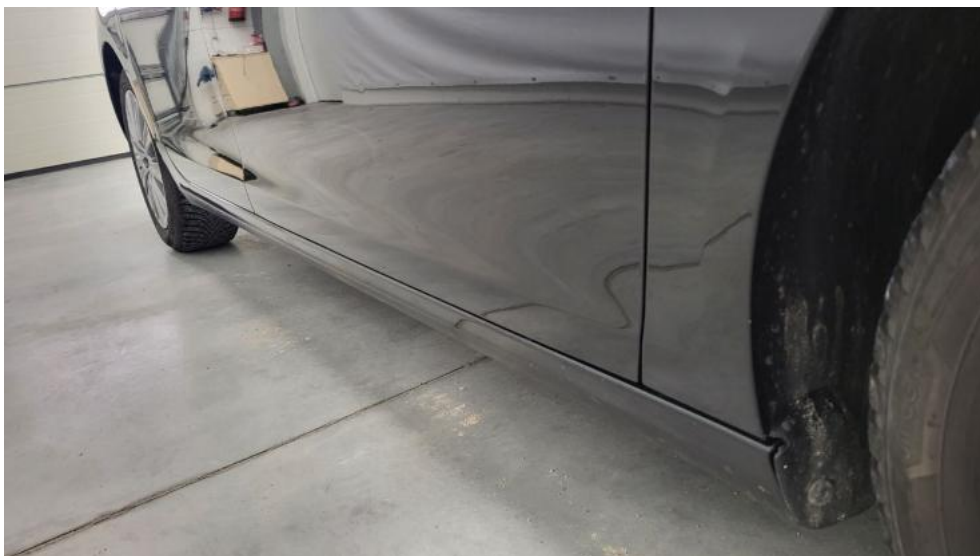


Photo 12.
Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa

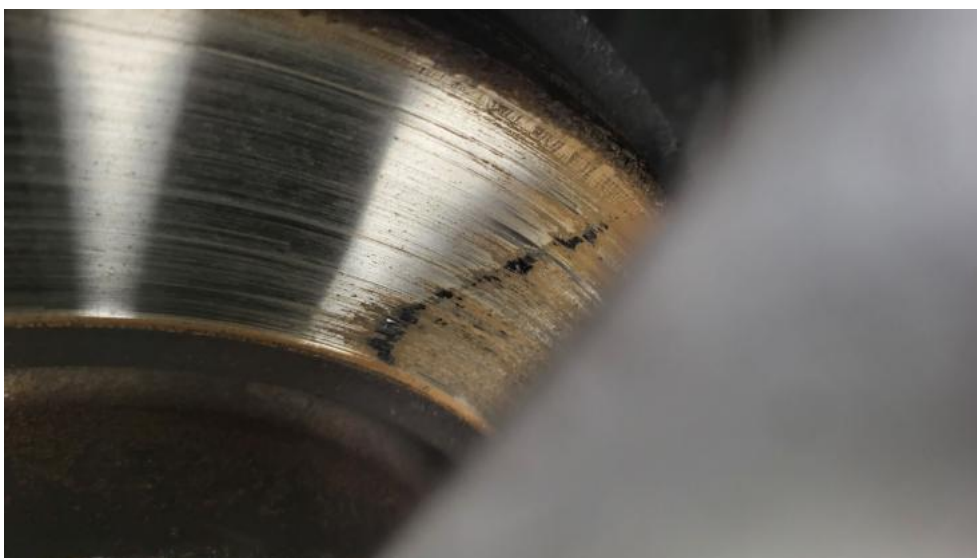


Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika

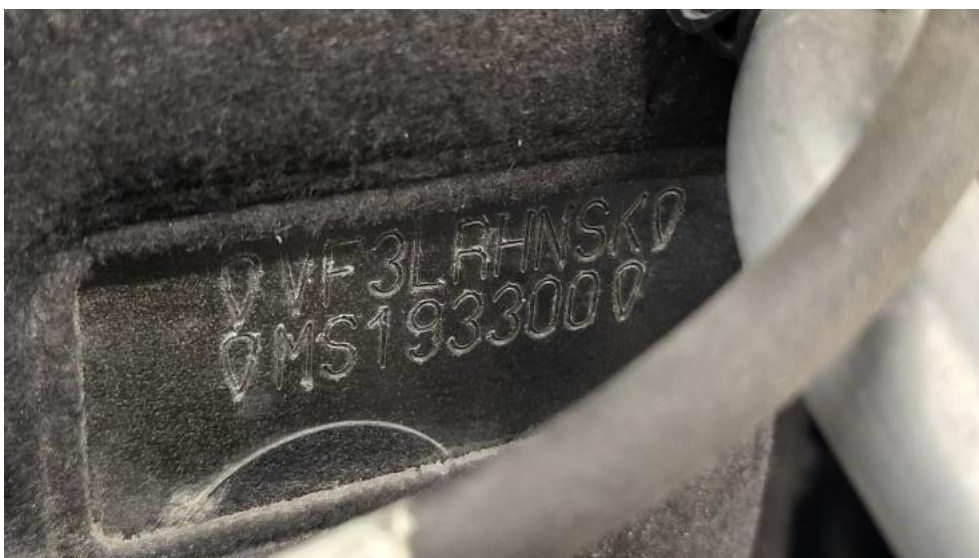


Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION

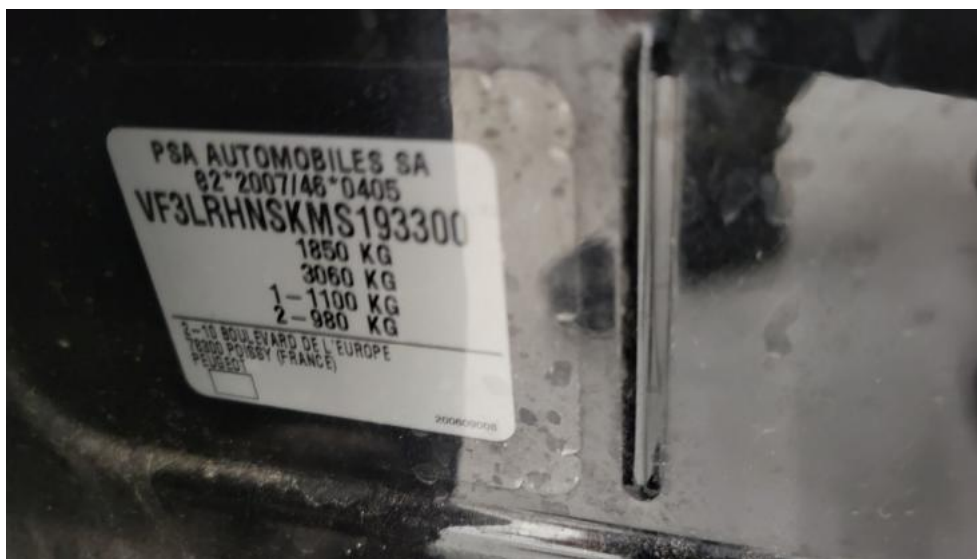


Photo 23.

Tabliczka znamionowa



Photo 24.

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe



Photo 28.

Widok z tylnej kanapy na deskę rozdz.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.
Konsola środkowa

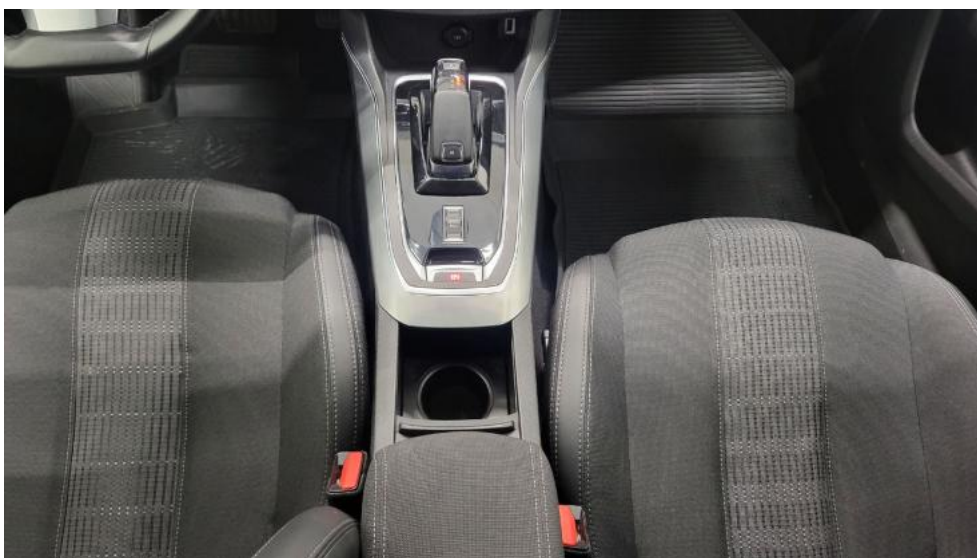


Photo 30.
Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION



Photo 31.
Kierownica (na wprost)



Photo 32.
Dowód rej. Str. 1

PHOTOGRAPHIC DOCUMENTATION**Photo 33.**

Dow. Rej. Str.2 i klucze

CERTYFIKAT GWARANCJI UMOWNYCH PEUGEOT

Gwarancje umowne PEUGEOT

W celu zatwierdzenia gwarancji umownych PEUGEOT niniejszy certyfikat musi zostać wypełniony i podpisany przez dealera odpowiedzialnego za sprzedaż. Warunkiem obowiązywania tych gwarancji jest wykonywanie przeglądów okresowych zgodnie z ich harmonogramem (dowodem na to powinny być uzupełnione odcinki kontrolne z niniejszej książki).

W przypadku napraw i przeglądów nieobjętych niniejszymi gwarancjami, wykonywanych przez autoryzowany serwis, nie przysługują żadne świadczenia z tytułu gwarancji umownych.

Gwarancje umowne PEUGEOT obowiązują od dnia faktycznego wydania pojazdu klientowi (data początku gwarancji zapisana na tej stronie).

Szczegóły gwarancji umownych PEUGEOT pojazdu oraz warunki ich obowiązywania znajdują się w formularzu zamówienia nowego pojazdu.

IDENTYFIKACJA SPRZEDAWCY

Pojazd jest przygotowywany przez:

PEUGEOT POLSKA Sp. z o.o.

Dział Sprzedaży Flotowej

Al. Krakowska 206, 02-213 Warszawa

NIP: 5260211989 REGON: 010012455

Kraj: **PL** Nr punktu sprzedaży: **8888P**

IDENTYFIKACJA SAMOCHODU

V.I.N. **VF3LRHNSK17S193300**

Data początku gwarancji: **270921**

Data końca gwarancji: **270923**

Model: **308**

Paliwo: **PB**

Silnik: **1.2 PT**

Olej silnikowy: **OW 30**

Moc: **130** kW/KM

Nr rejestracyjny: **WD 9726P**

* W zależności od silnika.

Wzrost

Wzrost osoby, która dokonała zakupu, musi być co najmniej 1,50 m.

Wzrost osoby, która dokonała zakupu, musi być co najmniej 1,50 m.

Photo 34.

Książka serwisowa – dane

PHOTOGRAPHIC DOCUMENTATION

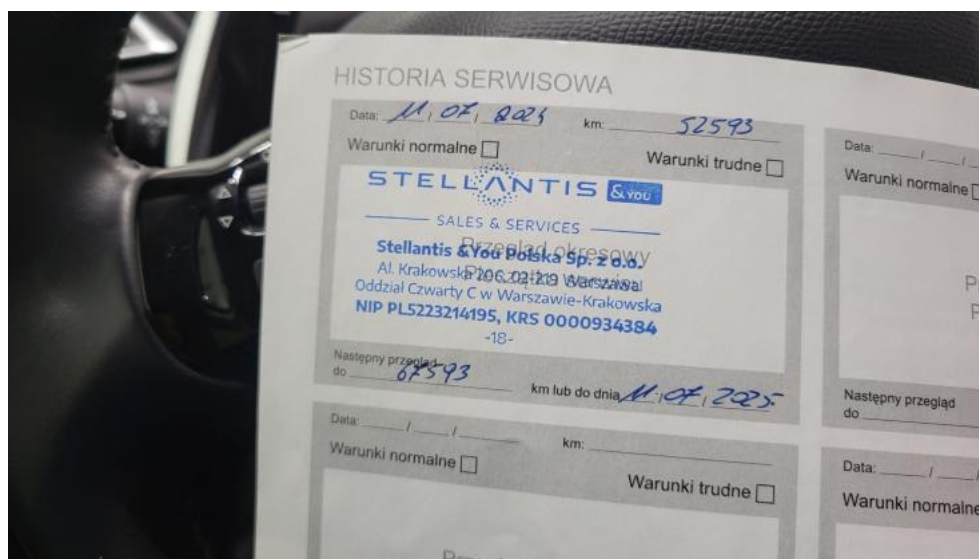


Photo 35.

Książka serwisowa – ostatni przegląd

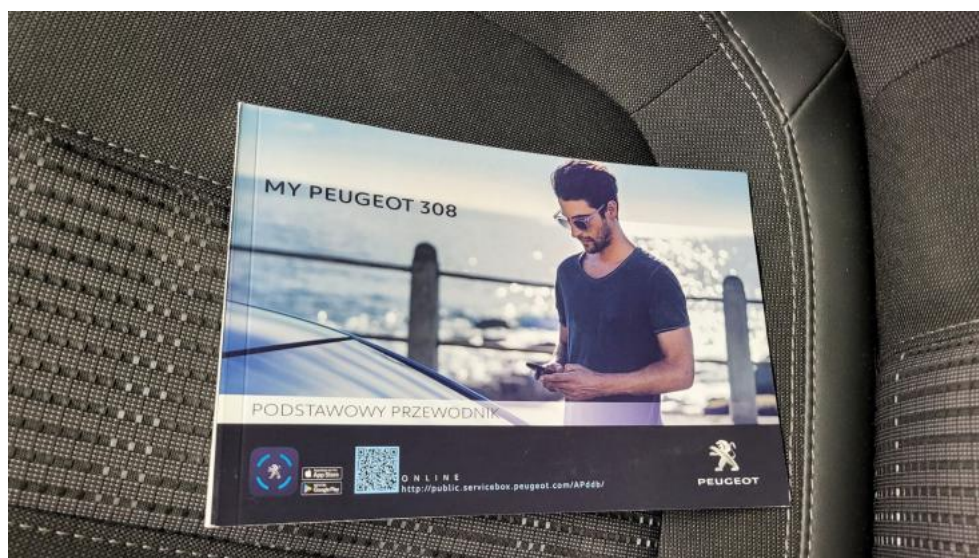


Photo 36.

Instrukcje

PHOTOGRAPHIC DOCUMENTATION



Photo 37.

Zestaw naprawczy koła



Photo 38.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Atrapa przednia - Wgniecenie/odkształcenie 1



Photo 40.

Pokrywa komory silnika - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Pokrywa komory silnika - Wgniecenie/odkształcenie 1



Photo 42.

Pokrywa komory silnika - Wgniecenie/odkształcenie 2

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Drzwi przednie P - Rysa/odprysk 1



Photo 44.

Drzwi przednie P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Drzwi tylne P - Rysa/odprysk 1



Photo 46.

Drzwi tylne P - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Drzwi tylne P - Wgniecenie/odkształcenie 1



Photo 48.

Próg P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Błotnik tylny P / Ściana boczna P - Rysa/odprysk 1



Photo 50.

Felga aluminiowa tylna P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Felga aluminiowa tylna P - Rysa/odprysk 2



Photo 52.

Pokrywy bagażnika - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Zderzak tylny - Rysa/odprysk 1



Photo 54.

Zderzak tylny - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Błotnik tylny L / Ściana boczna L - Rysa/odprysk 1



Photo 56.

Felga aluminiowa tylna L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Drzwi przed L - Rysa/odprysk 1



Photo 58.

Drzwi przed L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Drzwi tylne L - Rysa/odprysk 1



Photo 60.

Drzwi tylne L - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Próg L - Wgniecenie/odkształcenie 1



Photo 62.

Słupek przedni L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Felga Aluminiowa przednia L - Rysa/odprysk 1

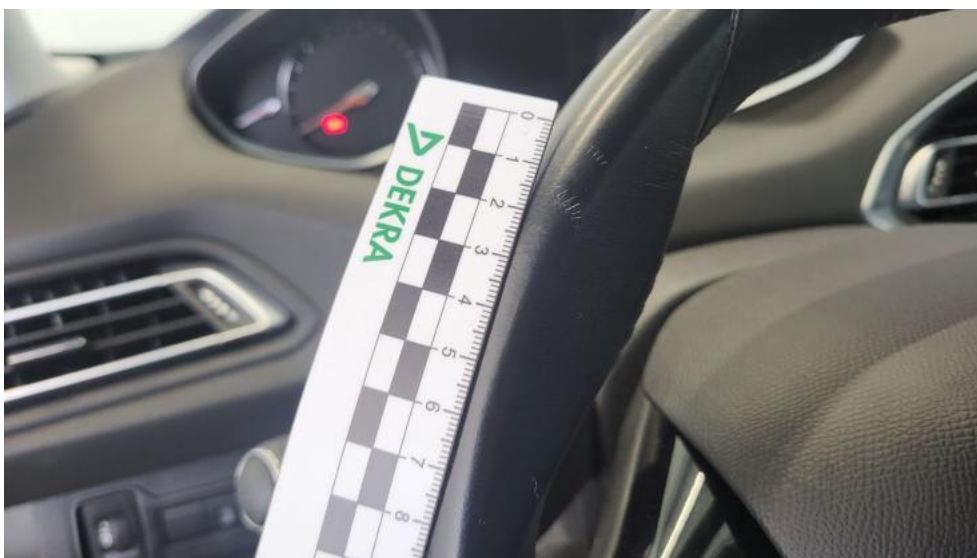


Photo 64.

Koło kierownicy - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Fotel prz. lew. - Inne 1



Photo 66.

Fotel prz. praw. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 67.

Kanapa tyl. - Inne 1



Photo 68.

Kanapa tyl. - Inne 2

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Tapicerka drzwi przednich P - Inne 1



Photo 70.

Tapicerka drzwi tylnych L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Wykładzina pokrywy tylnej - Inne 1