

DEKRA's commission No. : PKOL(W)/LODZ/22920/25/03/28
commission/ damage No. : FUTURA
Date of commission: 28-03-2025

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (NEW)
DEKRA Polska - współpraca O/Warszawa
inż. Józef Orłowski
TU - Włocławek

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0138626
Manufacturer	OPEL
Model	Corsa F Hatchback 19-23
Type / version	Corsa 1.2 Edition S&S
Body type	hatchback
Number of doors / seats	5/5
Curb weight [kg]	1030
Gross vehicle weight [kg]	1660
Wheelbase 1/2	2538
Engine type	spark ignition
Pollution reduction system	GPF
Engine capacity [ccm]	1199
Engine Power [hp/kW]	75/55
Gearbox	manual 5- gear
Registration /record No.	WD6229T
VIN / serial number	VXKUPHMHDL4247313
Date of first registration	16-11-2020
Date of next. tech. test	16-11-2025
Year of manufacture	2020 (year has been verified with the manufacturer's base)
Readout [km]	54 632 (read)
Body color / type of coating	grafitowy/METALIK

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	DEBICA, FRIGO 2	185/65 15 88T	5,0 mm
	left	DEBICA, FRIGO 2	185/65 15 88T	5,0 mm
back	right	DEBICA, FRIGO 2	185/65 15 88T	7,0 mm
	left	DEBICA, FRIGO 2	185/65 15 88T	7,0 mm

Standard equipment by Eurotax

- | | |
|---|---|
| 1. Additional gauges | 17. Lane control assistant |
| 2. Air conditioning | 18. Metallic paint |
| 3. Antilock-Brake-System (ABS), ESP
(Electronical Stabilizing Program), Traction
control | 19. Mobile Tire System |
| 4. Bluetooth interface | 20. On board computer |
| 5. Bord climate: other | 21. On board monitor |
| 6. Child seat fixation | 22. On board monitor, Radio, Soundsystem,
Touchscreen monitor, Voice control for
audiosystem, Voice control for telephone |
| 7. Collision Warning System, Other, Pedestrian
Emergency Brake Assist | 23. Passenger seat height adjustable, Passenger
seat with adjustable inclination |
| 8. Comfort driver seat, Comfort passenger seat | 24. Power windows front |
| 9. Cruise control | 25. Rear bench, Rear bench foldable in two separate
parts |
| 10. DAB radio | 26. Remote controlled central locking |
| 11. Door mirror(s) electrically adjustable in
general, Door mirrors heated, Mirror: others | 27. Steering wheel manually adjustabe |
| 12. Driver airbag, Head airbags front, Head
airbags rear, Passenger airbag, Side airbag
driver and passenger, Side airbags rear | 28. Steering wheel with radio operation |
| 13. Driver conditioning monitoring | 29. Textile upholstery |
| 14. Driver seat height adjustable, Driver seat with
adjustable inclination | 30. Traffic sign recognition |
| 15. Exterior design: other | 31. Tyre pressure control (RDC) |
| 16. Hill holder | |

Dealer's equipment (selected items)

- | | |
|---|---|
| 1. Armrest (s) front, Leather steering wheel, Power windows rear, Sports steering wheel,
Storage facilities in general | - |
| Elektryczne szyby, tył | |
| Kierownica sportowa pokryta skórą, spłaszczona u dołu | |
| Konsola centralna z podłokietnikiem i schowkiem | |
| 2. Metallic paint | - |
| 3. Park Distance Control rear, Rear view camera | - |
| Kamera cofania - panoramiczna 180 stopni | |
| Czujnik odległości przy parkowaniu - tył | |

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

CorrectionsFirst registrationMileageEquipment

Tyres

Other

stwierdzone braki i uszkodzenia -

Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 04-2025 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 10-04-2025

DEKRA's expert:
Kacper Sosnowski (NEW)
inż. Józef Orłowski

Document issued electronically valid without signature.

Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Front left fender	to 150
3	Left front pillar	to 150
4	Front left door	to 150
5	Roof	to 150
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	to 150
9	Rear left fender	to 150
10	Cover/lid	to 150
11	Right rear fender	to 150
12	Right rear door	to 150
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	to 150
16	Right front pillar	to 150
17	Front right fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book was presented and its number is given below:

.

Information concerning the origin of the vehicle

The vehicle purchased domestically from an authorized representative of the brand.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below: ograniczenia parkingowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of

the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

1

Expert comments - regarding valuation

Rysy na samochodzie. Brak oleju. Nietypowy kolor płynu chłodniczego. Nietypowe odgłosy z silnika-stuki. Odpryski na szybie czołowej. Rzeczoznawca dokonał oględzin pojazdu w warunkach parkingowych, co mogło ograniczyć pełną ocenę jego stanu technicznego. Dodatkowo, jeżeli jazda próbna została przeprowadzona (informacje w treści raportu), to wykonano ją w warunkach parkingowych, z niewielką prędkością, co może nie odzwierciedlać pełnych warunków eksploatacyjnych. Istnieje możliwość, że w innych okolicznościach ujawnią się dodatkowe uszkodzenia lub usterki, których nie można było wykryć podczas obecnych oględzin.

Zalecamy zatem skorzystanie z możliwości oględzin pojazdu we własnym zakresie lub w Autoryzowanej Stacji Obsługi danej marki, co pozwoli na pełniejszą weryfikację stanu technicznego pojazdu przed udziałem w aukcji.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.

Przekątna przednia lewa



Photo 2.

Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.

Próg lewy (widok od przodu)



Photo 12.

Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.
Bagażnik



Photo 16.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 17.
Komora silnika



Photo 18.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION



Photo 19.

Tabliczka znamionowa



Photo 20.

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 21.

Widok przez otwarte drzwi przednie lewe



Photo 22.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 23.

Widok przez otwarte drzwi tylne lewe



Photo 24.

Widok z tylnej kanapy na deskę rozdz.

PHOTOGRAPHIC DOCUMENTATION



Photo 25.
Konsola środkowa



Photo 26.
Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION**Photo 27.**

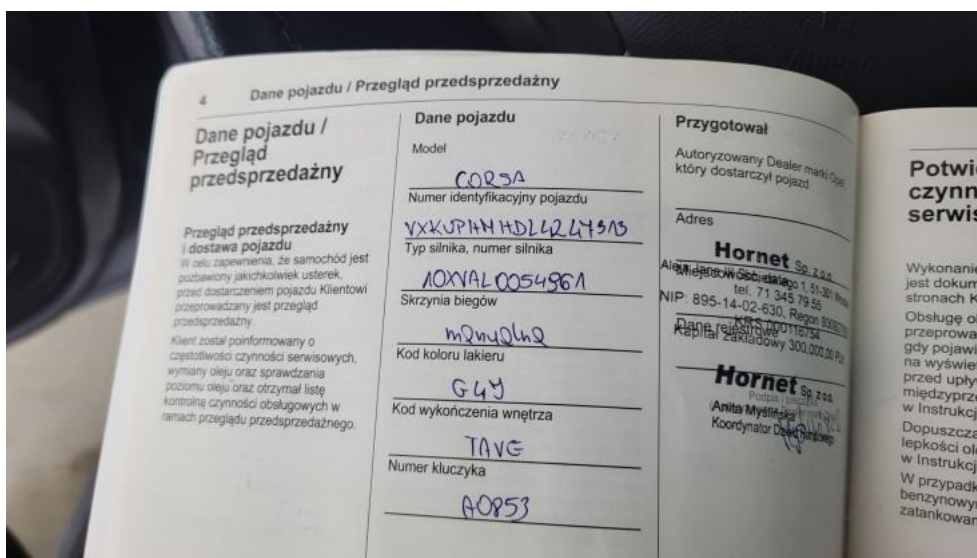
Kierownica (na wprost)

**Photo 28.**

Dowód rej. Str. 1

PHOTOGRAPHIC DOCUMENTATION**Photo 29.**

Dow. Rej. Str.2 i klucze

**Photo 30.**

Książka serwisowa – dane

PHOTOGRAPHIC DOCUMENTATION

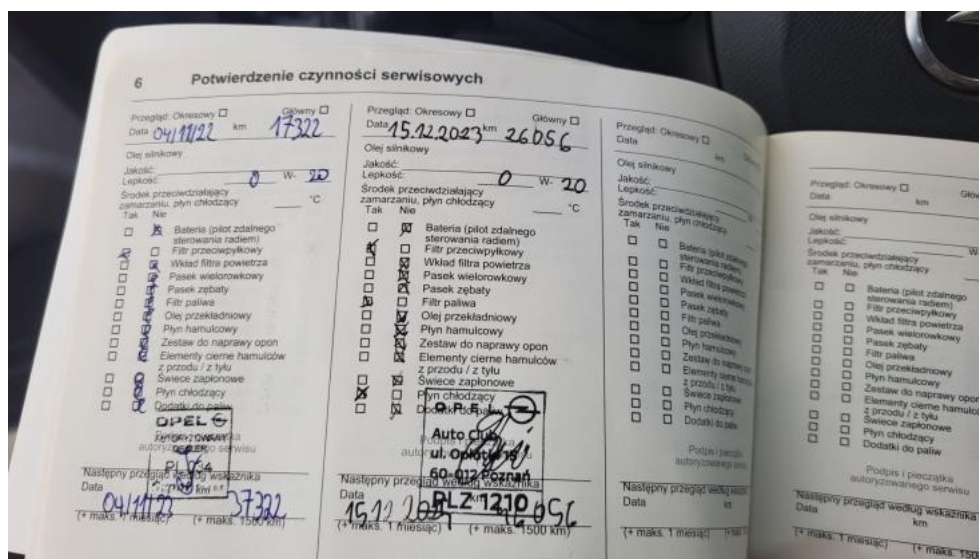


Photo 31.

Książka serwisowa – ostatni przegląd



Photo 32.

Instrukcja

PHOTOGRAPHIC DOCUMENTATION



Photo 33.

Pokrywa komory silnika - Rysa/odprysk 1



Photo 34.

Zderzak - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 35.

Błotnik przedni P - Wgniecenie/odkształcenie 1



Photo 36.

Kołpak przedni P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 37.

Drzwi przednie P - Rysa/odprysk 1



Photo 38.

Klamka drzwi prz P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION

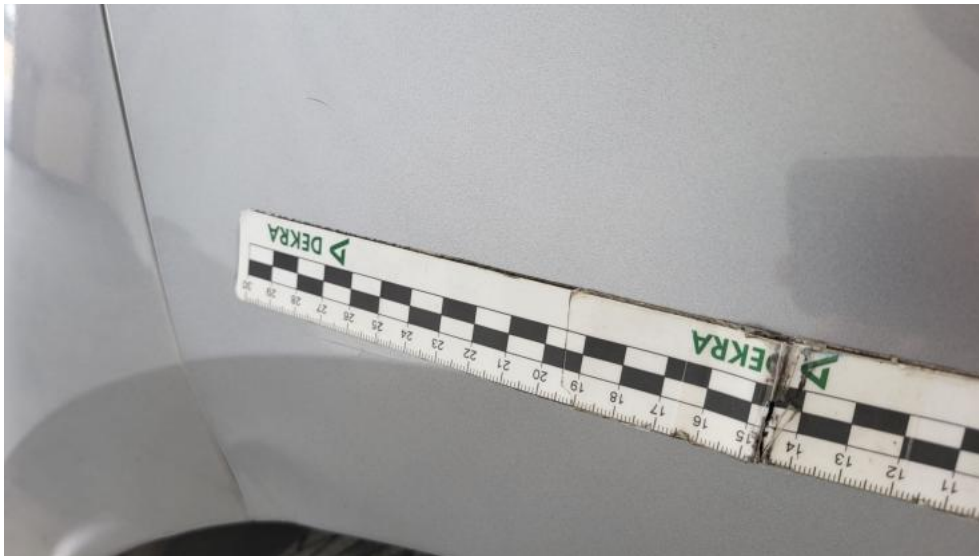


Photo 39.

Błotnik tylny P / Ściana boczna P - Rysa/odprysk 1



Photo 40.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Kołpak tylny P - Rysa/odprysk 1



Photo 42.

Zderzak tylny - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Błotnik tylny L / Ściana boczna L - Rysa/odprysk 1



Photo 44.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Kołpak tylny L - Rysa/odprysk 1



Photo 46.

Drzwi przed L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Drzwi przed L - Wgniecenie/odkształcenie 1

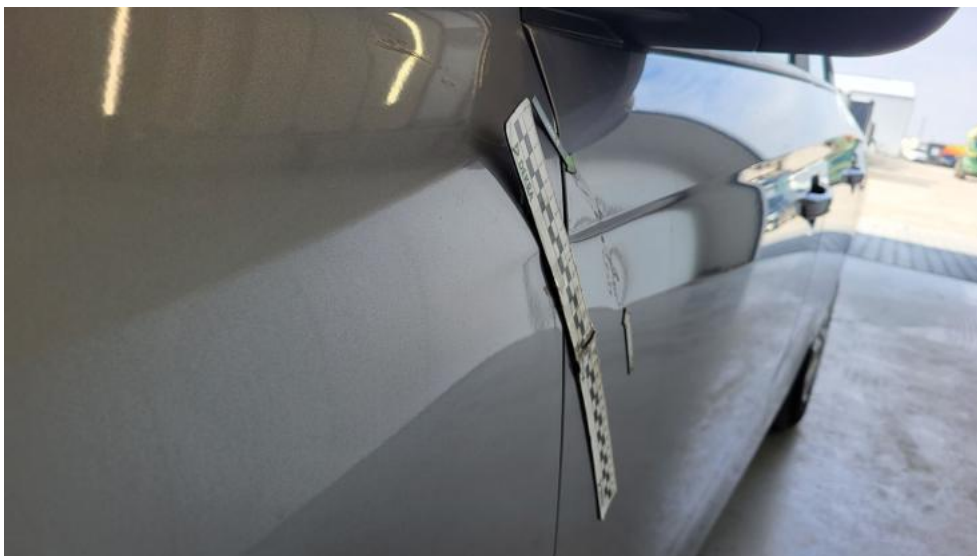


Photo 48.

Drzwi przed L - Wgniecenie/odkształcenie 2

PHOTOGRAPHIC DOCUMENTATION

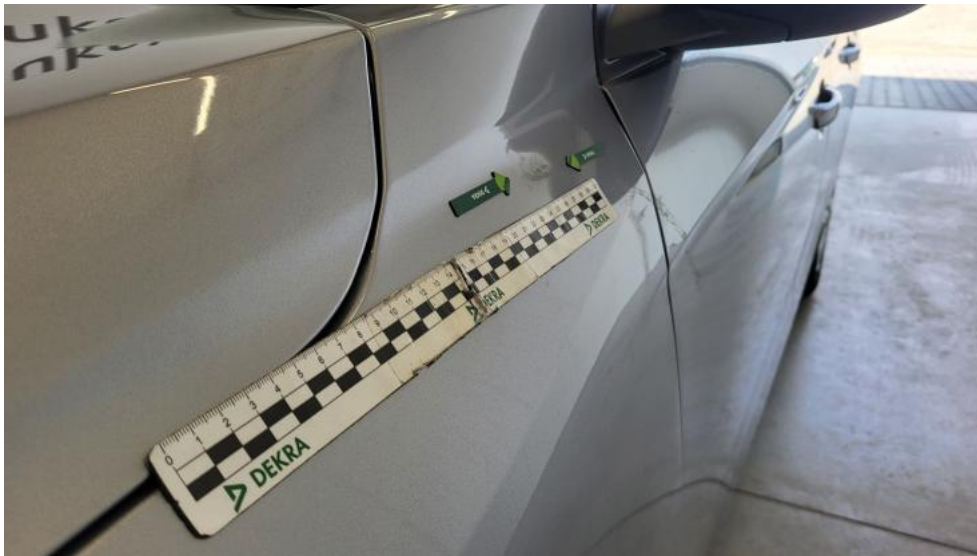


Photo 49.

Błotnik przedni L - Wgniecenie/odkształcenie 1



Photo 50.

Fotel prz. praw. - Inne 1

PHOTOGRAPHIC DOCUMENTATION

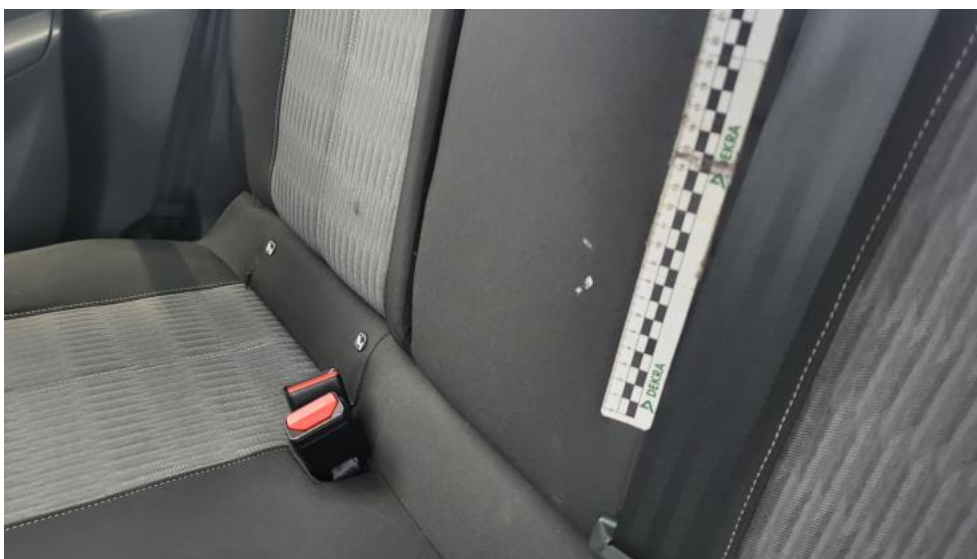


Photo 51.

Kanapa tyl. - Inne 1



Photo 52.

Ośłona p/słoneczna lewa - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Wykładzina podłogi bagażnika - Inne 1