

DEKRA's commission No. : PKOL(W)/LODZ/52276/25/07/16
commission/ damage No. : 23/000171
Date of commission: 16-07-2025

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (NEW)
DEKRA Polska - współpraca O/Warszawa
Andrzej Sosnowski
DEKRA Polska - Centrala

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0117686
Manufacturer	BMW
Model	Seria 7 [G11, G12] 15-19
Type / version	740d xDrive
Body type	sedan
Number of doors / seats	4/5
Curb weight [kg]	1860
Gross vehicle weight [kg]	2530
Wheelbase 1/2	3070
Engine type	Automatic ignition
Pollution reduction system	DPF
Engine capacity [ccm]	2993
Engine Power [hp/kW]	320/235
Gearbox	automatic
Registration /record No.	WZ965FS
VIN / serial number	WBA7C61070B073066
Date of first registration	29-08-2018
Date of next. tech. test	21-11-2025
Year of manufacture	2017 (year has been verified with the manufacturer's base)
Readout [km]	223 677 (read)
Body color / type of coating	black/double-layered, metallized

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	NEXEN, WINGUARD SPORT 2 WU7	245/40 20 99W	5,0 mm
	left	NEXEN, WINGUARD SPORT 2 WU7	245/40 20 99W	5,0 mm
back	right	NEXEN, WINGUARD SPORT 2 WU7	275/35 20 102W	4,0 mm
	left	NEXEN, WINGUARD SPORT 2 WU7	275/35 20 102W	4,0 mm

Standard equipment by Eurotax

- | | |
|--|---|
| 1. Additional gauges | 36. Interior lights: other accessories |
| 2. Additional gauges | 37. Interior lights: other accessories, Mirror: others |
| 3. Air suspension | 38. Keyless Engine start, Keyless go |
| 4. Airbag: other | 39. LED Fog Lamps |
| 5. Alarm | 40. LED front dim light |
| 6. Antilock-Brake-System (ABS) | 41. Leather steering wheel, Multi functional steering wheel |
| 7. Armrest (s) front, Storage facilities in general | 42. Leather steering wheel, Sports steering wheel |
| 8. Armrest (s) rear | 43. Leather upholstery |
| 9. Automated High-beam assist | 44. Mobile phone, Wireless device charging |
| 10. Automatic dimlight activation, Rain sensor | 45. On board computer |
| 11. Bord communication: other | 46. On board monitor |
| 12. Bord entertainment: other accessories | 47. Other |
| 13. Brake Assist | 48. Other |
| 14. Brake Assist, Traffic sign recognition | 49. Other |
| 15. CD-player, Navigation system, On board monitor, Radio | 50. Other |
| 16. Child seat fixation | 51. Other |
| 17. Cruise control | 52. Other |
| 18. Door mirror(s) electrically adjustable in general, Door mirrors heated | 53. Park Assistant |
| 19. Door mirrors autodimming, Rear-view mirror autodimming | 54. Park Distance Control front, Park Distance Control rear |
| 20. Driver airbag, Head airbags front, Passenger airbag, Side airbag driver and passenger | 55. Rear view camera |
| 21. Driver seat electrically adjustable, Memory seat, Passenger seat electrically adjustable | 56. Remote controlled central locking |
| 22. Dualzone automatic climate control | 57. Selectable driveline characteristics |
| 23. ESP (Electronical Stabilizing Program), Traction control | 58. Servotronic |
| 24. Electric tailgate | 59. Soundsystem |
| 25. Exterior design: other | 60. Start/Stop system |
| 26. Exterior lighting: other | 61. Steering wheel electrically adjustable |
| 27. Floor mat | 62. Telematic |
| 28. Follow me home | 63. Telematic |
| 29. Follow me home | 64. Tyre pressure control (RDC) |
| 30. Gesture control for multimedia, Gesture control for vehicle functions | 65. Uni-Lackierung |
| 31. Hatch/skibag in rear bench | 66. Wheel bolt locks |
| 32. Head-Up Display | 67. Whiplash-protection-system |
| 33. Headlamp wash | 68. Windscreen wash-nozzle heated |
| 34. Heated seat driver, Heated seat passenger | 69. Wood finish |
| 35. Interior lights: other accessories | |

Dealer's equipment (selected items)

- | | |
|---|---|
| 1. 4 or more zone automatic climate control, Air condition rear | - |
| 2. Adaptive light | - |
| 3. Autonomous parking system | - |
| 4. Brake Assist, Pre-Crash System, Traffic sign recognition | - |
| 5. Chassis: other | - |
| 6. Colored glass | - |
| 7. Door: other | - |
| 8. Exterior design: other | - |
| 9. Exterior design: other, Fog lamps, Interior: other, Leather upholstery, Light Alloy wheels 19", Sport seats front, Sports steering wheel | - |
| Tapicerka skórzana Dakota | |
| Kierownica sportowa typu M | |

Podsufitka Individual w kolorze antracytowym
 Pakiet aerodynamiczny
 Światła przeciwmgielne w technologii LED
 Fotele przednie komfortowe, regulowane elektrycznie
 Lakier niemetalizowany - Biel alpejska
 Felgi aluminiowe 19 Double Spoke 647, dwukolorowe z ogumieniem mieszanym
 Listwy ozdobne, drewno szlachetne Fineline, czarne, błyszczące, metaliczny szlif

10. Front seat with massage	-
11. Glass tilt/slide sunroof electric	-
12. Heated seat driver, Heated seat passenger, Rear seat heating	-
13. Interior: other	-
14. Leather upholstery	-
15. Metallic paint	-
16. Other	-
17. Rear spoiler	-
18. Soundsystem	-
19. Tinted rear windows, Windows: other	-
20. Ventilated front seat	-

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

Corrections

First registration

Mileage

Equipment

Tyres

Other

Current market situation -
 Earlier repairs -
 Uszkodzenia, stan -


Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 07-2025 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - due to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 21-07-2025

DEKRA's expert:
Kacper Sosnowski (NEW)
Andrzej Sosnowski

Document issued electronically valid without signature.

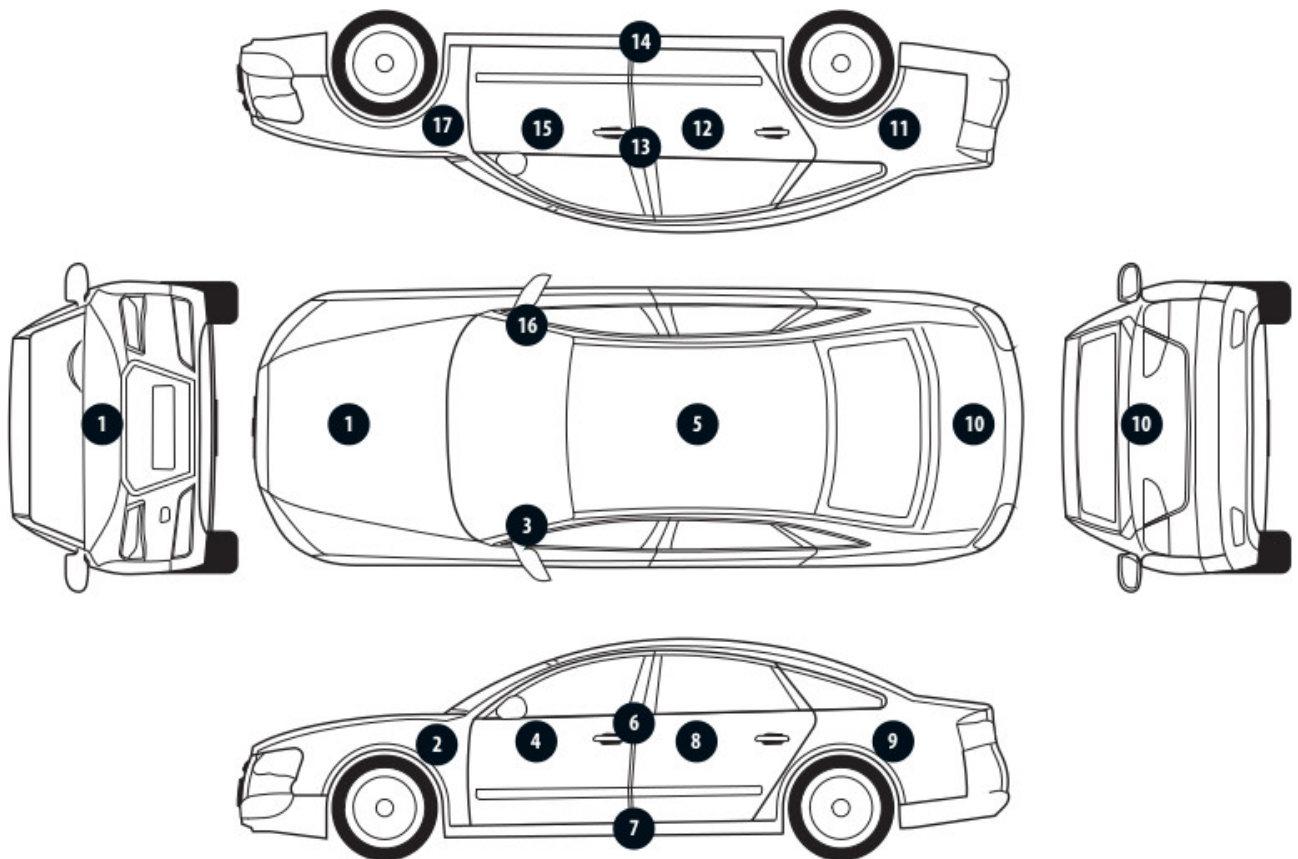Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Front left fender	to 150
3	Left front pillar	to 150
4	Front left door	150 - 500
5	Roof	to 150
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	to 150
9	Rear left fender	to 150
10	Cover/lid	to 150
11	Right rear fender	to 150
12	Right rear door	to 150
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	to 150
16	Right front pillar	to 150
17	Front right fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book was presented and its number is given below:
elektroniczna

Information concerning the origin of the vehicle

Lack of reliable data.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below:
ograniczenia placowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of

the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

2

Expert comments - regarding valuation

Rysy na samochodzie. Odpryski na szybie czołowej. Widoczne wady lakiernicze.

Rzeczoznawca dokonał oględzin pojazdu w warunkach parkingowych, co mogło ograniczyć pełną ocenę jego stanu technicznego. Dodatkowo, jeżeli jazda próbna została przeprowadzona (informacje w treści raportu), to wykonano ją w warunkach parkingowych, z niewielką prędkością, co może nie odzwierciedlać pełnych warunków eksploatacyjnych. Istnieje możliwość, że w innych okolicznościach ujawnią się dodatkowe uszkodzenia lub usterki, których nie można było wykryć podczas obecnych oględzin. Zalecamy zatem skorzystanie z możliwości oględzin pojazdu we własnym zakresie lub w Autoryzowanej Stacji Obsługi danej marki, co pozwoli na pełniejszą weryfikację stanu technicznego pojazdu przed udziałem w aukcji."

Restrictive disclaimer - regarding valuation

Nie weryfikowano szczegółowo stanu układu napędowego, zawieszenia, kierowniczego, hamulcowego oraz wydechowego. Ocena została wykonana bez użycia podnośnika i specjalistycznego sprzętu diagnostycznego, nie dokonywano demontażu osłon i innych elementów. Ocena określa ogólny stan pojazdu na dzień oględzin w miejscu jego udostępnienia, nie może być zatem traktowana jako kompleksowa ocena stanu technicznego. Specyfikacja wg. programu operacyjnego w zakresie wyposażenia standardowego i dodatkowego nie gwarantuje zgodności ze stanem faktycznym w zakresie możliwym do ustalenia przez rzeczoznawcę podczas oględzin pojazdu.

Pomiar grubości powłoki lakierowej wykonano w miejscach możliwych do ich wykonania pomiary nie gwarantują oryginalności poszczególnych elementów poddanych ocenie.

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.

- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu

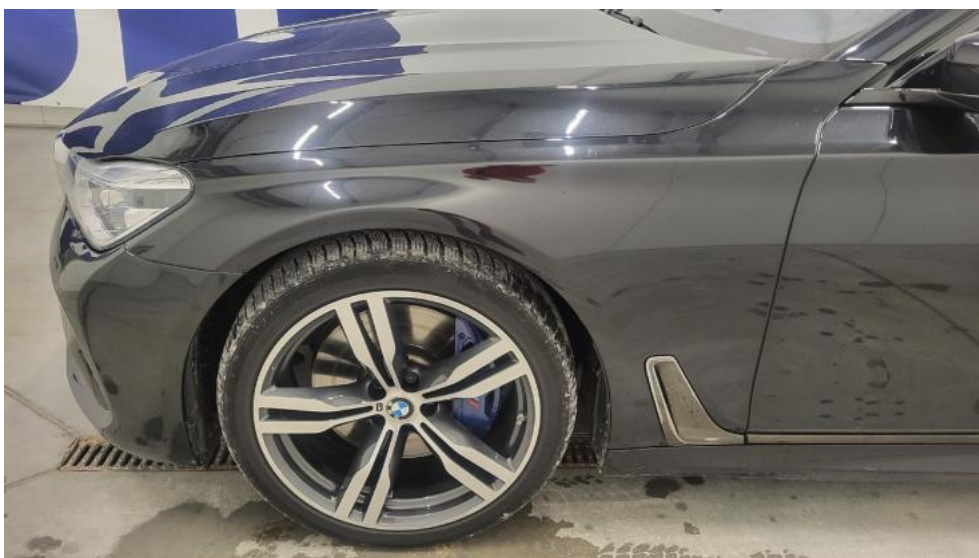


Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.

Próg lewy (widok od przodu)



Photo 12.

Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik

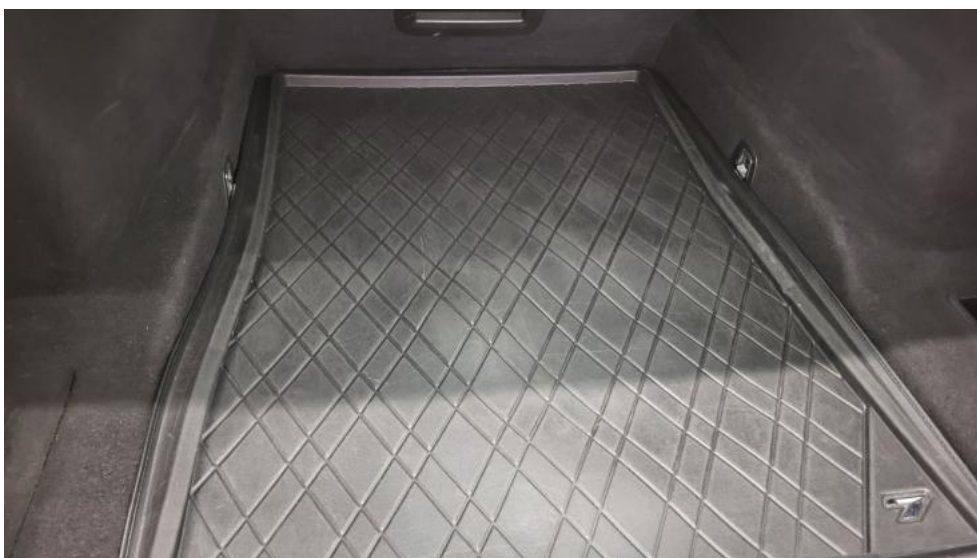


Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika

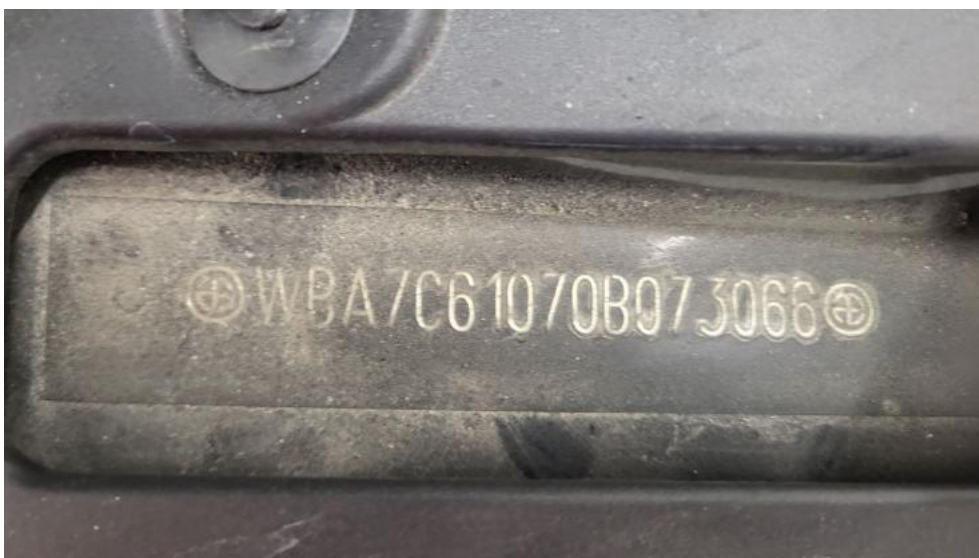


Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION



Photo 23.

Tabliczka znamionowa



Photo 24.

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe



Photo 28.

Widok z tylnej kanapy na deskę rozd.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.

Konsola środkowa



Photo 30.

Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION



Photo 31.

Kierownica (na wprost)



Photo 32.

Dowód rej. Str. 1

PHOTOGRAPHIC DOCUMENTATION



Photo 33.

Dow. Rej. Str.2 i klucze



Photo 34.

Książka serwisowa – dane

PHOTOGRAPHIC DOCUMENTATION**Photo 35.**

Książka serwisowa – ostatni przegląd

**Photo 36.**

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 37.

Zdjęcie do protokołu



Photo 38.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Zdjęcie do protokołu



Photo 40.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Zdjęcie do protokołu



Photo 42.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION

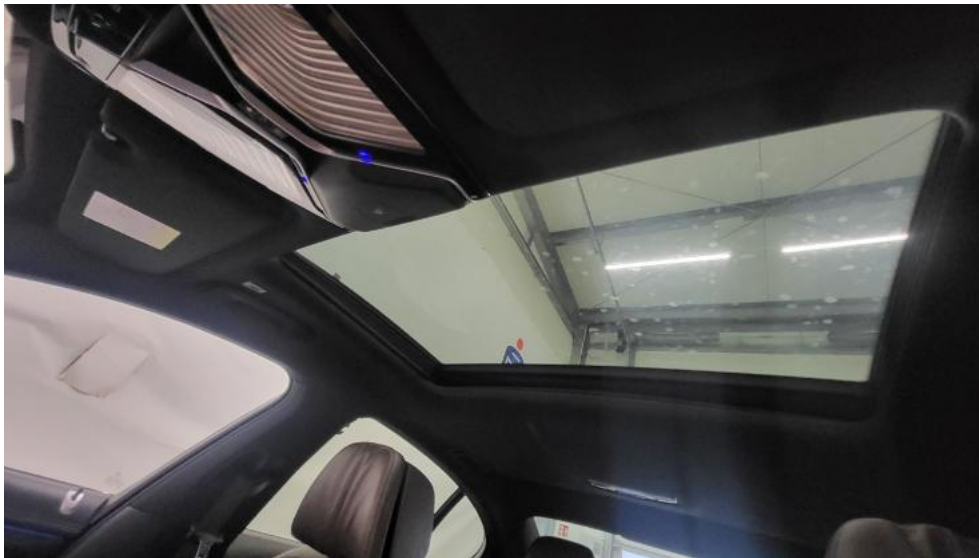


Photo 43.

Zdjęcie do protokołu



Photo 44.

Kratka/zaślepka halogenu P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Pokrywa komory silnika - Wgniecenie/odkształcenie 1



Photo 46.

Zderzak - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Felga aluminiowa przednia P - Rysa/odprysk 1



Photo 48.

Drzwi przednie P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Lusterko zew P - Rysa/odprysk 1



Photo 50.

Próg P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Próg P - Wgniecenie/odkształcenie 1



Photo 52.

Próg P - Wgniecenie/odkształcenie 2

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Błotnik tylny P / Ściana boczna P - Rysa/odprysk 1



Photo 54.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 2



Photo 56.

Felga aluminiowa tylna P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Zderzak tylny - Rysa/odprysk 1



Photo 58.

Zderzak tylny - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Zderzak tylny() - Rysa/odprysk 3



Photo 60.

Zderzak tylny cz dolna - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Zderzak tylny cz dolna - Pęknięcie/rozerwanie 1



Photo 62.

Dach - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION

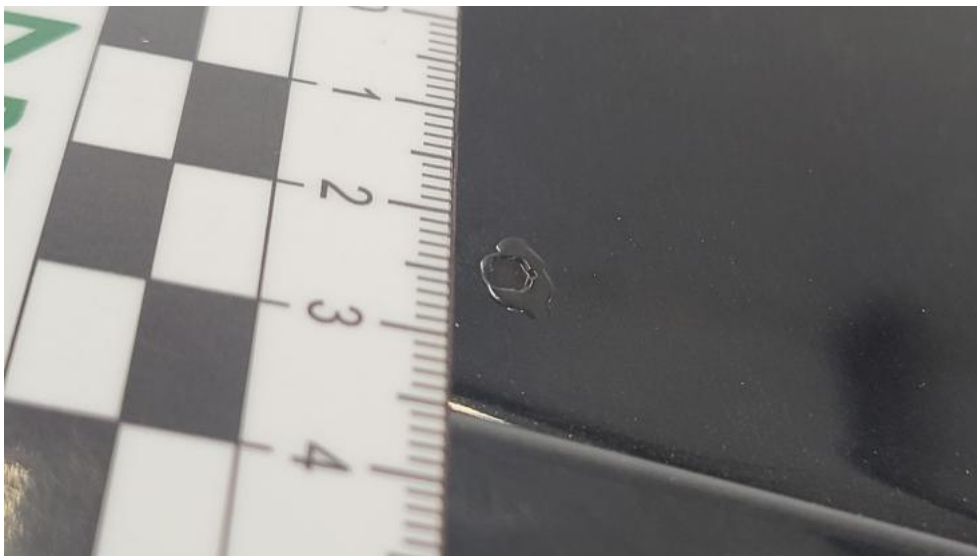


Photo 63.

Dach - Inne 1

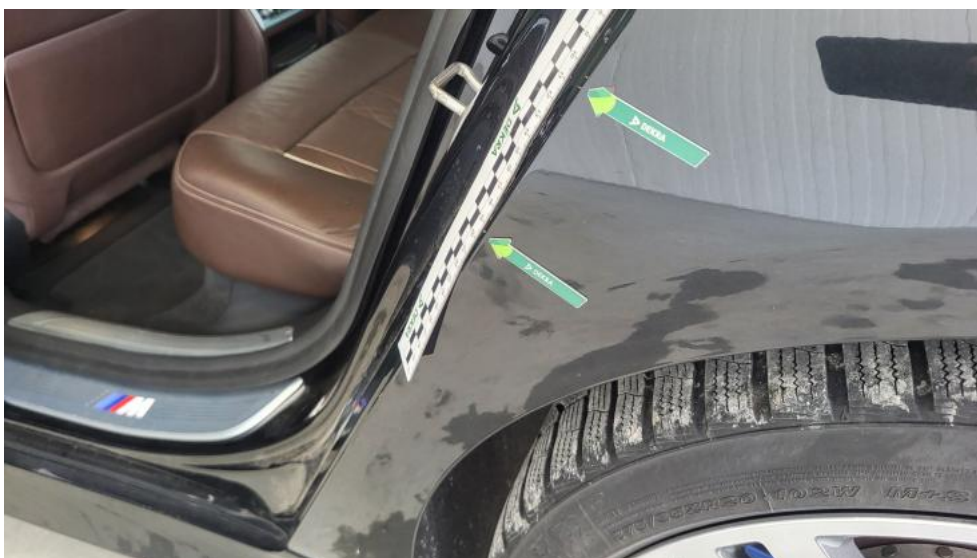


Photo 64.

Łotnik tylny L / Ściana boczna L - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1



Photo 66.

Błotnik tylny L / Ściana boczna L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 67.

Drzwi przed L - Wgniecenie/odkształcenie 1



Photo 68.

Drzwi przed L - Wgniecenie/odkształcenie 2

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Próg L - Wgniecenie/odkształcenie 1



Photo 70.

Felga Aluminiowa przednia L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Koło kierownicy - Inne 1



Photo 72.

Fotel prz. lew. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 73.

Fotel prz. praw. - Inne 1



Photo 74.

Kanapa tyl. - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 75.

Kanapa tyl. - Rysa/odprysk 2



Photo 76.

Tapicerka drzwi przednich L - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 77.

Tapicerka drzwi przednich L - Pęknięcie/rozerwanie 1



Photo 78.

Tapicerka drzwi tylnych L - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 79.

Tapicerka drzwi tylnych P - Rysa/odprysk 1