

DEKRA's commission No. : PKOL(W)/LODZ/73874/25/09/30
commission/ damage No. : 22/013785
Date of commission: 30-09-2025

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (NEW)
DEKRA Polska - współpraca O/Warszawa
Andrzej Sosnowski
DEKRA Polska - Centrala

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0134022
Manufacturer	BMW
Model	Seria 6 Gran Turismo [G32] 17-20
Type / version	620d xDrive M Sport sport-aut
Body type	hatchback
Number of doors / seats	5/5
Curb weight [kg]	1830
Gross vehicle weight [kg]	2500
Wheelbase 1/2	3070
Engine type	Automatic ignition
Pollution reduction system	DPF
Engine capacity [ccm]	1995
Engine Power [hp/kW]	190/140
Gearbox	automatic
Registration /record No.	D8ZENON
VIN / serial number	WBAJX41080BJ23133
Date of first registration	26-03-2019
Date of next. tech. test	26-03-2024
Year of manufacture	2018
Readout [km]	73 899 (read)
Body color / type of coating	white/double-layered, metallized

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	PIRELLI, SOTTOZERO 3 WINTER	245/45 19 102V	4,5 mm
	left	PIRELLI, SOTTOZERO 3 WINTER	245/45 19 102V	4,5 mm
back	right	PIRELLI, SOTTOZERO 3 WINTER	275/40 19 105V	5,0 mm
	left	PIRELLI, SOTTOZERO 3 WINTER	275/40 19 105V	5,0 mm

Standard equipment by Eurotax

- | | |
|---|---|
| 1. Additional gauges | 32. Interior: other |
| 2. Alarm | 33. Interior: other |
| 3. Antilock-Brake-System (ABS) | 34. LED Fog Lamps |
| 4. Armrest (s) front | 35. Leather finish dashbord |
| 5. Armrest (s) rear | 36. Leather upholstery |
| 6. Automated High-beam assist | 37. Light Alloy wheels 19'', Runflat tyres |
| 7. Automatic dimlight activation, Rain sensor | 38. Mobile Tire System |
| 8. Bluetooth interface, Hands-free system | 39. Navigation system |
| 9. Bord communication: other | 40. Other |
| 10. Bord communication: other | 41. Other |
| 11. Brake Assist | 42. Other |
| 12. CD-player | 43. Other |
| 13. Child seat fixation | 44. Park Assistant |
| 14. Collision Warning System | 45. Park Distance Control front, Park Distance Control rear |
| 15. Colored glass | 46. Rear seat-backs foldable in two separate parts |
| 16. Cruise control | 47. Rear spoiler |
| 17. Door mirrors autodimming | 48. Remote controlled central locking |
| 18. Door mirrors electrically foldable, Door mirrors heated | 49. Selectable driveline characteristics |
| 19. Driver airbag, Head airbags front, Passenger airbag, Side airbag driver and passenger | 50. Servotronic |
| 20. Driver seat electrically adjustable, Passenger seat electrically adjustable | 51. Sport seats front |
| 21. Dualzone automatic climate control | 52. Sports steering wheel |
| 22. ESP (Electronical Stabilizing Program), Traction control | 53. Start/Stop system |
| 23. Electric tailgate | 54. Start/Stop system |
| 24. Exterior design: other | 55. Steering wheel manually adjustabe |
| 25. Exterior design: other | 56. Telematic |
| 26. Exterior design: other | 57. Telematic |
| 27. Extra power outlet | 58. Tie-down ring |
| 28. Floor mat | 59. Uni-Lackierung |
| 29. Follow me home | 60. Wheel bolt locks |
| 30. Interior decoration: other | 61. Windscreen wash-nozzle heated |
| 31. Interior lights: other accessories | |

Dealer's equipment (selected items)

- | | | |
|---|-------|---|
| 1. 360 view camera, Park Assistant, Park Distance Control front, Park Distance Control rear, Rear view camera | | - |
| Kamera Surround View | | |
| Asystent parkowania | | |
| 2. 4 or more zone automatic climate control, Air condition rear | | - |
| 3. Adaptive Cruise Control, Brake Assist, Lane control assistant | | - |
| 4. Comfort driver seat, Comfort passenger seat | | - |
| 5. Door: other | | - |
| 6. Front seat with massage | | - |
| 7. Heated seat driver, Heated seat passenger, Rear seat heating | | - |
| 8. Interior decoration: other | | - |
| 9. Keyless entry, Keyless go | | - |
| 10. Leather upholstery | | - |
| 11. Metallic paint | | - |
| 12. Mobile phone, Wireless device charging | | - |
| 13. Other | | - |
| 14. Soundsystem | | - |
| 15. Tinted rear windows | | - |
| 16. Ventilated front seat | | - |

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

CorrectionsFirst registrationEquipmentTyresOther

The validity of the technical examination -

Earlier repairs -

Uszkodzenia, stan, weryfikacja serwisowa -

Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 10-2025 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 09-10-2025

DEKRA's expert:
Kacper Sosnowski (NEW)
Andrzej Sosnowski**Document issued electronically valid without signature.**

Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Front left fender	to 150
3	Left front pillar	to 150
4	Front left door	to 150
5	Roof	to 150
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	to 150
9	Rear left fender	to 150
10	Cover/lid	to 150
11	Right rear fender	150 - 1000
12	Right rear door	150 - 1000
13	Right middle pillar	to 150
14	Right side sill	150 - 500
15	Front right door	150 - 300
16	Right front pillar	150 - 300
17	Front right fender	150 - 300

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

Presented the following documents of the vehicle:

ksero pozwolenia czasowego

During the inspection the service book was presented and its number is given below:
elektroniczna

Information concerning the origin of the vehicle

Lack of reliable data.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below:
ograniczenia placowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of

page 5/46

the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

2

Expert comments - regarding valuation

Dostarczono ksero pozwolenia czasowego. Rysy na samochodzie. Minął termin wymiany płynu hamulcowego. Aktywna kontrolka ciśnienia w kołach. Informacja system alarmowy niedostępny. Niesprawne przyciski funkcyjne w jednym z kluczyków. Odpryski na szybie czołowej. Widoczne wady lakiernicze. Brak aktualnych badań technicznych.

Rzeczoznawca dokonał oględzin pojazdu w warunkach parkingowych, co mogło ograniczyć pełną ocenę jego stanu technicznego. Dodatkowo, jeżeli jazda próbna została przeprowadzona (informacje w treści raportu), to wykonano ją w warunkach parkingowych, z niewielką prędkością, co może nie odzwierciedlać pełnych warunków eksploatacyjnych. Istnieje możliwość, że w innych okolicznościach ujawnią się dodatkowe uszkodzenia lub usterki, których nie można było wykryć podczas obecnych oględzin. Zalecamy zatem skorzystanie z możliwości oględzin pojazdu we własnym zakresie lub w Autoryzowanej Stacji Obsługi danej marki, co pozwoli na pełniejszą weryfikację stanu technicznego pojazdu przed udziałem w aukcji."

Restrictive disclaimer - regarding valuation

Nie weryfikowano szczegółowo stanu układu napędowego, zawieszenia, kierowniczego, hamulcowego oraz wydechowego. Ocena została wykonana bez użycia podnośnika i specjalistycznego sprzętu diagnostycznego, nie dokonywano demontażu osłon i innych elementów. Ocena określa ogólny stan pojazdu na dzień oględzin w miejscu jego udostępnienia, nie może być zatem traktowana jako kompleksowa ocena stanu technicznego. Specyfikacja wg. programu operacyjnego w zakresie wyposażenia standardowego i dodatkowego nie gwarantuje zgodności ze stanem faktycznym w zakresie możliwym do ustalenia przez rzeczoznawcę podczas oględzin pojazdu.

Pomiar grubości powłoki lakierowej wykonano w miejscach możliwych do ich wykonania pomiary nie gwarantują oryginalności poszczególnych elementów poddanych ocenie.

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.

- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.

Przekątna przednia lewa



Photo 2.

Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.

Bok prawy z tyłu



Photo 6.

Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.

Próg lewy (widok od przodu)

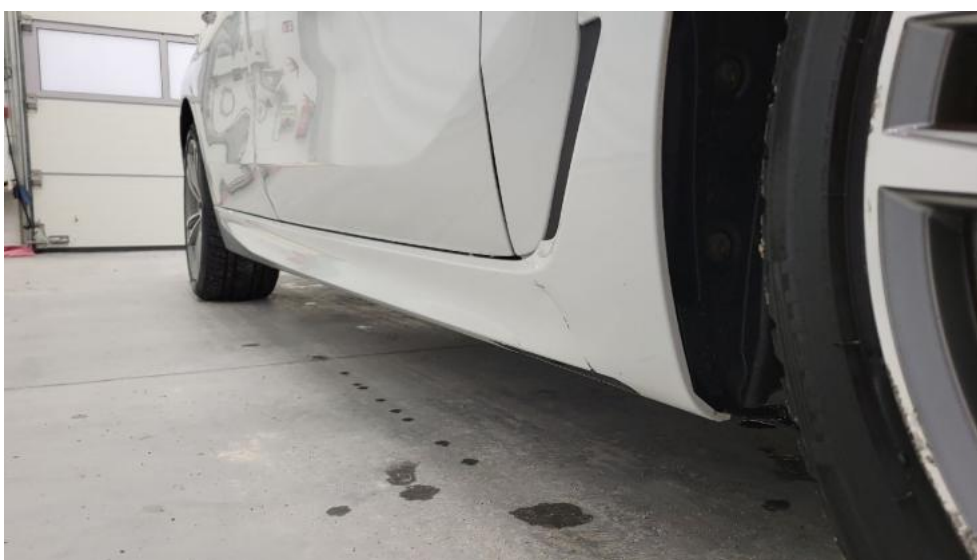


Photo 12.

Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika



Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION

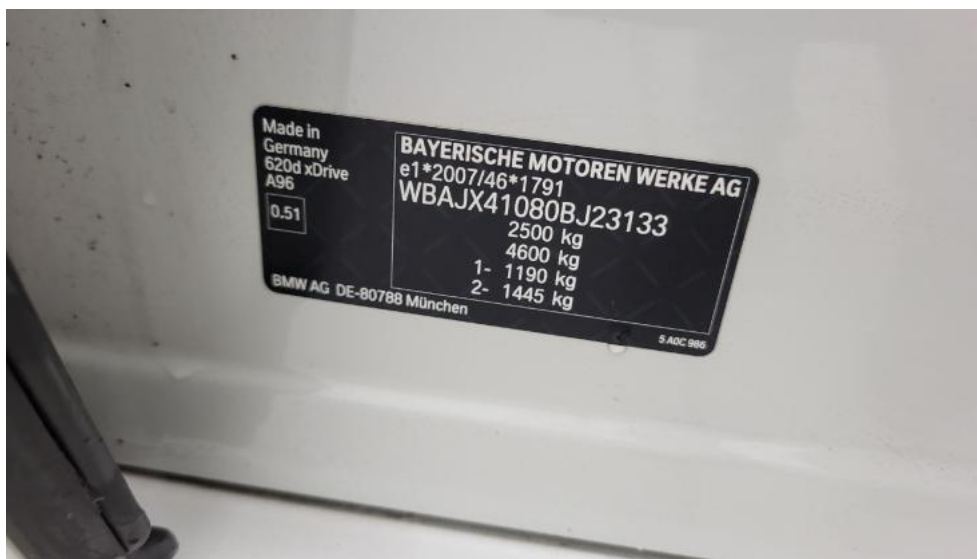


Photo 23.

Tabliczka znamionowa



Photo 24.

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe



Photo 28.

Widok z tylnej kanapy na deskę rozd.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.
Konsola środkowa



Photo 30.
Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION



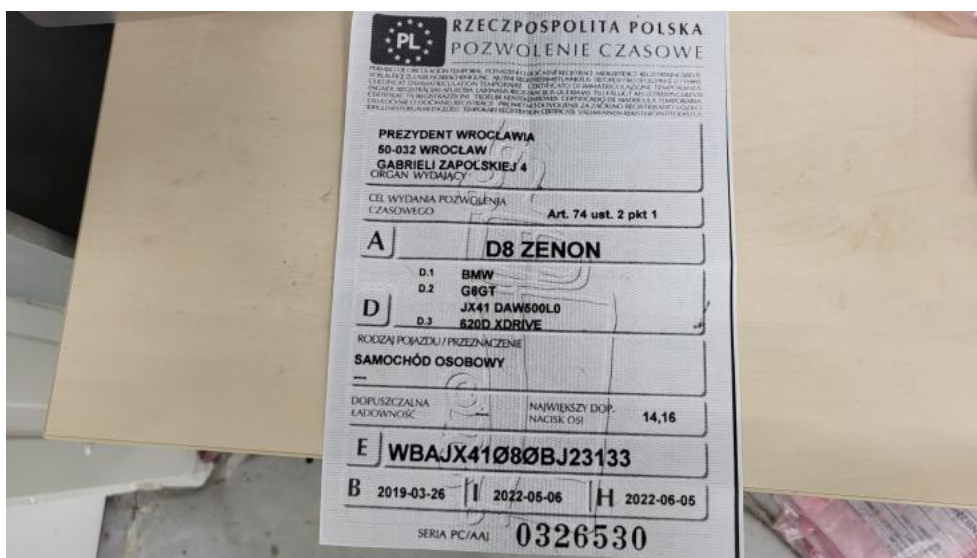
Photo 31.
Kierownica (na wprost)



Photo 32.
Książka serwisowa – dane

PHOTOGRAPHIC DOCUMENTATION**Photo 33.**

Książka serwisowa – ostatni przegląd

**Photo 34.**

Dow. rej. ksero Str. 1

PHOTOGRAPHIC DOCUMENTATION**Photo 35.**

Dow. Rej. ksero Str.2 i klucze

**Photo 36.**

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 37.

Zdjęcie do protokołu



Photo 38.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Zdjęcie do protokołu

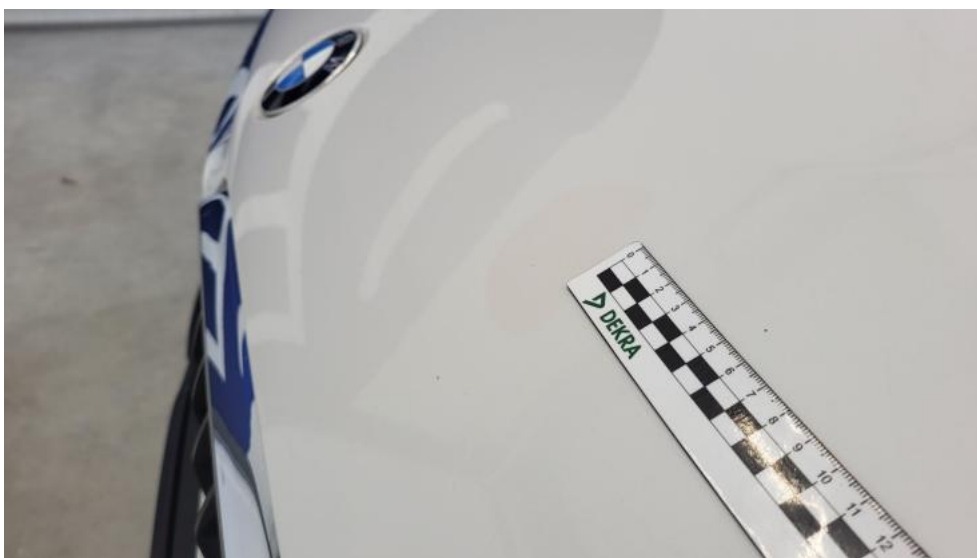


Photo 40.

Pokrywa komory silnika - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Wykładzina pokrywy komory silnika - Pęknięcie/rozerwanie 1



Photo 42.

Zderzak - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Zderzak - Rysa/odprysk 2



Photo 44.

Zderzak() - Rysa/odprysk 3

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Zderzak - Wgniecenie/odkształcenie 1



Photo 46.

Felga aluminiowa przednia P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Próg P - Wgniecenie/odkształcenie 1



Photo 48.

Próg P - Wgniecenie/odkształcenie 2

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Próg P - Pęknięcie/rozerwanie 1



Photo 50.

Ścianka tylna P / Ścianka boczna P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Felga aluminiowa tylna P - Rysa/odprysk 1



Photo 52.

Pokrywy bagażnika - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION

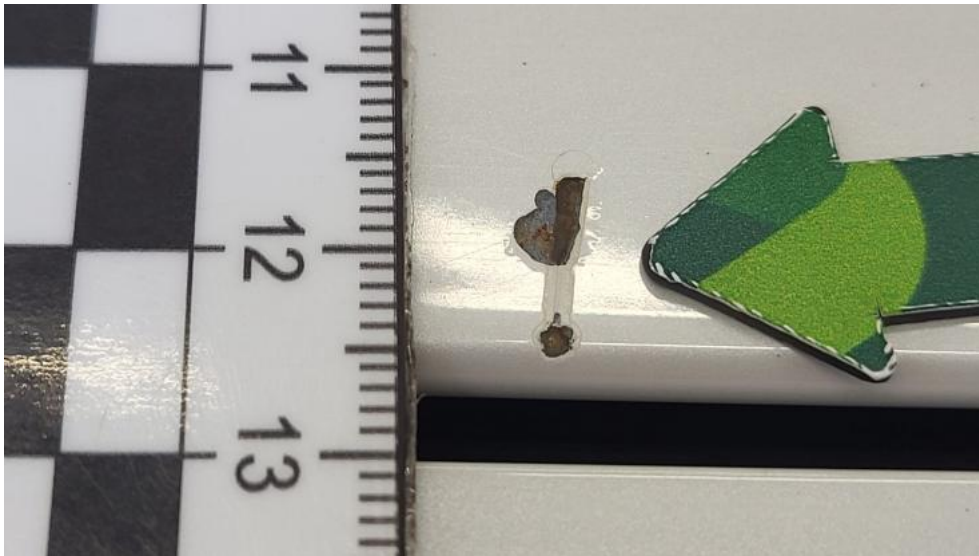


Photo 53.

Pokrywy bagażnika - Inne 1



Photo 54.

Zderzak tylny - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Zderzak tylny - Rysa/odprysk 2



Photo 56.

Zderzak tylny - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Zderzak tylny - Wgniecenie/odkształcenie 2



Photo 58.

Zderzak tylny - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Zderzak tylny cz dolna - Rysa/odprysk 1



Photo 60.

Zderzak tylny cz dolna - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Dach - Rysa/odprysk 1



Photo 62.

Dach - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1



Photo 64.

Felga aluminiowa tylna L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Drzwi przed L - Rysa/odprysk 1



Photo 66.

Drzwi przed L - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 67.

Drzwi przed L - Wgniecenie/odkształcenie 1



Photo 68.

Drzwi tylne L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Felga Aluminiowa przednia L - Rysa/odprysk 1



Photo 70.

Koło kierownicy - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Podłokietnik środkowy przedni - Rysa/odprysk 1



Photo 72.

Fotel prz. praw. - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 73.

Fotel prz. praw. - Pęknięcie/rozerwanie 1



Photo 74.

Fotel prz. praw. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 75.

Kanapa tyl. - Rysa/odprysk 1



Photo 76.

Tapicerka drzwi przednich L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 77.

Wykładzina podłogi bagażnika - Inne 1



Photo 78.

Wykładzina pokrywy tylnej - Rysa/odprysk 1