

DEKRA's commission No. : PKOL(W)/LODZ/02762/26/01/13
commission/ damage No. : 21/011404
Date of commission: 13-01-2026

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (WSP)
DEKRA Polska - współpraca O/Warszawa
Andrzej Sosnowski
DEKRA Polska - Centrala

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0137392
Manufacturer	PORSCHE
Model	718 Cayman [982] 16-
Type / version	718 Cayman GPF PDK
Body type	CPE
Number of doors / seats	2/2
Curb weight [kg]	1419
Gross vehicle weight [kg]	1685
Wheelbase 1/2	2475
Engine type	spark ignition
Pollution reduction system	GPF
Engine capacity [ccm]	1988
Engine Power [hp/kW]	300/220
Gearbox	automatic
Registration /record No.	KK51421
VIN / serial number	WP0ZZZ98ZNS250876
Date of first registration	27-05-2022
Date of next. tech. test	27-05-2027
Year of manufacture	2022
Readout [km]	63 459 (read)
Body color / type of coating	black/double-layered, metallized

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	CONTINENTAL, CONTIWINTERCONTACT TS830 P	235/40 19 92V	5,0 mm
	left	CONTINENTAL, CONTIWINTERCONTACT TS830 P	235/40 19 92V	6,5 mm
back	right	CONTINENTAL, CONTIWINTERCONTACT TS830 P	265/40 19 98V	3,5 mm

left	CONTINENTAL, CONTIWINTERCONTACT TS830 P	265/40 19 98V	3,5 mm
------	---	---------------	--------

Standard equipment by Eurotax

- | | |
|--|---|
| 1. Antilock-Brake-System (ABS) | 27. Interior decoration: other |
| 2. Artificial leather upholstery, Textile upholstery | 28. Interior lights: other accessories |
| 3. Automated High-beam assist | 29. Interior lights: other accessories |
| 4. Automatic climate control | 30. Interior: other |
| 5. Bi-Xenon Head lamps, LED Daytime running lights | 31. Interior: other |
| 6. Bord communication: other | 32. LED rear lights |
| 7. Bord entertainment: other accessories, On board monitor, Radio | 33. Leather gearshifter/switch |
| 8. Cabin air filter | 34. Leather steering wheel, Sports steering wheel, Steering wheel manually adjustable |
| 9. Colored glass, Heat reflecting windows | 35. Light Alloy wheels 18" |
| 10. Colour stripe in windscreen | 36. On board computer |
| 11. DAB radio | 37. Other |
| 12. Digital instruments | 38. Other |
| 13. Door mirror(s) electrically adjustable in general, Door mirrors heated, Mirror: others | 39. Other |
| 14. Driver airbag, Head airbags front, Passenger airbag, Side airbag driver and passenger | 40. Power steering |
| 15. Driver seat electrically adjustable, Passenger seat electrically adjustable, Sport seats front | 41. Power windows front |
| 16. ESP (Electronical Stabilizing Program) | 42. Rear spoiler |
| 17. Electric parking brake | 43. Rear swing door with window, Rear window heating |
| 18. Energy recovery system | 44. Remote controlled central locking |
| 19. Exterior design: other | 45. Selectable driveline characteristics |
| 20. Exterior design: other | 46. Soundsystem |
| 21. Exterior design: other | 47. Start/Stop system |
| 22. Exterior lighting: other, Side indicators | 48. Storage facilities in general |
| 23. Extra power outlet | 49. Tyre pressure control (RDC) |
| 24. Interior decoration: other | 50. Uni-Lackierung |
| 25. Interior decoration: other | 51. Vehicle immobilizer |
| 26. Interior decoration: other | 52. Windscreenwiper: other |

Dealer's equipment (selected items)

- | | | |
|---------------------------|-------|---|
| 1. Light Alloy wheels 19" | | - |
| 2. Metallic paint | | - |

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

CorrectionsMileageEquipmentTyres

Other

Earlier repairs -
Aktualna sytuacja rynkowa -
Braki uszkodzenia, stan -


Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 02-2026 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 10-02-2026

DEKRA's expert:
Kacper Sosnowski (WSP)
Andrzej Sosnowski

Document issued electronically valid without signature.

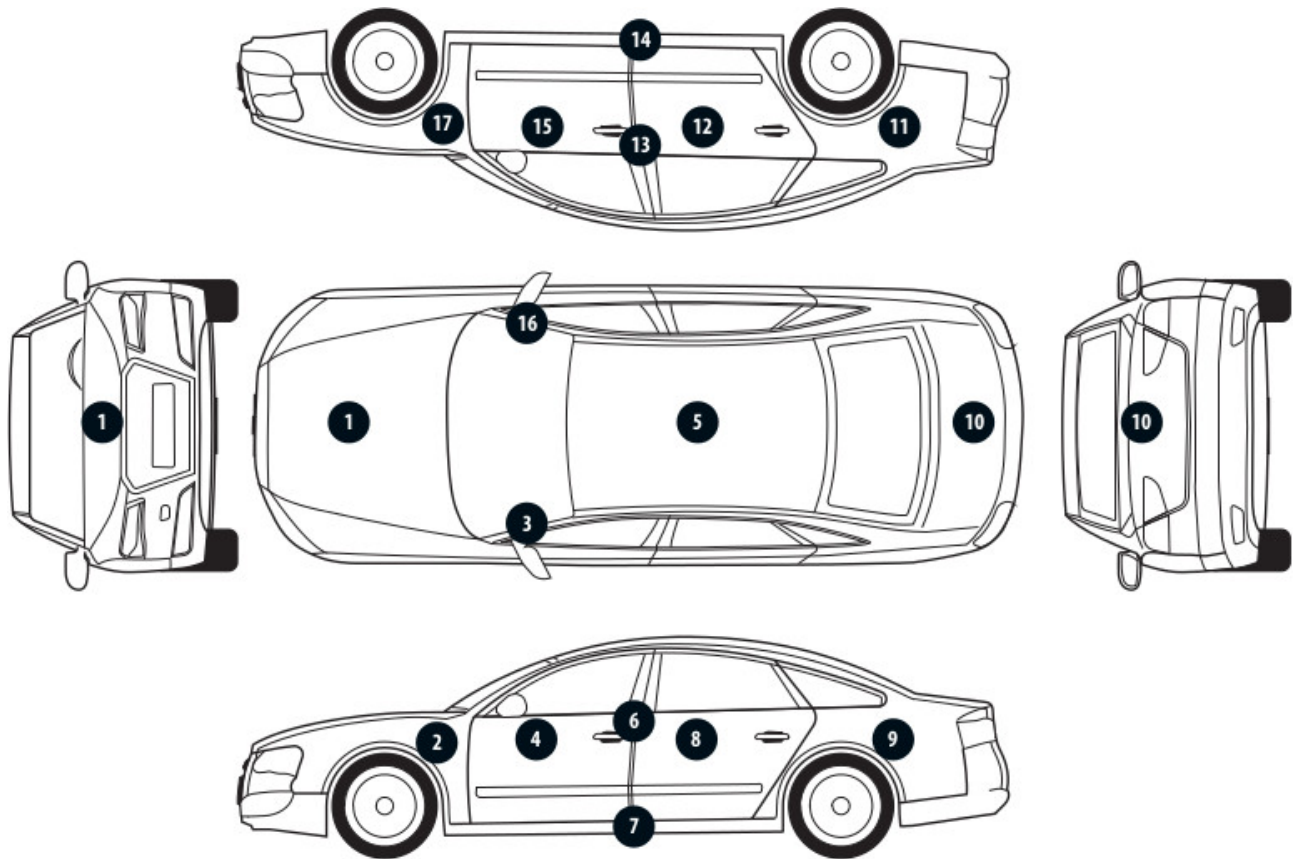Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	150 - 300
2	Front left fender	to 150
3	Left front pillar	150 - 300
4	Front left door	150 - 300
5	Roof	150 - 300
6	Left middle pillar	to 150
7	Right side sill	to 150
9	Rear left fender	to 150
10	Cover/lid	to 150
11	Right rear fender	to 150
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	to 150
16	Right front pillar	150 - 300
17	Front right fender	150 - 300

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

Presented the following documents of the vehicle:

ksero pozwolenia czasowego

During the inspection the service book of the vehicle was not provided.

Information concerning the origin of the vehicle

Lack of reliable data.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below: ograniczenia placowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the

page 6/36

assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

1

Expert comments - regarding valuation

Dostarczono ksero pozwolenia czasowego. Informacja wymagana wymiana okładzin hamulcowych. Pojazd oklejony folią, pomiar lakieru wykonany na folii elementy: pokrywa przednia, dach, słupek przedni lewy/prawy, błotnik przedni prawy. Rysy na samochodzie. Odpryski na szybie czołowej. Lusterka i lampy tylne oklejone folią. Widoczne wady lakiernicze.

Rzeczoznawca dokonał oględzin pojazdu w warunkach parkingowych, co mogło ograniczyć pełną ocenę jego stanu technicznego. Dodatkowo, jeżeli jazda próbna została przeprowadzona (informacje w treści raportu), to wykonano ją w warunkach parkingowych, z niewielką prędkością, co może nie odzwierciedlać pełnych warunków eksploatacyjnych. Istnieje możliwość, że w innych okolicznościach ujawnią się dodatkowe uszkodzenia lub usterki, których nie można było wykryć podczas obecnych oględzin. Zalecamy zatem skorzystanie z możliwości oględzin pojazdu we własnym zakresie lub w Autoryzowanej Stacji Obsługi danej marki, co pozwoli na pełniejszą weryfikację stanu technicznego pojazdu przed udziałem w aukcji."

Restrictive disclaimer - regarding valuation

Nie weryfikowano szczegółowo stanu układu napędowego, zawieszenia, kierowniczego, hamulcowego oraz wydechowego. Ocena została wykonana bez użycia podnośnika i specjalistycznego sprzętu diagnostycznego, nie dokonywano demontażu osłon i innych elementów. Ocena określa ogólny stan pojazdu na dzień oględzin w miejscu jego udostępnienia, nie może być zatem traktowana jako kompleksowa ocena stanu technicznego. Specyfikacja wg. programu operacyjnego w zakresie wyposażenia standardowego i dodatkowego nie gwarantuje zgodności ze stanem faktycznym w zakresie możliwym do ustalenia przez rzeczoznawcę podczas oględzin pojazdu. Pomiar grubości powłoki lakierowej wykonano w miejscach możliwych do ich wykonania pomiary nie gwarantują oryginalności poszczególnych elementów poddanych ocenie.

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.

- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION

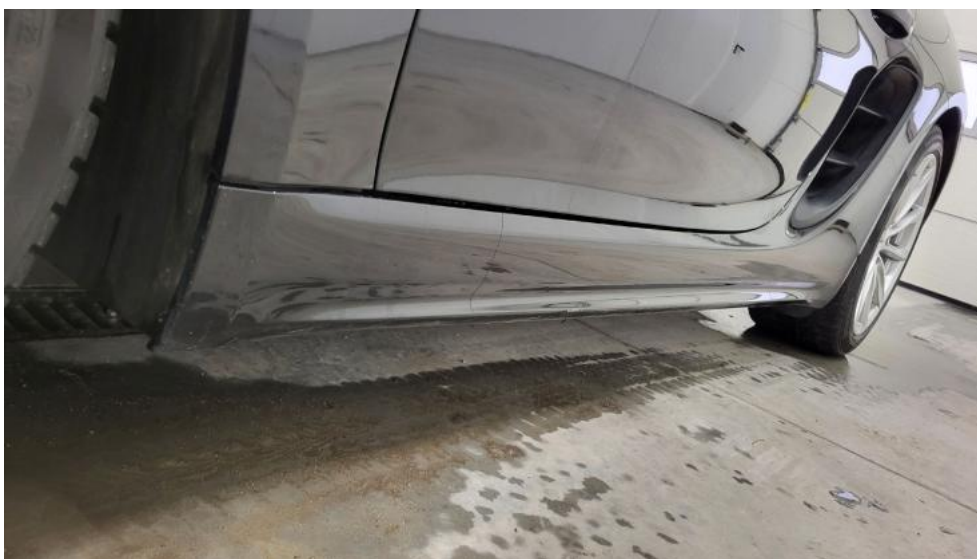


Photo 11.
Próg lewy (widok od przodu)

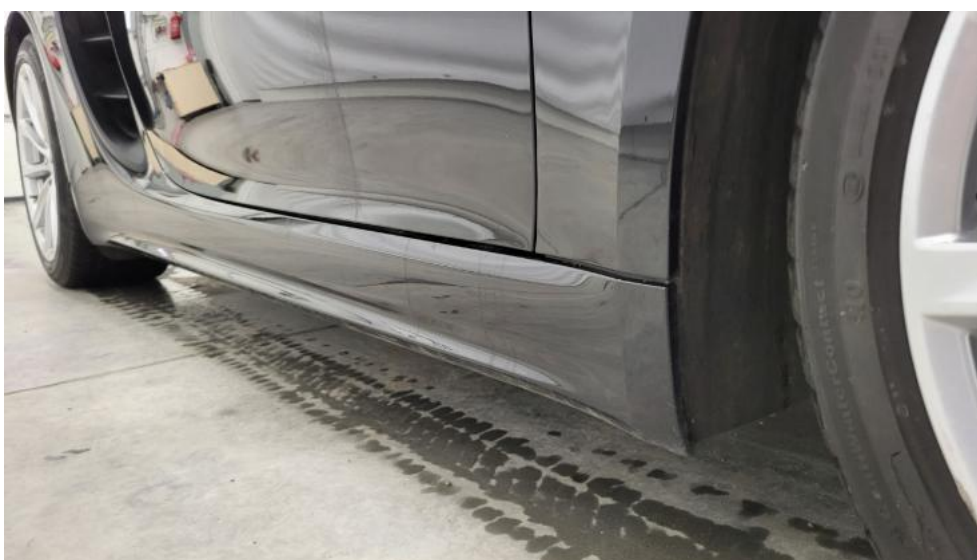


Photo 12.
Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika



Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION



Photo 23.

Tabliczka znamionowa



Photo 24.

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe



Photo 28.

Widok z tylnej kanapy na deskę rozd.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.

Konsola środkowa



Photo 30.

Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION

Photo 31.
Kierownica (na wprost)

Potwierdzenie przeglądu (zaznaczyć krzyżykiem odpowiednie pola!)

Wykonano przegląd przedprzedażny (bezpłatny)

Dnia 13/04/2022

Nr zlecenia 7827122

Przy przebiegu 1041




Tak/nie	Wymiana oleju Kontrola	Tak/nie	Wymiana oleju Kontrola
☐	Wymiana płynu hamulcowego	☐	Wymiana płynu hamulcowego
☐	Wymiana świec zapłonowych	☐	Wymiana świec zapłonowych
☐	Wymiana filtra powietrza	☐	Wymiana filtra powietrza
☐	Odwodnienie filtra paliwa	☐	Odwodnienie filtra paliwa
☐	Wymiana filtra paliwa	☐	Wymiana filtra paliwa
☐	Kontrola pasów napędowych	☐	Kontrola pasów napędowych
☐	Wymiana pasów napędowych	☐	Wymiana pasów napędowych
☐	Wymiana środka uszczelniającego do opon	☐	Wymiana środka uszczelniającego do opon
☐	Wymiana oleju w skrzyni biegów	☐	Wymiana oleju w skrzyni biegów
☐	Wymiana oleju: mechanizm różnicowy	☐	Wymiana oleju: mechanizm różnicowy
☐		☐	
☐		☐	
☐		☐	
Dnia		Dnia	
Nr zlecenia		Nr zlecenia	
Przy przebiegu		Przy przebiegu	
Pieczętka	Pieczętka	Pieczętka	Pieczętka


Photo 32.
Książka serwisowa – dane

PHOTOGRAPHIC DOCUMENTATION**Photo 33.**

Książka serwisowa – ostatni przegląd

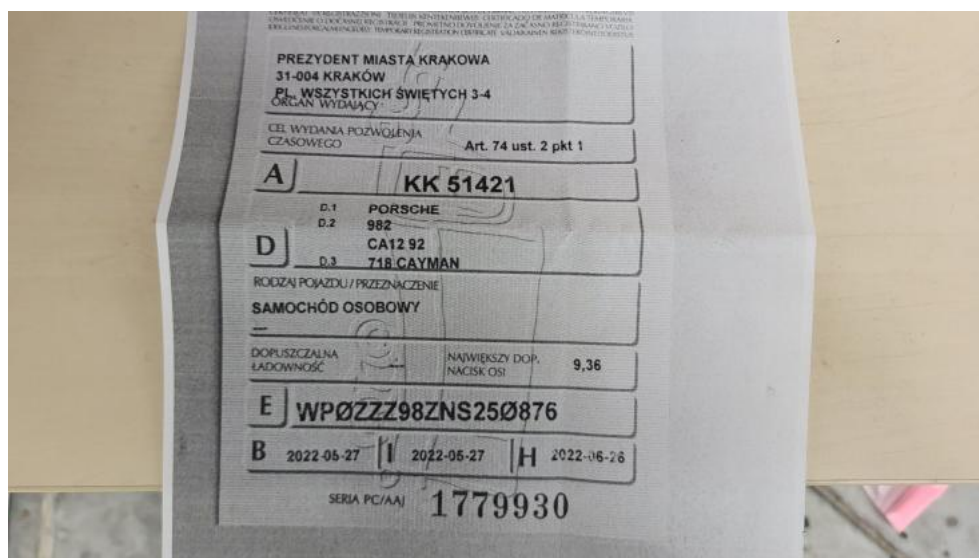**Photo 34.**

Dow. rej. ksero Str. 1

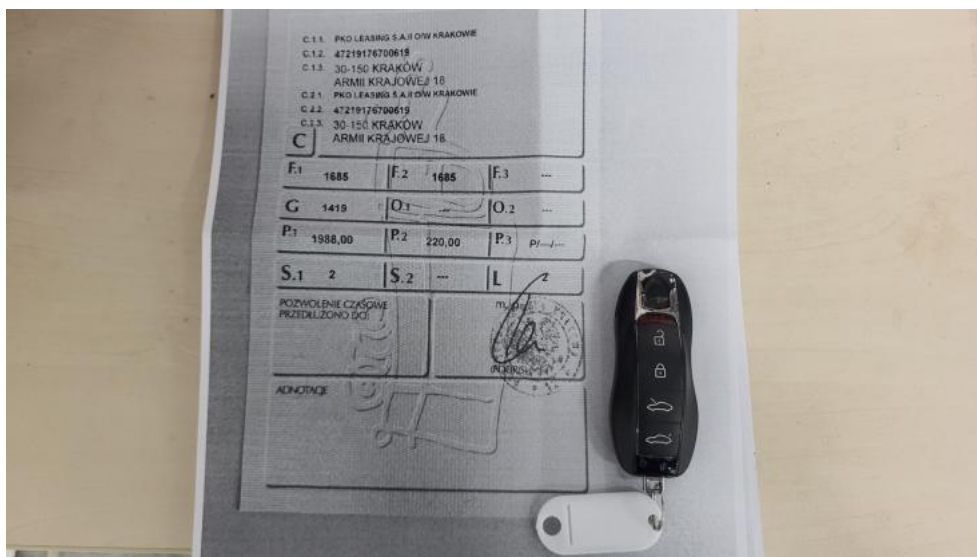PHOTOGRAPHIC DOCUMENTATION**Photo 35.**

Dow. Rej. ksero Str.2 i klucze

**Photo 36.**

Instrukcje

PHOTOGRAPHIC DOCUMENTATION



Photo 37.

Zdjęcie do protokołu



Photo 38.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Zdjęcie do protokołu

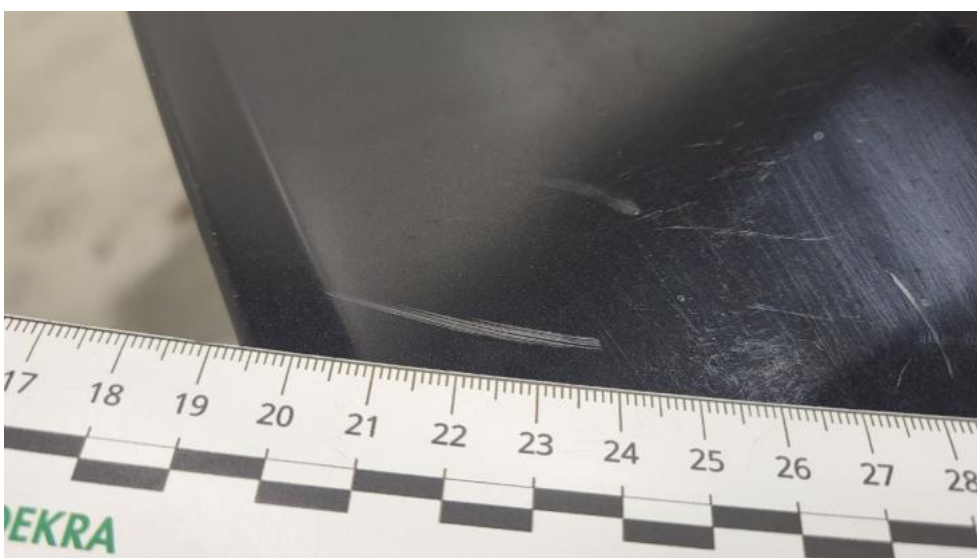


Photo 40.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Zdjęcie do protokołu



Photo 42.

Szyba czołowa - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION

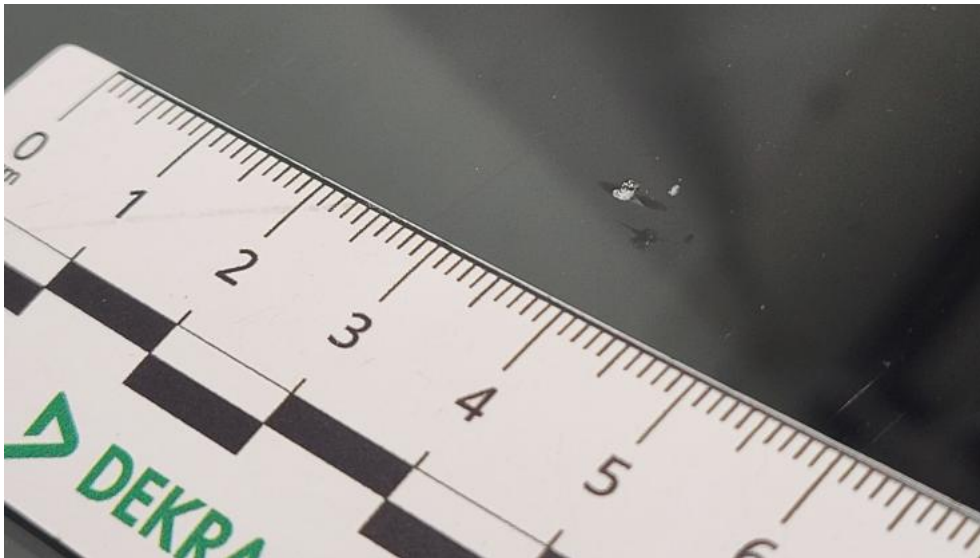


Photo 43.

Szyba czołowa - Pęknięcie/rozerwanie 1

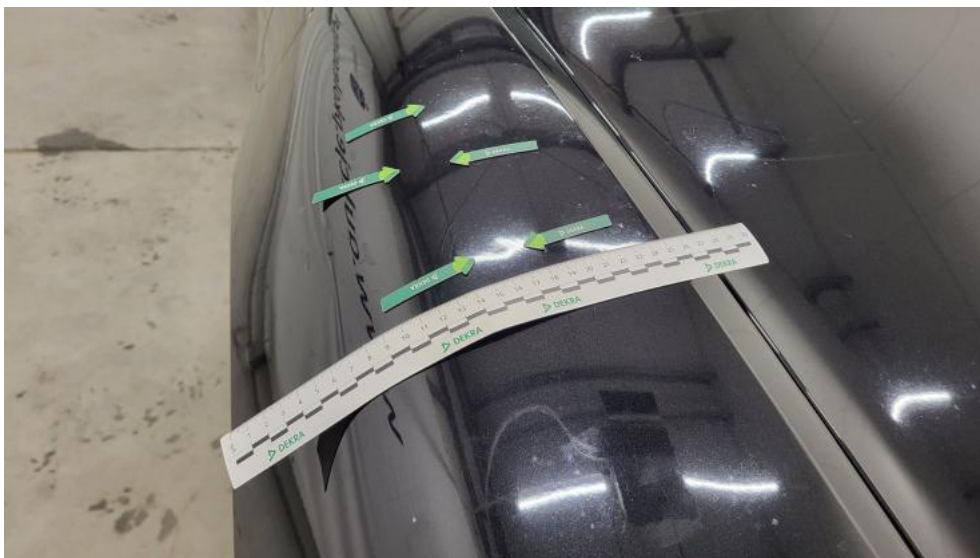


Photo 44.

Blotnik przedni P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Felga aluminiowa przednia P - Rysa/odprysk 1



Photo 46.

Drzwi przednie P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Próg P - Wgniecenie/odkształcenie 1



Photo 48.

Dach - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1



Photo 50.

Drzwi przed L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Drzwi przed L - Wgniecenie/odkształcenie 1



Photo 52.

Drzwi przed L - Wgniecenie/odkształcenie 2

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Błotnik przedni L - Rysa/odprysk 1

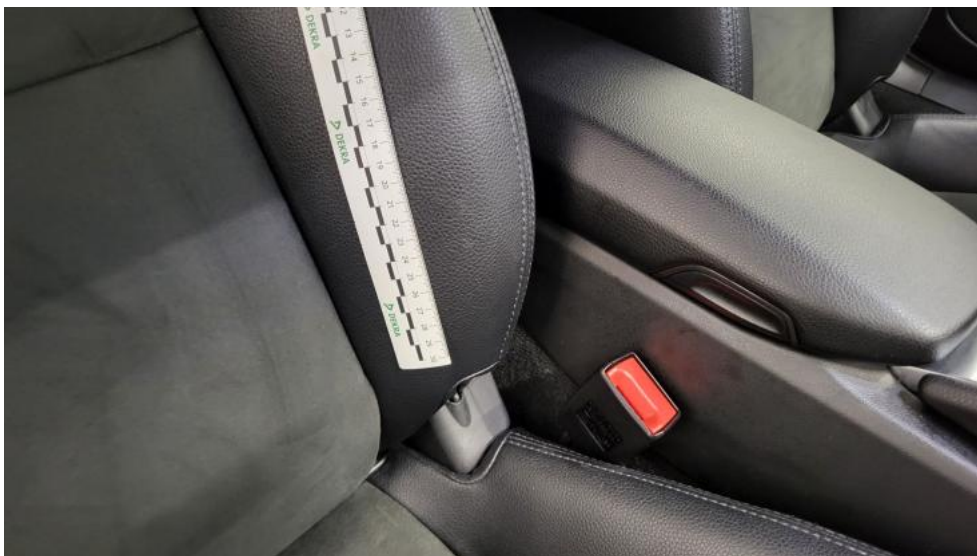


Photo 54.

Fotel prz. praw. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Uchwyt drzwi prze L - Rysa/odprysk 1