

DEKRA's commission No. : PKOL(W)/LODZ/72289/25/09/24
commission/ damage No. : 20/042657
Date of commission: 24-09-2025

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (NEW)
DEKRA Polska - współpraca O/Warszawa
Andrzej Sosnowski
DEKRA Polska - Centrala

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	jeeps
EC code (Eurotax)	0126869
Manufacturer	KIA
Model	Sorento 15-18
Type / version	Sorento 2.0 CRDI Business Line Plus aut
Body type	KOM
Number of doors / seats	5/7
Curb weight [kg]	1873
Gross vehicle weight [kg]	2620
Wheelbase 1/2	2780
Engine type	Automatic ignition
Pollution reduction system	DPF
Engine capacity [ccm]	1995
Engine Power [hp/kW]	185/136
Gearbox	automatic
Registration /record No.	TK2925Y
VIN / serial number	KNAPH81ADH5317868
Date of first registration	08-05-2017
Date of next. tech. test	19-08-2026
Year of manufacture	2017 (year has been verified with the manufacturer's base)
Readout [km]	110 972 (read)
Body color / type of coating	white/double-layered, metallized

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	NOKIAN, WR SUV 3	235/55 19 105V	4,0 mm
	left	NOKIAN, WR SUV 3	235/55 19 105V	4,0 mm
back	right	NOKIAN, WR SUV 3	235/55 19 105V	4,5 mm
	left	NOKIAN, WR SUV 3	235/55 19 105V	4,5 mm

Standard equipment by Eurotax

- | | |
|--|--|
| 1. 2 single seats rear | 45. LED rear lights |
| 2. 360 view camera | 46. Lane control assistant |
| 3. Accoustic windows | 47. Lane control assistant |
| 4. Active body control | 48. Leather gearshifter/switch, Leather steering wheel |
| 5. Adaptive Cruise Control | 49. Leather upholstery |
| 6. Adaptive light, Headlamp wash, Xenon-light | 50. Light Alloy wheels 19" |
| 7. Air condition rear, Automatic climate control | 51. Luggage compartment cover |
| 8. Alarm | 52. Lumbar adjust driver electric |
| 9. Antilock-Brake-System (ABS) | 53. Metal finish |
| 10. Armrest (s) front, Armrest (s) rear, Storage facilities in general | 54. On board computer |
| 11. Automatic dimlight activation | 55. Other |
| 12. Blind spot warning | 56. Other |
| 13. Bluetooth interface, Bord communication: other, CD-player, Hands-free system, mp3 Player, Navigation system, Radio, Rear view camera, USB in | 57. Other |
| 14. Bluetooth interface, Bord communication: other, DAB radio, mp3 Player, Navigation system, Rear view camera, Soundsystem, USB in | 58. Other |
| 15. Brake Assist | 59. Other |
| 16. Child seat fixation | 60. Park Assistant |
| 17. Cruise control | 61. Park Distance Control front, Park Distance Control rear |
| 18. DAB radio | 62. Passenger seat electrically adjustable |
| 19. Door mirror(s) electrically adjustable in general | 63. Power assisted brakes |
| 20. Door mirrors electrically foldable | 64. Power windows front, Power windows rear |
| 21. Door mirrors heated | 65. Rain sensor |
| 22. Driver airbag, Head airbags front, Passenger airbag, Side airbag driver, Side airbag driver and passenger | 66. Rear Cross Traffic Alert |
| 23. Driver seat electrically adjustable, Memory seat | 67. Rear seat heating |
| 24. ESP (Electronical Stabilizing Program) | 68. Rear seat-backs foldable in two separate parts |
| 25. Electric parking brake | 69. Rear-view mirror autodimming |
| 26. Electric tailgate | 70. Remote controlled central locking |
| 27. Exterior design: other | 71. Roof railing |
| 28. Exterior design: other | 72. Seatbelt pretensioner front, Seatbelts vertically adjustable front |
| 29. Exterior design: other | 73. Start/Stop system |
| 30. Exterior design: other, Side indicators | 74. Steering wheel heated |
| 31. Extra power outlet | 75. Steering wheel manually adjustabe |
| 32. Fog lamps | 76. Steering wheel with radio operation |
| 33. Full size spare wheel | 77. Storage facilities in general |
| 34. Glass sunroof fixed | 78. Storage facilities in general |
| 35. Heated seat driver, Heated seat passenger | 79. Sunblind rear side door manual |
| 36. Hill holder | 80. Tinted rear windows |
| 37. Interior decoration: other | 81. Traffic sign recognition |
| 38. Interior lights: other accessories | 82. Tyre pressure control (RDC) |
| 39. Interior: other | 83. USB in |
| 40. Interior: other | 84. Uni-Lackierung |
| 41. Interior: other | 85. Vehicle immobilizer |
| 42. Interior: other | 86. Ventilated front seat |
| 43. Keyless go, Other | 87. Windows: other |
| 44. LED Daytime running lights | 88. {TSA - system stabilizacji toru jazdy przyczepy} |

Dealer's equipment (selected items)

1. 360 view camera, DAB radio, Park Assistant -
KiaRoundViewCamera - system monitorowania otoczenia pojazdu z kamerą 360
Kia Auto Park Assist - system automatycznego parkowania prostopadłego i równoległego
Tuner cyfrowy DAB
2. Active body control, Adaptive Cruise Control -
Kia Smart Cruise Control - aktywny tempomat z automatyczną regulacją odległości
Nivomat - zawieszenie tylne z funkcją samopoziomowania

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

Corrections

Equipment

Tyres

Other

Current market situation -
Uszkodzenia, braki, stan, weryfikacja serwisowa -


Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 10-2025 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - due to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 19-11-2025

DEKRA's expert:
Kacper Sosnowski (NEW)
Andrzej Sosnowski

Document issued electronically valid without signature.

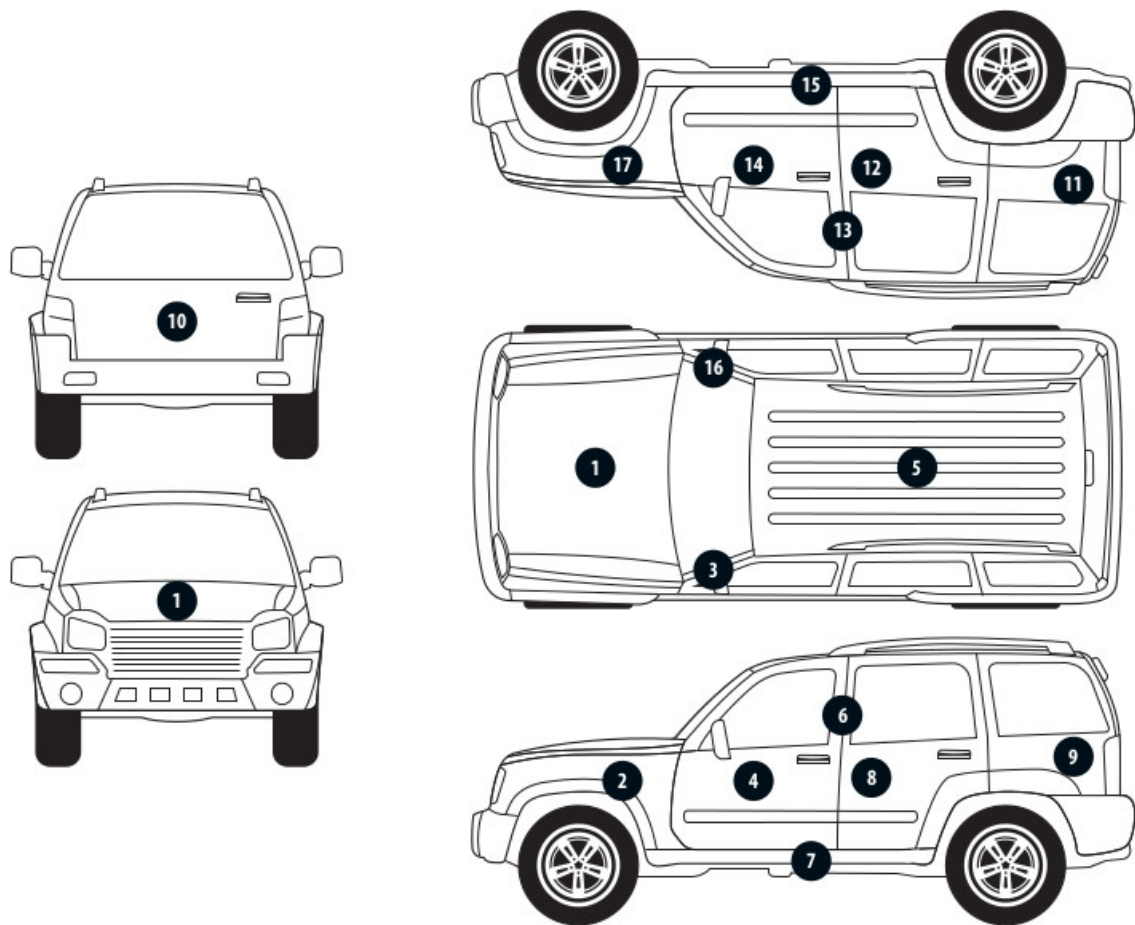Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [µm]
1	Front cover	to 150
2	Left front fender	to 150
3	Left front pillar	to 150
4	Left front wall	to 150
5	Roof	to 150
6	Left middle pillar	to 150
7	Left side sill	to 150
8	Left rear wall	to 150
9	Left side wall	to 150
10	Cover/tailgate	to 150
11	Side right wall	to 150
12	Rear right door	to 150
13	Middle right pillar	to 150
14	Front right door	to 150
15	Right side sill	to 150
16	Right front pillar	to 150
17	Right front fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book was presented and its number is given below:

.

Information concerning the origin of the vehicle

Lack of reliable data.

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below:
ograniczenia placowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

Anti-theft protection

fabryczne

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.
- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation**Kluczyki**

TAK

1

Expert comments - regarding valuation

Rysy na samochodzie. Aktywna kontrolka silnika. Odpryski na szybie czołowej.

Rzeczoznawca dokonał oględzin pojazdu w warunkach parkingowych, co mogło ograniczyć pełną ocenę jego stanu technicznego. Dodatkowo, jeżeli jazda próbna została przeprowadzona (informacje w treści raportu), to wykonano ją w warunkach parkingowych, z niewielką prędkością, co może nie odzwierciedlać pełnych warunków eksploatacyjnych. Istnieje możliwość, że w innych okolicznościach ujawnią się dodatkowe uszkodzenia lub usterki, których nie można było wykryć podczas obecnych oględzin. Zalecamy zatem skorzystanie z możliwości oględzin pojazdu we własnym zakresie lub w Autoryzowanej Stacji Obsługi danej marki, co pozwoli na pełniejszą weryfikację stanu technicznego pojazdu przed udziałem w aukcji."

Restrictive disclaimer - regarding valuation

Nie weryfikowano szczegółowo stanu układu napędowego, zawieszenia, kierowniczego, hamulcowego oraz wydechowego. Ocena została wykonana bez użycia podnośnika i specjalistycznego sprzętu diagnostycznego, nie dokonywano demontażu osłon i innych elementów. Ocena określa ogólny stan pojazdu na dzień oględzin w miejscu jego udostępnienia, nie może być zatem traktowana jako kompleksowa ocena stanu technicznego. Specyfikacja wg. programu operacyjnego w zakresie wyposażenia standardowego i dodatkowego nie gwarantuje zgodności ze stanem faktycznym w zakresie możliwym do ustalenia przez rzeczoznawcę podczas oględzin pojazdu. Pomiar grubości powłoki lakierowej wykonano w miejscach możliwych do ich wykonania pomiary nie gwarantują oryginalności poszczególnych elementów poddanych ocenie.

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.

Próg lewy (widok od przodu)



Photo 12.

Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.

Spód pojazdu przód



Photo 14.

Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika

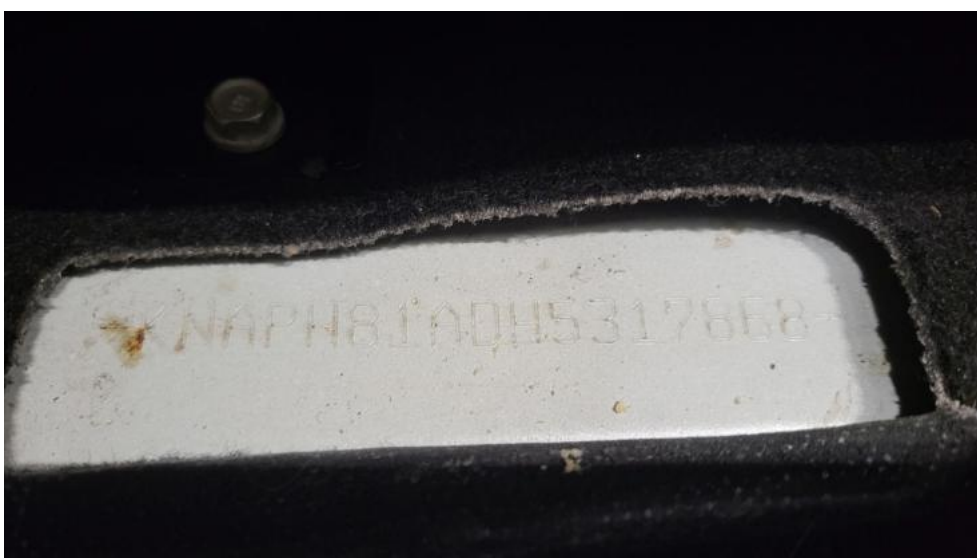


Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION**Photo 23.**

Tabliczka znamionowa

**Photo 24.**

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe



Photo 28.

Widok z tylnej kanapy na deskę rozdź.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.

Konsola środkowa



Photo 30.

Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION**Photo 31.**

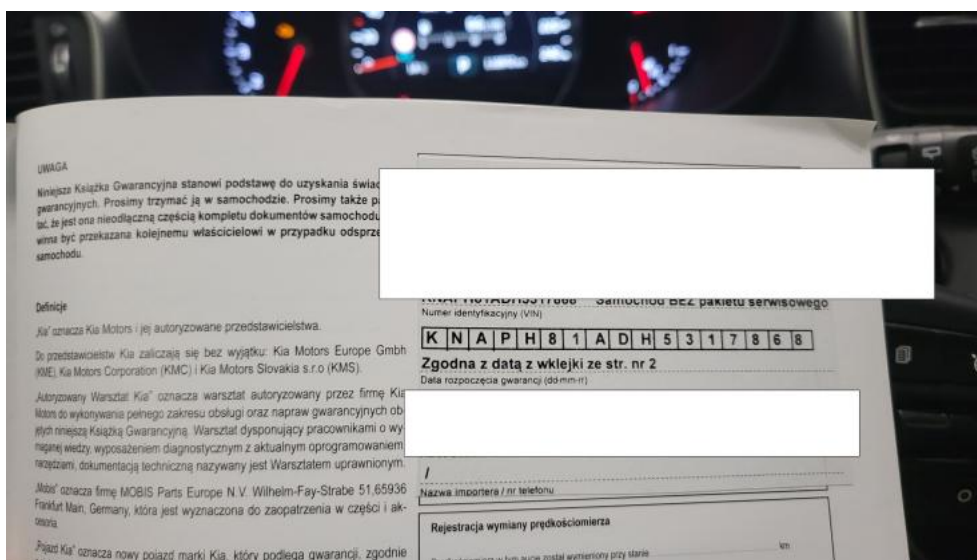
Kierownica (na wprost)

**Photo 32.**

Dowód rej. Str. 1

PHOTOGRAPHIC DOCUMENTATION**Photo 33.**

Dow. Rej. Str.2 i klucze

**Photo 34.**

Książka serwisowa – dane

PHOTOGRAPHIC DOCUMENTATION

REJESTR MECHANICZNYCH PRZEGLĄDÓW OKRESOWYCH

PRZEGLĄD I: 19-08-2018 km

Data przeglądu: 19-08-2018

Rzeczywisty przebieg pojazdu (km): 24583

Wynik badania testerem GDS: OK

Termin następnego przeglądu - data / przebieg: 19-08-2020 / 59583

Czytelne imię i nazwisko mechanika wykonującego OT: Grzegorz Zbilnicki

Czytelne imię i nazwisko osoby nadzorującej OT: Sławomir Lwowski

Wykonane czynności:

	TAK	NIE
Wymiana oleju:	☒	☐
Wymiana płynu hamulcowego:	☒	☐
Wymiana filtra paliwa:	☒	☐
Wymiana filtra powietrza:	☒	☐

Czynności dodatkowe: Filtr kabinowy

Photo 35.

Książka serwisowa – ostatni przegląd

**Photo 36.**

Instrukcje

PHOTOGRAPHIC DOCUMENTATION



Photo 37.

Zdjęcie do protokołu



Photo 38.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Zdjęcie do protokołu



Photo 40.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Zdjęcie do protokołu



Photo 42.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Zdjęcie do protokołu



Photo 44.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Listwa śr zderzaka przedniego - Inne 1



Photo 46.

Pokrywa komory silnika - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Pokrywa komory silnika - Pęknięcie/rozerwanie 1

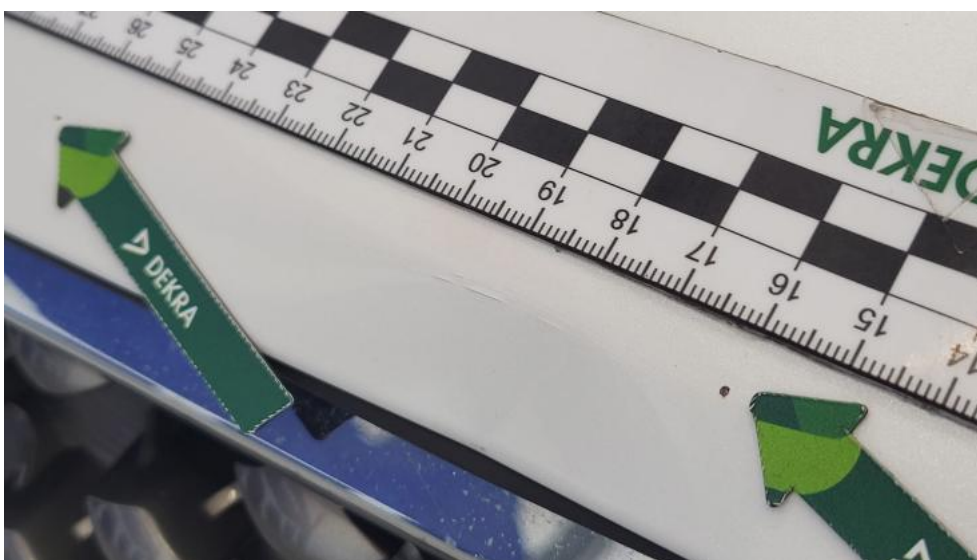


Photo 48.

Pokrywa komory silnika - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Spoiler zderzaka przedniego - Rysa/odprysk 1



Photo 50.

Zderzak przedni cz dolna - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Zderzak przedni cz dolna - Pęknięcie/rozerwanie 1



Photo 52.

Drzwi przednie P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Drzwi tylne P - Rysa/odprysk 1



Photo 54.

Drzwi tylne P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1



Photo 56.

Felga aluminiowa tylna P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Zderzak tylny - Wgniecenie/odkształcenie 1



Photo 58.

Ścianka tylna L / Ścianka boczna L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Drzwi przed L - Wgniecenie/odkształcenie 1



Photo 60.

Drzwi tylne L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Słupek przedni L - zdjęcie pogładowe 1



Photo 62.

Słupek przedni L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Fotel prz. lew. - Inne 1



Photo 64.

Fotel prz. praw. - Inne 1