

DEKRA's commission No. : PKOL(W)/LODZ/89683/25/11/19
commission/ damage No. : 20/043709
Date of commission: 19-11-2025

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (NEW)
DEKRA Polska - współpraca O/Warszawa
Tomasz Ziemniak (NEW)
DEKRA Polska - współpraca O/Konin

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0115387
Manufacturer	AUDI
Model	A4 [8W] 15-19
Type / version	A4 2.0 TDI S tronic
Body type	sedan
Number of doors / seats	4/5
Curb weight [kg]	1465
Gross vehicle weight [kg]	2065
Wheelbase 1/2	2820
Engine type	Automatic ignition
Pollution reduction system	KSC
Engine capacity [ccm]	1968
Engine Power [hp/kW]	150/110
Gearbox	automatic 7- gear
Registration /record No.	WZ095CA
VIN / serial number	WAUZZZF43GA045818
Date of first registration	21-03-2016
Date of next. tech. test	06-07-2025
Year of manufacture	2016
Readout [km]	293 067 (read)
Body color / type of coating	granatowy/METALIK

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	EUROREPAR RELIANCE, WINTER	235/45 18 98V	5,0 mm
	left	EUROREPAR RELIANCE, WINTER	235/45 18 98V	5,0 mm
back	right	EUROREPAR RELIANCE, WINTER	235/45 18 98V	6,0 mm
	left	EUROREPAR RELIANCE, WINTER	235/45 18 98V	6,0 mm

Standard equipment by Eurotax

- | | |
|---|--|
| 1. Alarm | 23. On board computer |
| 2. Antilock-Brake-System (ABS) | 24. On board monitor |
| 3. Armrest (s) front | 25. Other |
| 4. Automatic climate control | 26. Other |
| 5. Automatic dimlight activation | 27. Other |
| 6. Bluetooth interface, Bord entertainment: other accessories, Radio | 28. Other |
| 7. Brake Assist, Pre-Crash System | 29. Other |
| 8. Child seat fixation | 30. Power steering |
| 9. Colored glass | 31. Power windows front, Power windows rear |
| 10. Diminished spare wheel | 32. Rain sensor |
| 11. Door mirror(s) electrically adjustable in general, Door mirrors heated | 33. Rear seat-backs foldable in two separate parts |
| 12. Driver airbag, Head airbags front, Passenger airbag, Side airbag driver, Side airbag driver and passenger | 34. Rear-view mirror autodimming |
| 13. Driver seat height adjustable, Passenger seat height adjustable | 35. Remote controlled central locking |
| 14. ESP (Electronical Stabilizing Program) | 36. Sport suspension |
| 15. Exterior design: other | 37. Start/Stop system |
| 16. Exterior design: other | 38. Steering wheel electrically adjustable |
| 17. Floor mat | 39. Textile upholstery |
| 18. Hill holder | 40. Tyre pressure control (RDC) |
| 19. Interior decoration: other | 41. Uni-Lackierung |
| 20. LED Daytime running lights | 42. Wheel bolt locks |
| 21. Leather steering wheel, Multi functional steering wheel | 43. Xenon-light |
| 22. Light Alloy wheels 16" | |

Dealer's equipment (selected items)

- | | |
|--|---|
| 1. Bluetooth interface, Bord communication: other, DVD-player, Navigation system, USB in | - |
| 2. Bumpers: other, Exterior design: other, Light Alloy wheels 18" | - |
| Felgi aluminiowe 18 (10-ramienne) z ogumieniem 245/45 | |
| Pakiet S line exterior | |
| 3. Cruise control | - |
| 4. DAB radio | - |
| 5. Door mirrors electrically foldable | - |
| 6. Exterior design: other | - |
| 7. Heated seat driver, Heated seat passenger | - |
| 8. Interior decoration: other | - |
| 9. Leather steering wheel, Multi functional steering wheel, Sports steering wheel, Steering wheel heated | - |
| 10. Other | - |
| 11. Park Distance Control front, Park Distance Control rear | - |
| 12. Soundsystem | - |
| 13. Trizone automatic climate control | - |

Base value of the vehicle

Base value of the vehicle by Eurotax (net)

CorrectionsFirst registrationMileageEquipmentTyresOther

The validity of the technical examination -
Earlier repairs -
Korekta z tytułu uszkodzeń pojazdu -
Korekta z tytułu weryfikacji serwisowej -


Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 11-2025 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 22-11-2025

DEKRA's expert:
Kacper Sosnowski (NEW)
Tomasz Ziemniak (NEW)

Document issued electronically valid without signature.

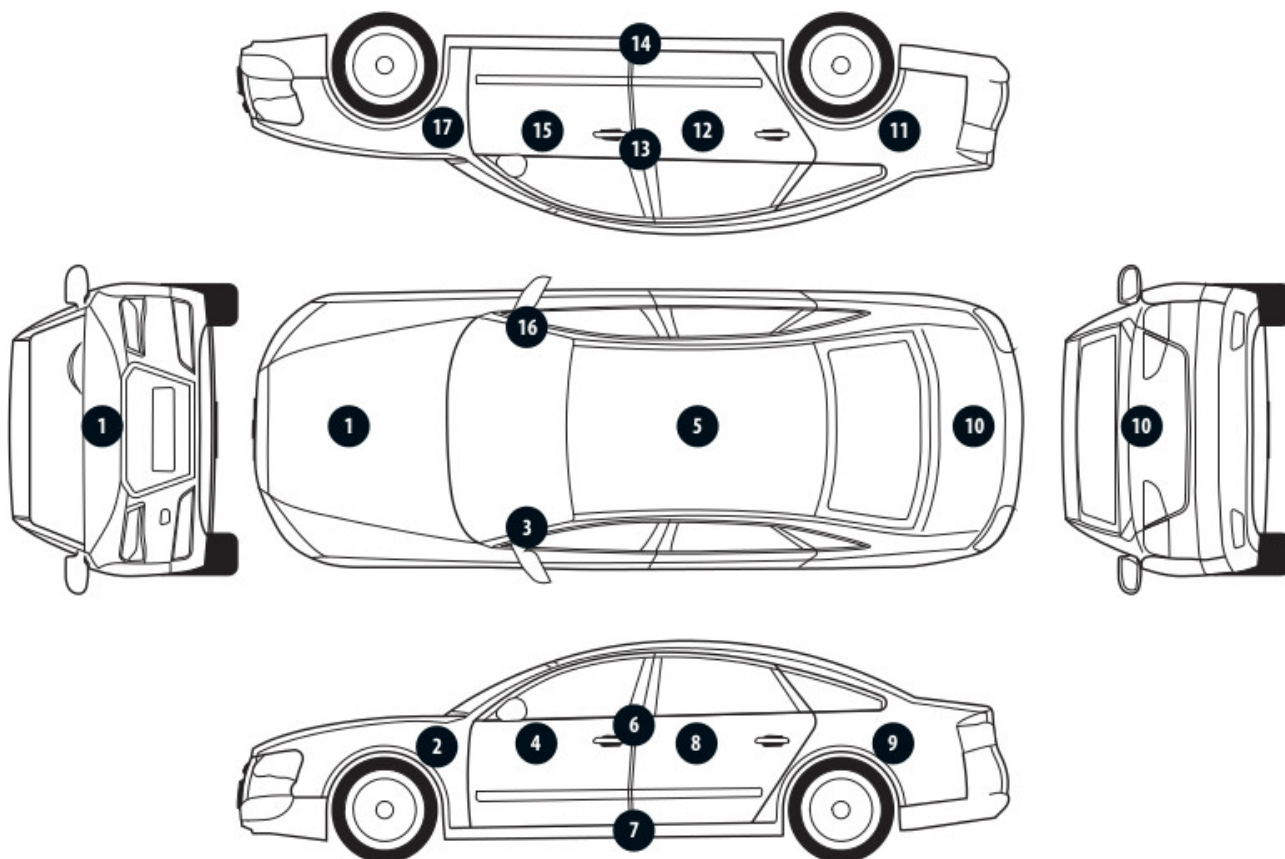Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Front left fender	to 150
3	Left front pillar	150 - 200
4	Front left door	150 - 200
5	Roof	to 150
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	150 - 300
9	Rear left fender	150 - 1000
10	Cover/lid	to 150
11	Right rear fender	150 - 2000
12	Right rear door	150 - 500
13	Right middle pillar	150 - 300
14	Right side sill	150 - 500
15	Front right door	150 - 1000
16	Right front pillar	150 - 300
17	Front right fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book was presented and its number is given below:

Elektroniczna

Information concerning the origin of the vehicle

The vehicle purchased domestically from an authorized representative of the brand.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

The test drive has been conducted on a distance and in time enabling rough estimation of the technical condition of the vehicle.

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted (with the exception of the year of production) - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.

- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

1

Expert comments - regarding valuation

Brak aktualnych badań technicznych. Rysy na samochodzie. Głośna praca drzwi przednich prawych. Aktywna kontrolka silnika. Wymiana oleju przekroczone od 49000km. Przegląd przekroczone od 64200km. Odpryski na szybie czołowej. Widoczne wady lakiernicze. niesprawne składanie elektryczne lewego lusterka.

Restrictive disclaimer - regarding valuation

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.

Przekątna przednia lewa



Photo 2.

Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.

Bok prawy z tyłu



Photo 6.

Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.

Próg lewy (widok od przodu)



Photo 12.

Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika



Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION

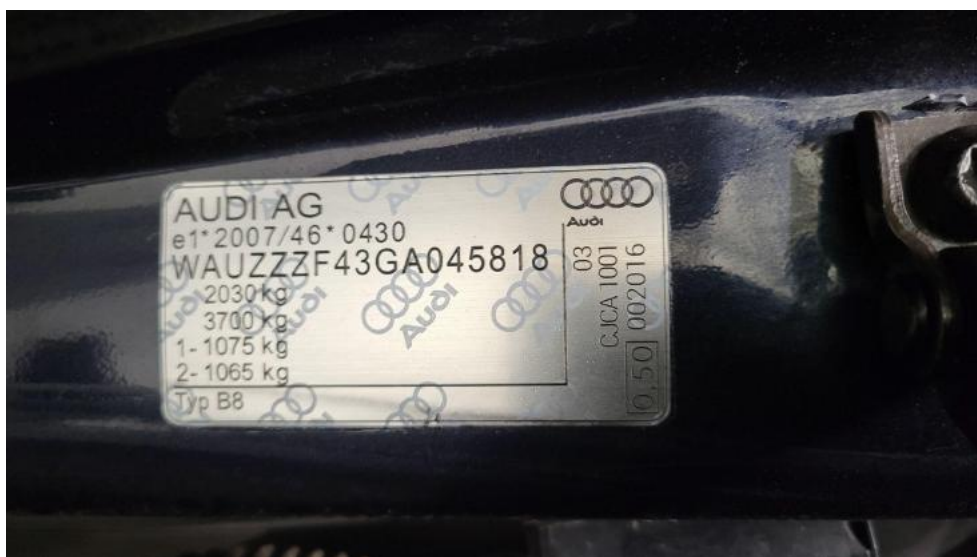


Photo 23.
Tabliczka znamionowa



Photo 24.
Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe



Photo 28.

Widok z tylnej kanapy na deskę rozdź.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.

Konsola środkowa

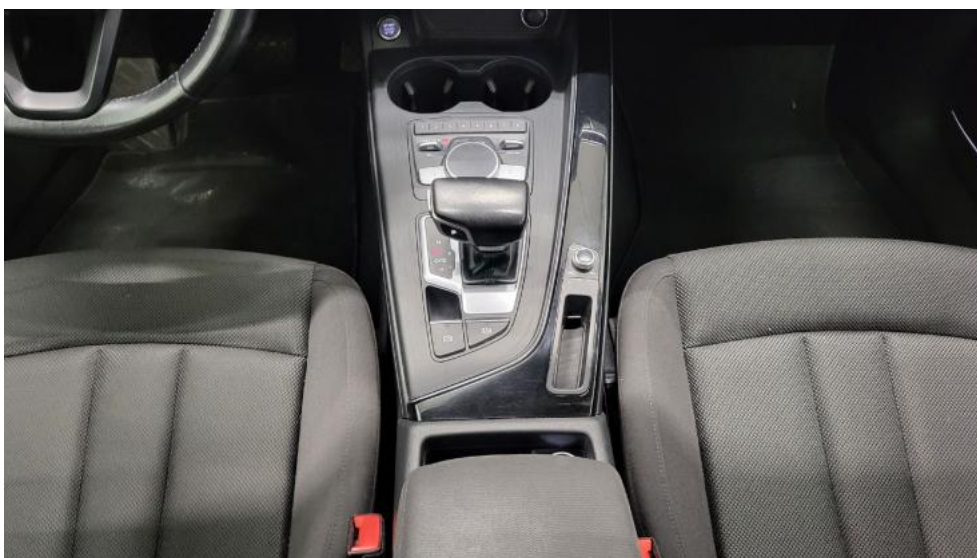


Photo 30.

Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION



Photo 31.
Kierownica (na wprost)



Photo 32.
Dowód rej. Str. 1

PHOTOGRAPHIC DOCUMENTATION



Photo 33.

Dow. Rej. Str.2 i klucze

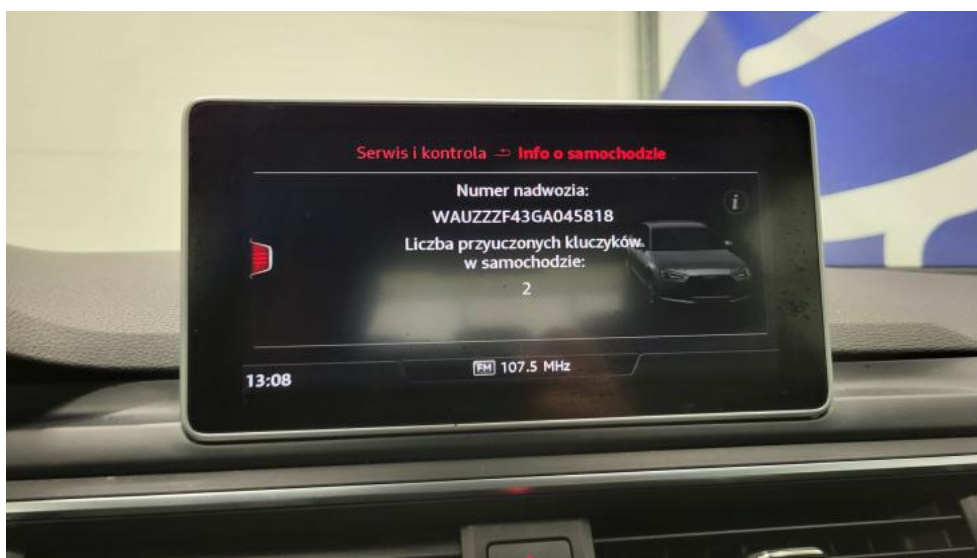


Photo 34.

Książka serwisowa – dane

PHOTOGRAPHIC DOCUMENTATION

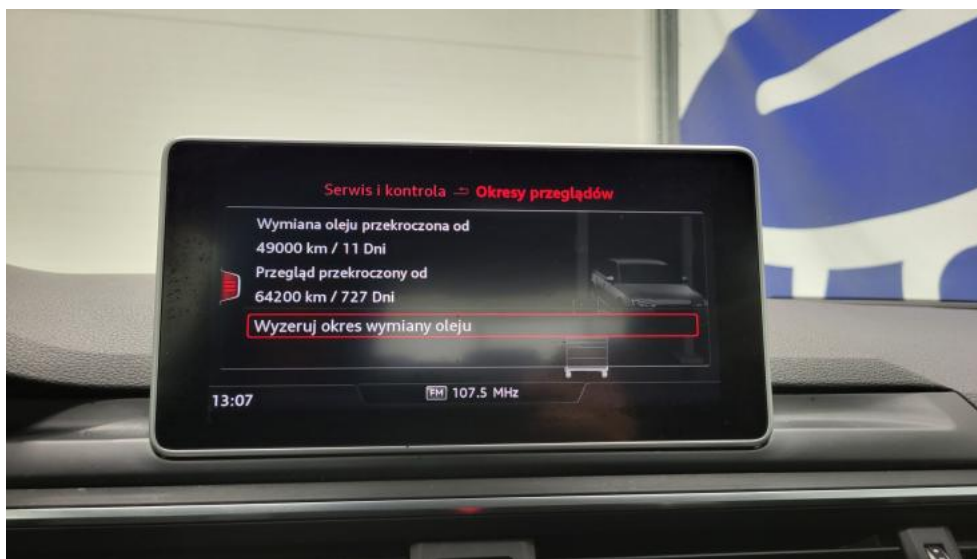


Photo 35.

Książka serwisowa – ostatni przegląd



Photo 36.

Pokrywa komory silnika - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 37.

Pokrywa komory silnika - Wgniecenie/odkształcenie 1

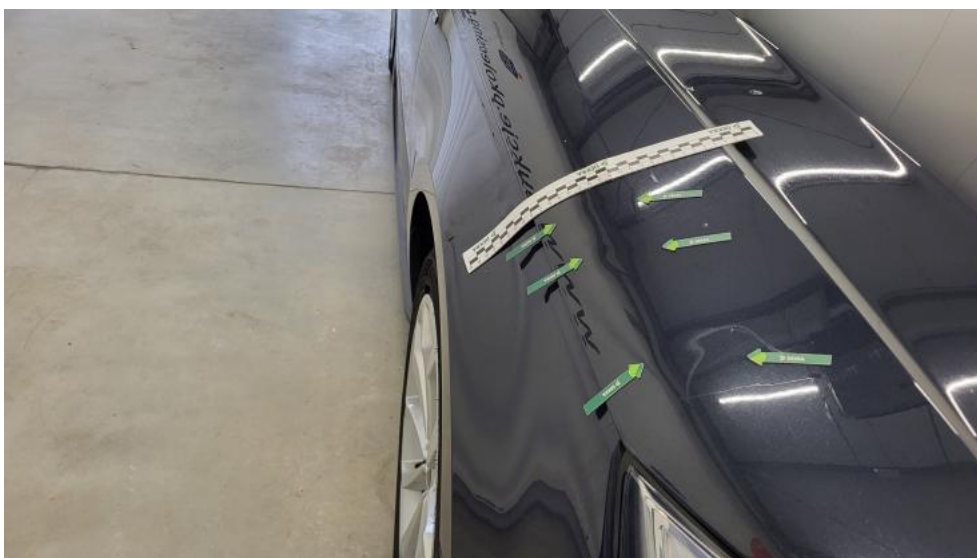


Photo 38.

Pokrywa komory silnika - Wgniecenie/odkształcenie 2

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Pokrywa komory silnika - Inne 1



Photo 40.

Zderzak - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Zderzak - Wgniecenie/odkształcenie 1



Photo 42.

Zderzak - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Błotnik przedni P - Rysa/odprysk 1



Photo 44.

Felga aluminiowa przednia P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Opona przednia P - Pęknięcie/rozerwanie 1



Photo 46.

Drzwi przednie P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Drzwi przednie P - Wgniecenie/odkształcenie 1



Photo 48.

Drzwi tylne P - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Drzwi tylne P - Wgniecenie/odkształcenie 1



Photo 50.

Drzwi tylne P - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Lusterko zew P - Rysa/odprysk 1



Photo 52.

Próg P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Słupek przedni P - Rysa/odprysk 1

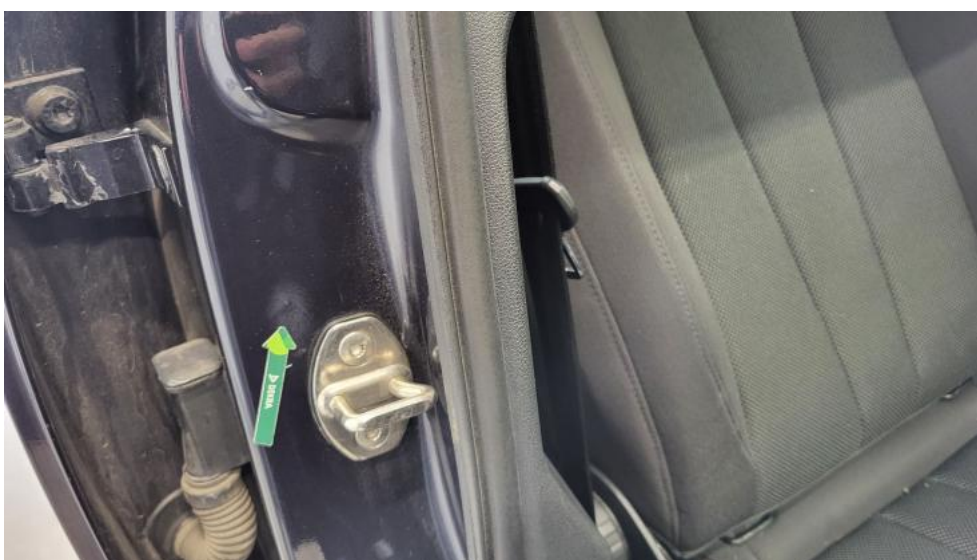


Photo 54.

Słupek środkowy P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Ścianka tylna P / Ścianka boczna P - zdjęcie poglądowe 1



Photo 56.

Ścianka tylna P / Ścianka boczna P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION

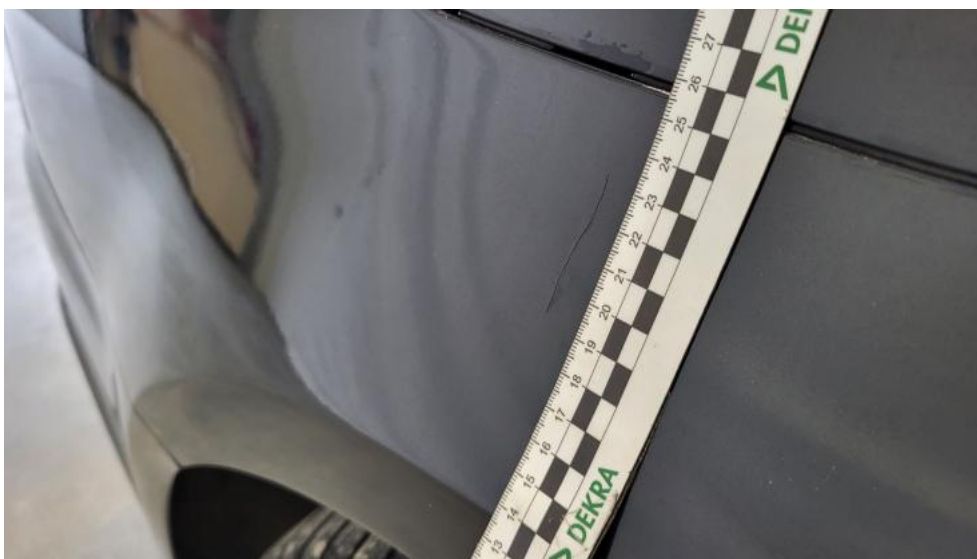


Photo 57.

Łotnik tylny P / Ściana boczna P - Pęknięcie/rozerwanie 1



Photo 58.

Łotnik tylny P / Ściana boczna P - Pęknięcie/rozerwanie 2

PHOTOGRAPHIC DOCUMENTATION

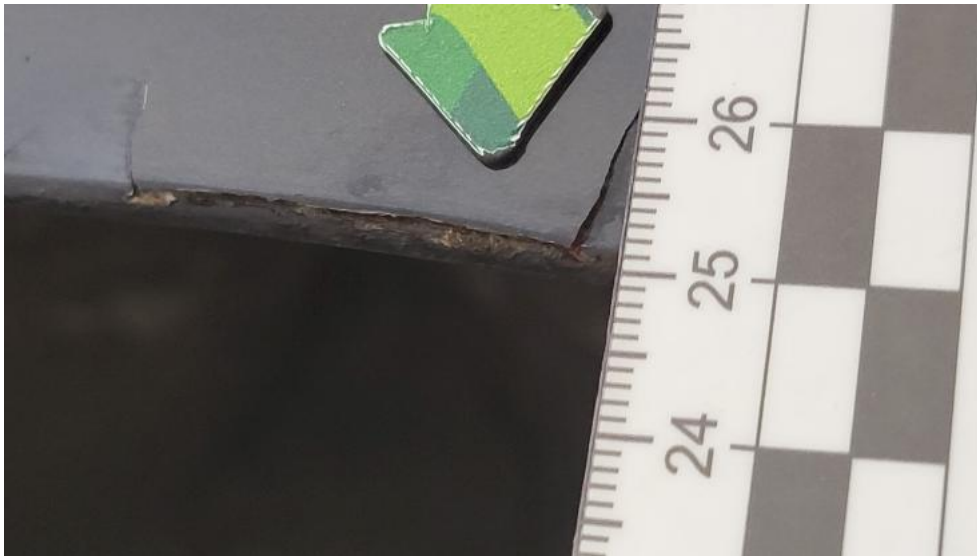


Photo 59.

Błotnik tylny P / Ściana boczna P - Inne 1



Photo 60.

Felga aluminiowa tylna P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Listwa śr zderzaka tylnego - Pęknięcie/rozerwanie 1



Photo 62.

Listwa śr zderzaka tylnego - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Pokrywy bagażnika - Wgniecenie/odkształcenie 1



Photo 64.

Zderzak tylny - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Zderzak tylny - Wgniecenie/odkształcenie 2



Photo 66.

Zderzak tylny() - Wgniecenie/odkształcenie 3

PHOTOGRAPHIC DOCUMENTATION



Photo 67.

Zderzak tylny - Pęknięcie/rozerwanie 1



Photo 68.

Dach - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Dach - Wgniecenie/odkształcenie 1

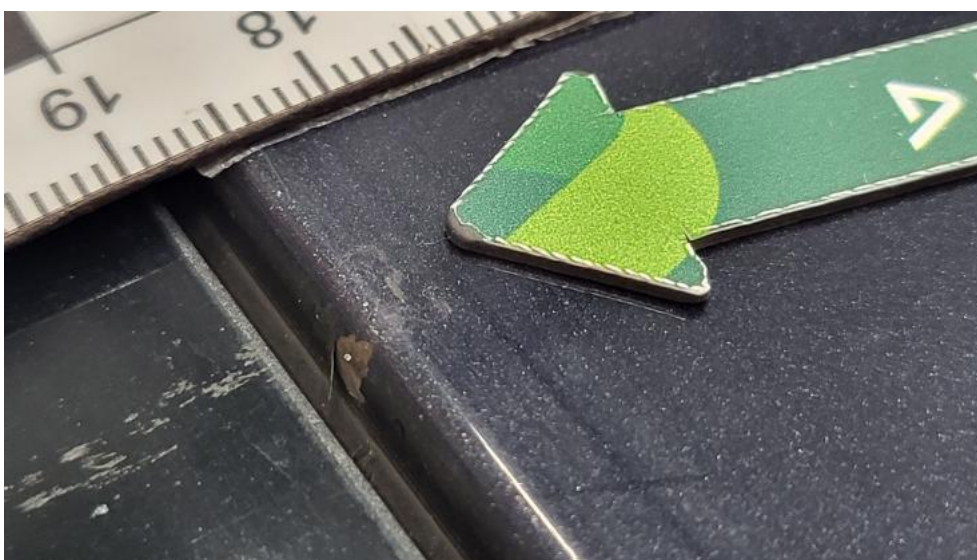


Photo 70.

Dach - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Błotnik tylny L / Ściana boczna L - zdjęcie poglądowe 1



Photo 72.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 73.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 2



Photo 74.

Błotnik tylny L / Ściana boczna L() - Wgniecenie/odkształcenie 3

PHOTOGRAPHIC DOCUMENTATION



Photo 75.

Błotnik tylny L / Ściana boczna L - Inne 1



Photo 76.

Felga aluminiowa tylna L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 77.

Drzwi przed L - Rysa/odprysk 1



Photo 78.

Drzwi przed L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 79.

Drzwi tylne L - Rysa/odprysk 1

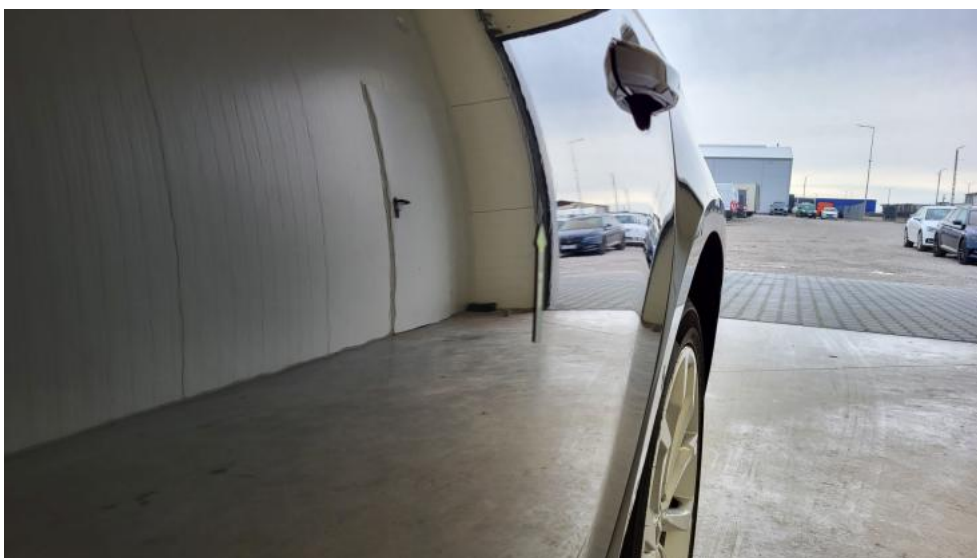


Photo 80.

Drzwi tylne L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 81.

Próg L - Wgniecenie/odkształcenie 1



Photo 82.

Słupiek przedni L - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 83.

Słupek przedni L - Wgniecenie/odkształcenie 1



Photo 84.

Słupek przedni L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 85.

Błotnik przedni L - Wgniecenie/odkształcenie 1



Photo 86.

Felga Aluminiowa przednia L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 87.

Opona przednia L - Pęknięcie/rozerwanie 1



Photo 88.

Podłokietnik środkowy przedni - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 89.

Fotel prz. lew. - zdjęcie poglądowe 1

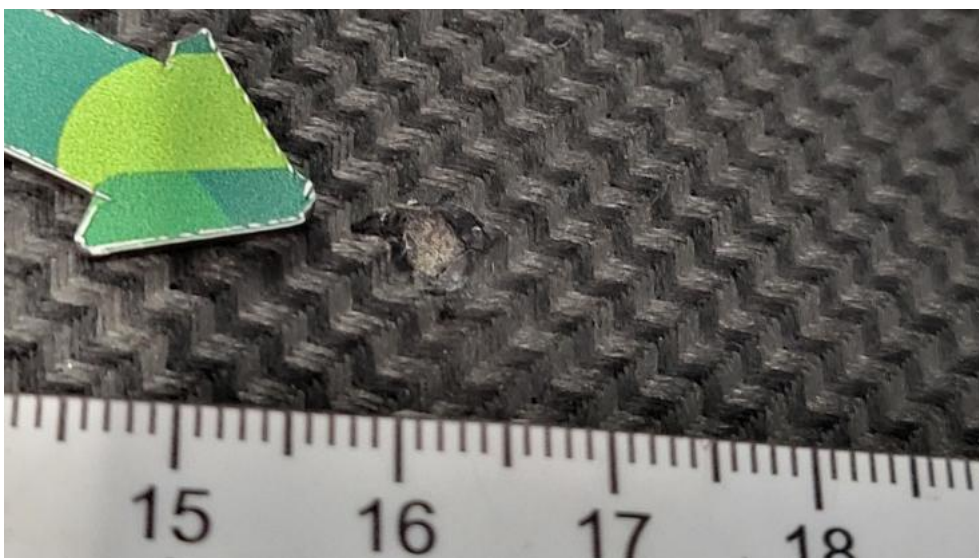


Photo 90.

Fotel prz. lew. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 91.

Oslony fotela prz. P - Inne 1



Photo 92.

Tapicerka drzwi tylnych P - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 93.

Podsufitka - Inne 1



Photo 94.

Wykładzina(y) słupka przedniego L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 95.

Wykładzina podłogi - Inne 1