

DEKRA's commission No. : PKOL(W)/LODZ/95545/26/10/12
commission/ damage No. : 21/044246
Date of commission: 12-10-2026

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (WSP)
DEKRA Polska - współpraca O/Warszawa
Marcin Godzwon (WSP)
DEKRA Polska - współpraca O/Katowice

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	jeeps
EC code (Eurotax)	0139174
Manufacturer	BMW
Model	X7 [G07] 18-22
Type / version	X7 M50i sport-aut
Body type	KOM
Number of doors / seats	5/7
Curb weight [kg]	2490
Gross vehicle weight [kg]	3295
Wheelbase 1/2	3105
Engine type	spark ignition
Pollution reduction system	GPF
Engine capacity [ccm]	4395
Engine Power [hp/kW]	530/390
Gearbox	automatic 8- gear
Registration /record No.	LU343MM
VIN / serial number	WBACX610509J02929
Date of first registration	28-09-2021
Date of next. tech. test	28-09-2026
Year of manufacture	2021 (year has been verified with the manufacturer's base)
Readout [km]	135 065 (read)
Body color / type of coating	grafitowy/METALIK

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	PIRELLI, SCORPION WINTER	285/35 22 106V	3,0 mm
	left	PIRELLI, SCORPION WINTER	285/35 22 106V	3,5 mm
back	right	PIRELLI, SCORPION WINTER	315/30 22 107V	3,0 mm
	left	PIRELLI, SCORPION WINTER	315/30 22 107V	3,0 mm

Standard equipment by Eurotax

- | | |
|---|---|
| 1. 2 single seats rear, 3 single seats middle, Electrically adjustable rear seats | 47. Exterior design: other |
| 2. 4 or more zone automatic climate control, Air condition rear | 48. Exterior lighting: other |
| 3. Accoustic windows | 49. Extra power outlet |
| 4. Active Blind spot system, Blind spot warning | 50. Floor mat |
| 5. Active body control | 51. Follow me home |
| 6. Active speed sign recognition | 52. Gesture control for multimedia, Gesture control for vehicle functions |
| 7. Adaptive light, LED front dim light | 53. Glass tilt/slide sunroof electric |
| 8. Aerodynamics package, Exterior design: other | 54. Head-Up Display |
| 9. Alarm | 55. Headlamp wash nozzle heated |
| 10. Android Auto, Apple CarPlay | 56. Heated seat driver, Heated seat passenger |
| 11. Antilock-Brake-System (ABS) | 57. Hill descent control |
| 12. Armrest (s) front, Armrest (s) rear | 58. Interior lights: other accessories |
| 13. Automated High-beam assist | 59. Interior: other |
| 14. Automatic Emergency Call | 60. Interior: other |
| 15. Automatic Emergency Call | 61. Keyless entry, Keyless go |
| 16. Automatic dimlight activation, Rain sensor | 62. LED Fog Lamps |
| 17. Bluetooth interface, Bord entertainment: other accessories, Mobile phone | 63. LED rear lights |
| 18. Bluetooth interface, Bord entertainment: other accessories, Navigation system, On board monitor, Touchscreen monitor | 64. Lane control assistant |
| 19. Bluetooth interface, Mobile phone preparation, USB in | 65. Leather finish dashbord |
| 20. Bluetooth interface, Mobile phone, Wireless device charging | 66. Leather steering wheel, Sports steering wheel |
| 21. Bord entertainment: other accessories | 67. Leather upholstery |
| 22. Bord entertainment: other accessories | 68. Limited slip differential: other |
| 23. Bord entertainment: other accessories, Soundsystem | 69. Luggage:other |
| 24. Cargo net | 70. Mirror: others |
| 25. Central locking | 71. Multi functional steering wheel, Steering wheel with radio operation |
| 26. Child seat fixation | 72. Other |
| 27. Collision Warning System | 73. Other |
| 28. Collision Warning System, Pedestrian Emergency Brake Assist | 74. Other |
| 29. Comfort driver seat, Comfort passenger seat | 75. Other |
| 30. Cruise control, Distance control | 76. Other |
| 31. DAB radio | 77. Other |
| 32. Digital key | 78. Other |
| 33. Door mirrors electrically foldable, Door mirrors heated | 79. Other |
| 34. Door: other | 80. Other |
| 35. Driver airbag, Head airbags front, Head airbags rear, Passenger airbag, Side airbag driver and passenger, Side airbags rear | 81. Park Assistant, Park Distance Control front, Park Distance Control rear, Rear view camera |
| 36. Driver-information-system | 82. Rear Cross Traffic Alert |
| 37. ESP (Electronical Stabilizing Program), Traction control | 83. Rear seat-backs foldable in two separate parts |
| 38. Electric parking brake | 84. Roof railing |
| 39. Electric tailgate | 85. Selectable driveline characteristics |
| 40. Exterior design: other | 86. Servotronic |
| 41. Exterior design: other | 87. Sport seats front |
| 42. Exterior design: other | 88. Steering wheel electrically adjustable |
| 43. Exterior design: other | 89. Steering: other |

- | | |
|----------------------------|----------------------|
| 44. Exterior design: other | 90. USB in |
| 45. Exterior design: other | 91. Wheel bolt locks |
| 46. Exterior design: other | 92. Wood finish |

Dealer's equipment (selected items)

- | | |
|--|---|
| 1. Armrest (s) front, Bord climate: other, Steering wheel heated | - |
| Podłokietniki przednie ogrzewane | |
| Kierownica ogrzewana | |
| 2. Comfort driver seat, Comfort passenger seat, Driver seat electrically adjustable, Memory seat, Passenger seat electrically adjustable | - |
| 3. Front seat with massage | - |
| 4. Glass tilt/slide sunroof electric | - |
| 5. Heated seat driver, Heated seat passenger, Rear seat heating | - |
| 6. Interior decoration: other | - |
| 7. Interior: other | - |
| 8. Leather finish dashbord | - |
| 9. Leather upholstery | - |
| 10. Light alloy wheels 22", Runflat tyres | - |
| 11. Metallic paint | - |
| 12. Other | - |
| 13. Other | - |
| 14. Other | - |
| 15. Sunblind rear side door manual | - |
| 16. Tinted rear windows | - |
| 17. Towbar removable | - |
| 18. Ventilated front seat | - |

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

Corrections

First registration

Mileage

Equipment

Tyres

Other

- | | |
|----------------------------------|---|
| wymagany serwis układu elektryki | - |
| wymagany serwis kluczyka | - |

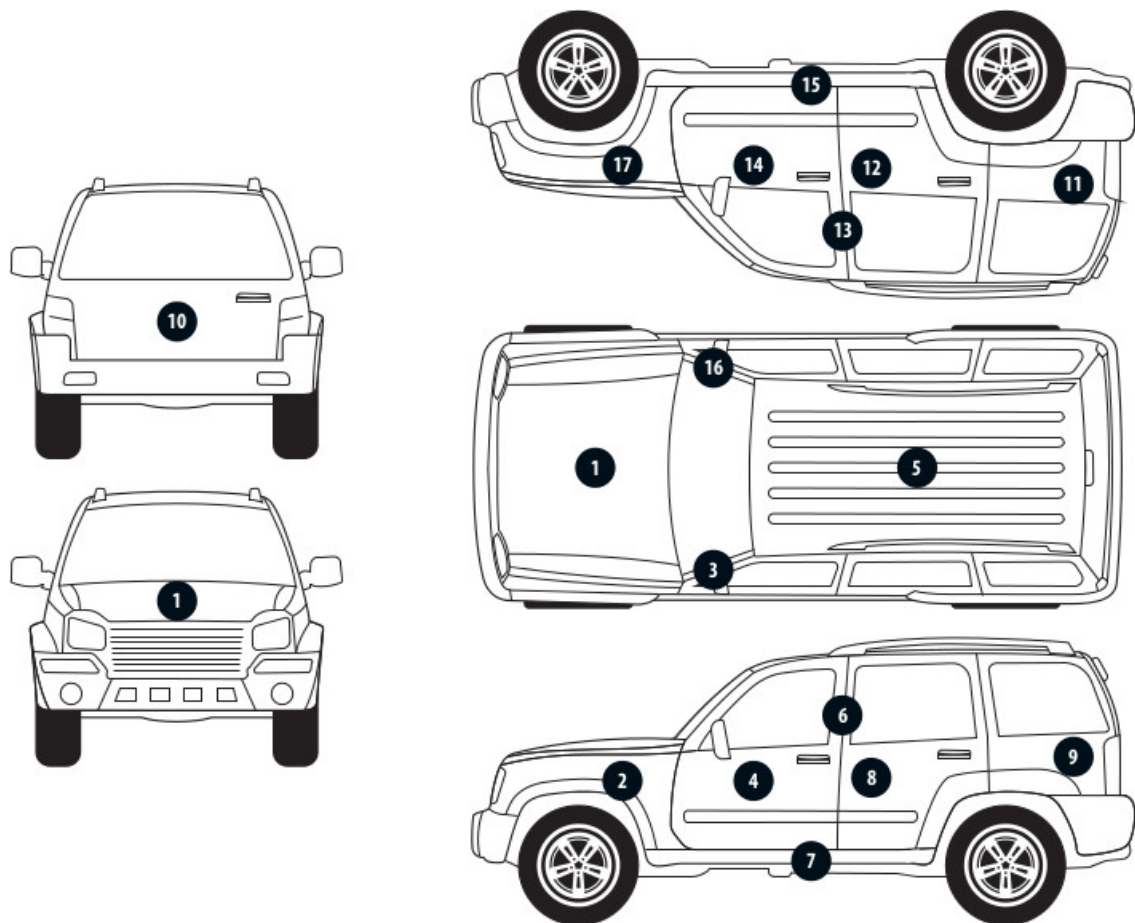
Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 10-2026 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 16-10-2026

DEKRA's expert:
Kacper Sosnowski (WSP)
Marcin Godzwon (WSP)

Document issued electronically valid without signature.

Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Left front fender	to 150
3	Left front pillar	to 150
4	Left front wall	to 150
5	Roof	to 150
6	Left middle pillar	to 150
7	Left side sill	to 150
8	Left rear wall	to 150
9	Left side wall	to 150
10	Cover/tailgate	to 150
11	Side right wall	150 - 200
12	Rear right door	to 150
13	Middle right pillar	to 150
14	Front right door	to 150
15	Right side sill	150 - 500
16	Right front pillar	to 150
17	Right front fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

Information concerning the origin of the vehicle

The vehicle purchased domestically from an authorized representative of the brand.

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below: warunki parkingowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Conducted

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

Anti-theft protection

immobilizer

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.
- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation**Kluczyki**

TAK

2

Expert comments - regarding valuation

Rysy na samochodzie. Brak aktualnych badań technicznych. Brak półki bagażnika. niesprawne otwieranie pokrywy bagażnika za pomocą uchwytu na pokrywie bagażnika. Informacja należy wymienić okładziny hamulcowe. Aktywna kontrolka ciśnienia w kołach. Minął termin wymiany okładzin hamulcowych tylnych od 40km. Widoczne wady lakiernicze. niesprawne elektryczne domykanie drzwi przednich lewych. niesprawne przyciski funkcyjne w jednym z kluczyków, grot prawidłowy.

Restrictive disclaimer - regarding valuation

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu

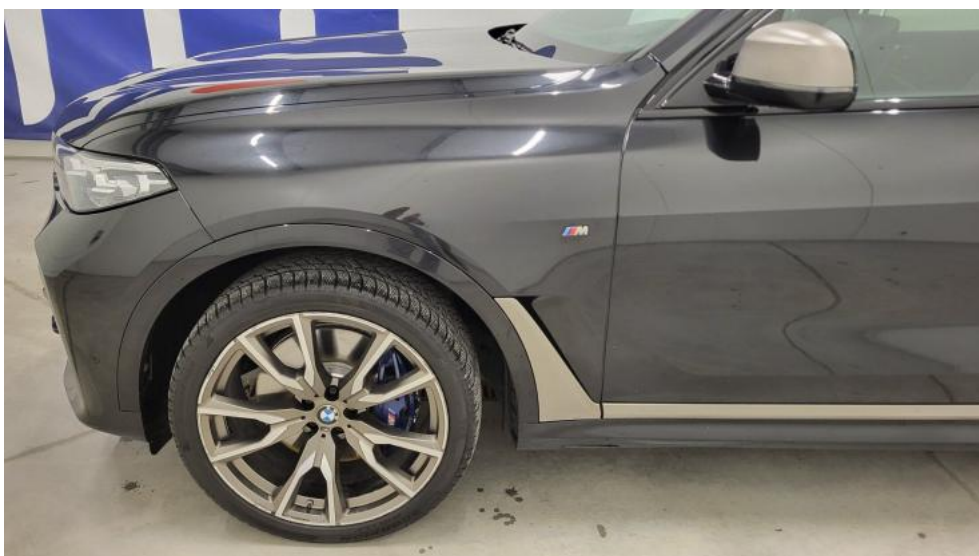


Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.

Próg lewy (widok od przodu)

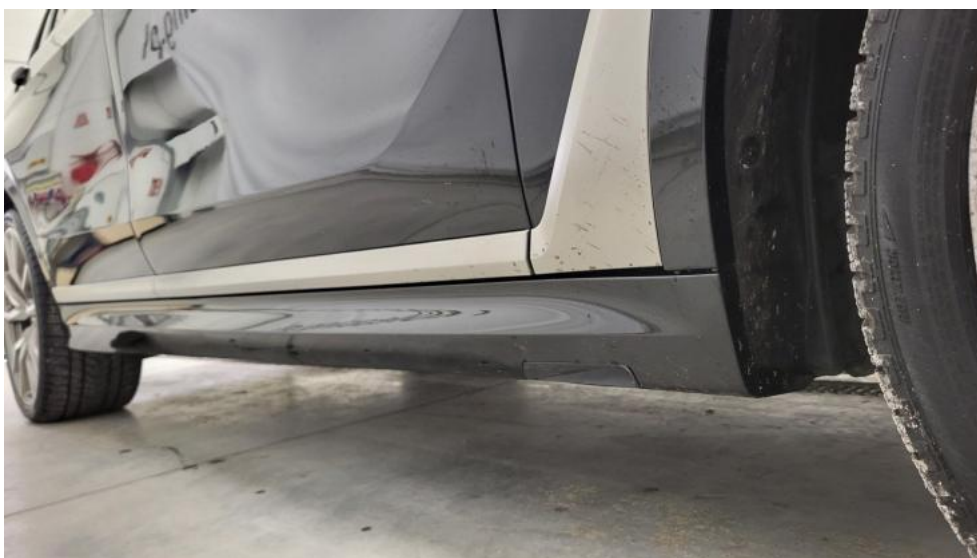


Photo 12.

Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION

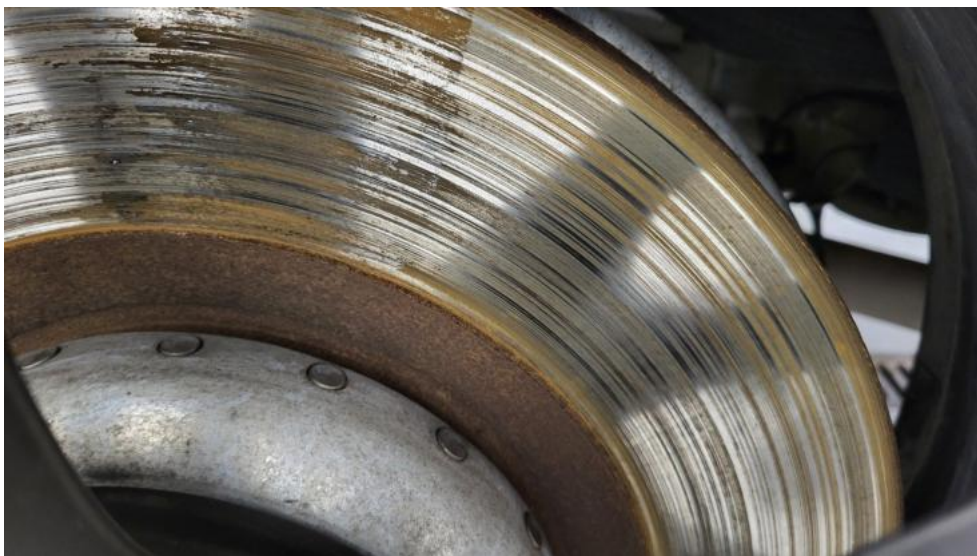


Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Komora silnika

PHOTOGRAPHIC DOCUMENTATION



Photo 21.

Numer identyfikacyjny



Photo 22.

Tabliczka znamionowa

PHOTOGRAPHIC DOCUMENTATION



Photo 23.

Zestaw wskaźników - przebieg



Photo 24.

Zestaw wskaźników - serwis

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe



Photo 28.

Widok z tylnej kanapy na deskę rozdz.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.
Konsola środkowa



Photo 30.
Tunel środkowy

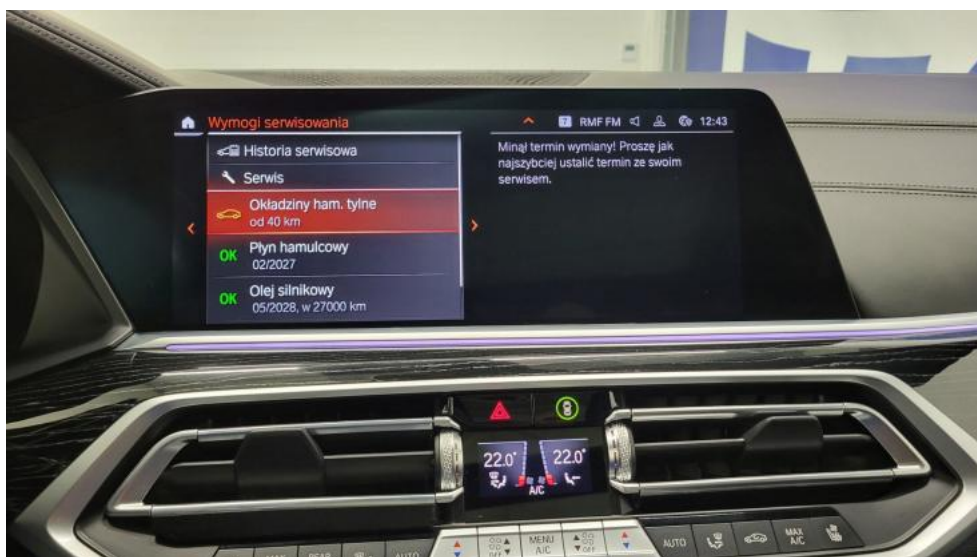
PHOTOGRAPHIC DOCUMENTATION



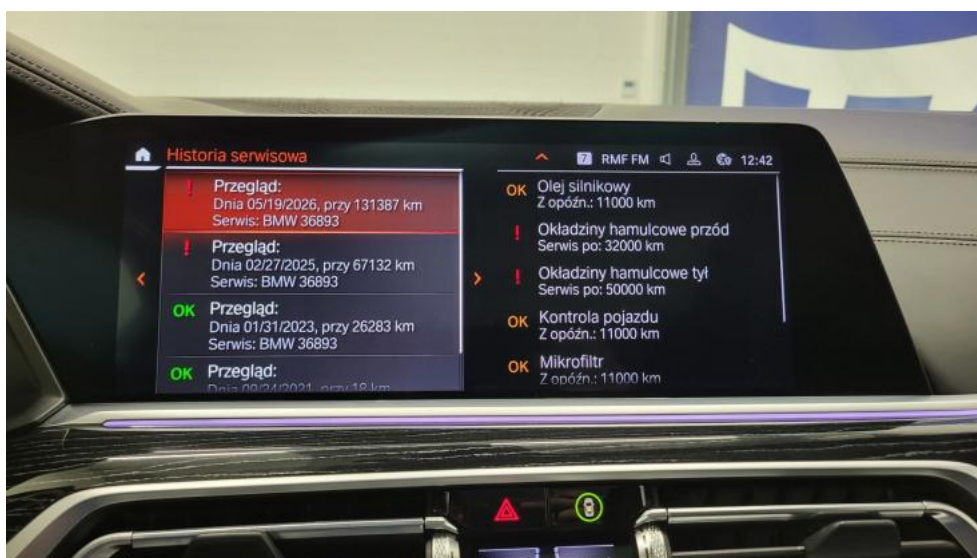
Photo 31.
Kierownica (na wprost)



Photo 32.
Dowód rej. Str. 1

PHOTOGRAPHIC DOCUMENTATION**Photo 33.**

Książka serwisowa – dane

**Photo 34.**

Książka serwisowa – ostatni przegląd

PHOTOGRAPHIC DOCUMENTATION**Photo 35.**

Dow. Rej. Str. 2

**Photo 36.**

Kluczyki

PHOTOGRAPHIC DOCUMENTATION



Photo 37.

Zdjęcie do protokołu



Photo 38.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Zdjęcie do protokołu

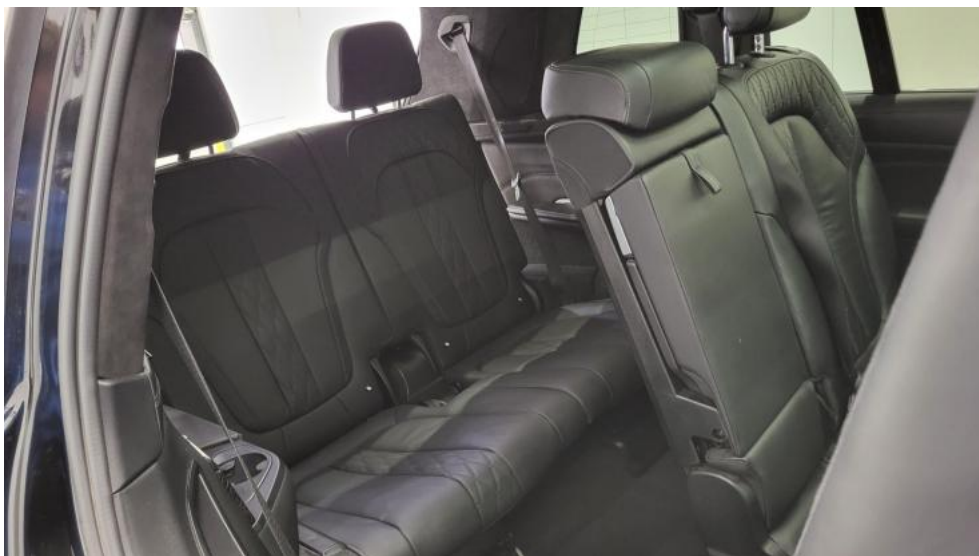


Photo 40.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 41.
Zdjęcie do protokołu

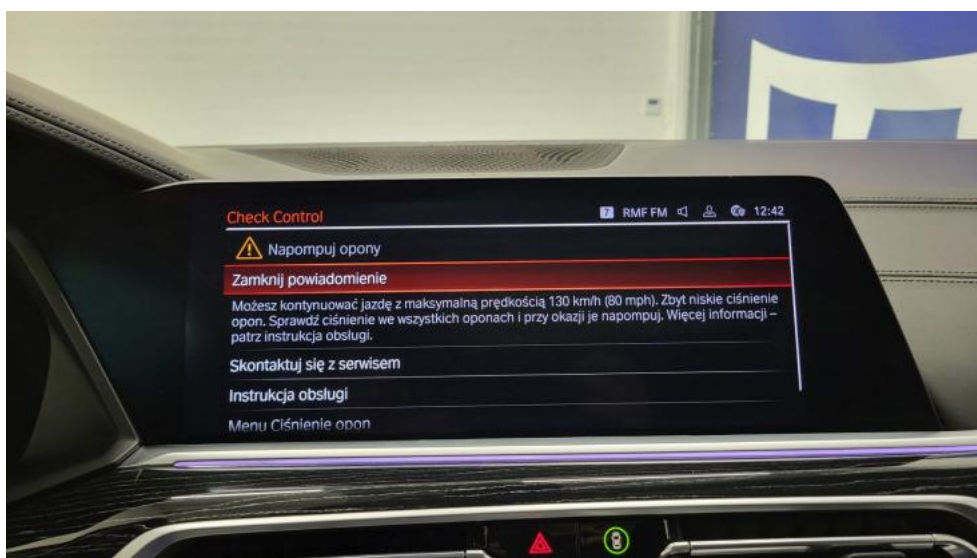


Photo 42.
Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION

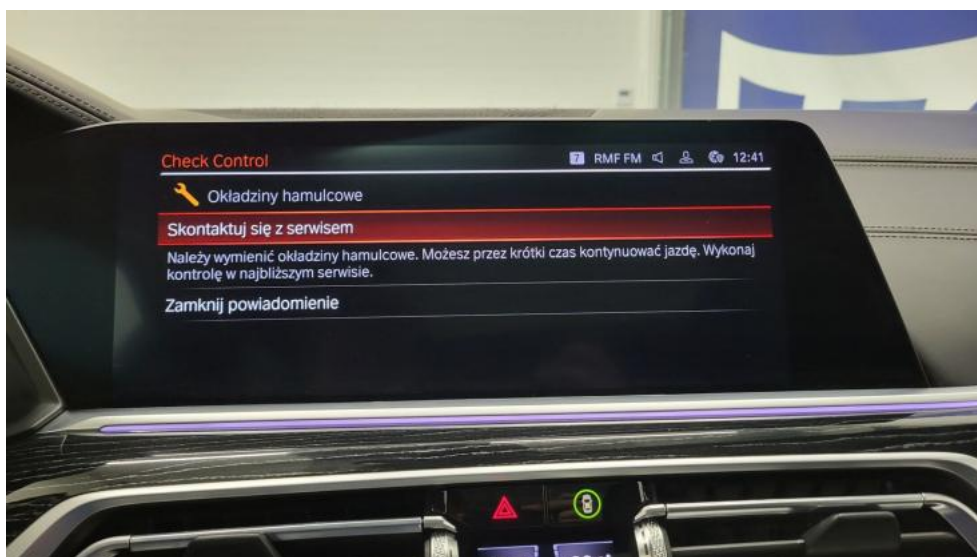


Photo 43.

Zdjęcie do protokołu



Photo 44.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Zdjęcie do protokołu



Photo 46.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Zdjęcie do protokołu

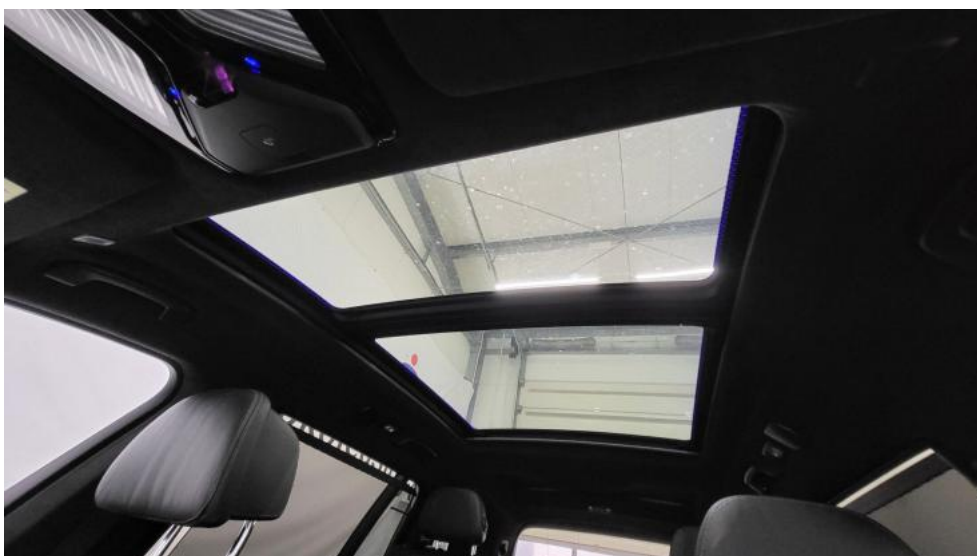


Photo 48.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION

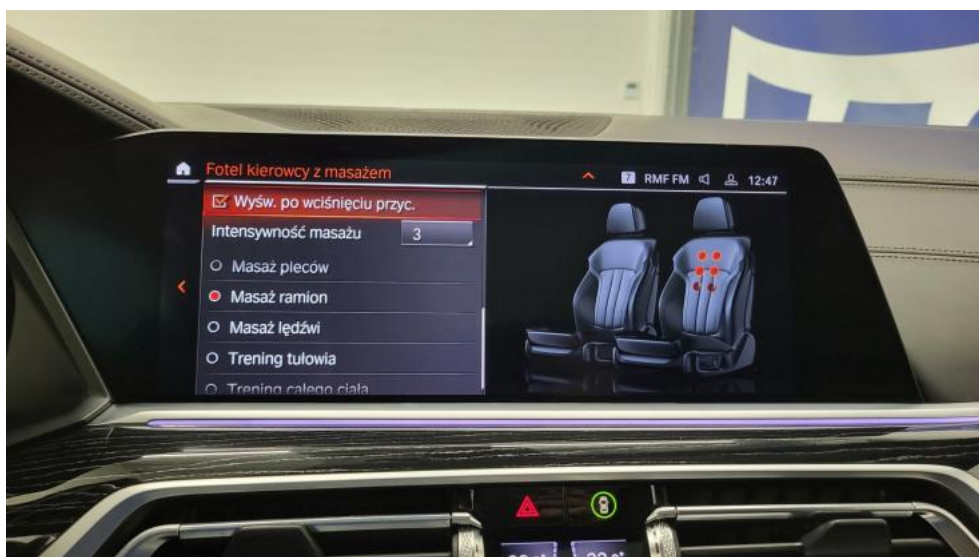


Photo 49.

Zdjęcie do protokołu



Photo 50.

Pokrywa komory silnika - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Pokrywa komory silnika - Rysa/odprysk 2



Photo 52.

Pokrywa komory silnika - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Szyba czołowa - zdjęcie poglądowe 1

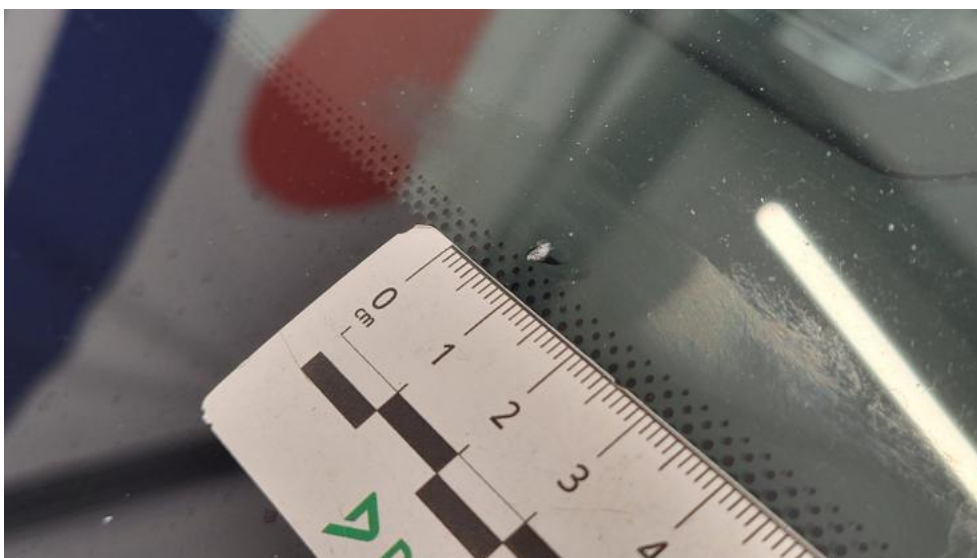


Photo 54.

Szyba czołowa - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Felga aluminiowa przednia P - Rysa/odprysk 1



Photo 56.

Opona przednia P - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Drzwi przednie P - Rysa/odprysk 1



Photo 58.

Drzwi tylne P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION

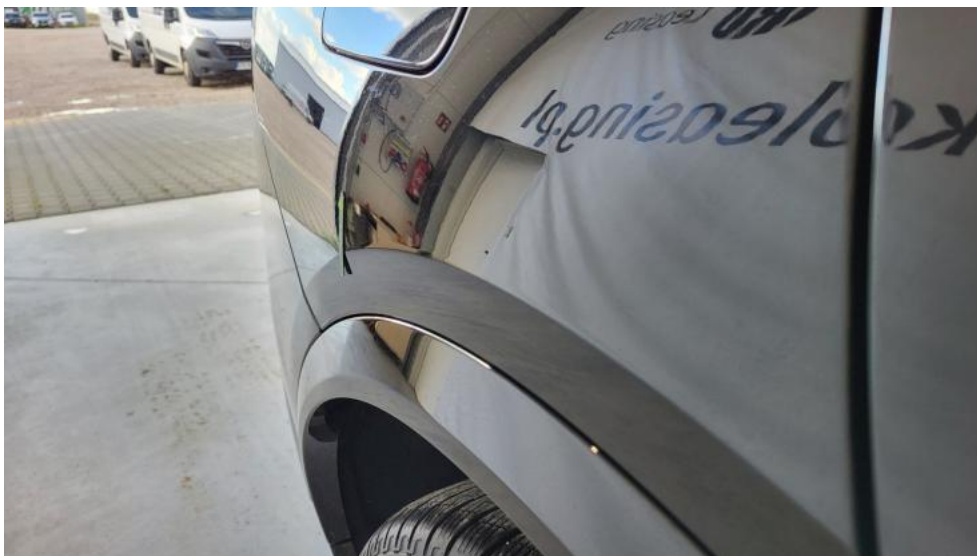


Photo 59.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1



Photo 60.

Felga aluminiowa tylna P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION

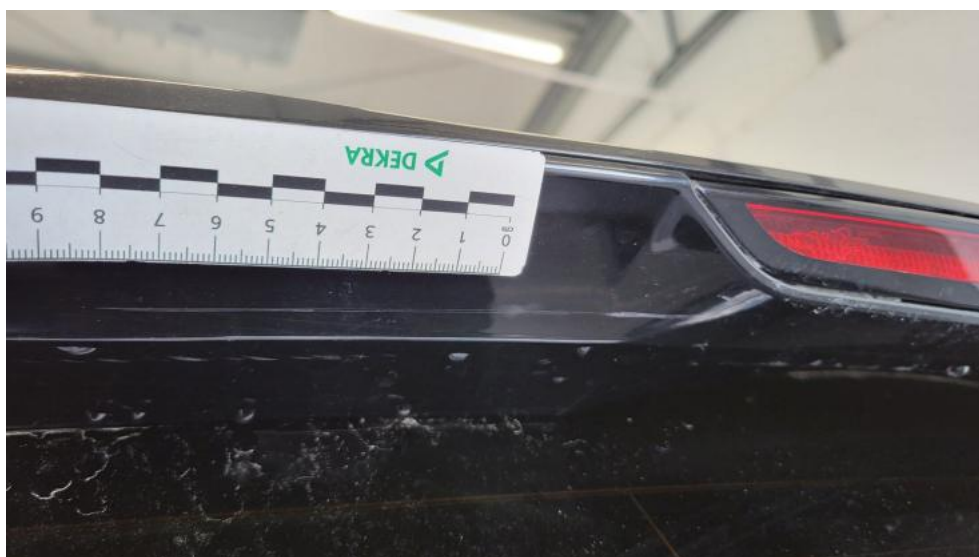


Photo 61.

Pokrywy bagażnika - Rysa/odprysk 1



Photo 62.

Pokrywy bagażnika - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Pokrywy bagażnika - Wgniecenie/odkształcenie 1



Photo 64.

Pokrywy bagażnika - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Szyba tylna - Rysa/odprysk 1



Photo 66.

Zderzak tylny - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 67.

Zderzak tylny - Rysa/odprysk 2



Photo 68.

Zderzak tylny() - Rysa/odprysk 3

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Zderzak tylny cz dolna - Rysa/odprysk 1



Photo 70.

Dach - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Dach - Rysa/odprysk 2



Photo 72.

Błotnik tylny L / Ściana boczna L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 73.

Błotnik tylny L / Ściana boczna L - Rysa/odprysk 2



Photo 74.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION

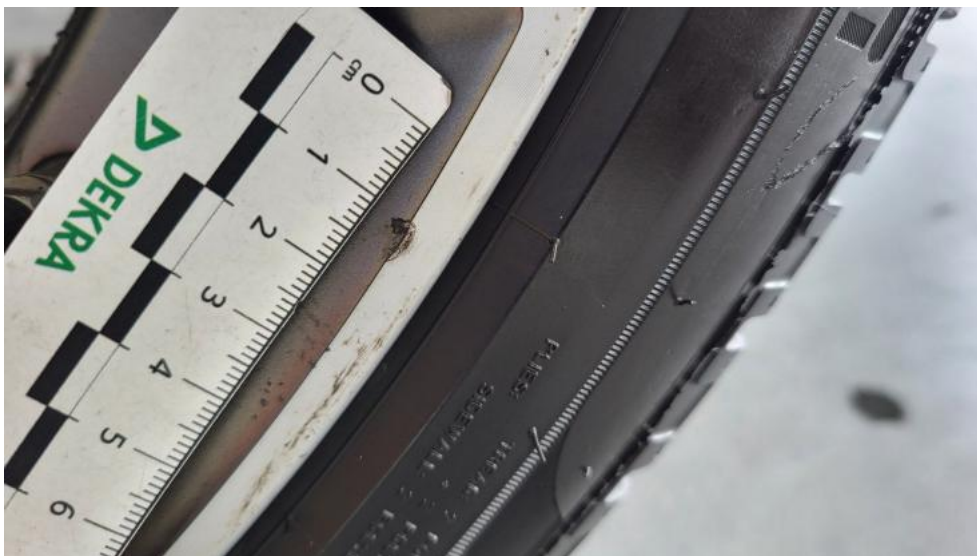


Photo 75.

Felga aluminiowa tylna L - Rysa/odprysk 1



Photo 76.

Listwa krawędzi błotnika tyl L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 77.

Drzwi przed L - Rysa/odprysk 1



Photo 78.

Drzwi przed L - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 79.

Drzwi tylne L - Rysa/odprysk 1



Photo 80.

Drzwi tylne L - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 81.

Drzwi tylne L() - Rysa/odprysk 3



Photo 82.

Listwa drzwi przednich L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 83.

Lusterko zew L - Rysa/odprysk 1



Photo 84.

Próg L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 85.
Próg L - Rysa/odprysk 2



Photo 86.
Słupek przedni L - Rysa/odprysk 1

A close-up photograph of a tire tread. A black arrow points to the word 'ROTATION' embossed in the rubber. Below this, smaller text is visible, including 'ON VEHICLE TIRE PLACARD', 'ON A STEADILY ROTATED WHEEL', and 'UNDERINFLATION, OVERLOADING, IMPROPER REPAIR'. A white ruler with black markings and the 'DEKRA' logo is placed against the tire for scale. The ruler shows a measurement of approximately 4.5 cm. The tire is mounted on a silver-colored alloy wheel.

Felga Aluminiowa przednia L - Rysa/odprysk 1



Felga Aluminiowa przednia L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 89.

Koło kierownicy - Rysa/odprysk 1



Photo 90.

Konsola tunelu śr. - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 91.

Fotel prz. lew. - Rysa/odprysk 1



Photo 92.

Fotel prz. praw. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 93.

Kanapa tyl. - Rysa/odprysk 1



Photo 94.

Kanapa tyl. - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 95.

Tapicerka drzwi przednich L - Rysa/odprysk 1



Photo 96.

Tapicerka drzwi przednich L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 97.

Tapicerka drzwi przednich P - Pęknięcie/rozerwanie 1



Photo 98.

Tapicerka drzwi tylnych L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 99.

Tapicerka drzwi tylnych L - Pęknięcie/rozerwanie 1



Photo 100.

Dywanik prze L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 101.

Półka/roleta tylna - Inne 1