

DEKRA's commission No. : PKOL(W)/LODZ/57946/26/06/24
commission/ damage No. : PS24/043321
Date of commission: 24-06-2026

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (WSP)
DEKRA Polska - współpraca O/Warszawa
Andrzej Sosnowski
DEKRA Polska - Centrala

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0148726
Manufacturer	TOYOTA
Model	Camry 21-24
Type / version	Camry 2.5 Hybrid Comfort CVT
Body type	sedan
Number of doors / seats	4/5
Curb weight [kg]	1608
Gross vehicle weight [kg]	2100
Wheelbase 1/2	2825
Engine type	spark ignition
Pollution reduction system	three-way catalytic converter
Engine capacity [ccm]	2487
Engine Power [hp/kW]	178/131
Gearbox	automatic
Registration /record No.	WI590PH
VIN / serial number	JTNB23HK903102420
Date of first registration	22-09-2021
Date of next. tech. test	22-09-2026
Year of manufacture	2021 (year has been verified with the manufacturer's base)
Readout [km]	107 034 (read)
Body color / type of coating	black/double-layered, metallized

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	MICHELIN, PRIMACY 3	215/55 17 94W	3,0 mm
	left	MICHELIN, PRIMACY 3	215/55 17 94W	3,5 mm
back	right	MICHELIN, PRIMACY 3	215/55 17 94W	3,0 mm
	left	MICHELIN, PRIMACY 3	215/55 17 94W	3,0 mm

Standard equipment by Eurotax

- | | |
|--|---|
| 1. Adaptive Cruise Control | 39. Interior decoration: other |
| 2. Android Auto, Apple CarPlay | 40. Keyless go |
| 3. Antilock-Brake-System (ABS) | 41. LED Daytime running lights |
| 4. Armrest (s) rear | 42. LED front dim light |
| 5. Automated High-beam assist | 43. LED rear lights |
| 6. Automatic Emergency Call | 44. Lane control assistant |
| 7. Automatic antenna/ window-antenna | 45. Lane control assistant |
| 8. Automatic climate control | 46. Leather gearshifter/switch, Leather steering wheel |
| 9. Automatic dimlight activation | 47. Light alloy wheels from 17" |
| 10. Bluetooth interface | 48. Lumbar adjust driver electric |
| 11. Bord climate: other | 49. Multi functional steering wheel |
| 12. Bord communication: other | 50. On board computer |
| 13. CD-player, Radio | 51. On board monitor |
| 14. Child lock manually | 52. Other |
| 15. Child seat fixation | 53. Other |
| 16. Collision Warning System | 54. Park Distance Control front, Park Distance Control rear |
| 17. DAB radio | 55. Power assisted brakes |
| 18. Diminished spare wheel | 56. Power steering, Pre-Crash System |
| 19. Distribution of braking force electronically | 57. Power windows front, Power windows rear |
| 20. Door mirror(s) electrically adjustable in general, Door mirrors heated | 58. Pre-Crash System |
| 21. Door mirrors electrically foldable | 59. Radio |
| 22. Driver airbag, Passenger airbag | 60. Rain sensor |
| 23. Driver knee airbag | 61. Rear bench foldable in two separate parts |
| 24. Driver seat electrically adjustable | 62. Rear view camera |
| 25. ESP (Electronical Stabilizing Program) | 63. Rear-view mirror autodimming |
| 26. Electric parking brake | 64. Remote controlled central locking |
| 27. Electric tailgate | 65. Selectable driveline characteristics |
| 28. Exterior design: other | 66. Side airbag driver and passenger |
| 29. Exterior design: other | 67. Side indicators |
| 30. Exterior design: other | 68. Steering: other |
| 31. Exterior lighting: other | 69. Textile upholstery |
| 32. Extra power outlet | 70. Traction control |
| 33. Floor mat | 71. Traffic sign recognition |
| 34. Fog lamps | 72. Tyre pressure control (RDC) |
| 35. Head airbags front | 73. USB in |
| 36. Headlamp wash | 74. USB in |
| 37. Hill holder | 75. Uni-Lackierung |
| 38. Interior decoration: other | 76. Vehicle immobilizer |

Dealer's equipment (selected items)

1. Metallic paint -

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

CorrectionsFirst registrationMileageEquipmentTyresOther

Earlier repairs -
The specific type of the operation -
Braki uszkodzenia, stan -


Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 07-2026 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 03-07-2026

DEKRA's expert:
Kacper Sosnowski (WSP)
Andrzej Sosnowski

Document issued electronically valid without signature.

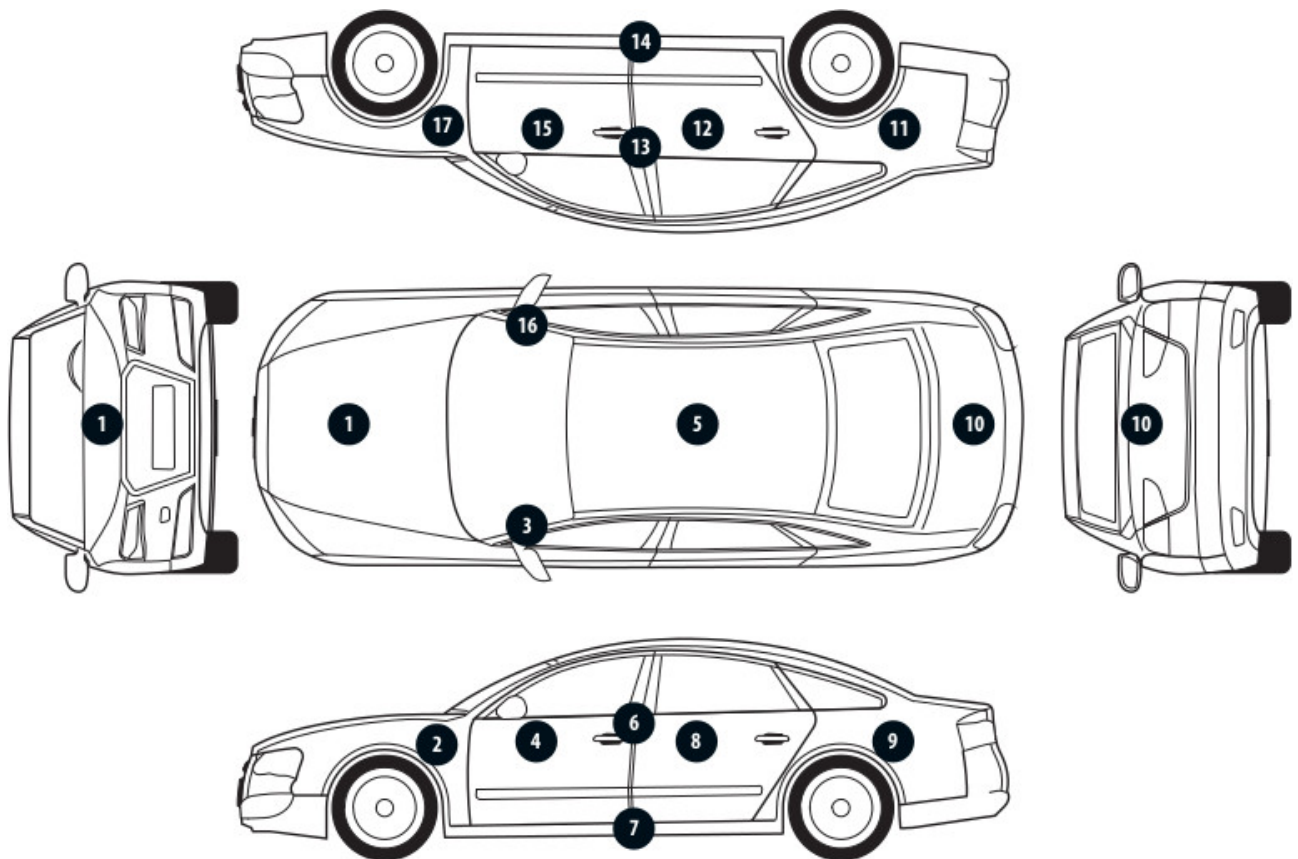Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	150 - 200
2	Front left fender	to 150
3	Left front pillar	150 - 200
4	Front left door	150 - 200
5	Roof	to 150
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	150 - 200
9	Rear left fender	150 - 500
10	Cover/lid	to 150
11	Right rear fender	to 150
12	Right rear door	to 150
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	to 150
16	Right front pillar	to 150
17	Front right fender	150 - 300

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book of the vehicle was not provided.

Information concerning the origin of the vehicle

Lack of reliable data.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below: ograniczenia placowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the

assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

2

Expert comments - regarding valuation

Rysy na samochodzie. Pojazd TAXI. Widoczne ślady po grafice reklamowej. Odpryski na szybie czołowej.

Rzeczoznawca dokonał oględzin pojazdu w warunkach parkingowych, co mogło ograniczyć pełną ocenę jego stanu technicznego. Dodatkowo, jeżeli jazda próbna została przeprowadzona (informacje w treści raportu), to wykonano ją w warunkach parkingowych, z niewielką prędkością, co może nie odzwierciedlać pełnych warunków eksploatacyjnych. Istnieje możliwość, że w innych okolicznościach ujawnią się dodatkowe uszkodzenia lub usterki, których nie można było wykryć podczas obecnych oględzin. Zalecamy zatem skorzystanie z możliwości oględzin pojazdu we własnym zakresie lub w Autoryzowanej Stacji Obsługi danej marki, co pozwoli na pełniejszą weryfikację stanu technicznego pojazdu przed udziałem w aukcji."

Restrictive disclaimer - regarding valuation

Nie weryfikowano szczegółowo stanu układu napędowego, zawieszenia, kierowniczego, hamulcowego oraz wydechowego. Ocena została wykonana bez użycia podnośnika i specjalistycznego sprzętu diagnostycznego, nie dokonywano demontażu osłon i innych elementów. Ocena określa ogólny stan pojazdu na dzień oględzin w miejscu jego udostępnienia, nie może być zatem traktowana jako kompleksowa ocena stanu technicznego. Specyfikacja wg. programu operacyjnego w zakresie wyposażenia standardowego i dodatkowego nie gwarantuje zgodności ze stanem faktycznym w zakresie możliwym do ustalenia przez rzeczoznawcę podczas oględzin pojazdu. Pomiar grubości powłoki lakierowej wykonano w miejscach możliwych do ich wykonania pomiary nie gwarantują oryginalności poszczególnych elementów poddanych ocenie.

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.

- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.

Przekątna przednia lewa



Photo 2.

Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.

Bok prawy z tyłu



Photo 6.

Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.

Próg lewy (widok od przodu)

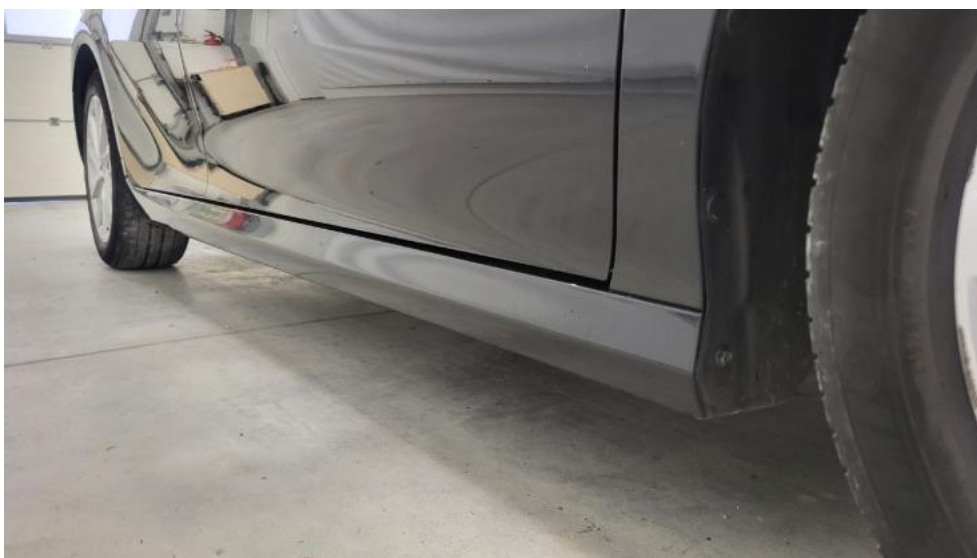


Photo 12.

Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika



Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION

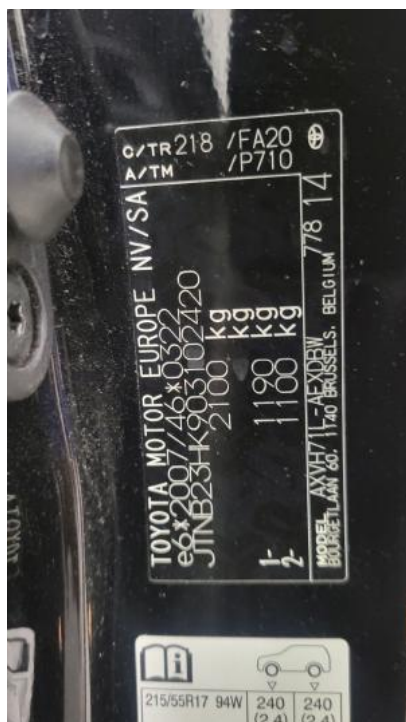


Photo 23.

Tabliczka znamionowa



Photo 24.

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Zestaw wskaźników - serwis



Photo 26.

Widok przez otwarte drzwi przednie lewe

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Kierownica z lewej strony



Photo 28.

Widok przez otwarte drzwi tylne lewe

PHOTOGRAPHIC DOCUMENTATION



Photo 29.

Widok z tylnej kanapy na deskę rozdź.



Photo 30.

Konsola środkowa

PHOTOGRAPHIC DOCUMENTATION

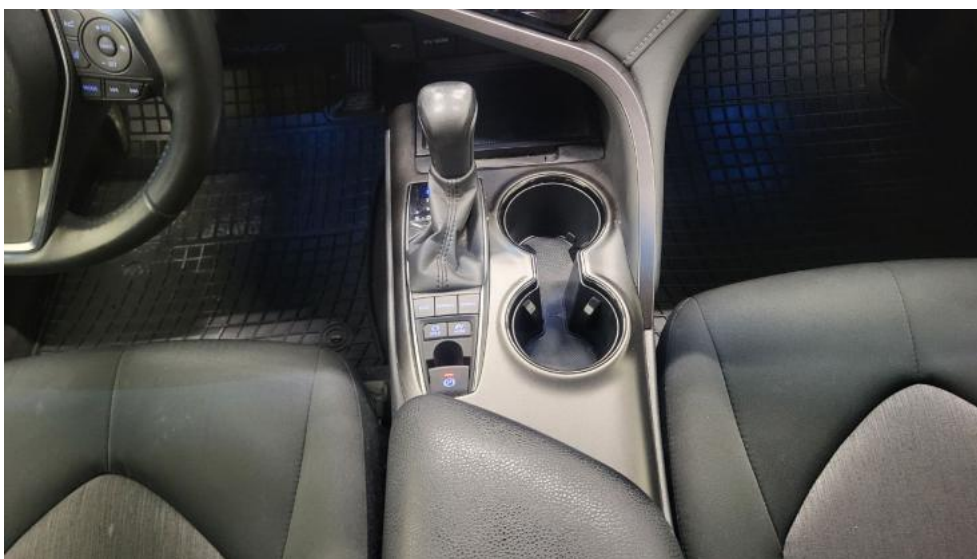


Photo 31.
Tunel środkowy



Photo 32.
Kierownica (na wprost)

PHOTOGRAPHIC DOCUMENTATION



Photo 33.

Dowód rej. Str. 1



Photo 34.

Dowód rej. str. 2

PHOTOGRAPHIC DOCUMENTATION



Photo 35.

Kluczyki

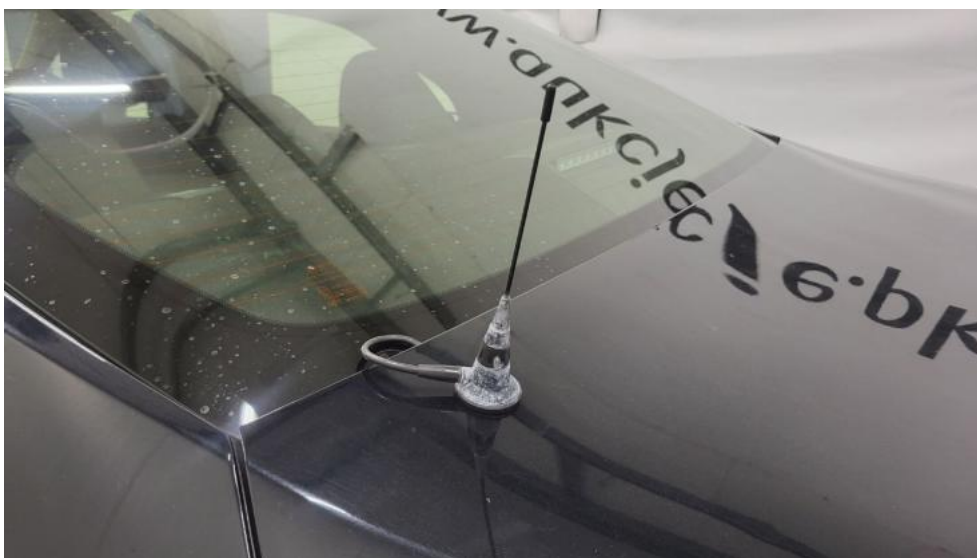


Photo 36.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 37.

Zdjęcie do protokołu

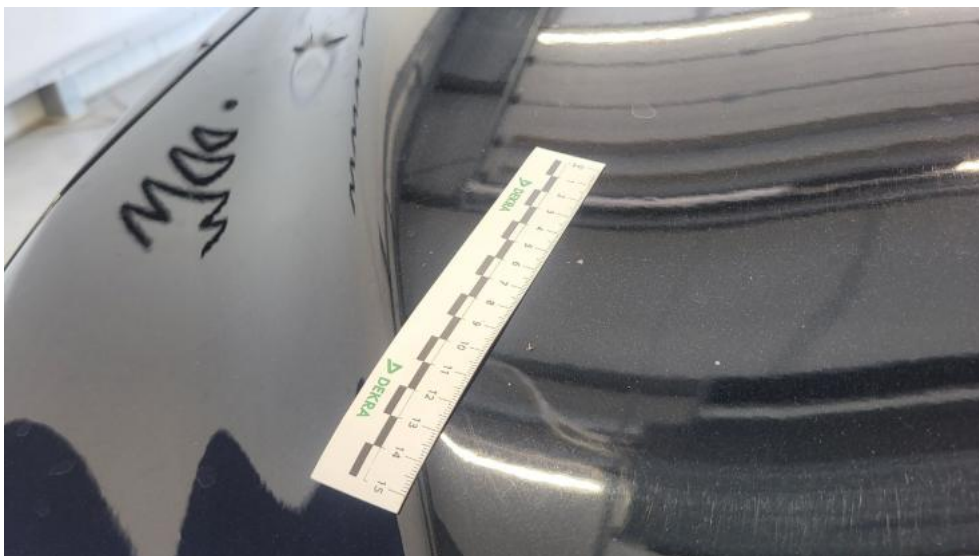


Photo 38.

Pokrywa komory silnika - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Pokrywa komory silnika - Wgniecenie/odkształcenie 1



Photo 40.

Zderzak - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Zderzak - Pęknięcie/rozerwanie 1



Photo 42.

Zderzak przedni cz P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Felga aluminiowa przednia P - Rysa/odprysk 1



Photo 44.

Drzwi przednie P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Drzwi tylne P - Rysa/odprysk 1



Photo 46.

Drzwi tylne P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.
Drzwi tylne P - Inne 1



Photo 48.
Próg P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Próg P - Rysa/odprysk 2



Photo 50.

Ścianka tylna P / Ścianka boczna P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Błotnik tylny P / Ściana boczna P - Rysa/odprysk 2

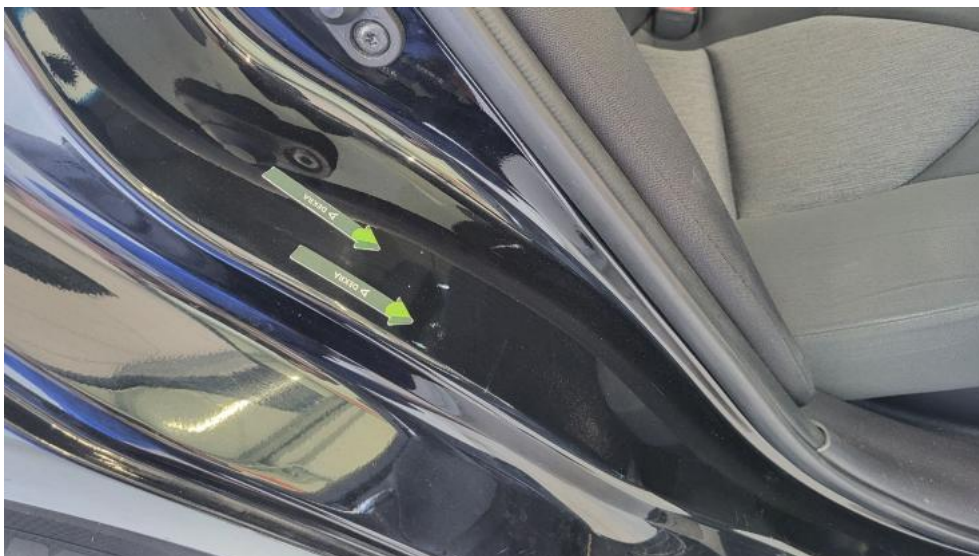


Photo 52.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 2



Photo 54.

Felga aluminiowa tylna P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Pokrywy bagażnika - Wgniecenie/odkształcenie 1



Photo 56.

Pokrywy bagażnika - Wgniecenie/odkształcenie 2

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Zderzak tylny - Rysa/odprysk 1



Photo 58.

Zderzak tylny - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Zderzak tylny - Pęknięcie/rozerwanie 1



Photo 60.

Zderzak tylny - Inne 1

PHOTOGRAPHIC DOCUMENTATION

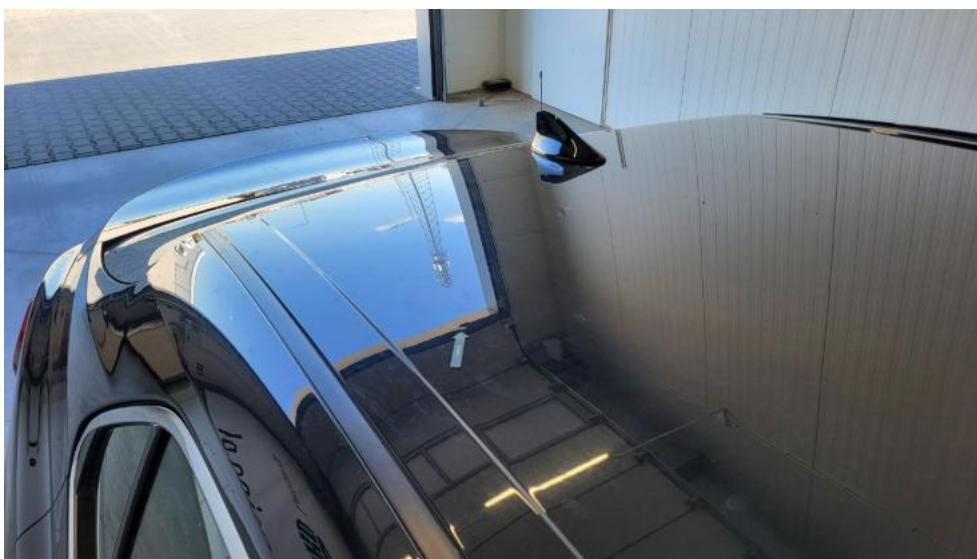


Photo 61.

Dach - Wgniecenie/odkształcenie 1



Photo 62.

Dach - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Ścianka tylna L / Ścianka boczna L - Wgniecenie/odkształcenie 1



Photo 64.

Felga aluminiowa tylna L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Drzwi przed L - Rysa/odprysk 1



Photo 66.

Drzwi przed L - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 67.

Drzwi przed L - Wgniecenie/odkształcenie 1



Photo 68.

Drzwi tylne L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Drzwi tylne L - Inne 1



Photo 70.

Felga Aluminiowa przednia L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Fotel prz. lew. - Inne 1



Photo 72.

Fotel prz. praw. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 73.
Kanapa tyl. - Inne 1



Photo 74.
Podsufitka - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 75.

Dywanik prze L - Pęknięcie/rozerwanie 1



Photo 76.

Listwy progowe lew. - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 77.

Wykładzina podłogi - Pęknięcie/rozerwanie 1



Photo 78.

Wykładzina podłogi bagażnika - Pęknięcie/rozerwanie 1