

DEKRA's commission No. : PKOL(W)/LODZ/07468/26/01/29
commission/ damage No. : 22/015906
Date of commission: 29-01-2026

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (WSP)
DEKRA Polska - współpraca O/Warszawa
Bartłomiej Chodakowski (WSP)
DEKRA Polska - współpraca O/Wrocław

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0157734
Manufacturer	OPEL
Model	Mokka 20-24
Type / version	Mokka 1.2 T GS S&S aut
Body type	hatchback
Number of doors / seats	5/5
Curb weight [kg]	1295
Gross vehicle weight [kg]	1740
Wheelbase 1/2	2557
Engine type	spark ignition
Pollution reduction system	GPF
Engine capacity [ccm]	1199
Engine Power [hp/kW]	130/96
Gearbox	automatic 8- gear
Registration /record No.	TK270AY
VIN / serial number	VXKUSHNSSNW022434
Date of first registration	30-03-2022
Date of next. tech. test	30-03-2025
Year of manufacture	2022 (year has been verified with the manufacturer's base)
Readout [km]	38 662 (read)
Body color / type of coating	granatowy/METALIK

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	CONTINENTAL, ECOCONTACT 6	215/60 17 96H	3,0 mm
	left	CONTINENTAL, ECOCONTACT 6	215/60 17 96H	2,5 mm
back	right	CONTINENTAL, ECOCONTACT 6	215/60 17 96H	3,0 mm
	left	CONTINENTAL, ECOCONTACT 6	215/60 17 96H	3,0 mm

Standard equipment by Eurotax

- | | |
|---|--|
| 1. 360 view camera, Rear view camera | 33. Interior lights: other accessories, Mirror: others |
| 2. Adaptive Cruise Control | 34. Interior: other |
| 3. Additional gauges | 35. Interior: other |
| 4. Android Auto, Apple CarPlay, On board monitor, Radio, Soundsystem, Touchscreen monitor, USB in | 36. Interior: other |
| 5. Antilock-Brake-System (ABS), ESP (Electronical Stabilizing Program), Traction control | 37. LED Daytime running lights |
| 6. Armrest (s) front, Storage facilities in general | 38. LED Fog Lamps |
| 7. Automated High-beam assist | 39. LED front dim light |
| 8. Automated High-beam assist, Automatic dimlight activation | 40. LED rear lights |
| 9. Automatic climate control | 41. Leather steering wheel, Multi functional steering wheel, Sports steering wheel |
| 10. Blind spot warning, Other | 42. Light alloy wheels from 17" |
| 11. Bluetooth interface | 43. Mobile Tire System |
| 12. Bord climate: other | 44. On board monitor |
| 13. Child lock manually | 45. Other |
| 14. Child seat fixation | 46. Paint: other, Uni-Lackierung |
| 15. Collision Warning System, Pedestrian Emergency Brake Assist | 47. Park Distance Control front, Park Distance Control rear |
| 16. Collision Warning System, Power assisted brakes | 48. Passenger seat height adjustable, Passenger seat with adjustable inclination |
| 17. Comfort driver seat, Comfort passenger seat | 49. Power windows front, Power windows rear |
| 18. DAB radio | 50. Rain sensor |
| 19. Door mirror(s) electrically adjustable in general, Door mirrors heated | 51. Rear bench foldable in two separate parts |
| 20. Door mirrors electrically foldable | 52. Rear-view mirror autodimming |
| 21. Driver airbag, Head airbags front, Head airbags rear, Passenger airbag, Side airbag driver and passenger, Side airbags rear | 53. Roof: other |
| 22. Driver conditioning monitoring | 54. Selectable driveline characteristics |
| 23. Driver seat height adjustable, Driver seat with adjustable inclination | 55. Start/Stop system |
| 24. Electric parking brake | 56. Steering wheel heated |
| 25. Exterior design: other | 57. Steering wheel manually adjustabe |
| 26. Exterior design: other | 58. Steering wheel with gear-switches |
| 27. Exterior design: other | 59. Textile upholstery, Upholstery with leather inserts |
| 28. Full Cabin Spoiler | 60. Tinted rear windows |
| 29. Heated seat driver, Heated seat passenger | 61. Traffic sign recognition |
| 30. Hill holder | 62. Tyre pressure control (RDC) |
| 31. Interior decoration: other | 63. USB in |
| 32. Interior lights: other accessories | 64. {Układ zaawansowany utrzymania w linii pasa ruchu} |

Base value of the vehicle

Base value of the vehicle by Eurotax (net)

CorrectionsFirst registrationMileageTyresOther

The validity of the technical examination -
Earlier repairs -

Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 02-2026 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 16-02-2026

DEKRA's expert:
Kacper Sosnowski (WSP)
Bartłomiej Chodakowski (WSP)

Document issued electronically valid without signature.

The image contains three line drawings of a car with numbered callouts 1 through 17, representing different views:

- Front View (Left):** Shows the front of the car. Callout 1 points to the front grille.
- Top View (Middle):** Shows the car from above. Callouts include:
 - 1: Front left corner.
 - 3: Front right corner.
 - 5: Center of the roof.
 - 10: Rear right corner.
 - 16: Rear left corner.
- Side View (Bottom):** Shows the side profile of the car. Callouts include:
 - 2: Front wheel.
 - 4: Front door handle.
 - 6: Rear door handle.
 - 8: Rear door handle.
 - 7: Bottom center of the side panel.
 - 9: Rear wheel.
- Rear View (Top):** Shows the back of the car. Callouts include:
 - 11: Rear right corner.
 - 12: Rear right side panel.
 - 13: Center of the rear window.
 - 14: Center of the rear window (top).
 - 15: Rear left side panel.
 - 17: Rear left corner.

No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Front left fender	150 - 200
3	Left front pillar	150 - 200
4	Front left door	to 150
5	Roof	150 - 200
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	to 150
9	Rear left fender	to 150
10	Cover/lid	to 150
11	Right rear fender	150 - 1000
12	Right rear door	150 - 200
13	Right middle pillar	150 - 500
14	Right side sill	150 - 200
15	Front right door	150 - 200
16	Right front pillar	150 - 200
17	Front right fender	150 - 200

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book was presented and its number is given below:

Elektroniczna

Information concerning the origin of the vehicle

The vehicle purchased domestically from an authorized representative of the brand.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below:

Warunki parkingowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted (with the exception of the year of production) - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.

- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

2

Expert comments - regarding valuation

Brak aktualnych badań technicznych. Lewa przednia szyba zacina sie podczas podnoszenia. Odpryski na szybie czołowej. Widoczne wady lakiernicze. Bardzo liczne wgniecenia na dachu. Rysy na samochodzie.

Restrictive disclaimer - regarding valuation

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raporu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.
Próg lewy (widok od przodu)

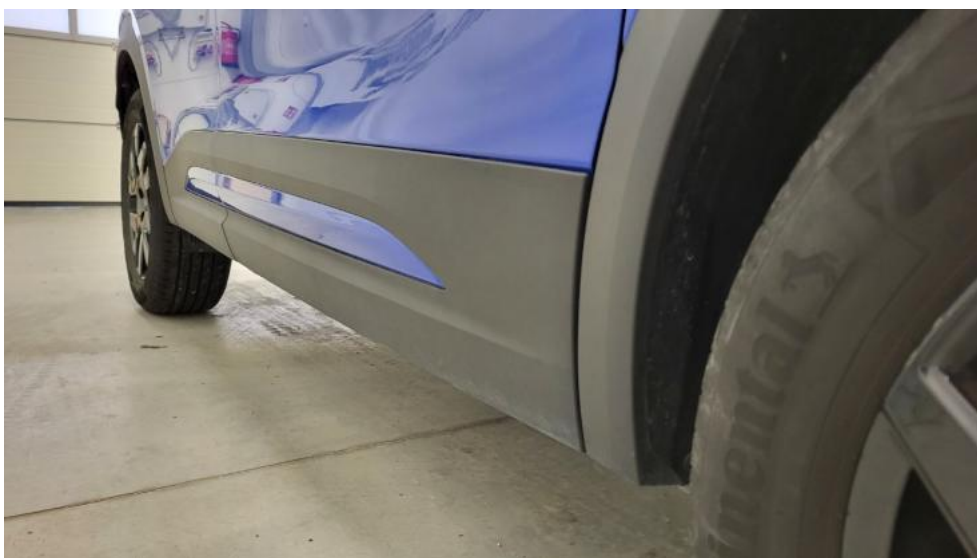


Photo 12.
Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION

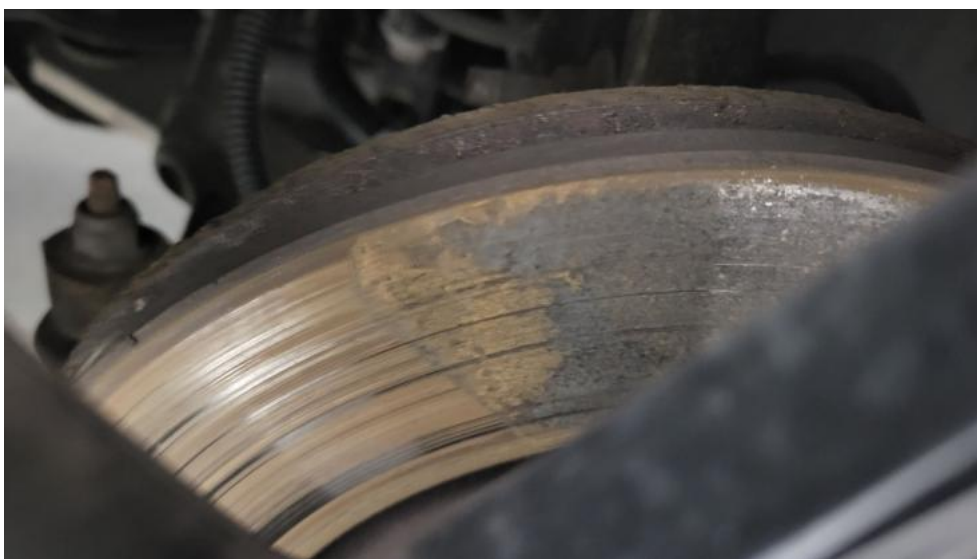


Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa

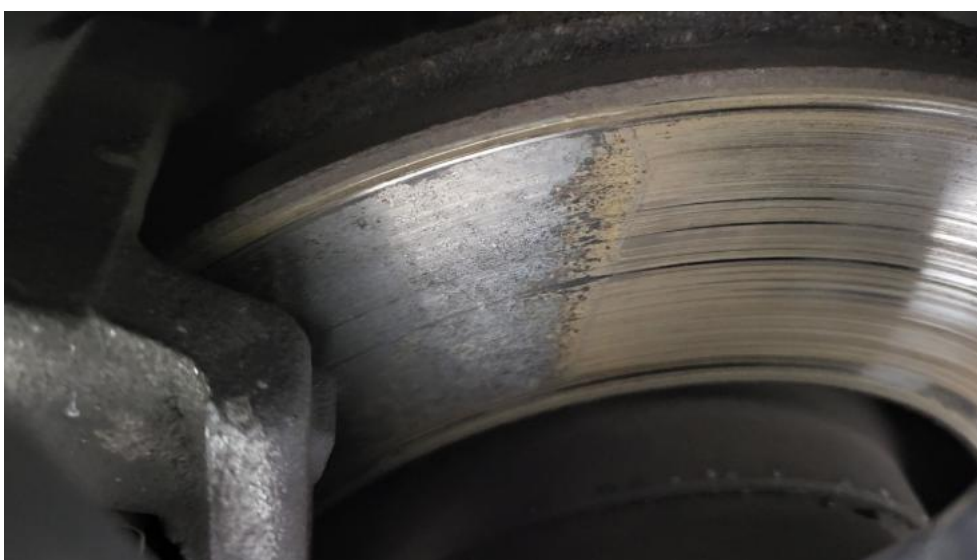


Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.

Bagażnik



Photo 20.

Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika



Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION



Photo 23.

Tabliczka znamionowa



Photo 24.

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe



Photo 28.

Widok z tylnej kanapy na deskę rozdź.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.

Konsola środkowa

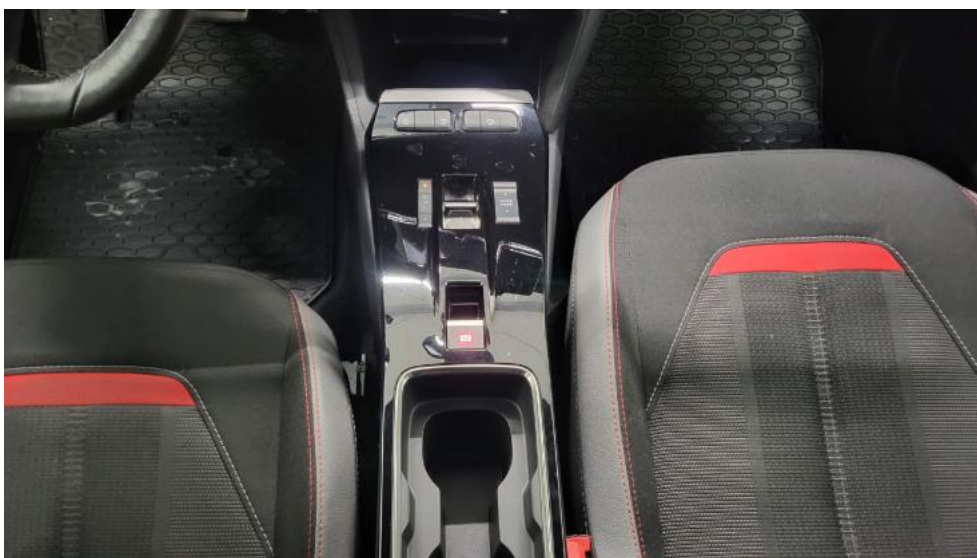


Photo 30.

Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION



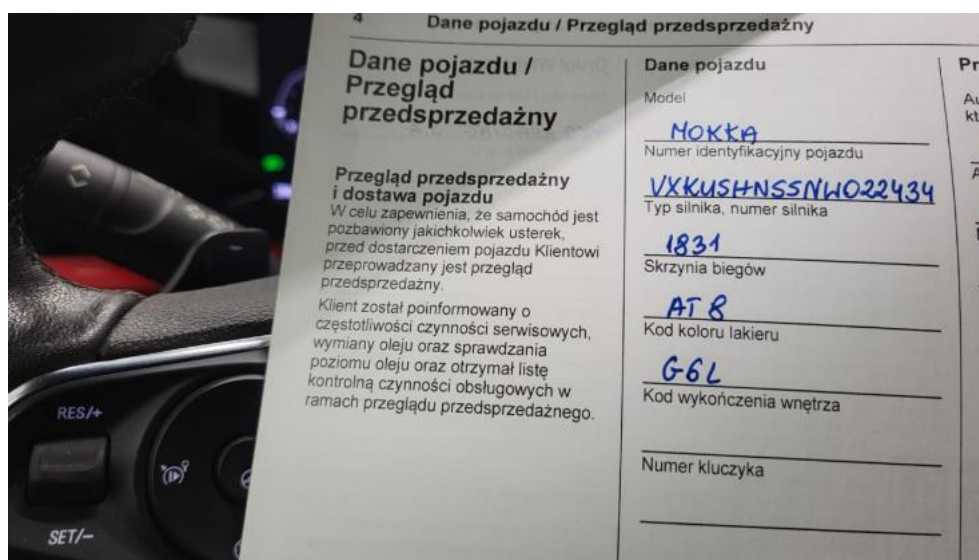
Photo 31.
Kierownica (na wprost)




Photo 32.
Dowód rej. Str. 1

PHOTOGRAPHIC DOCUMENTATION**Photo 33.**

Dow. Rej. Str.2 i klucze

**Photo 34.**

Książka serwisowa – dane

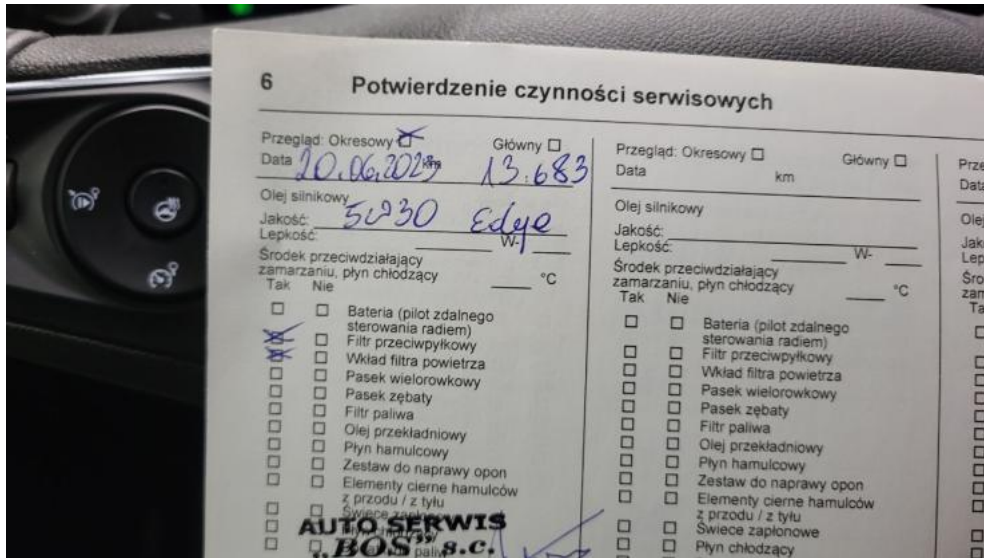PHOTOGRAPHIC DOCUMENTATION

6 Potwierdzenie czynności serwisowych

Przegląd: Okresowy ☒ Główny ☐
Data: 20.06.2025 13.683
Olej silnikowy
Jakość: 5W30 Edge
Lepkość: W.
Środek przeciwdziałający zamarzaniu, płyn chłodzący
Tak Nie °C
☒ ☐ Bateria (pilot zdalnego sterowania radiem)
☒ ☐ Filtrowanie powietrza
☒ ☐ Wkład filtra powietrza
☒ ☐ Pasek wielorowkowy
☒ ☐ Pasek zębaty
☒ ☐ Filtrowanie paliwa
☒ ☐ Olej przekładniowy
☒ ☐ Płyn hamulcowy
☒ ☐ Zestaw do naprawy opon
☒ ☐ Elementy ciernie hamulców z przodu / z tyłu
☒ ☐ Świece zapłonowe
☒ ☐ Płyn chłodzący

Przegląd: Okresowy ☐ Główny ☐
Data: km
Olej silnikowy
Jakość: W.
Lepkość: W.
Środek przeciwdziałający zamarzaniu, płyn chłodzący
Tak Nie °C
☐ ☐ Bateria (pilot zdalnego sterowania radiem)
☐ ☐ Filtrowanie powietrza
☐ ☐ Wkład filtra powietrza
☐ ☐ Pasek wielorowkowy
☐ ☐ Pasek zębaty
☐ ☐ Filtrowanie paliwa
☐ ☐ Olej przekładniowy
☐ ☐ Płyn hamulcowy
☐ ☐ Zestaw do naprawy opon
☐ ☐ Elementy ciernie hamulców z przodu / z tyłu
☐ ☐ Świece zapłonowe
☐ ☐ Płyn chłodzący

AUTO SERWIS BOS s.c.

Photo 35.

Książka serwisowa – ostatni przegląd

**Photo 36.**

Instrukcje

PHOTOGRAPHIC DOCUMENTATION



Photo 37.

Zestaw naprawczy koła



Photo 38.

Atrapa przednia - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Listwa śr zderzaka przedniego - Rysa/odprysk 1



Photo 40.

Pokrywa komory silnika - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Pokrywa komory silnika - Wgniecenie/odkształcenie 2



Photo 42.

Wykładzina pokrywy komory silnika - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Zderzak - Rysa/odprysk 1

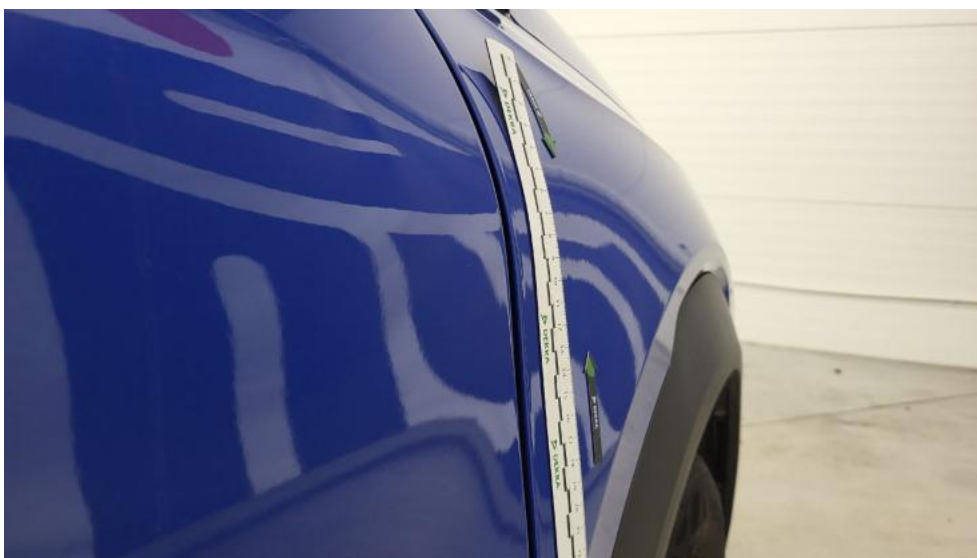


Photo 44.

Łotnik przedni P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Felga aluminiowa przednia P - Rysa/odprysk 1



Photo 46.

Drzwi przednie P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Drzwi przednie P - Wgniecenie/odkształcenie 1



Photo 48.

Drzwi tylne P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Listwa drzwi przednich P - Rysa/odprysk 1



Photo 50.

Słupek przedni P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1



Photo 52.

Pokrywy bagażnika - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Dach - zdjęcie poglądowe 1



Photo 54.

Dach - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION

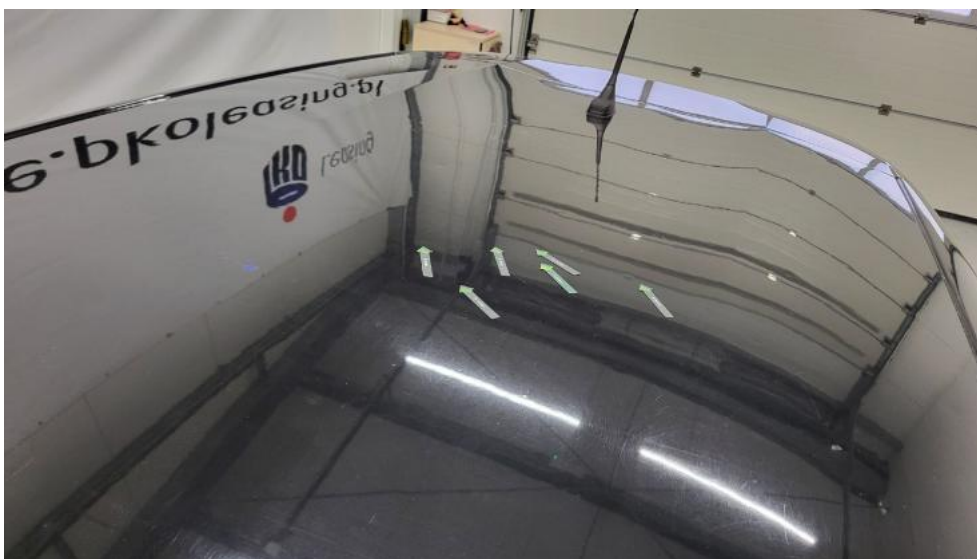


Photo 55.

Dach - Wgniecenie/odkształcenie 2



Photo 56.

Dach() - Wgniecenie/odkształcenie 3

PHOTOGRAPHIC DOCUMENTATION

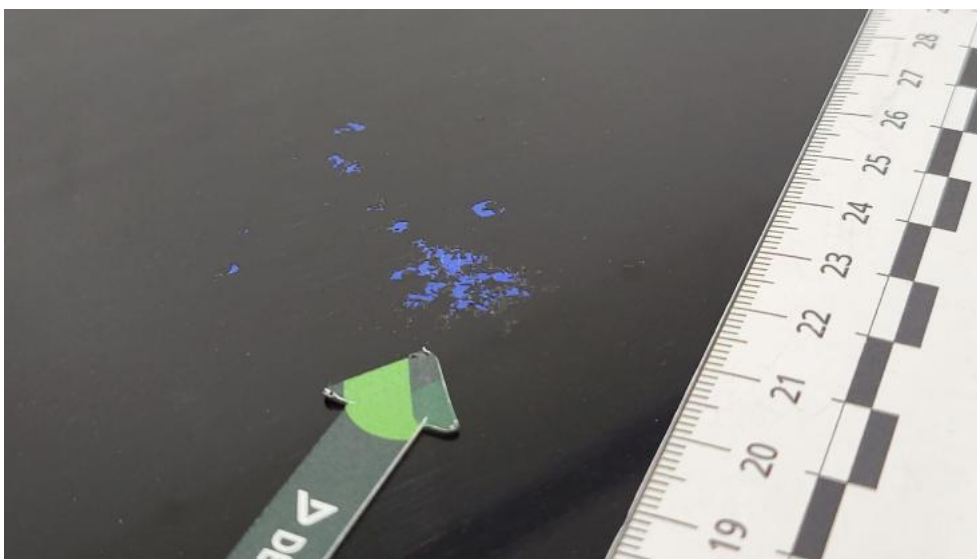


Photo 57.
Dach - Inne 1

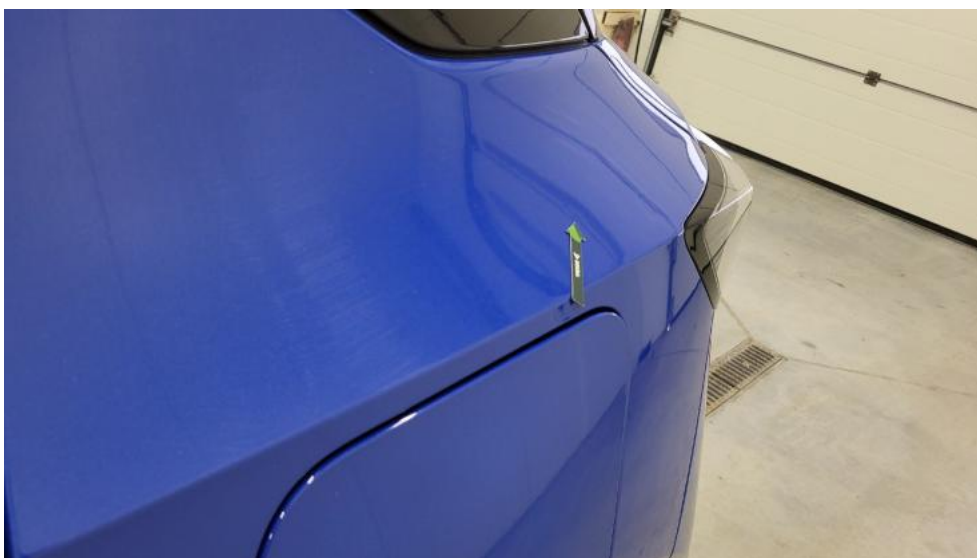


Photo 58.
Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION

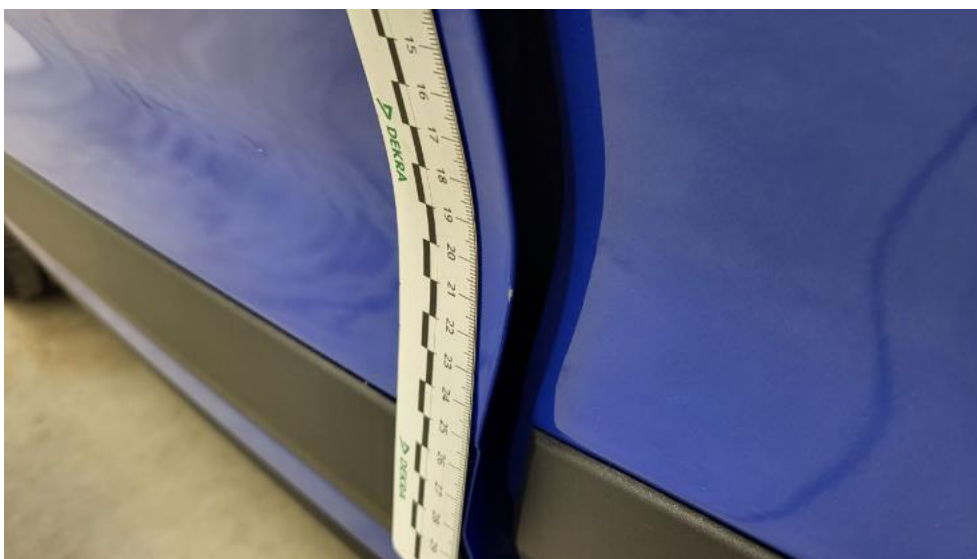


Photo 59.

Drzwi przed L - Rysa/odprysk 1



Photo 60.

Konsola tunelu śr. - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION

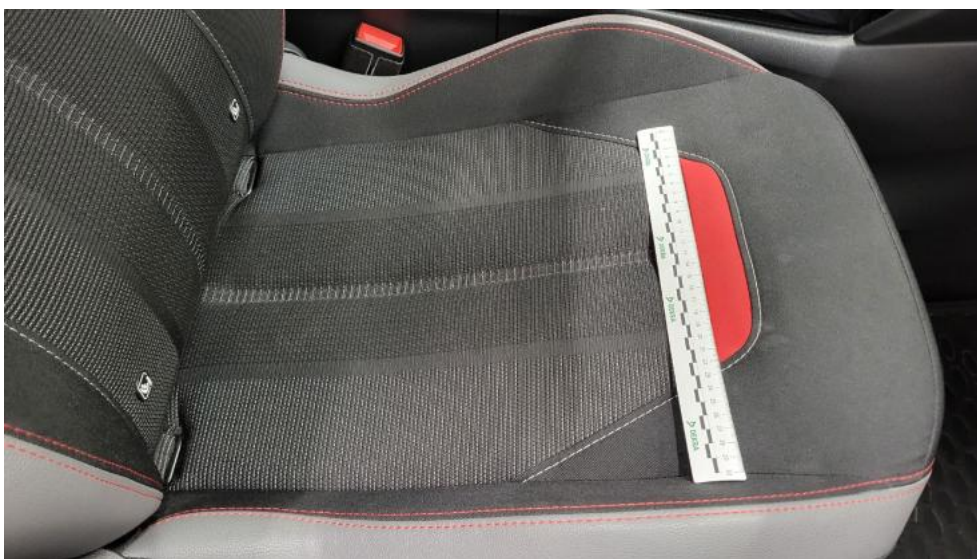


Photo 61.

Fotel prz. praw. - Inne 1