

DEKRA's commission No. : PKOL(W)/LODZ/97039/26/10/16
commission/ damage No. : 00005/EO/23
Date of commission: 16-10-2026

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (WSP)
DEKRA Polska - współpraca O/Warszawa
inż. Dariusz Pawliszyn
DEKRA Polska - O. Poznań

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0145374
Manufacturer	BMW
Model	Seria 6 Gran Turismo [G32] 20-23
Type / version	620d xDrive mHEV aut
Body type	hatchback
Number of doors / seats	5/5
Curb weight [kg]	1890
Gross vehicle weight [kg]	2550
Wheelbase 1/2	3070
Engine type	Automatic ignition
Pollution reduction system	KSC
Engine capacity [ccm]	1995
Engine Power [hp/kW]	190/140
Gearbox	automatic 8- gear
Registration /record No.	WU3730P
VIN / serial number	WBAJY01040CJ01405
Date of first registration	27-09-2021
Year of manufacture	2021 (year has been verified with the manufacturer's base)
Readout [km]	105 574 (read)
Body color / type of coating	white/single-layered

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	PIRELLI, CINTURATO P7	245/50 18 100Y	3,5 mm
	left	PIRELLI, CINTURATO P7	245/50 18 100Y	3,5 mm
back	right	PIRELLI, CINTURATO P7	245/50 18 100Y	3,5 mm
	left	PIRELLI, CINTURATO P7	245/50 18 100Y	3,5 mm

Standard equipment by Eurotax

- | | |
|--|---|
| 1. kierowcy elektrochromatyczne) | 32. Interior decoration: other |
| 2. Additional gauges, Bluetooth interface, Digital instruments, Internet access, Navigation system, On board monitor, Radio, Touchscreen monitor, USB in, Voice control for audiosystem, Voice control for navigation system | 33. LED rear lights |
| 3. Air suspension rear axle | 34. Leather steering wheel, Sports steering wheel |
| 4. Alarm | 35. Leather upholstery |
| 5. Android Auto, Apple CarPlay | 36. Light Alloy wheels 18" |
| 6. Antilock-Brake-System (ABS) | 37. Mobile Tire System |
| 7. Armrest (s) front, Armrest (s) rear | 38. Mobile phone |
| 8. Automated High-beam assist | 39. Other |
| 9. Automatic Emergency Call | 40. Other |
| 10. Automatic climate control | 41. Other |
| 11. Automatic dimlight activation, Rain sensor | 42. Other |
| 12. Bord communication: other | 43. Other |
| 13. Bord communication: other | 44. Other |
| 14. Bord communication: other | 45. Other |
| 15. Bord communication: other | 46. Other |
| 16. Bord entertainment: other accessories | 47. Park Assistant, Park Distance Control front, Park Distance Control rear, Rear view camera |
| 17. Child seat fixation | 48. Park Distance Control front, Park Distance Control rear |
| 18. Collision Warning System, Other | 49. Rear seat-backs foldable in two separate parts |
| 19. Colored glass | 50. Rear spoiler |
| 20. Cornering Headlights, LED front dim light | 51. Rear-view mirror autodimming |
| 21. Cruise control | 52. Selectable driveline characteristics |
| 22. DAB radio | 53. Servotronic |
| 23. Driver airbag, Head airbags front, Head airbags rear, Passenger airbag, Side airbag driver and passenger, Side airbags rear | 54. Start/Stop system |
| 24. Driver seat electrically adjustable, Passenger seat electrically adjustable | 55. Steering wheel manually adjustable |
| 25. ESP (Electronical Stabilizing Program), Traction control | 56. Telematic |
| 26. Electric tailgate | 57. Tie-down ring |
| 27. Exterior design: other | 58. Tyre pressure control (RDC) |
| 28. Exterior design: other | 59. Uni-Lackierung |
| 29. Extra power outlet | 60. Vehicle immobilizer |
| 30. Floor mat | 61. Wheel bolt locks |
| 31. Follow me home | 62. Windscreen wash-nozzle heated |

Dealer's equipment (selected items)

- | | |
|---|---|
| 1. 4 or more zone automatic climate control, Air condition rear | - |
| 2. Adaptive Cruise Control, Blind spot warning, City Emergency Brake Assist, Collision Warning System, Intersection Assist, Lane control assistant, Pedestrian Emergency Brake Assist, Rear Cross Traffic Alert, Side Pre-Crash System, Steering: other | - |
| Tempomat aktywny z funkcją Stop&Go | |
| Asystent unikania kolizji | |
| Ostrzeganie przed ruchem poprzecznym z przodu | |
| Systemy asystujące kierowcy | |
| Asystent kierowania i pasa ruchu | |
| Asystent zatrzymania awaryjnego | |
| Asystent pasa awaryjnego | |
| Asystent utrzymania pasa ruchu z aktywną ochroną przed kolizją boczną i ingeren. w układ kierowniczy | |
| Ostrzeganie o skrzyżowaniach z funkcją hamowania w mieście | |

3. Bord communication: other	-
4. Comfort driver seat, Comfort passenger seat, Driver seat electrically adjustable, Passenger seat electrically adjustable	-
5. Door: other	-
6. Exterior design: other	-
7. Exterior design: other	-
8. Free service 4 years or more, more than 60000 km	-
9. Free service 4 years or more, more than 60000 km	-
10. Heated seat driver, Heated seat passenger, Rear seat heating	-
11. Independent vehicle heater	-
12. Interior lights: other accessories	-
13. Other	-
14. Pre-Crash System	-
15. Steering wheel heated	-
16. Sunblind rear side door manual, Sunblind tailgate window electric	-
17. Tinted rear windows	-
18. Ventilated front seat	-
19. {Reflektory laserowe BMW}	-

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

Corrections

First registration

Mileage

Equipment

Tyres

Other

State of the vehicle -


Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 10-2026 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 20-10-2026

DEKRA's expert:
Kacper Sosnowski (WSP)
inż. Dariusz Pawliszyn

Document issued electronically valid without signature.

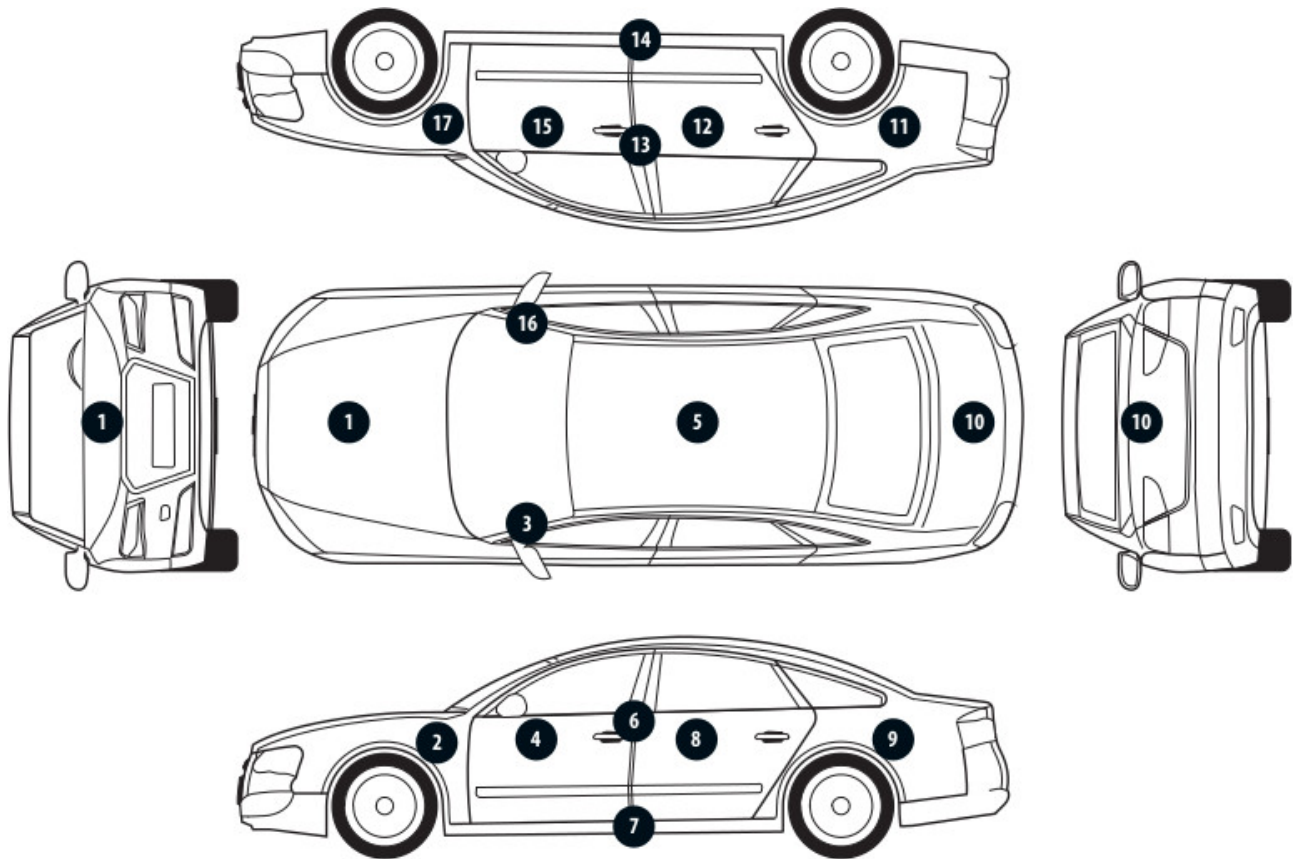Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Front left fender	to 150
3	Left front pillar	to 150
4	Front left door	to 150
5	Roof	to 150
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	to 150
9	Rear left fender	to 150
10	Cover/lid	to 150
11	Right rear fender	to 150
12	Right rear door	to 150
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	to 150
16	Right front pillar	to 150
17	Front right fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book of the vehicle was not provided.

Information concerning the origin of the vehicle

The vehicle purchased domestically from an authorized representative of the brand.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below: parking

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the

page 6/41

assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

1

Expert comments - regarding valuation

Dostarczono ksero pozwolenia czasowego. Rysy na samochodzie. Minął termin wymiany płynu hamulcowego od 09/2026. Brak zaślepek w tylnej kanapie. Odpryski na szybie czołowej.

Restrictive disclaimer - regarding valuation

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.
Próg lewy (widok od przodu)



Photo 12.
Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Komora silnika

PHOTOGRAPHIC DOCUMENTATION



Photo 21.

Numer identyfikacyjny



Photo 22.

Tabliczka znamionowa

PHOTOGRAPHIC DOCUMENTATION



Photo 23.

Zestaw wskaźników - przebieg



Photo 24.

Zestaw wskaźników - serwis

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe



Photo 28.

Widok z tylnej kanapy na deskę rozdz.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.
Konsola środkowa



Photo 30.
Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION



Photo 31.
Kierownica (na wprost)

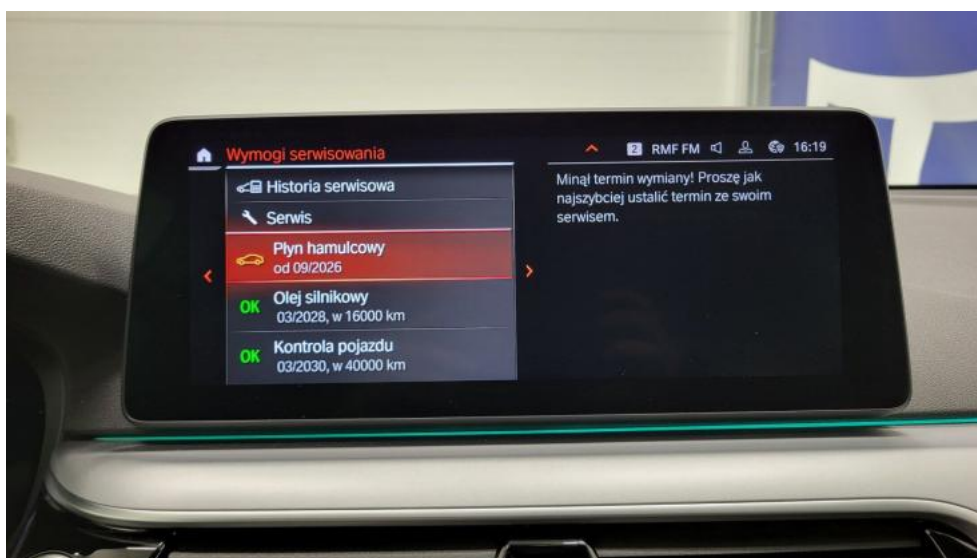
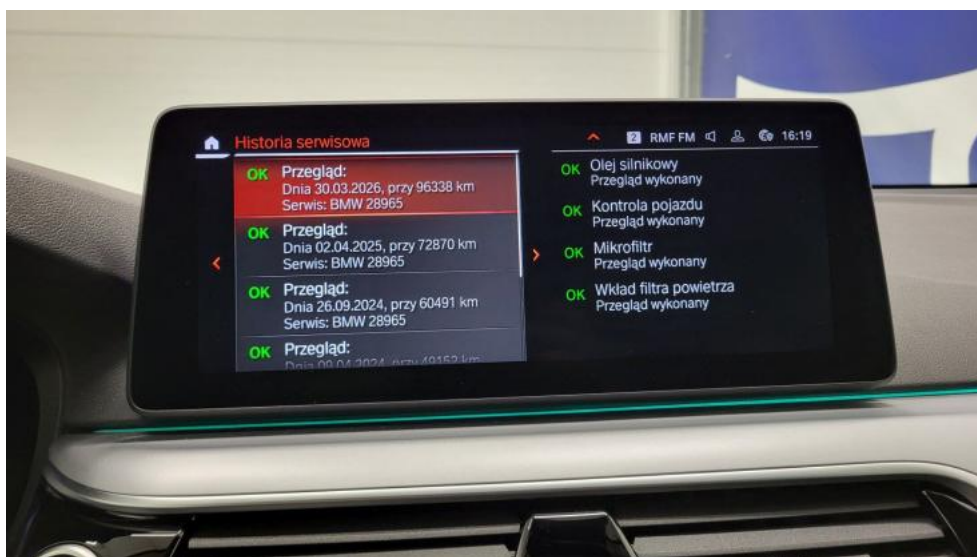
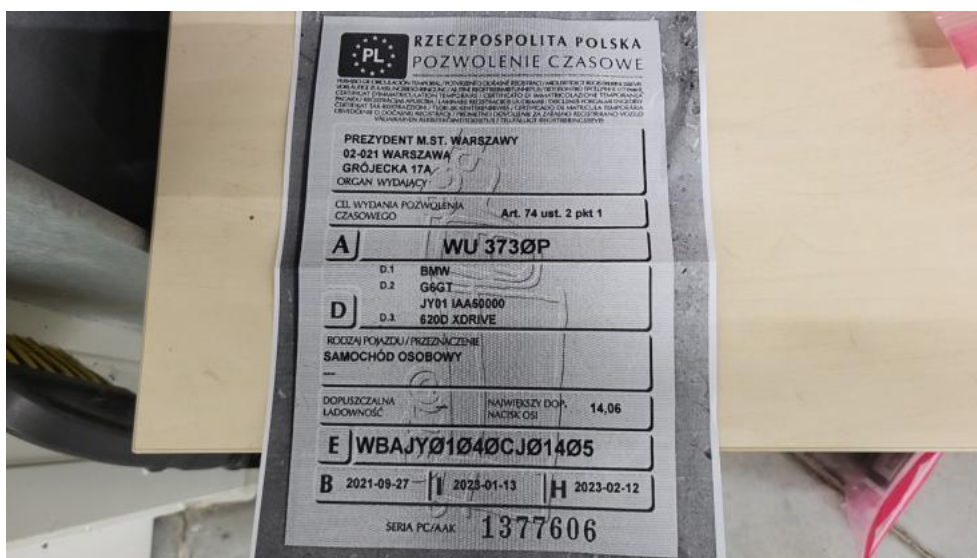



Photo 32.
Książka serwisowa – dane

PHOTOGRAPHIC DOCUMENTATION**Photo 33.**

Książka serwisowa – ostatni przegląd

**Photo 34.**

Dow. rej. ksero Str. 1

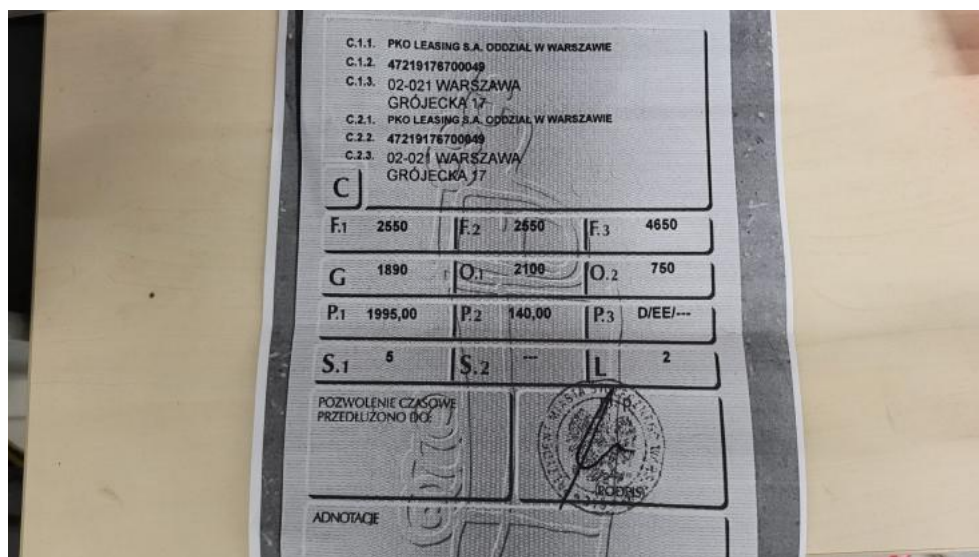PHOTOGRAPHIC DOCUMENTATION**Photo 35.**

Dow. Rej. ksero Str. 2

**Photo 36.**

Instrukcje

PHOTOGRAPHIC DOCUMENTATION



Photo 37.
Kluczyki



Photo 38.
Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Zdjęcie do protokołu

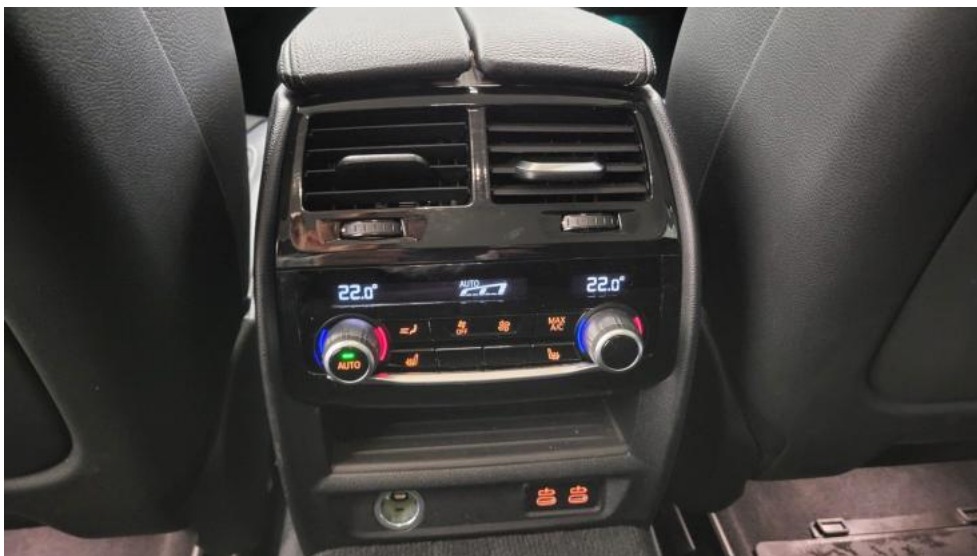


Photo 40.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Zdjęcie do protokołu



Photo 42.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Pokrywa komory silnika - Rysa/odprysk 1



Photo 44.

Zderzak - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Zderzak - Rysa/odprysk 1



Photo 46.

Zderzak - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Zderzak() - Rysa/odprysk 3



Photo 48.

Reflektor P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Drzwi przednie P - Rysa/odprysk 1



Photo 50.

Drzwi przednie P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Drzwi tylne P - Wgniecenie/odkształcenie 1



Photo 52.

Drzwi tylne P - Wgniecenie/odkształcenie 2

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Drzwi tylne P() - Wgniecenie/odkształcenie 3



Photo 54.

Ścianka tylna P / Ścianka boczna P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1



Photo 56.

Pokrywy bagażnika - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Zderzak tylny - Rysa/odprysk 1



Photo 58.

Zderzak tylny - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Zderzak tylny - Wgniecenie/odkształcenie 1



Photo 60.

Dach - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1



Photo 62.

Drzwi przed L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Drzwi przed L - Wgniecenie/odkształcenie 1



Photo 64.

Kanapa tyl. - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Tapicerka drzwi tylnych P - Pęknięcie/rozerwanie 1

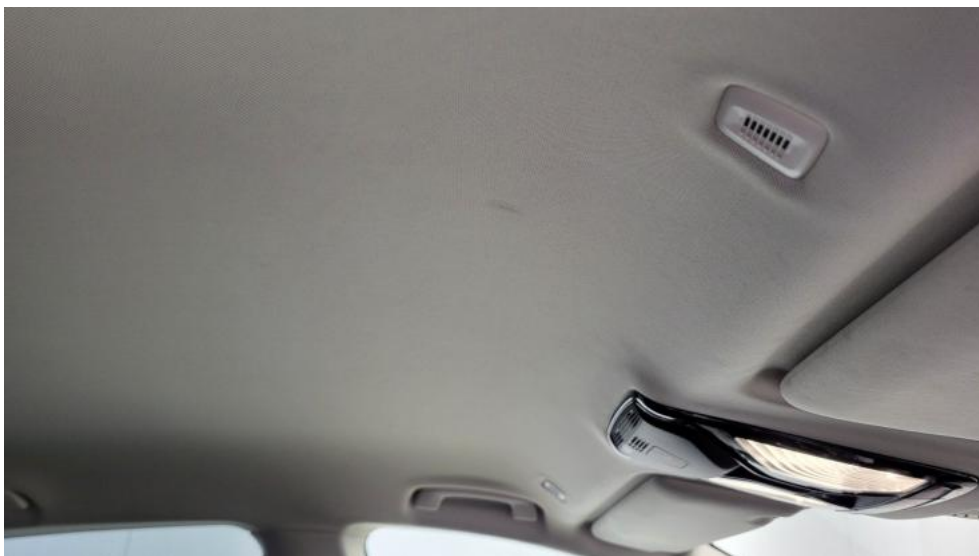


Photo 66.

Podsufitka - Inne 1

PHOTOGRAPHIC DOCUMENTATION

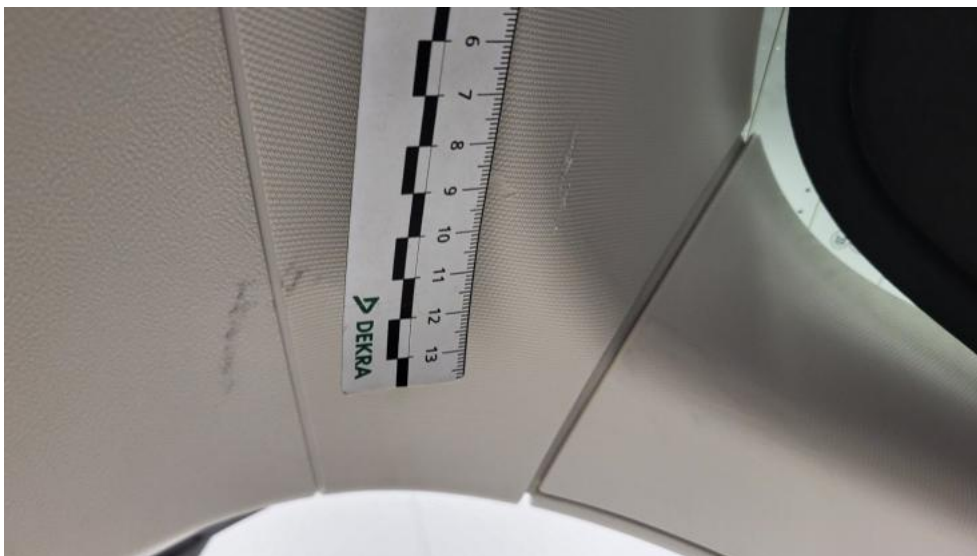


Photo 67.

Wykładzina pokrywy tylnej - Rysa/odprysk 1