

DEKRA's commission No. : PKOL(W)/LODZ/77042/26/08/18
commission/ damage No. : 21/044114
Date of commission: 18-08-2026

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (WSP)
DEKRA Polska - współpraca O/Warszawa
inż. Józef Orłowski
TU - Włocławek

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0138626
Manufacturer	OPEL
Model	Corsa F Hatchback 19-23
Type / version	Corsa 1.2 Edition S&S
Body type	hatchback
Number of doors / seats	5/5
Curb weight [kg]	1055
Gross vehicle weight [kg]	1660
Wheelbase 1/2	2538
Engine type	spark ignition
Pollution reduction system	GPF
Engine capacity [ccm]	1199
Engine Power [hp/kW]	75/55
Gearbox	manual 5- gear
Registration /record No.	WZ114EG
VIN / serial number	VXKUPHMHDM4237841
Date of first registration	30-08-2021
Date of next. tech. test	27-08-2026
Year of manufacture	2021 (year has been verified with the manufacturer's base)
Readout [km]	125 355 (read)
Body color / type of coating	red/METALIK

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	HANKOOK, VENTUS PRIME 4	195/55 16 87H	4,0 mm
	left	HANKOOK, VENTUS PRIME 4	195/55 16 87H	4,0 mm
back	right	HANKOOK, VENTUS PRIME 4	195/55 16 87H	3,0 mm
	left	HANKOOK, VENTUS PRIME 4	195/55 16 87H	3,0 mm

Standard equipment by Eurotax

- | | |
|---|---|
| 1. Additional gauges | 17. Lane control assistant |
| 2. Air conditioning | 18. Light Alloy wheels 16" |
| 3. Antilock-Brake-System (ABS), ESP
(Electronical Stabilizing Program), Traction
control | 19. Metallic paint |
| 4. Bluetooth interface | 20. Mobile Tire System |
| 5. Bord climate: other | 21. On board computer |
| 6. Child seat fixation | 22. On board monitor |
| 7. Collision Warning System, Other, Pedestrian
Emergency Brake Assist | 23. On board monitor, Radio, Soundsystem,
Touchscreen monitor, Voice control for
audiosystem, Voice control for telephone |
| 8. Comfort driver seat, Comfort passenger seat | 24. Passenger seat height adjustable, Passenger
seat with adjustable inclination |
| 9. Cruise control | 25. Power windows front |
| 10. DAB radio | 26. Rear bench, Rear bench foldable in two separate
parts |
| 11. Door mirror(s) electrically adjustable in
general, Door mirrors heated, Mirror: others | 27. Remote controlled central locking |
| 12. Driver airbag, Head airbags front, Head
airbags rear, Passenger airbag, Side airbag
driver and passenger, Side airbags rear | 28. Steering wheel manually adjustabe |
| 13. Driver conditioning monitoring | 29. Steering wheel with radio operation |
| 14. Driver seat height adjustable, Driver seat with
adjustable inclination | 30. Textile upholstery |
| 15. Exterior design: other | 31. Traffic sign recognition |
| 16. Hill holder | 32. Tyre pressure control (RDC) |

Dealer's equipment (selected items)

- | | |
|---|---|
| 1. Armrest (s) front, Leather steering wheel, Power windows rear, Sports steering wheel,
Storage facilities in general | - |
| Elektryczne szyby, tył | |
| Kierownica sportowa pokryta skórą, spłaszczona u dołu | |
| Konsola centralna z podłokietnikiem i schowkiem | |
| 2. Metallic paint | - |
| 3. Park Distance Control rear, Rear view camera | - |
| Kamera cofania - panoramiczna 180 stopni | |
| Czujnik odległości przy parkowaniu - tył | |
| 4. Wheels: other | - |

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

CorrectionsFirst registrationMileage

EquipmentTyresOther

Regularity of service review -
State of the vehicle -
stwierdzone braki i uszkodzenia -

Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 08-2026 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 24-08-2026

DEKRA's expert:
Kacper Sosnowski (WSP)
inż. Józef Orłowski

Document issued electronically valid without signature.

Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Front left fender	to 150
3	Left front pillar	to 150
4	Front left door	to 150
5	Roof	to 150
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	to 150
9	Rear left fender	to 150
10	Cover/lid	to 150
11	Right rear fender	to 150
12	Right rear door	to 150
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	to 150
16	Right front pillar	to 150
17	Front right fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book was presented and its number is given below:

.

Information concerning the origin of the vehicle

The vehicle purchased domestically from an authorized representative of the brand.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below: ograniczenia parkingowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of

the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

2

Expert comments - regarding valuation

Rysy na samochodzie. Odpryski na szybie czołowej.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.

Przekątna przednia lewa



Photo 2.

Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.

Bok prawy z tyłu



Photo 6.

Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION

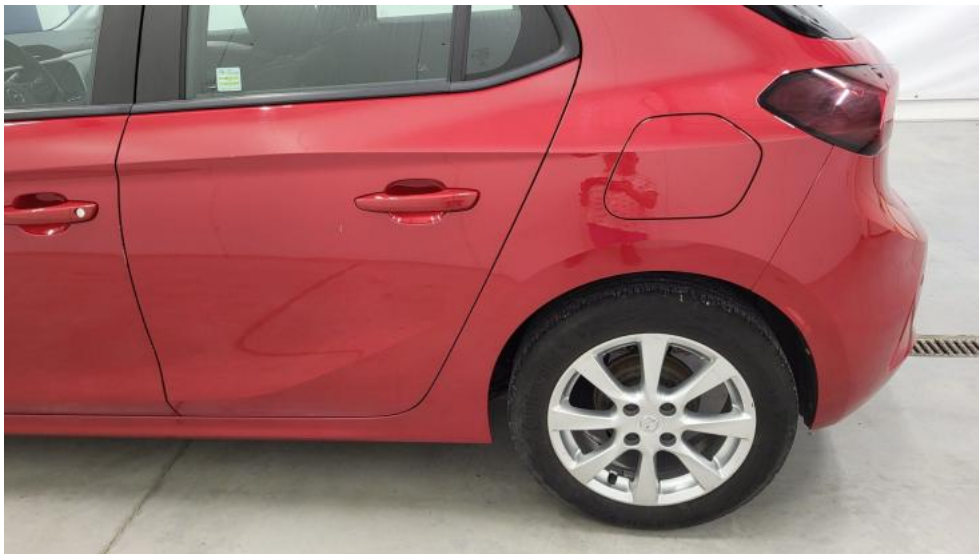


Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.
Próg lewy (widok od przodu)

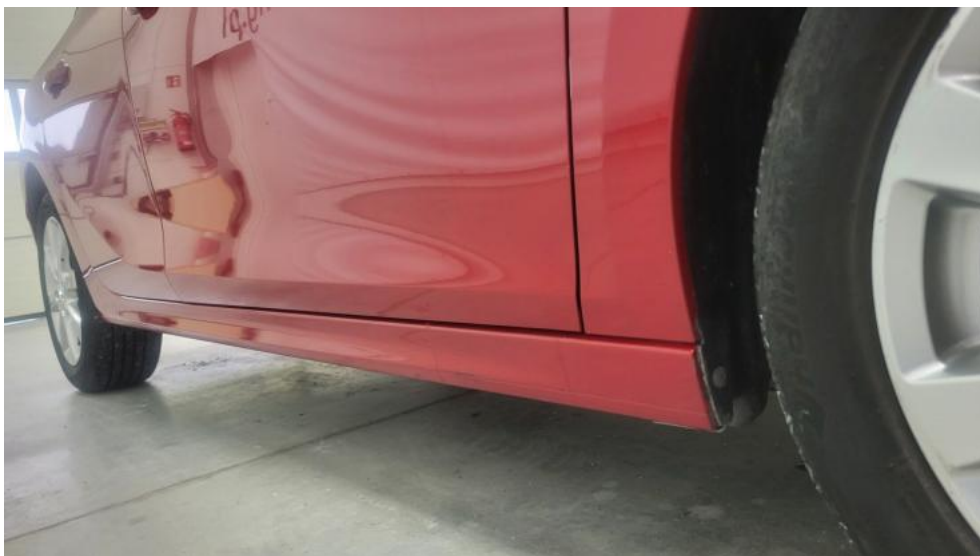


Photo 12.
Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Komora silnika

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Numer identyfikacyjny



Photo 22.
Tabliczka znamionowa

PHOTOGRAPHIC DOCUMENTATION



Photo 23.

Zestaw wskaźników - przebieg



Photo 24.

Zestaw wskaźników - serwis

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe



Photo 28.

Widok z tylnej kanapy na deskę rozdź.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.
Konsola środkowa

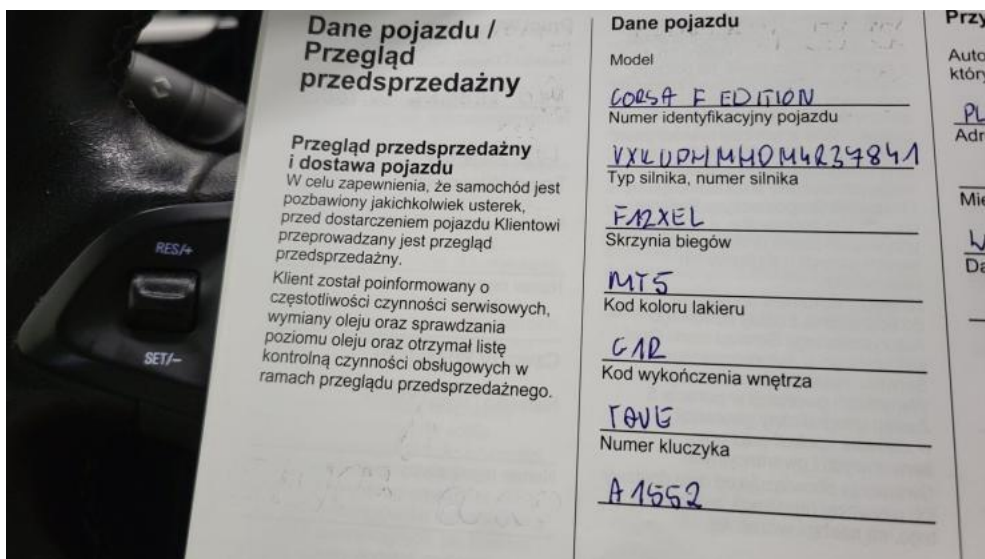


Photo 30.
Tunel środkowy

[illegible]

DEKRA Polska Sp. z o.o.
02-673 Warszawa, ul. Konstruktorska 12A
www.dekra.pl

PHOTOGRAPHIC DOCUMENTATION



Dane pojazdu / Przegląd przedprzedażny


Przegląd przedprzedażny i dostawa pojazdu
W celu zapewnienia, że samochód jest pozbawiony jakichkolwiek usterek, przed dostarczeniem pojazdu Klientowi przeprowadzany jest przegląd przedprzedażny.
Klient został poinformowany o częstotliwości czynności serwisowych, wymiany oleju oraz sprawdzania poziomu oleju oraz otrzymał listę kontrolną czynności obsługowych w ramach przeglądu przedprzedażnego.

Dane pojazdu

Model: CORSA F EDITION
Numer identyfikacyjny pojazdu: VXKUDPMHDM4R34841
Typ silnika, numer silnika: F12XEL
Skrzynia biegów: MT5
Kod koloru lakieru: G1R
Kod wykończenia wnętrza: TAU6
Numer kluczyka: A1552

Photo 33.

Książka serwisowa – dane

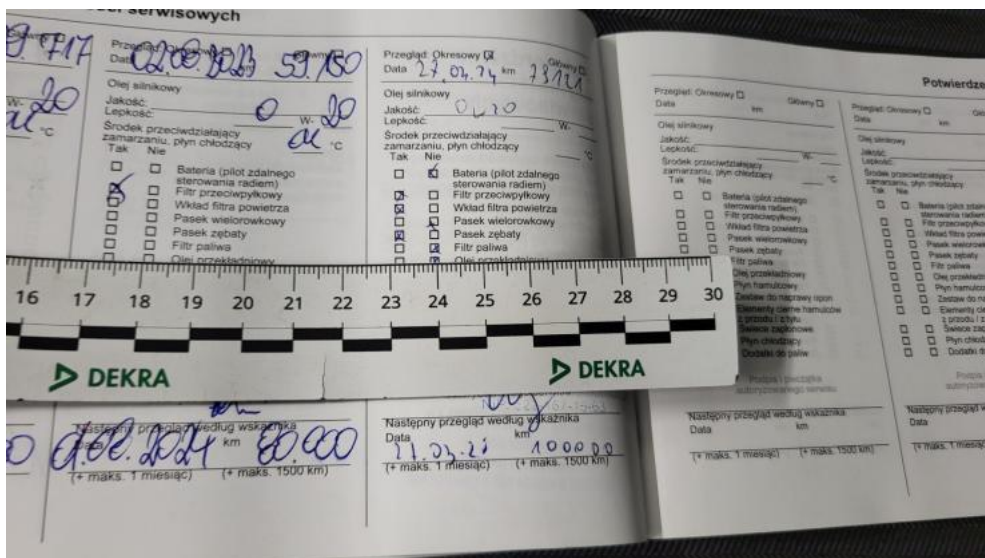

Przegląd okresowy

Data: 23.08.24 km: 73724

Olej silnikowy: 0420
Jakość: 0420
Lepkość: 0420
Środek przeciwzłazający: 0420
Tak Nie

☐ Bateria (pilota zdalnego sterowania radiem)
☐ Filtrowanie powietrza
☐ Wkład filtra powietrza
☐ Pasek wielorowkowy
☐ Pasek zębaty
☐ Filtrowanie paliwa

Przegląd okresowy

Data: 23.08.24 km: 73724

Olej silnikowy: 0420
Jakość: 0420
Lepkość: 0420
Środek przeciwzłazający: 0420
Tak Nie

☐ Bateria (pilota zdalnego sterowania radiem)
☐ Filtrowanie powietrza
☐ Wkład filtra powietrza
☐ Pasek wielorowkowy
☐ Pasek zębaty
☐ Filtrowanie paliwa

Przegląd okresowy

Data: 23.08.24 km: 73724

Olej silnikowy: 0420
Jakość: 0420
Lepkość: 0420
Środek przeciwzłazający: 0420
Tak Nie

☐ Bateria (pilota zdalnego sterowania radiem)
☐ Filtrowanie powietrza
☐ Wkład filtra powietrza
☐ Pasek wielorowkowy
☐ Pasek zębaty
☐ Filtrowanie paliwa

Przegląd okresowy

Data: 23.08.24 km: 73724

Olej silnikowy: 0420
Jakość: 0420
Lepkość: 0420
Środek przeciwzłazający: 0420
Tak Nie

☐ Bateria (pilota zdalnego sterowania radiem)
☐ Filtrowanie powietrza
☐ Wkład filtra powietrza
☐ Pasek wielorowkowy
☐ Pasek zębaty
☐ Filtrowanie paliwa

Photo 34.

Książka serwisowa – ostatni przegląd

PHOTOGRAPHIC DOCUMENTATION**Photo 35.**

Dow. Rej. Str. 2

**Photo 36.**

Instrukcje

PHOTOGRAPHIC DOCUMENTATION



Photo 37.
Zestaw naprawczy koła



Photo 38.
Kluczyki

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Zdjęcie do protokołu



Photo 40.

Pokrywa komory silnika - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Zderzak - Rysa/odprysk 1



Photo 42.

Zderzak przedni cz górna - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Felga aluminiowa przednia P - Rysa/odprysk 1



Photo 44.

Drzwi przednie P - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Drzwi przednie P - Rysa/odprysk 1



Photo 46.

Drzwi przednie P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Drzwi tylne P - Rysa/odprysk 1



Photo 48.

Drzwi tylne P - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Klamka drzwi prz P - Rysa/odprysk 1



Photo 50.

Klamka drzwi tyl P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Listwa drzwi tylnych P - Rysa/odprysk 1



Photo 52.

Błotnik tylny P / Ściana boczna P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION

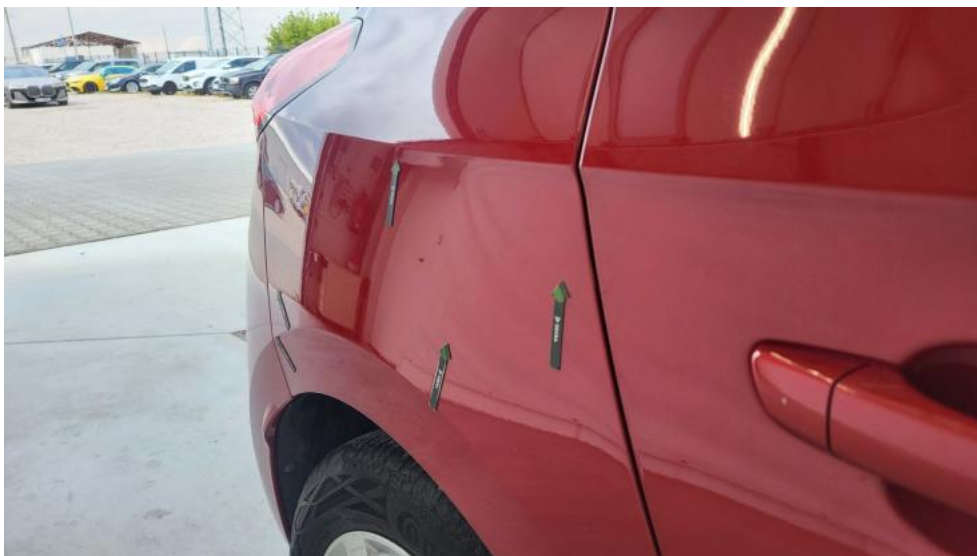


Photo 53.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1



Photo 54.

Felga aluminiowa tylna P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Pokrywy bagażnika - Rysa/odprysk 1



Photo 56.

Pokrywy bagażnika - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.
Pokrywy bagażnika - Inne 1



Photo 58.
Zderzak tylny - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Zderzak tylny - Wgniecenie/odkształcenie 1



Photo 60.

Zderzak tylny - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Dach - Rysa/odprysk 1



Photo 62.

Łotnik tylny L / Ściana boczna L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION

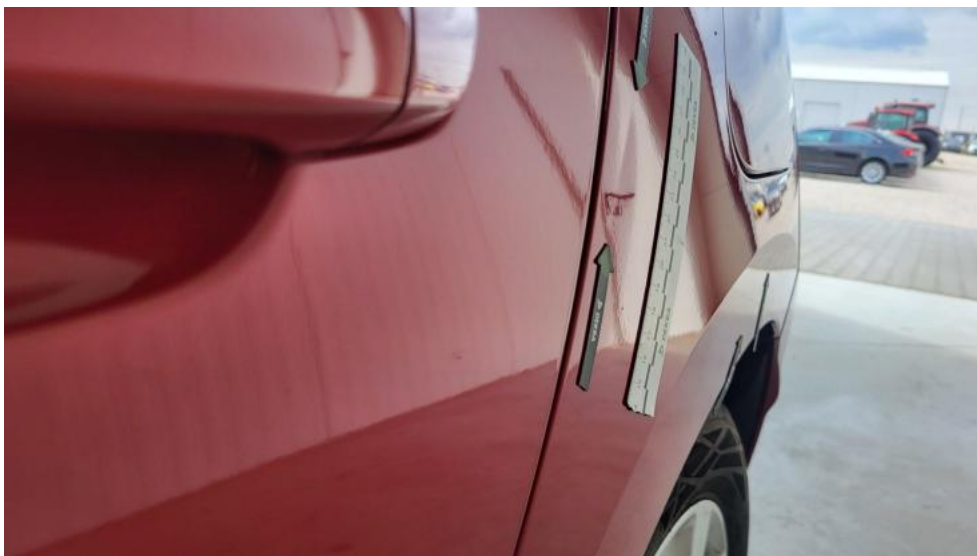


Photo 63.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1



Photo 64.

Drzwi przed L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Drzwi przed L - Wgniecenie/odkształcenie 1



Photo 66.

Drzwi tylne L - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 67.

Drzwi tylne L - Rysa/odprysk 1



Photo 68.

Drzwi tylne L - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Drzwi tylne L - Wgniecenie/odkształcenie 1



Photo 70.

Drzwi tylne L - Wgniecenie/odkształcenie 2

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Klamka drzwi prz L - Rysa/odprysk 1



Photo 72.

Klamka drzwi tyl L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 73.

Słupek przedni L - Rysa/odprysk 1



Photo 74.

Ślotnik przedni L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 75.

Błotnik przedni L - Rysa/odprysk 2



Photo 76.

Błotnik przedni L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 77.

Felga Aluminiowa przednia L - Rysa/odprysk 1



Photo 78.

Fotel prz. lew. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 79.

Fotel prz. praw. - Inne 1



Photo 80.

Osłona p/słoneczna lewa - Inne 1