

DEKRA's commission No. : PKOL(W)/LODZ/56391/25/07/31
commission/ damage No. : 20/002083
Date of commission: 31-07-2025

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (NEW)
DEKRA Polska - współpraca O/Warszawa
Andrzej Sosnowski
DEKRA Polska - Centrala

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	jeeps
EC code (Eurotax)	0125126
Manufacturer	JEEP
Model	Grand Cherokee 16-20
Type / version	Gr. Cherokee 6.4 V8 SRT8
Body type	KOM
Number of doors / seats	5/5
Curb weight [kg]	2343
Gross vehicle weight [kg]	2949
Wheelbase 1/2	2915
Engine type	spark ignition
Pollution reduction system	three-way catalytic converter
Engine capacity [ccm]	6417
Engine Power [hp/kW]	468/344
Gearbox	automatic
Registration /record No.	WZ6228Y
VIN / serial number	1C4RJFDJ1KC748431
Date of first registration	12-08-2019
Date of next. tech. test	23-01-2026
Year of manufacture	2019 (year has been verified with the manufacturer's base)
Readout [km]	141 718 (read)
Body color / type of coating	black/double-layered, metallized

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	FALKEN, EUROWINTER HS01 SUV	295/40 20 110V	8,0 mm
	left	FALKEN, EUROWINTER HS01 SUV	295/40 20 110V	8,0 mm
back	right	FALKEN, EUROWINTER HS01 SUV	295/40 20 110V	8,5 mm
	left	FALKEN, EUROWINTER HS01 SUV	295/40 20 110V	8,5 mm

Standard equipment by Eurotax

- | | |
|---|---|
| 1. Active body control, Selectable driveline characteristics | 46. Leather upholstery |
| 2. Adaptive Cruise Control | 47. Light Alloy wheels 20" |
| 3. Alarm | 48. Limited slip differential: other |
| 4. Antilock-Brake-System (ABS) | 49. Lumbar adjust driver electric, Lumbar adjust passenger electric |
| 5. Automated High-beam assist | 50. On board monitor |
| 6. Automatic climate control | 51. Other |
| 7. Automatic headlight elevation control | 52. Other |
| 8. Bi-Xenon Head lamps | 53. Other |
| 9. Blind spot warning | 54. Other |
| 10. Bluetooth interface, Bord entertainment: other accessories, Navigation system | 55. Other |
| 11. Bluetooth interface, Hands-free system, Voice control for audiosystem, Voice control for navigation system, Voice control for telephone | 56. Other |
| 12. Bord communication: other | 57. Other |
| 13. Child seat fixation | 58. Other |
| 14. Collision Warning System | 59. Other |
| 15. Diminished spare wheel | 60. Other, Rear-view mirror autodimming |
| 16. Door mirror with memory, Memory seat | 61. Park Assistant |
| 17. Door mirror(s) electrically adjustable in general, Door mirrors autodimming, Door mirrors electrically foldable, Door mirrors heated | 62. Park Assistant |
| 18. Double slide sunroof electric | 63. Power assisted brakes |
| 19. Driver airbag, Head airbags front, Head airbags rear, Passenger airbag, Side airbag driver, Side airbag driver and passenger | 64. Power assisted brakes |
| 20. Driver knee airbag | 65. Power windows front, Power windows rear |
| 21. Driver seat electrically adjustable, Memory seat, Passenger seat electrically adjustable | 66. Pre-Crash System |
| 22. ESP (Electronical Stabilizing Program) | 67. Rain sensor |
| 23. Electric tailgate | 68. Rear bench foldable in two separate parts |
| 24. Exterior design: other | 69. Rear seat heating |
| 25. Exterior design: other | 70. Rear view camera |
| 26. Exterior design: other | 71. Selectable driveline characteristics |
| 27. Exterior design: other | 72. Selectable driveline characteristics |
| 28. Exterior design: other | 73. Servotronic |
| 29. Exterior design: other | 74. Soundsystem |
| 30. Exterior thermometer, On board computer, Other | 75. Sport suspension |
| 31. Extra power outlet | 76. Steering wheel electrically adjustable |
| 32. Floor mat | 77. Steering wheel heated |
| 33. Floor mat | 78. Steering wheel with gear-switches |
| 34. Fog lamps | 79. Steering: other |
| 35. Headlamp wash | 80. Telematic |
| 36. Heated seat driver, Heated seat passenger | 81. Tinted rear windows |
| 37. Hill holder | 82. Tyre pressure control (RDC) |
| 38. Interior: other | 83. USB in |
| 39. Keyless go | 84. USB in |
| 40. LED Daytime running lights | 85. Uni-Lackierung |
| 41. LED rear lights | 86. Vehicle immobilizer |
| 42. Lane control assistant | 87. Ventilated front seat |
| 43. Leather finish dashboard | 88. Whiplash-protection-system |
| 44. Leather gearshifter/switch | 89. {TSC - system stabilizacji toru jazdy przyczepy} |
| 45. Leather steering wheel, Sports steering wheel | |

Dealer's equipment (selected items)

1. Light Alloy wheels 20'' -
2. Metalic paint -

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

Corrections

First registration

Mileage

Equipment

Tyres

Other

Current market situation -
Earlier repairs -
Braki, uszkodzenia stan, weryfikacja serwisowa -


Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 08-2025 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 18-08-2025

DEKRA's expert:
Kacper Sosnowski (NEW)
Andrzej Sosnowski

Document issued electronically valid without signature.

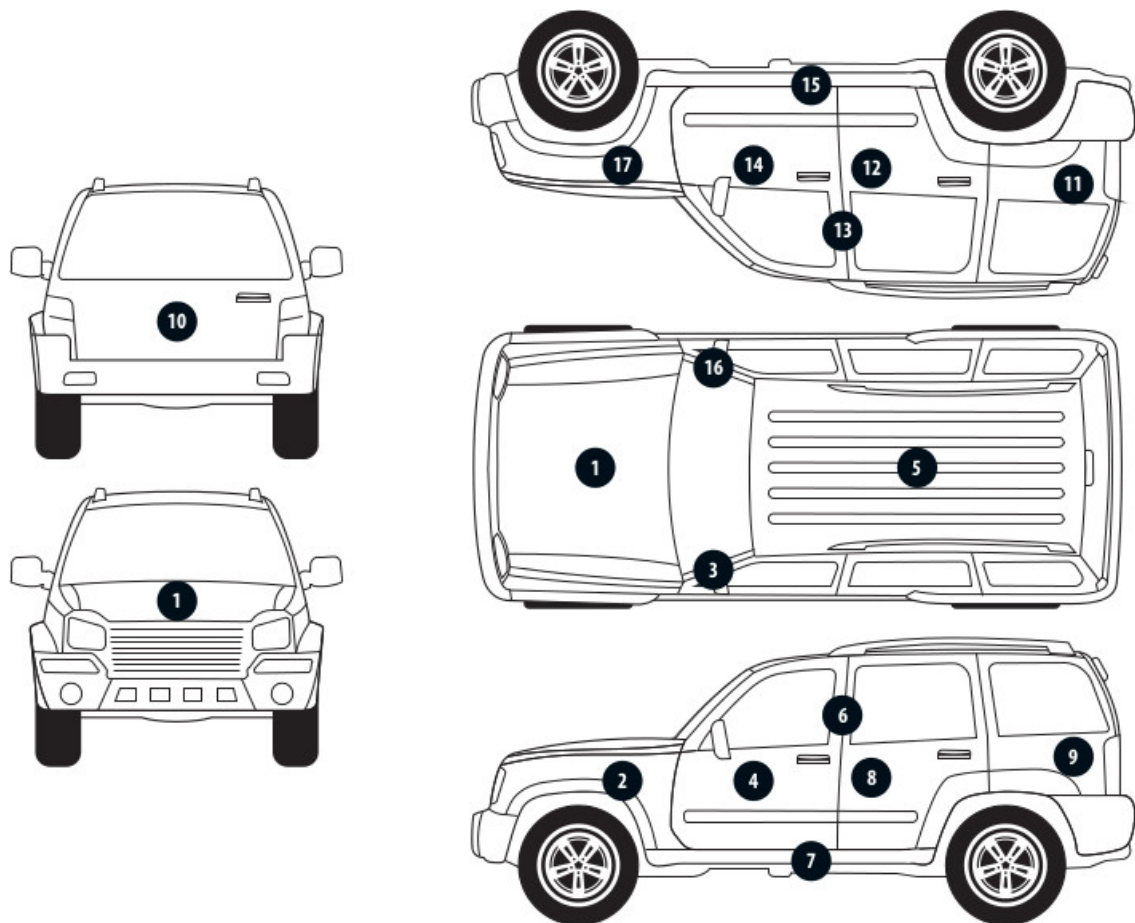Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [µm]
1	Front cover	150 - 300
2	Left front fender	150 - 300
3	Left front pillar	150 - 300
4	Left front wall	150 - 300
5	Roof	150 - 300
6	Left middle pillar	to 150
7	Left side sill	to 150
8	Left rear wall	150 - 300
9	Left side wall	150 - 300
10	Cover/tailgate	150 - 300
11	Side right wall	150 - 300
12	Rear right door	150 - 300
13	Middle right pillar	to 150
14	Front right door	150 - 500
15	Right side sill	to 150
16	Right front pillar	150 - 300
17	Right front fender	150 - 1000

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book of the vehicle was not provided.

Information concerning the origin of the vehicle

Lack of reliable data.

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below: ograniczenia placowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

Anti-theft protection

fabryczne

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.
- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation**Kluczyki**

TAK

1

Expert comments - regarding valuation

Lewy przedni reflektor luźny. Nierówna praca silnika. Rysy na samochodzie. Odpryski na szybie czołowej. Widoczne wady lakiernicze.

Rzeczoznawca dokonał oględzin pojazdu w warunkach parkingowych, co mogło ograniczyć pełną ocenę jego stanu technicznego. Dodatkowo, jeżeli jazda próbna została przeprowadzona (informacje w treści raportu), to wykonano ją w warunkach parkingowych, z niewielką prędkością, co może nie odzwierciedlać pełnych warunków eksploatacyjnych. Istnieje możliwość, że w innych okolicznościach ujawnią się dodatkowe uszkodzenia lub usterki, których nie można było wykryć podczas obecnych oględzin. Zalecamy zatem skorzystanie z możliwości oględzin pojazdu we własnym zakresie lub w Autoryzowanej Stacji Obsługi danej marki, co pozwoli na pełniejszą weryfikację stanu technicznego pojazdu przed udziałem w aukcji."

Restrictive disclaimer - regarding valuation

Nie weryfikowano szczegółowo stanu układu napędowego, zawieszenia, kierowniczego, hamulcowego oraz wydechowego. Ocena została wykonana bez użycia podnośnika i specjalistycznego sprzętu diagnostycznego, nie dokonywano demontażu osłon i innych elementów. Ocena określa ogólny stan pojazdu na dzień oględzin w miejscu jego udostępnienia, nie może być zatem traktowana jako kompleksowa ocena stanu technicznego. Specyfikacja wg. programu operacyjnego w zakresie wyposażenia standardowego i dodatkowego nie gwarantuje zgodności ze stanem faktycznym w zakresie możliwym do ustalenia przez rzeczoznawcę podczas oględzin pojazdu.

Pomiar grubości powłoki lakierowej wykonano w miejscach możliwych do ich wykonania pomiary nie gwarantują oryginalności poszczególnych elementów poddanych ocenie.

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.

Przekątna przednia lewa



Photo 2.

Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.

Bok prawy z tyłu



Photo 6.

Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.

Próg lewy (widok od przodu)



Photo 12.

Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód

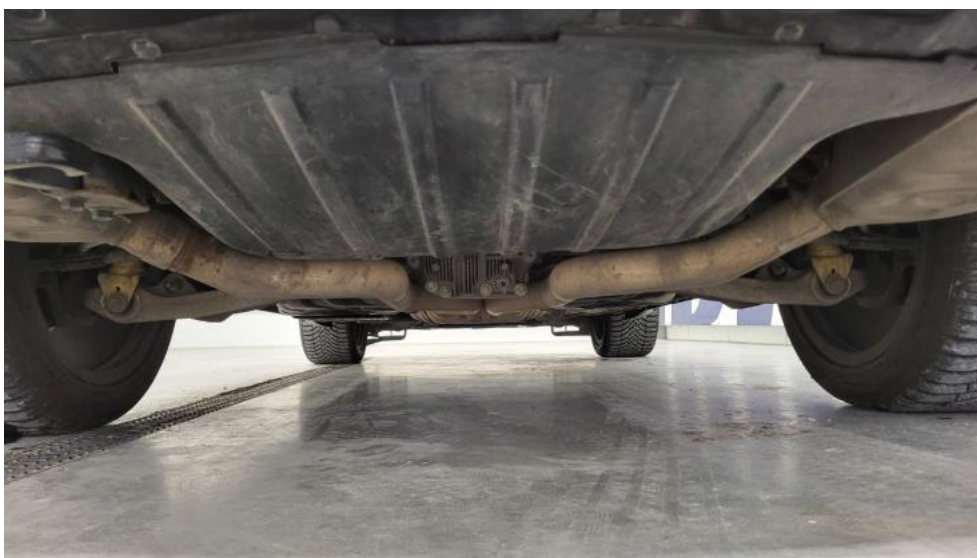


Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION

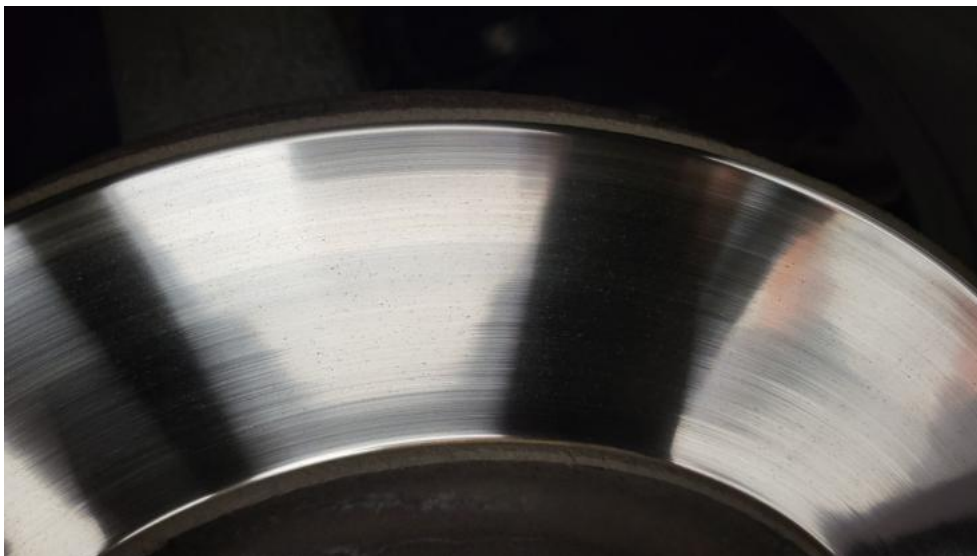


Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION

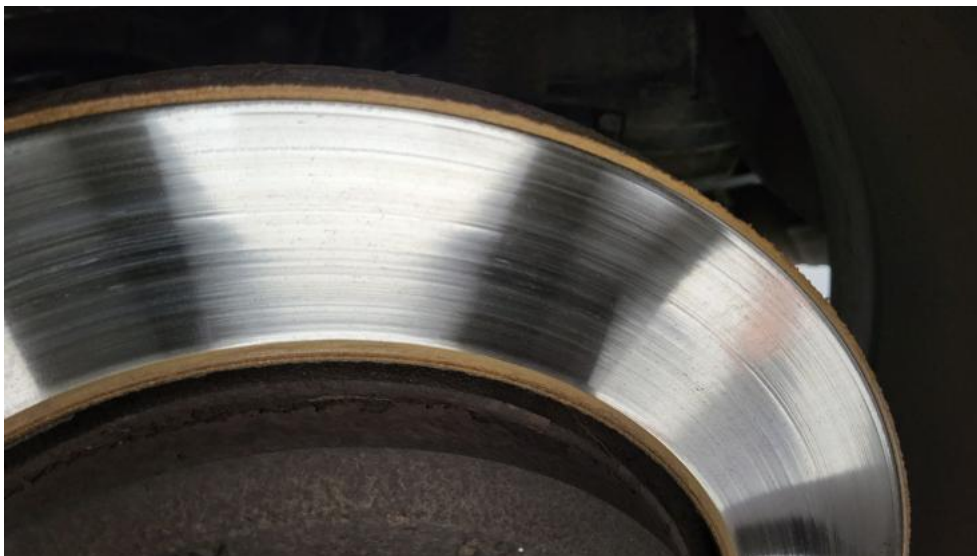


Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika



Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION

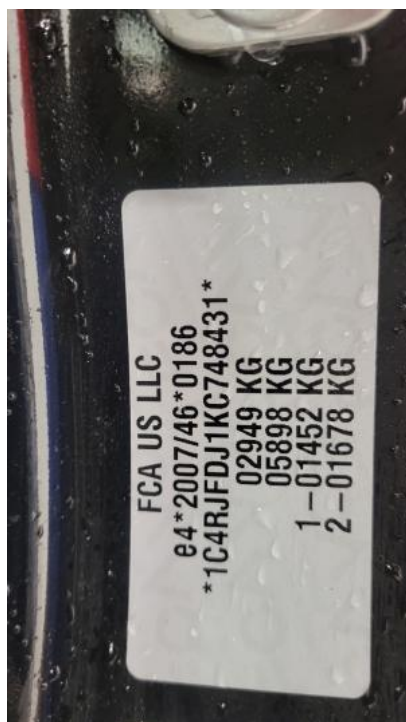


Photo 23.

Tabliczka znamionowa



Photo 24.

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe

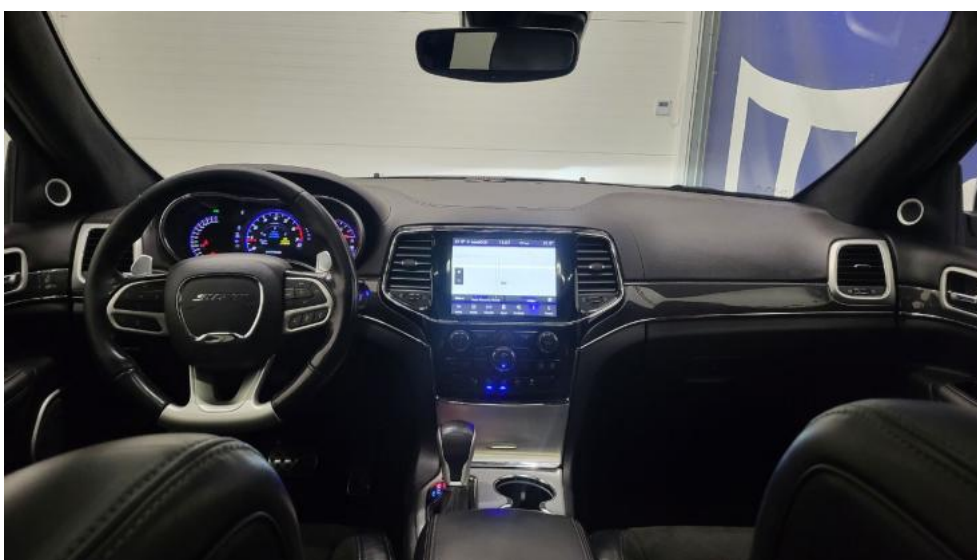


Photo 28.

Widok z tylnej kanapy na deskę rozdz.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.

Konsola środkowa



Photo 30.

Tunel środkowy

A detailed view of the driver's side interior of a 2015 Chevrolet Camaro SS. The steering wheel is black with silver accents and features the 'SS' logo in the center. Behind the wheel is a digital instrument cluster with blue and red lighting. To the right of the steering wheel is a large infotainment screen displaying a navigation map. The dashboard and center console are black with silver trim. The driver's side door panel is visible on the left, showing a silver door handle and a speaker. The overall interior is black with silver accents.

[illegible]

DEKRA Polska Sp. z o.o.
02-673 Warszawa, ul. Konstruktorska 12A
www.dekra.pl

PHOTOGRAPHIC DOCUMENTATION



Photo 33.

Dow. Rej. Str.2 i klucze



Photo 34.

Instrukcje

PHOTOGRAPHIC DOCUMENTATION



Photo 35.

Zdjęcie do protokołu



Photo 36.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 37.

Zdjęcie do protokołu



Photo 38.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Zdjęcie do protokołu

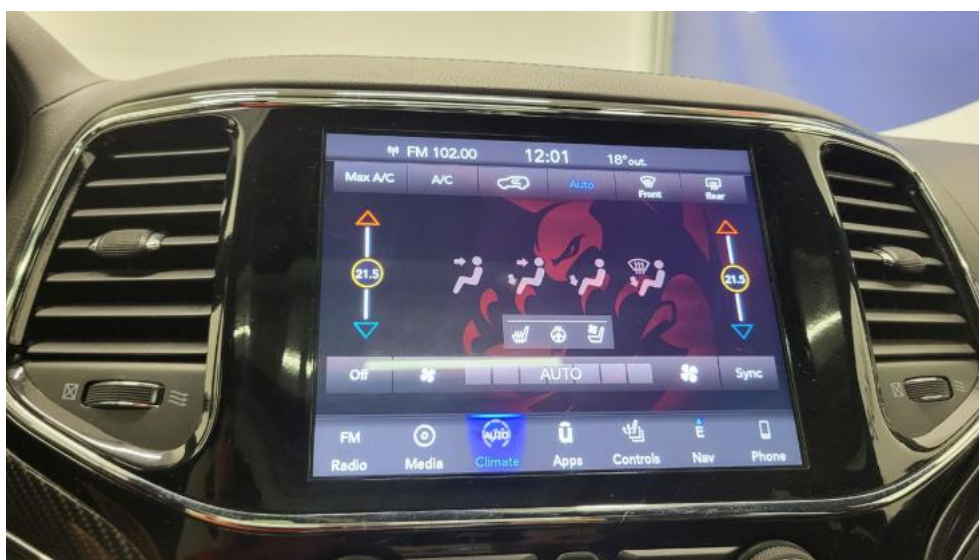


Photo 40.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Zdjęcie do protokołu



Photo 42.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Atrapa przednia - Rysa/odprysk 1



Photo 44.

Pokrywa komory silnika - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Pokrywa komory silnika - Inne 1



Photo 46.

Pokrywa komory silnika - Inne 2

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Błotnik przedni P - Wgniecenie/odkształcenie 1



Photo 48.

Felga aluminiowa przednia P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Listwa błotnika przedniego P - Rysa/odprysk 1



Photo 50.

Listwa błotnika przedniego P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Opona przednia P - Pęknięcie/rozerwanie 1



Photo 52.

Drzwi przednie P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Drzwi przednie P - Wgniecenie/odkształcenie 2



Photo 54.

Listwa drzwi tylnych P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Listwa drzwi tylnych P - Wgniecenie/odkształcenie 1



Photo 56.

Ścianka tylna P / Ścianka boczna P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Listwa krawędzi błotnika tyl P - Wgniecenie/odkształcenie 1



Photo 58.

Pokrywy bagażnika - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Zderzak tylny - Rysa/odprysk 1



Photo 60.

Zderzak tylny - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Zderzak tylny() - Rysa/odprysk 3



Photo 62.

Zderzak tylny cz dolna - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1



Photo 64.

Drzwi przed L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Drzwi przed L - Wgniecenie/odkształcenie 1



Photo 66.

Listwa drzwi przednich L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 67.

Listwa drzwi tylnych L - Rysa/odprysk 1



Photo 68.

Lusterko zew L - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Próg L - zdjęcie poglądowe 1

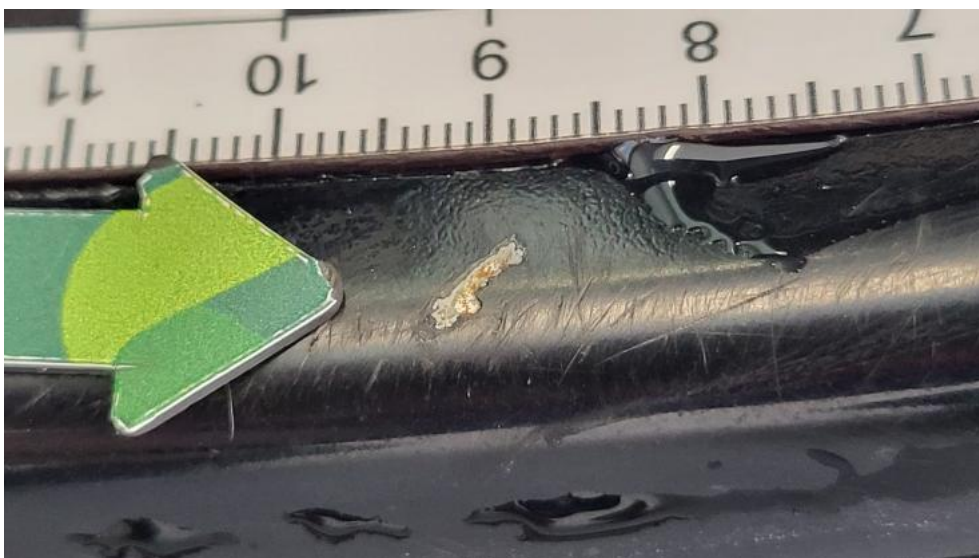


Photo 70.

Próg L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Błotnik przedni L - Inne 1



Photo 72.

Fotel prz. lew. - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 73.

Fotel prz. lew. - Inne 1



Photo 74.

Fotel prz. praw. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 75.

Tapicerka drzwi przednich L - Wgniecenie/odkształcenie 1



Photo 76.

Wykładzina pokrywy tylnej - Rysa/odprysk 1