

DEKRA's commission No. : PKOL(W)/LODZ/18912/25/03/14
commission/ damage No. : 21/060437
Date of commission: 14-03-2025

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (NEW)
DEKRA Polska - współpraca O/Warszawa
inż. Józef Orłowski
TU - Włocławek

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0145353
Manufacturer	BMW
Model	Seria 5 [G30/F90] 20-23
Type / version	520d xDrive mHEV M Sport sport-aut
Body type	sedan
Number of doors / seats	4/5
Curb weight [kg]	1735
Gross vehicle weight [kg]	2405
Wheelbase 1/2	2975
Engine type	Automatic ignition
Pollution reduction system	KSC
Engine capacity [ccm]	1995
Engine Power [hp/kW]	190/140
Gearbox	automatic 8- gear
Registration /record No.	DW3RE59
VIN / serial number	WBA51BL090WX57208
Date of first registration	12-01-2022
Date of next. tech. test	12-01-2025
Year of manufacture	2021 (year has been verified with the manufacturer's base)
Readout [km]	89 849 (read)
Body color / type of coating	grafitowy/METALIK

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	PIRELLI, SOTTOZERO	245/45 18 100Y	4,0 mm
	left	PIRELLI, SOTTOZERO	245/45 18 100Y	4,0 mm
back	right	PIRELLI, SOTTOZERO	245/45 18 100Y	3,5 mm
	left	PIRELLI, SOTTOZERO	245/45 18 100Y	3,5 mm

Standard equipment by Eurotax

- | | |
|---|---|
| 1. Additional gauges, Navigation system, On board monitor, Touchscreen monitor | 30. Interior decoration: other |
| 2. Aerodynamics package, Exterior design: other | 31. Interior lights: other accessories |
| 3. Alarm | 32. Interior: other |
| 4. Alcantara upholstery, Textile upholstery | 33. LED front dim light |
| 5. Android Auto, Apple CarPlay | 34. LED rear lights |
| 6. Armrest (s) front | 35. Leather steering wheel, Sports steering wheel |
| 7. Armrest (s) rear | 36. Light Alloy wheels 18" |
| 8. Automatic climate control | 37. Mobile Tire System |
| 9. Automatic dimlight activation, Rain sensor | 38. Mobile phone |
| 10. Bord communication: other | 39. Multi functional steering wheel |
| 11. Bord communication: other | 40. Other |
| 12. Bord communication: other | 41. Other |
| 13. Bord communication: other | 42. Other |
| 14. Bord entertainment: other accessories | 43. Other |
| 15. Child seat fixation | 44. Other |
| 16. Collision Warning System, Other | 45. Other |
| 17. Colored glass | 46. Park Distance Control front, Park Distance Control rear |
| 18. Cruise control | 47. Rear seat-backs foldable in two separate parts |
| 19. DAB radio | 48. Rear-view mirror autodimming |
| 20. Door mirror(s) electrically adjustable in general, Door mirrors heated | 49. Selectable driveline characteristics |
| 21. Door mirrors autodimming | 50. Servotronic |
| 22. Door mirrors electrically foldable | 51. Sport seats front |
| 23. Driver airbag, Head airbags front, Head airbags rear, Passenger airbag, Side airbag driver and passenger, Side airbags rear | 52. Start/Stop system |
| 24. Driver seat electrically adjustable, Passenger seat electrically adjustable | 53. Steering wheel manually adjustable |
| 25. ESP (Electronical Stabilizing Program), Traction control | 54. Telematic |
| 26. Exterior design: other | 55. Tie-down ring |
| 27. Exterior design: other | 56. Uni-Lackierung |
| 28. Floor mat | 57. Wheel bolt locks |
| 29. Follow me home | 58. Windscreen wash-nozzle heated |

Dealer's equipment (selected items)

- | | |
|--|---|
| 1. Automated High-beam assist | - |
| 2. Automated High-beam assist, Cornering Headlights, LED front dim light | - |
| 3. Bord communication: other | - |
| 4. Heated seat driver, Heated seat passenger | - |
| 5. Metallic paint | - |
| 6. Rear view camera | - |
| 7. Soundsystem | - |
| 8. Sport suspension | - |

Base value of the vehicle

Base value of the vehicle by Eurotax (net)

Corrections

First registration

Mileage

Equipment

Tyres

Other

stwierdzone braki i uszkodzenia -

Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 03-2025 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 20-03-2025

DEKRA's expert:
Kacper Sosnowski (NEW)
inż. Józef Orłowski

Document issued electronically valid without signature.

Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Front left fender	to 150
3	Left front pillar	to 150
4	Front left door	to 150
5	Roof	to 150
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	to 150
9	Rear left fender	to 150
10	Cover/lid	to 150
11	Right rear fender	to 150
12	Right rear door	to 150
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	to 150
16	Right front pillar	to 150
17	Front right fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book was presented and its number is given below:
elektroniczna

Information concerning the origin of the vehicle

The vehicle purchased domestically from an authorized representative of the brand.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below:
ograniczenia parkingowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of

the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

1

Expert comments - regarding valuation

W samochodzie nieprzyjemny zapach po papierosach. Nietypowe odgłosy z komory silnika do weryfikacji serwisowej. Dywanik prawy przód przepalony. Roleta chłodnicy do weryfikacji. Brak płynu zestawu naprawczego. Termin przeglądu minął 210km temu. Aktywna kontrolka serwisu. Rysy na samochodzie. Odpryski na szybie czołowej.

Rzeczoznawca dokonał oględzin pojazdu w warunkach parkingowych, co mogło ograniczyć pełną ocenę jego stanu technicznego. Dodatkowo, jeżeli jazda próbna została przeprowadzona (informacje w treści raportu), to wykonano ją w warunkach parkingowych, z niewielką prędkością, co może nie odzwierciedlać pełnych warunków eksploatacyjnych. Istnieje możliwość, że w innych okolicznościach ujawnią się dodatkowe uszkodzenia lub usterki, których nie można było wykryć podczas obecnych oględzin.

Zalecamy zatem skorzystanie z możliwości oględzin pojazdu we własnym zakresie lub w Autoryzowanej Stacji Obsługi danej marki, co pozwoli na pełniejszą weryfikację stanu technicznego pojazdu przed udziałem w aukcji.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.

Bok prawy z tyłu



Photo 6.

Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.

Próg lewy (widok od przodu)



Photo 12.

Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika

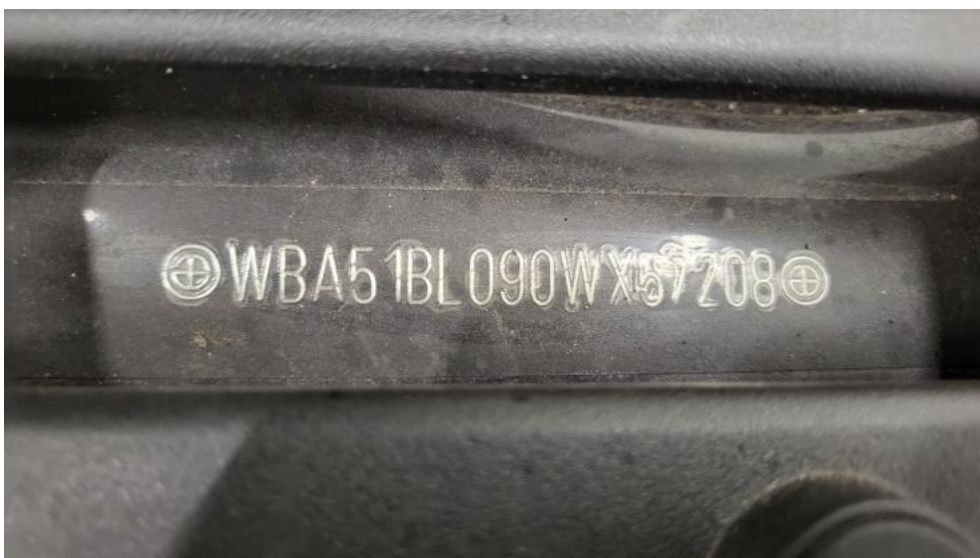


Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION



Photo 23.

Tabliczka znamionowa



Photo 24.

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe

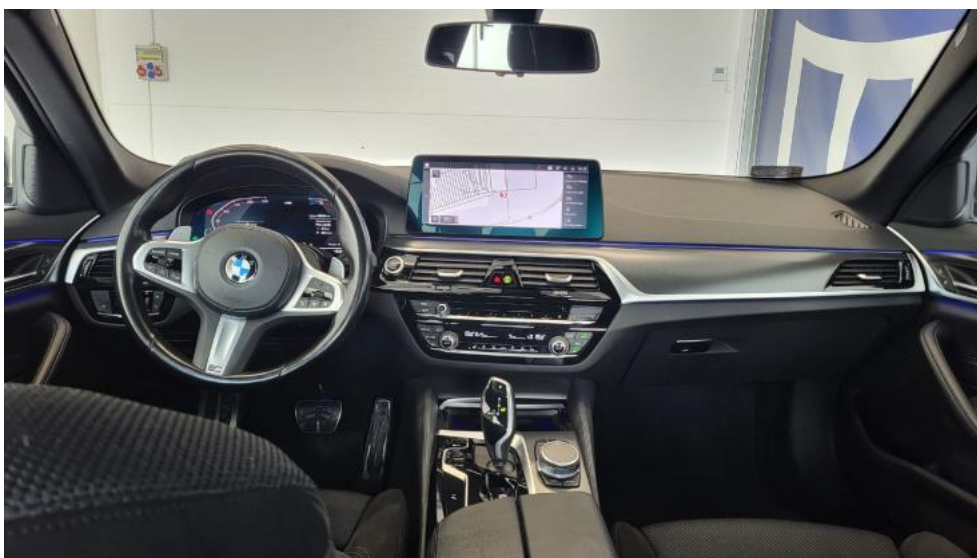


Photo 28.

Widok z tylnej kanapy na deskę rozdz.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.

Konsola środkowa



Photo 30.

Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION**Photo 31.**

Kierownica (na wprost)

RODZAJ POJAZDU SAMOCHÓD OSOBOWY		C.1.1 PKO LEASING S.A. IV ODDZIAŁ WE WROCŁAWIU C.1.2 47219176700720 C.1.3 58-428 WROCŁAW KRAKOWSKA 119		WSPÓLNOTA EUROPEJSKA RZECZPOSPOLITA POLSKA Dowód Rejestracyjny	
PRZELICZENIE ---		C.2.1 PKO LEASING S.A. IV ODDZIAŁ WE WROCŁAWIU C.2.2 47219176700720 C.2.3 58-428 WROCŁAW KRAKOWSKA 119		PREZYDENT WROCŁAWIA UL. G. ZAPOLSKIEJ 4 50-032 WROCŁAW	
ROK PRODUKCJI 2021		C F.1 2405 kg F.2 2405 kg F.3 4405 kg		ORGAN WYDAJĄCY A DW 3RE59	
DOPUSZCZALNA CIĘŻAR NOŚNA ---		G 1735 kg J M1		D.1 BMW D.2 G5L -51BL -1AAS0000	
NAWIEKSIZY DOP. NACISK OSI 13,03 kN		K e1*2007/46*1688*15		D.3 520D XDRIVE	
NIEKASY POJAZDU AAD3646630		L 2 O.1 2000 kg O.2 750 kg		E WBA51BL090WX57208	
		P.1 1995,00 cm³ P.2 140,00 kW		B 12.01.2022 17.01.2022 H ---	
SERIA DR/ BAS 0165783		P.3 D EE Q ---		SERIA DR/ BAS 0165783	
		S.1 5 S.2 ---			

Photo 32.

Dowód rej. Str. 1

PHOTOGRAPHIC DOCUMENTATION



Photo 33.

Dow. Rej. Str.2 i klucze



Photo 34.

Książka serwisowa – dane

PHOTOGRAPHIC DOCUMENTATION



Photo 35.

Książka serwisowa – ostatni przegląd



Photo 36.

Instrukcje

PHOTOGRAPHIC DOCUMENTATION



Photo 37.

Zestaw naprawczy koła

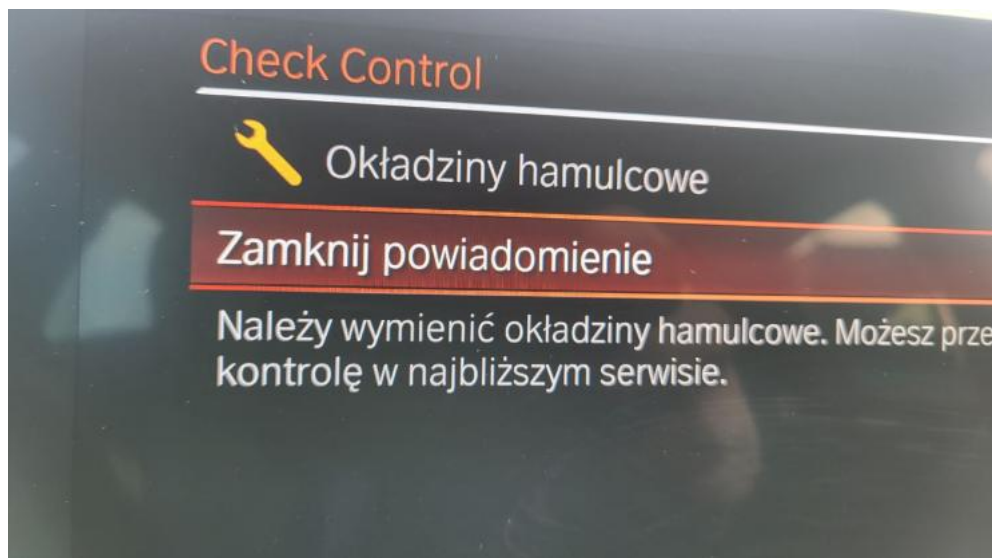


Photo 38.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Zdjęcie do protokołu



Photo 40.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Atrapa przednia - Pęknięcie/rozerwanie 1



Photo 42.

Atrapa przednia - Inne 1

PHOTOGRAPHIC DOCUMENTATION

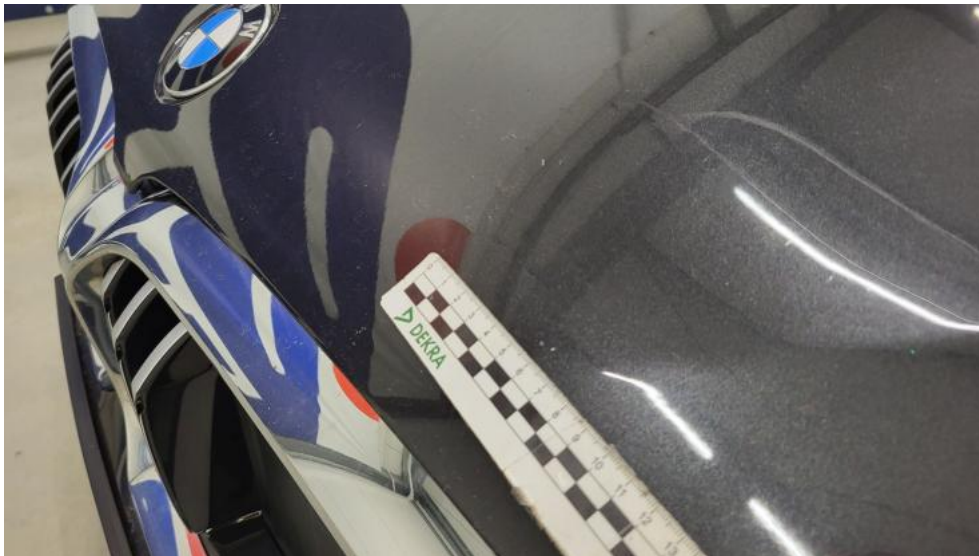


Photo 43.

Pokrywa komory silnika - Rysa/odprysk 1



Photo 44.

Pokrywa komory silnika - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Szyba czołowa - zdjęcie poglądowe 1

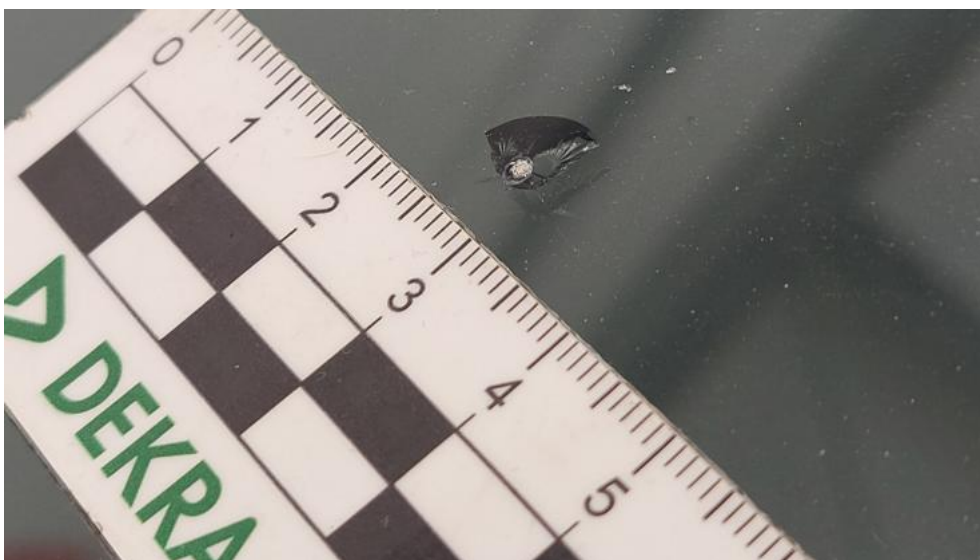


Photo 46.

Szyba czołowa - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Zderzak - Rysa/odprysk 1



Photo 48.

Zderzak - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Zderzak() - Rysa/odprysk 3



Photo 50.

Zderzak - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Felga aluminiowa przednia P - Rysa/odprysk 1



Photo 52.

Felga aluminiowa przednia P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Drzwi tylne P - Rysa/odprysk 1



Photo 54.

Łotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Felga aluminiowa tylna P - Rysa/odprysk 1



Photo 56.

Opona tylna P - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Drzwi przed L - Rysa/odprysk 1

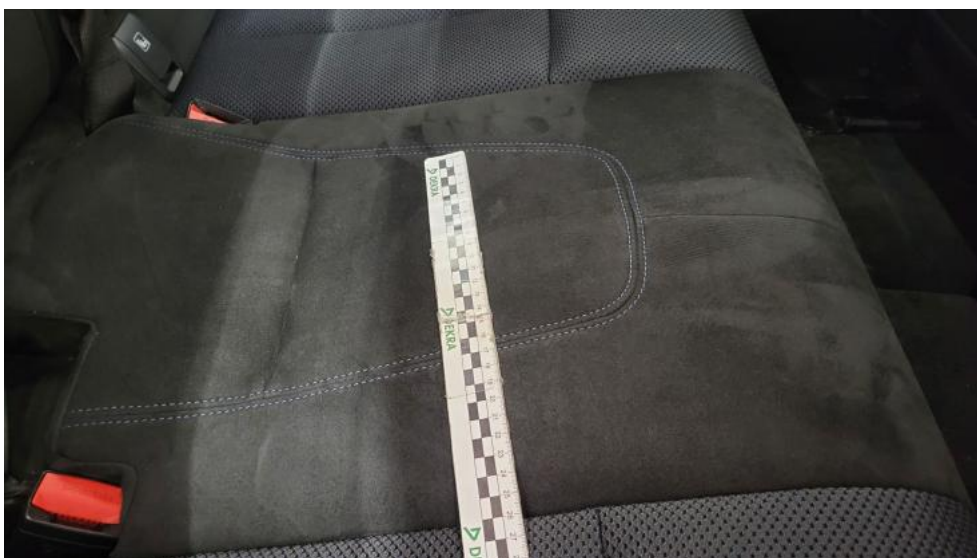


Photo 58.

Kanapa tyl. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Zaglówek fotela prz. P - Inne 1



Photo 60.

Tapicerka drzwi przednich P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Tapicerka drzwi tylnych L - Wgniecenie/odkształcenie 1



Photo 62.

Dywanik prze P - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Wykładzina podłogi bagażnika - Wgniecenie/odkształcenie 1