

DEKRA's commission No. : PKOL(W)/LODZ/08070/26/01/30
commission/ damage No. : 21/012591
Date of commission: 30-01-2026

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (WSP)
DEKRA Polska - współpraca O/Warszawa
Tomasz Ziemniak (WSP)
DEKRA Polska - współpraca O/Konin

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0142558
Manufacturer	LEXUS
Model	LC Convertible 20-24
Type / version	LC 500 Prestige
Body type	CAB
Number of doors / seats	2/4
Curb weight [kg]	2047
Gross vehicle weight [kg]	2450
Wheelbase 1/2	2870
Engine type	spark ignition
Pollution reduction system	three-way catalytic converter
Engine capacity [ccm]	4969
Engine Power [hp/kW]	464/341
Gearbox	automatic 10- gear
Registration /record No.	WZ855CL
VIN / serial number	JTHFPAAY20A101890
Date of first registration	25-03-2021
Date of next. tech. test	25-03-2026
Year of manufacture	2021 (year has been verified with the manufacturer's base)
Readout [km]	74 045 (read)
Body color / type of coating	blue/METALIK

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	CONTINENTAL, SPORTCONTACT 7	265/35 22 102Y	4,0 mm
	left	CONTINENTAL, SPORTCONTACT 7	265/35 22 102Y	4,0 mm
back	right	CONTINENTAL, SPORTCONTACT 7	295/30 22 103Y	3,0 mm
	left	CONTINENTAL, SPORTCONTACT 7	295/30 22 103Y	3,0 mm

Standard equipment by Eurotax

- | | |
|---|---|
| 1. Active body control | 28. Limited slip differential in general |
| 2. Adaptive Cruise Control | 29. Memory seat |
| 3. Alarm, Vehicle immobilizer | 30. Navigation system, Other |
| 4. Apple CarPlay | 31. On board monitor |
| 5. Automated High-beam assist | 32. Other |
| 6. Bord entertainment: other accessories | 33. Other |
| 7. Bord entertainment: other accessories, Soundsystem | 34. Other |
| 8. Door mirror with memory | 35. Other |
| 9. Door mirror(s) electrically adjustable in general, Door mirrors heated | 36. Other |
| 10. Door mirrors autodimming | 37. Park Distance Control front, Park Distance Control rear |
| 11. Door: other | 38. Pre-Crash System |
| 12. Driver airbag, Passenger airbag | 39. Pre-Crash System |
| 13. Driver knee airbag, Passenger knee airbag | 40. Rain sensor |
| 14. Driver seat electrically adjustable, Passenger seat electrically adjustable | 41. Rear view camera |
| 15. Dualzone automatic climate control | 42. Rear-view mirror autodimming |
| 16. Electric parking brake | 43. Side airbag driver and passenger |
| 17. Exterior design: other | 44. Sport seats front |
| 18. Head airbags front, Head airbags rear | 45. Steering wheel electrically adjustable |
| 19. Headlamp wash | 46. Steering wheel heated |
| 20. Heated seat driver, Heated seat passenger | 47. Storage facilities in general |
| 21. Hill holder | 48. Textile top, Top: electrically operated |
| 22. Interior decoration: other | 49. Textile upholstery |
| 23. Interior decoration: other | 50. Traffic sign recognition |
| 24. Keyless entry, Keyless go | 51. Tyre pressure control (RDC) |
| 25. LED front dim light | 52. Uni-Lackierung |
| 26. Lane control assistant | 53. Ventilated front seat |
| 27. Leather upholstery | |

Additional equipment

1. Felgi aluminiowe 22 z ogumieniem -

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

CorrectionsFirst registrationMileageEquipmentTyres

Other

Korekta z tytułu uszkodzeń pojazdu -

Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 02-2026 POL) with regard to technical and market parameters affecting the value of the vehicle.


Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 16-02-2026

DEKRA's expert:
Kacper Sosnowski (WSP)
Tomasz Ziemniak (WSP)

Document issued electronically valid without signature.

Measurement of thickness of the vehicle lacquer coating

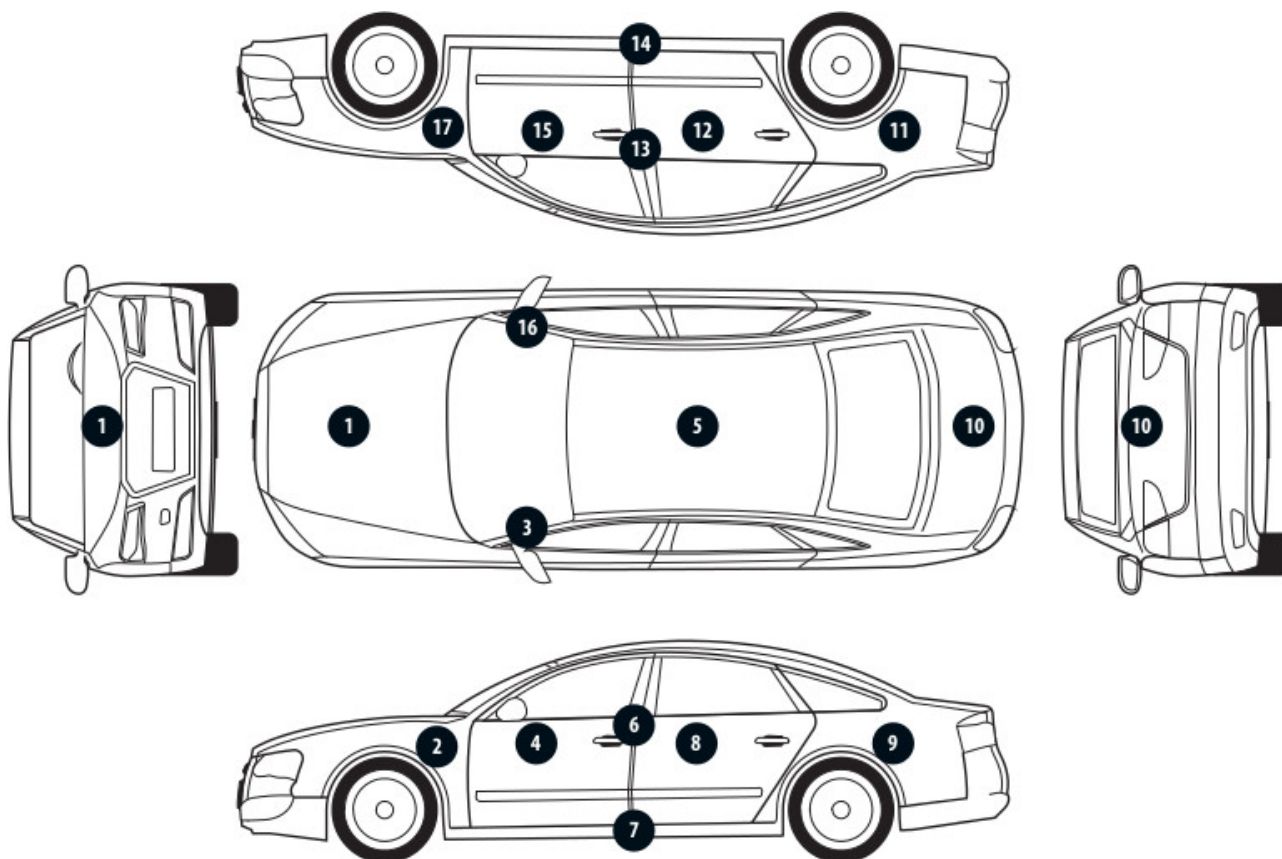

No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	150 - 500
2	Front left fender	150 - 500
3	Left front pillar	150 - 500
4	Front left door	150 - 500
6	Left middle pillar	150 - 500
7	Right side sill	150 - 500
9	Rear left fender	150 - 500
11	Right rear fender	150 - 500
13	Right middle pillar	150 - 500
14	Right side sill	150 - 500
15	Front right door	150 - 500
16	Right front pillar	150 - 500
17	Front right fender	150 - 500

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book was presented and its number is given below:

C/972238/201

Information concerning the origin of the vehicle

The vehicle purchased domestically from an authorized representative of the brand.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

The test drive has been conducted on a distance and in time enabling rough estimation of the technical condition of the vehicle.

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of

the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

2

Expert comments - regarding valuation

Niesprawne silowniki pokrywy silnika, pokrywa opada. Pojazd oklejony folią, pomiar lakieru wykonany na folii. Lusterka oklejone folią. Odpryski na szybie czołowej. Rysy na samochodzie.

Restrictive disclaimer - regarding valuation

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.

Bok prawy z tyłu



Photo 6.

Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.
Próg lewy (widok od przodu)



Photo 12.
Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika



Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION



Photo 23.
Tabliczka znamionowa



Photo 24.
Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe



Photo 28.

Widok z tylnej kanapy na deskę rozdziel.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.

Konsola środkowa



Photo 30.

Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION



Photo 31.

Kierownica (na wprost)

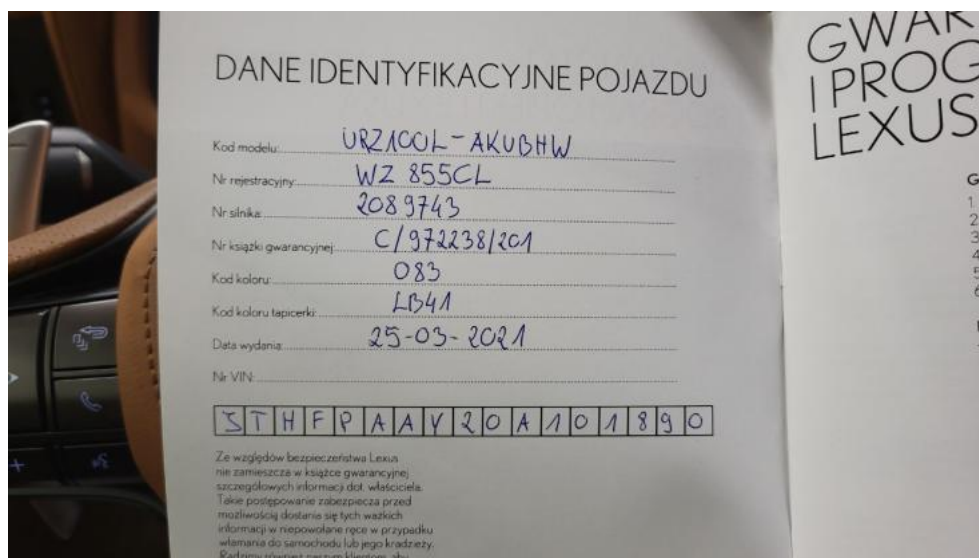


Photo 32.

Dowód rej. Str. 1

PHOTOGRAPHIC DOCUMENTATION**Photo 33.**

Dow. Rej. Str.2 i klucze

**Photo 34.**

Książka serwisowa – dane

PHOTOGRAPHIC DOCUMENTATION

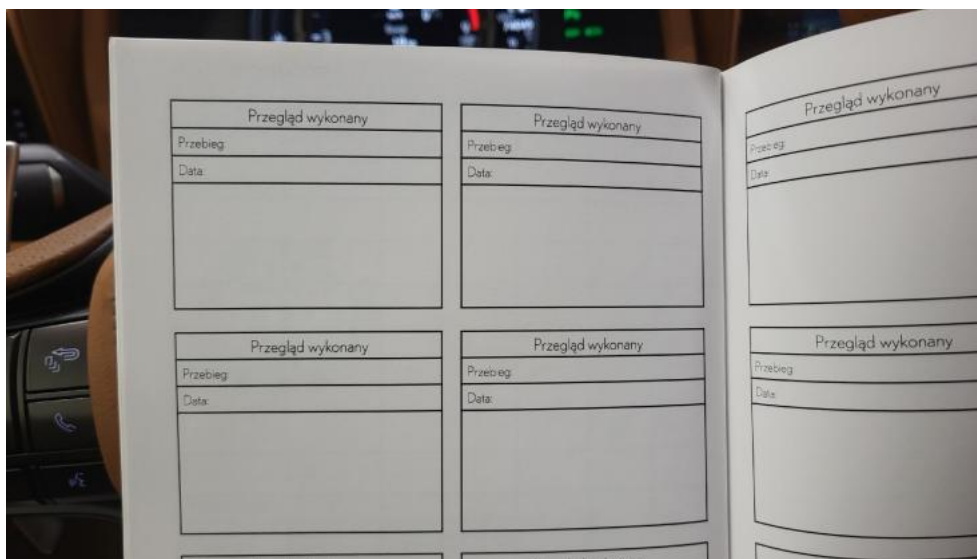


Photo 35.

Książka serwisowa – ostatni przegląd

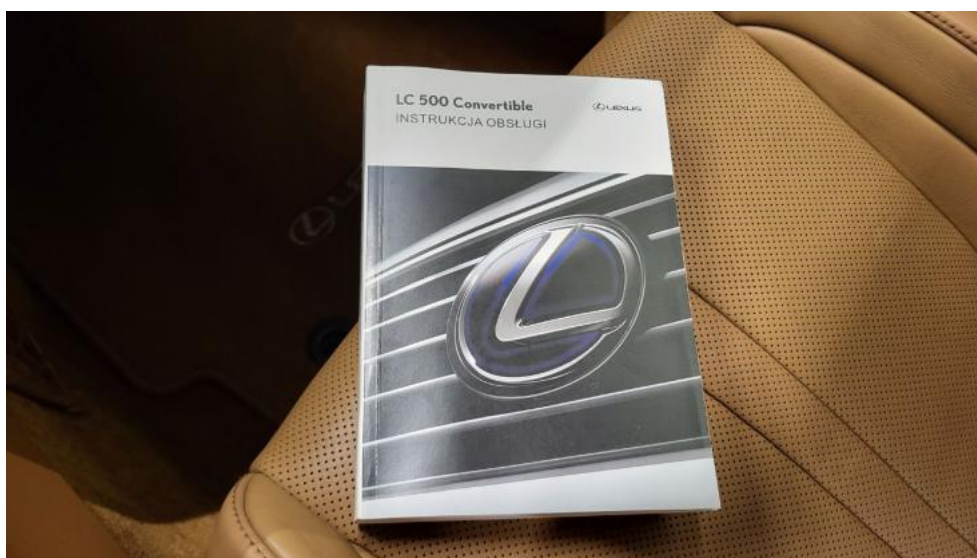


Photo 36.

Instrukcje

PHOTOGRAPHIC DOCUMENTATION



Photo 37.

Zdjęcie do protokołu



Photo 38.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Zdjęcie do protokołu



Photo 40.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Zdjęcie do protokołu



Photo 42.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Zdjęcie do protokołu



Photo 44.

Spoiler zderzaka przedniego - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Spoiler zderzaka przedniego - Pęknięcie/rozerwanie 1



Photo 46.

Spoiler zderzaka przedniego - Pęknięcie/rozerwanie 2

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Felga aluminiowa przednia P - Rysa/odprysk 1



Photo 48.

Drzwi przednie P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1



Photo 50.

Zaślepka tyl haka hol. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Drzwi przed L - Rysa/odprysk 1



Photo 52.

Lusterko zew L - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION

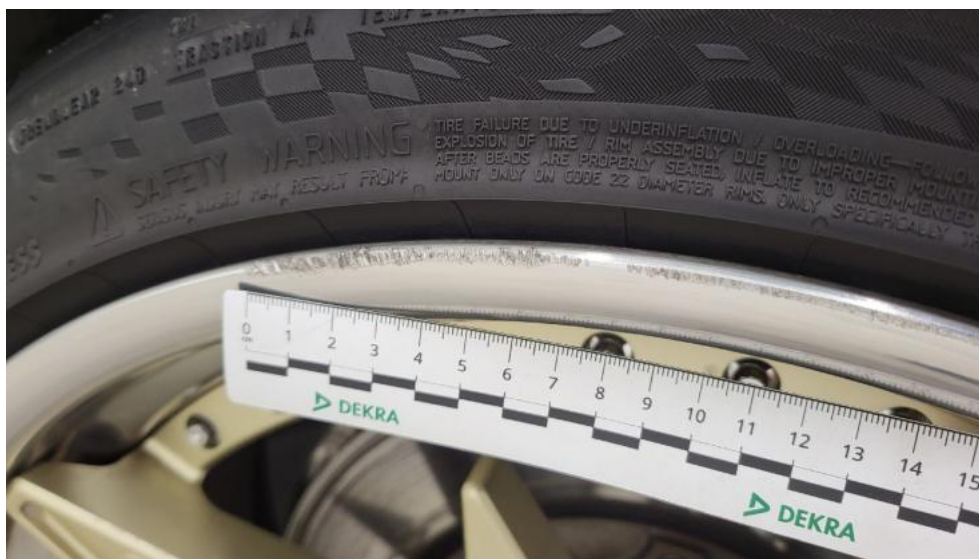


Photo 53.

Felga Aluminiowa przednia L - Rysa/odprysk 1



Photo 54.

Konsola tunelu śr. - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Podsufitka - Inne 1

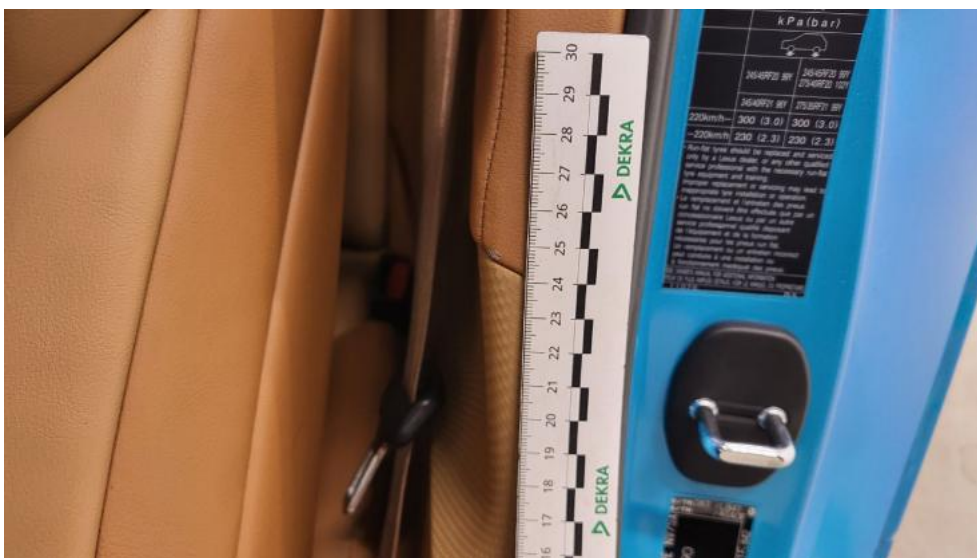


Photo 56.

Wykładzina(y) słupka środkowego L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Wykładzina(y) słupka środkowego L - Wgniecenie/odkształcenie 1



Photo 58.

Wykładzina(y) słupka środkowego P - Wgniecenie/odkształcenie 1