

DEKRA's commission No. : PKOL(W)/LODZ/81909/26/09/01
commission/ damage No. : 24/028962
Date of commission: 01-09-2026

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (WSP)
DEKRA Polska - współpraca O/Warszawa
inż. Dariusz Pawliszyn
DEKRA Polska - O. Poznań

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0114481
Manufacturer	MERCEDES-BENZ
Model	V Klasa 14-19
Type / version	V 250 d 4-Matic Avantgarde 7G-Tronic (d ³ ugi)
Body type	KOM
Number of doors / seats	4/8
Curb weight [kg]	2600
Gross vehicle weight [kg]	3200
Wheelbase 1/2	3200
Engine type	Automatic ignition
Pollution reduction system	DPF
Engine capacity [ccm]	2143
Engine Power [hp/kW]	190/140
Gearbox	automatic 7- gear
Registration /record No.	DX09732
VIN / serial number	WDF44781313295887
Date of first registration	18-04-2017
Date of next. tech. test	13-07-2027
Year of manufacture	2017 (year has been verified with the manufacturer's base)
Readout [km]	137 214 (read)
Body color / type of coating	brązowy/double-layered, metallized

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	MICHELIN, PILOT SPORT 3	245/45 19 102Y	3,0 mm
	left	MICHELIN, PILOT SPORT 3	245/45 19 102Y	3,0 mm
back	right	MICHELIN, PILOT SPORT 3	245/45 19 102Y	3,0 mm
	left	MICHELIN, PILOT SPORT 3	245/45 19 102Y	3,0 mm

Standard equipment by Eurotax

- | | |
|---|--|
| 1. 2 single seats middle, 2 single seats rear | 25. Multi functional steering wheel |
| 2. Air conditioning | 26. On board computer |
| 3. Antilock-Brake-System (ABS) | 27. On board monitor, Radio, USB in |
| 4. Automatic headlight elevation control, Cornering Headlights, LED front dim light | 28. Other |
| 5. Check-Control-System | 29. Other |
| 6. Child lock manually | 30. Other |
| 7. Child seat fixation | 31. Other |
| 8. Colored glass | 32. Other |
| 9. Comfort suspension | 33. Other |
| 10. Cruise control | 34. Passenger seat height adjustable, Passenger seat with adjustable inclination |
| 11. Door mirror(s) electrically adjustable in general, Door mirrors heated | 35. Power assisted brakes |
| 12. Driver airbag, Head airbags front, Passenger airbag, Side airbag driver, Side airbag driver and passenger | 36. Power assisted brakes |
| 13. Driver seat height adjustable | 37. Power steering |
| 14. ESP (Electronical Stabilizing Program) | 38. Power windows front, Power windows rear |
| 15. Exterior lighting: other | 39. Rain sensor |
| 16. Exterior thermometer | 40. Remote controlled central locking |
| 17. Headrest rear, middle, Headrests front, Rear headrests | 41. Sliding door with window left |
| 18. Hill holder | 42. Start/Stop system |
| 19. Interior decoration: other | 43. Steering wheel manually adjustable |
| 20. Interior lights: other accessories | 44. Traction control |
| 21. Interior: other | 45. Tyre pressure control (RDC) |
| 22. Interior: other | 46. Uni-Lackierung |
| 23. Leather upholstery | 47. Vehicle immobilizer |
| 24. Light alloy wheels from 17" | 48. Wood finish |

Dealer's equipment (selected items)

- | | |
|---|---|
| 1. 3 places bench middle | - |
| 2. 3 places front bench | - |
| 3. Air condition rear | - |
| 4. Alarm | - |
| Alarm antywłamaniowy z zabezpieczeniem przed odholowaniem i systemem zabezpieczenia wnętrza | |
| 5. Bord climate: other | - |
| 6. Bord climate: other, Independent vehicle heater | - |
| 7. CD-player, DVD-player, On board monitor, Radio | - |
| 8. Distance control, Power assisted brakes | - |
| 9. Door mirrors autodimming, Door mirrors electrically foldable, Exterior lighting: other, Rear-view mirror autodimming | - |
| Lusterka boczne oraz lusterko wsteczne automatycznie przyciemniane | |
| Lusterka boczne składane elektrycznie | |
| Lusterka boczne z oświetleniem podłoża | |
| 10. Driver seat electrically adjustable, Memory seat, Passenger seat electrically adjustable | - |
| 11. Electric tailgate, Rear swing door with window | - |
| 12. Extra power outlet | - |
| 13. Full size spare wheel | - |
| 14. Head airbags front, Head airbags rear | - |
| 15. Heated seat driver, Heated seat passenger | - |
| 16. Interior: other | - |
| 17. Interior: other | - |
| 18. Interior: other, Leather gearshifter/switch, Leather steering wheel, Leather upholstery, Wood finish | - |

Tapicerka skórzana Nappa	
Wykończenie wnętrza w drewnie - heban, ciemny antracyt, polerowany	
Górna część deski rozdzielczej w skórze ze szwem ozdobnym	
Kierownica i drążek biegów w skórze Nappa	
Pedały sportowe wykończone Aluminium	
Podłokietniki w drzwiach w skórze	
19. Lane control assistant, Other, Pre-Crash System	-
System PRE-SAFE z funkcją rewersyjnego napinania pasów przednich, zamykanie dachu i szyb	
Colision Prevention Assist - ostrzeżenie przed zbyt małym odstępem od poprzedzającego pojazdu	
Asystent utrzymania linii pasa ruchu	
Asystent martwego punktu	
20. Leather steering wheel	-
21. Lumbar adjust driver, Lumbar adjust passenger	-
22. Metalic paint	-
23. Other	-
24. Other	-
25. Other	-
26. Park Assistant, Rear view camera	-
Kamery ułatwiające parkowanie 360	
Asystent parkowania z Parktronic- aktywny (system automatycznego parkowania - parkowanie równoległe)	
27. Roof railing	-
28. Sliding door right electric	-
29. Sliding door right electric	-
30. Soundsystem	-
31. Storage facilities in general	-
32. Tinted rear windows	-
33. Towbar removable	-
34. Windows: other	-
35. Windscreen wash-nozzle heated	-

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

Corrections

First registration

Equipment

Tyres

Other

State of the vehicle -


Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 09-2026 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 09-09-2026

DEKRA's expert:
Kacper Sosnowski (WSP)
inż. Dariusz Pawliszyn

Document issued electronically valid without signature.

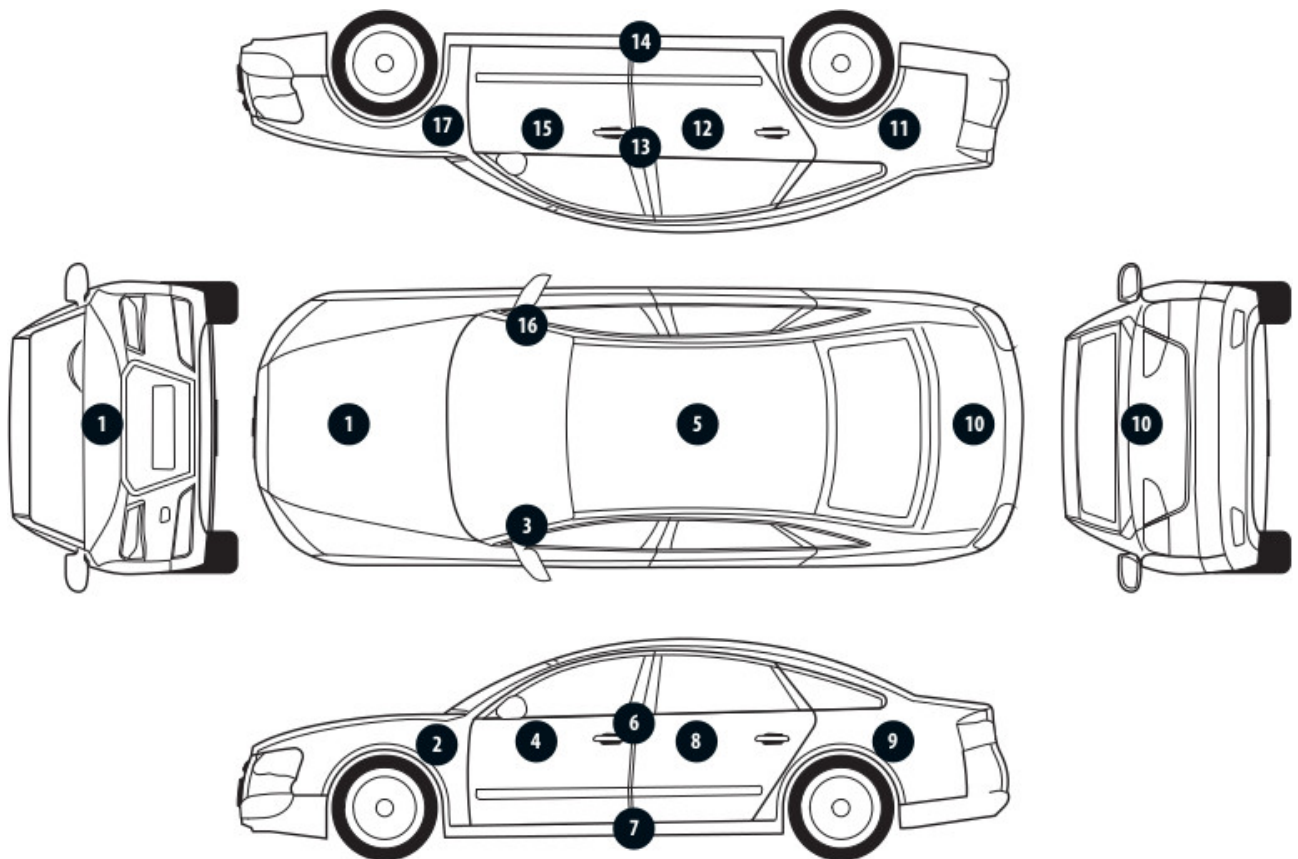Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Front left fender	to 150
3	Left front pillar	to 150
4	Front left door	to 150
5	Roof	to 150
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	to 150
9	Rear left fender	to 150
10	Cover/lid	to 150
11	Right rear fender	to 150
12	Right rear door	to 150
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	to 150
16	Right front pillar	to 150
17	Front right fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book of the vehicle was not provided.

Information concerning the origin of the vehicle

The vehicle purchased domestically from an authorized representative of the brand.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below: parking

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the

assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

2

Expert comments - regarding valuation

Rysy na samochodzie. Aktywne kontrolki. Aktywna kontrolka ciśnienia w kołach. Informacja hamulec parkingowy. Informacja dolac plyn chłodzący. Przegląd A wymagany od 314 dni. Głośna i nierówna praca silnika przez chwilę po uruchomieniu pojazdu, do weryfikacji serwisowej. Odpryski na szybie czołowej.

Restrictive disclaimer - regarding valuation

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.
Tył



Photo 8.
Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.

Próg lewy (widok od przodu)



Photo 12.

Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika



Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION



Photo 23.
Tabliczka znamionowa



Photo 24.
Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Zestaw wskaźników - serwis



Photo 26.

Widok przez otwarte drzwi przednie lewe

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Kierownica z lewej strony



Photo 28.

Widok przez otwarte drzwi tylne lewe

PHOTOGRAPHIC DOCUMENTATION



Photo 29.

Widok z tylnej kanapy na deskę rozd.



Photo 30.

Konsola środkowa

PHOTOGRAPHIC DOCUMENTATION



Photo 31.
Tunel środkowy



Photo 32.
Kierownica (na wprost)

PHOTOGRAPHIC DOCUMENTATION



Photo 33.

Dowód rej. Str. 1



Photo 34.

Książka serwisowa – dane

PHOTOGRAPHIC DOCUMENTATION



Photo 35.

Książka serwisowa – ostatni przegląd



Photo 36.

Dow. Rej. Str. 2

PHOTOGRAPHIC DOCUMENTATION

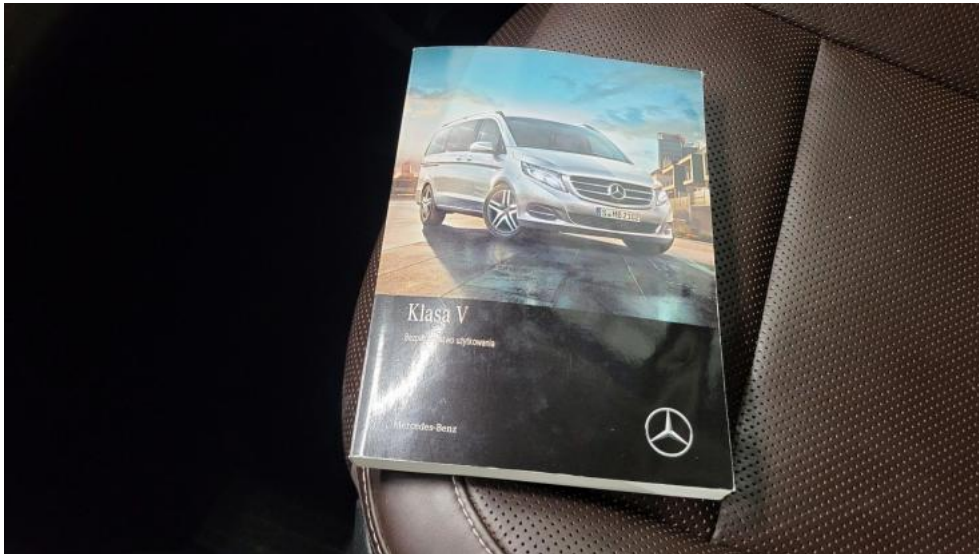


Photo 37.
Instrukcje



Photo 38.
Kluczyki

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Zdjęcie do protokołu

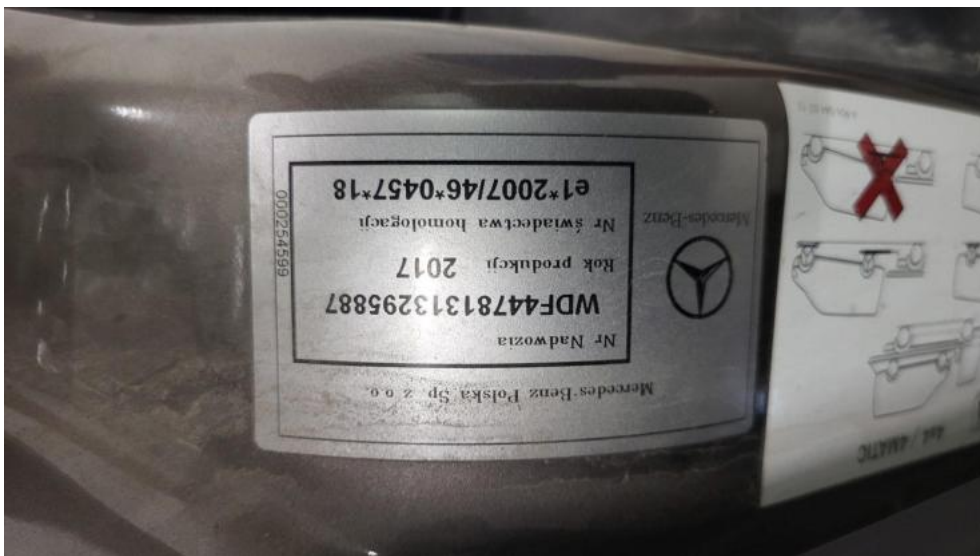


Photo 40.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION

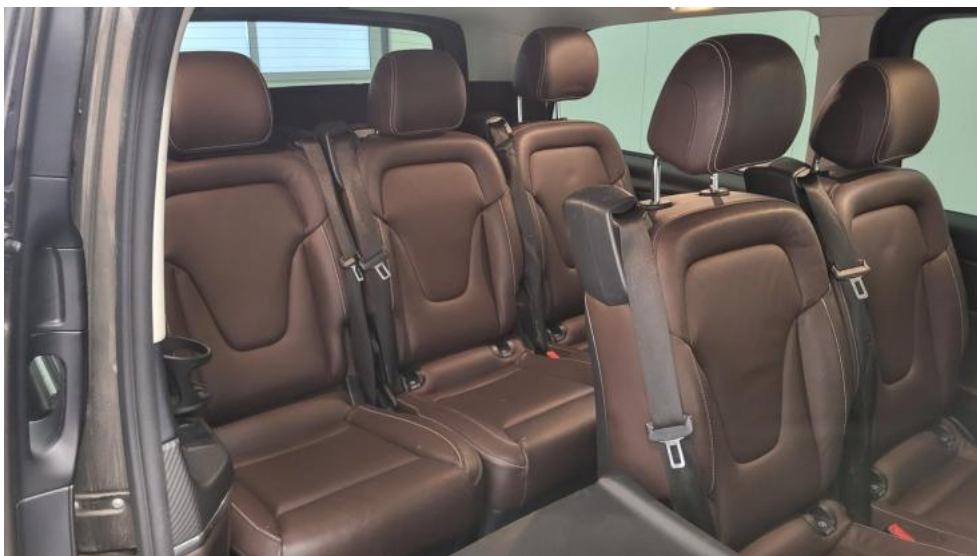


Photo 41.

Zdjęcie do protokołu



Photo 42.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 43.
Zdjęcie do protokołu



Photo 44.
Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Pokrywa komory silnika - Rysa/odprysk 1



Photo 46.

Pokrywa komory silnika - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.
Szyba czołowa - Inne 1



Photo 48.
Zderzak - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Błotnik przedni P - Wgniecenie/odkształcenie 1



Photo 50.

Felga aluminiowa przednia P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Drzwi przednie P - Rysa/odprysk 1



Photo 52.

Drzwi przednie P - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Drzwi przednie P - Wgniecenie/odkształcenie 1



Photo 54.

Drzwi przednie P - Wgniecenie/odkształcenie 2

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Drzwi tylne P - zdjęcie pogładowe 1



Photo 56.

Drzwi tylne P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Drzwi tylne P - Wgniecenie/odkształcenie 1



Photo 58.

Listwa drzwi tylnych P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Lusterko zew P - Rysa/odprysk 1



Photo 60.

Ścianka tylna P / Ściana boczna P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1



Photo 62.

Zderzak tylny - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Drzwi przed L - zdjęcie poglądowe 1



Photo 64.

Drzwi przed L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Drzwi przed L - Rysa/odprysk 2



Photo 66.

Drzwi przed L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 67.

Drzwi tylne L - Wgniecenie/odkształcenie 1



Photo 68.

Listwa drzwi przednich L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Listwa drzwi przednich L - Inne 1



Photo 70.

Felga Aluminiowa przednia L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Opona przednia L - Pęknięcie/rozerwanie 1



Photo 72.

Koło kierownicy - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 73.

Fotel prz. lew. - Rysa/odprysk 1



Photo 74.

Kanapa tyl. - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 75.

Kanapa tyl. - Pęknięcie/rozerwanie 1



Photo 76.

Podsufitka - Inne 1