

DEKRA's commission No. : PKOL(W)/LODZ/70073/26/07/28
commission/ damage No. : PS24/00708
Date of commission: 28-07-2026

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (WSP)
DEKRA Polska - współpraca O/Warszawa
Andrzej Sosnowski
DEKRA Polska - Centrala

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0141808
Manufacturer	VOLKSWAGEN
Model	Multivan 6.1 19-24
Type / version	Multivan 6.1 2.0 TDI L1 Highline 4Motion DSG
Body type	KOM
Number of doors / seats	5/7
Curb weight [kg]	2513
Gross vehicle weight [kg]	3080
Wheelbase 1/2	3000
Engine type	Automatic ignition
Pollution reduction system	KSC
Engine capacity [ccm]	1968
Engine Power [hp/kW]	199/146
Gearbox	automatic
Registration /record No.	CB081RG
VIN / serial number	WV2ZZZ7HZLH022681
Date of first registration	23-01-2020
Date of next. tech. test	28-03-2026
Year of manufacture	2019 (year has been verified with the manufacturer's base)
Readout [km]	157 621 (read)
Body color / type of coating	grafitowy/double-layered, metallized

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	KUMHO, ECSTA SPORT	255/45 18 103Y	3,0 mm
	left	KUMHO, ECSTA SPORT	255/45 18 103Y	3,0 mm
back	right	KUMHO, ECSTA SPORT	255/45 18 103Y	4,0 mm
	left	KUMHO, ECSTA SPORT	255/45 18 103Y	4,0 mm

Standard equipment by Eurotax

- | | |
|--|--|
| 1. Alarm | 38. Other |
| 2. Antilock-Brake-System (ABS), ESP
(Electronical Stabilizing Program), Hill holder,
Traction control | 39. Other |
| 3. Armrest (s) front | 40. Other |
| 4. Automatic climate control | 41. Other |
| 5. Automatic dimlight activation, Follow me home | 42. Other |
| 6. Automatic headlight elevation control | 43. Other |
| 7. Bluetooth interface | 44. Other |
| 8. Body-coloured bumpers | 45. Other |
| 9. Bord communication: other | 46. Other |
| 10. Cabin air filter | 47. Other, Storage facilities in general |
| 11. Child lock manually | 48. Park Assistant, Park Distance Control front, Park
Distance Control rear |
| 12. Child seat fixation | 49. Rain sensor |
| 13. Colored glass | 50. Rear seats rotatable |
| 14. Comfort driver seat, Comfort passenger seat,
Driver seat height adjustable, Lumbar adjust
driver, Lumbar adjust passenger, Passenger
seat height adjustable | 51. Rear-view mirror autodimming |
| 15. Cornering Headlights, Fog lamps | 52. Remote controlled central locking |
| 16. Crosswind Assistant | 53. Rev counter |
| 17. Cruise control | 54. Seats: other |
| 18. Door mirror(s) electrically adjustable in
general, Door mirrors heated | 55. Servotronic |
| 19. Door: other, Rear swing door with window | 56. Sliding door left |
| 20. Driver airbag, Passenger airbag, Side airbag
driver, Side airbag driver and passenger | 57. Sliding door right electric |
| 21. Electric tailgate | 58. Soundsystem |
| 22. Exterior design: other | 59. Special tyres |
| 23. Exterior design: other | 60. Sport suspension |
| 24. Extra power outlet | 61. Start/Stop system |
| 25. Floor mat | 62. Sunblind rear side door manual |
| 26. Heated seat driver, Heated seat passenger | 63. Textile upholstery |
| 27. Hill holder | 64. Textile upholstery |
| 28. Independent vehicle heater | 65. Textile upholstery |
| 29. Internet access, Navigation system,
Touchscreen monitor | 66. Tinted rear windows |
| 30. LED front dim light | 67. Tyre pressure control (RDC) |
| 31. LED rear lights | 68. USB in |
| 32. Leather steering wheel, Multi functional
steering wheel | 69. USB in |
| 33. Light alloy wheels from 17" | 70. Uni-Lackierung |
| 34. Luggage compartment cover | 71. Vehicle immobilizer |
| 35. Mobile Tire System | 72. Voice control for audiosystem, Voice control for
navigation system |
| 36. Mobile phone | 73. Windows: other |
| 37. On board computer | 74. Windscreen wash-nozzle heated |

Dealer's equipment (selected items)

- | | |
|--|---|
| 1. Automated High-beam assist | - |
| 2. DAB radio | - |
| 3. Door mirrors electrically foldable, Door mirrors heated | - |
| 4. Electric tailgate | - |
| 5. Light Alloy wheels 18" | - |

Additional equipment

1. Driver seat electrically adjustable -
2. Hak holowniczy stały -
3. Leather gearshifter/switch, Leather steering wheel, Leather upholstery,
Leather/wooden steering wheel, Upholstery with leather inserts -

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

Corrections

First registration

Equipment

Tyres

Other

- The validity of the technical examination -
- Current market situation -
- Uszkodzenia, stan -

Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 08-2026 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - due to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 17-08-2026

DEKRA's expert:
Kacper Sosnowski (WSP)
Andrzej Sosnowski

Document issued electronically valid without signature.

Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Front left fender	to 150
3	Left front pillar	to 150
4	Front left door	to 150
5	Roof	to 150
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	to 150
9	Rear left fender	to 150
10	Cover/lid	to 150
11	Right rear fender	to 150
12	Right rear door	to 150
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	to 150
16	Right front pillar	to 150
17	Front right fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book was presented and its number is given below:
elektroniczna

Information concerning the origin of the vehicle

Lack of reliable data.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below:
ograniczenia placowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of

the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

2

Expert comments - regarding valuation

Brak aktualnych badań technicznych. Pierwsza rejestracja w kraju 15-01-2024. Rysy na samochodzie. Odpryski na szybie czołowej. Substancja na samochodzie.

Rzeczoznawca dokonał oględzin pojazdu w warunkach parkingowych, co mogło ograniczyć pełną ocenę jego stanu technicznego. Dodatkowo, jeżeli jazda próbna została przeprowadzona (informacje w treści raportu), to wykonano ją w warunkach parkingowych, z niewielką prędkością, co może nie odzwierciedlać pełnych warunków eksploatacyjnych. Istnieje możliwość, że w innych okolicznościach ujawnią się dodatkowe uszkodzenia lub usterki, których nie można było wykryć podczas obecnych oględzin. Zalecamy zatem skorzystanie z możliwości oględzin pojazdu we własnym zakresie lub w Autoryzowanej Stacji Obsługi danej marki, co pozwoli na pełniejszą weryfikację stanu technicznego pojazdu przed udziałem w aukcji."

Restrictive disclaimer - regarding valuation

Nie weryfikowano szczegółowo stanu układu napędowego, zawieszenia, kierowniczego, hamulcowego oraz wydechowego. Ocena została wykonana bez użycia podnośnika i specjalistycznego sprzętu diagnostycznego, nie dokonywano demontażu osłon i innych elementów. Ocena określa ogólny stan pojazdu na dzień oględzin w miejscu jego udostępnienia, nie może być zatem traktowana jako kompleksowa ocena stanu technicznego. Specyfikacja wg. programu operacyjnego w zakresie wyposażenia standardowego i dodatkowego nie gwarantuje zgodności ze stanem faktycznym w zakresie możliwym do ustalenia przez rzeczoznawcę podczas oględzin pojazdu.

Pomiar grubości powłoki lakierowej wykonano w miejscach możliwych do ich wykonania pomiary nie gwarantują oryginalności poszczególnych elementów poddanych ocenie.

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.

- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.
Próg lewy (widok od przodu)



Photo 12.
Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód

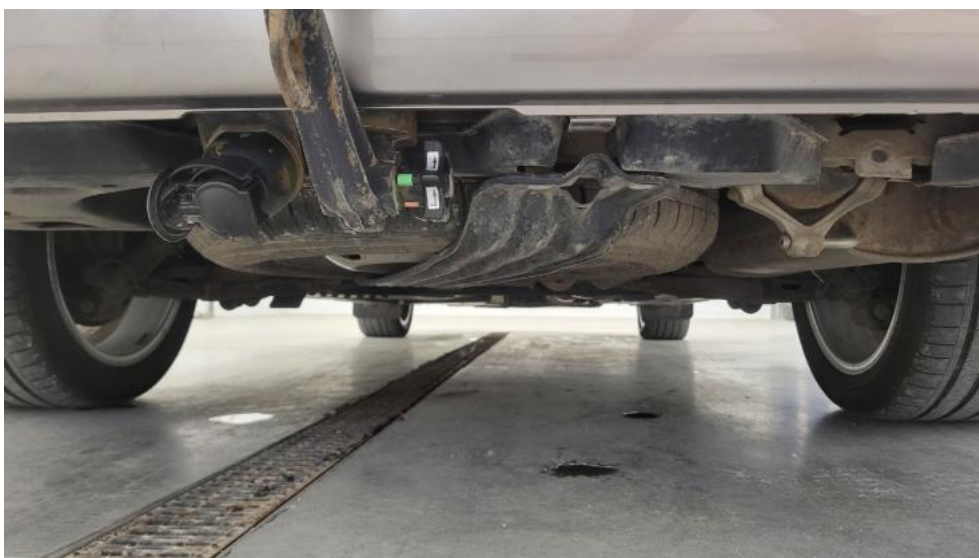


Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika



Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION

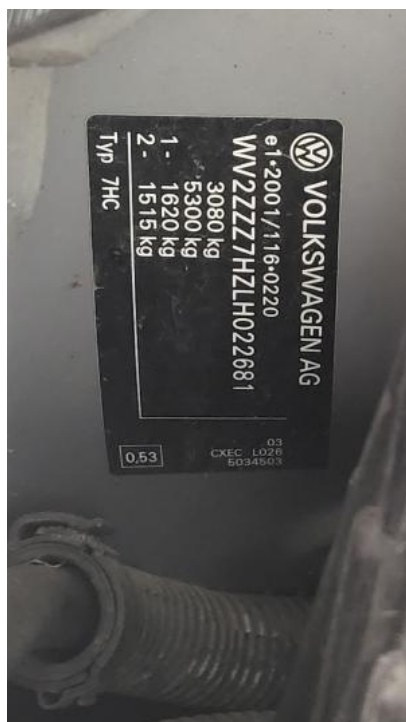


Photo 23.

Tabliczka znamionowa



Photo 24.

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Zestaw wskaźników - serwis

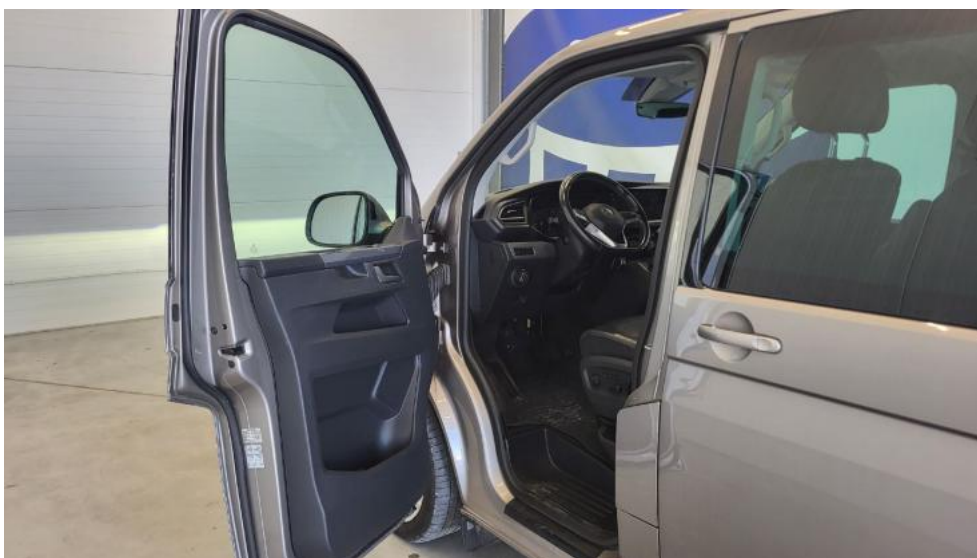


Photo 26.

Widok przez otwarte drzwi przednie lewe

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Kierownica z lewej strony



Photo 28.

Widok przez otwarte drzwi tylne lewe

PHOTOGRAPHIC DOCUMENTATION



Photo 29.

Widok z tylnej kanapy na deskę rozdź.



Photo 30.

Konsola środkowa

PHOTOGRAPHIC DOCUMENTATION



Photo 31.
Tunel środkowy




Photo 32.
Kierownica (na wprost)

[illegible]

Dowód rej. Str. 1



Książka serwisowa – dane

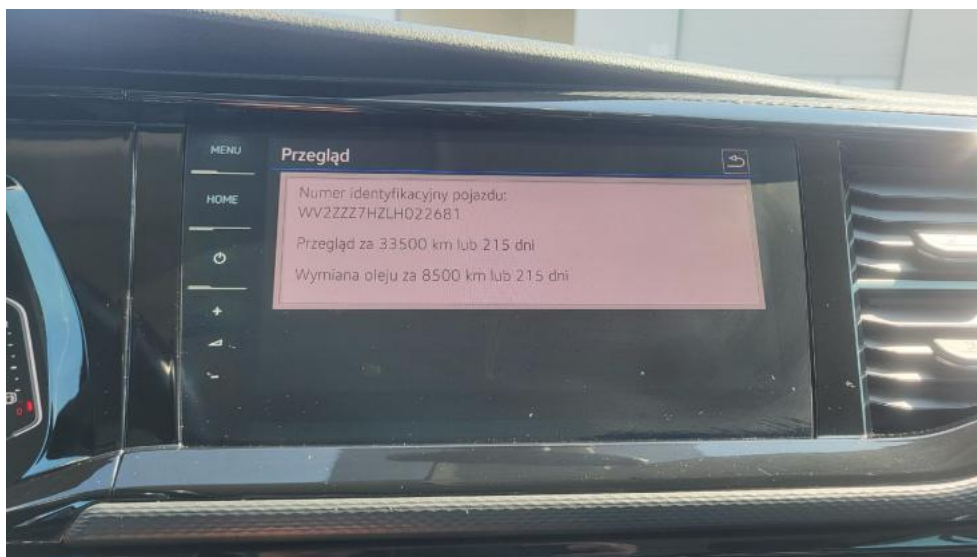PHOTOGRAPHIC DOCUMENTATION**Photo 35.**

Książka serwisowa – ostatni przegląd

**Photo 36.**

Dowód rej. str. 2

PHOTOGRAPHIC DOCUMENTATION

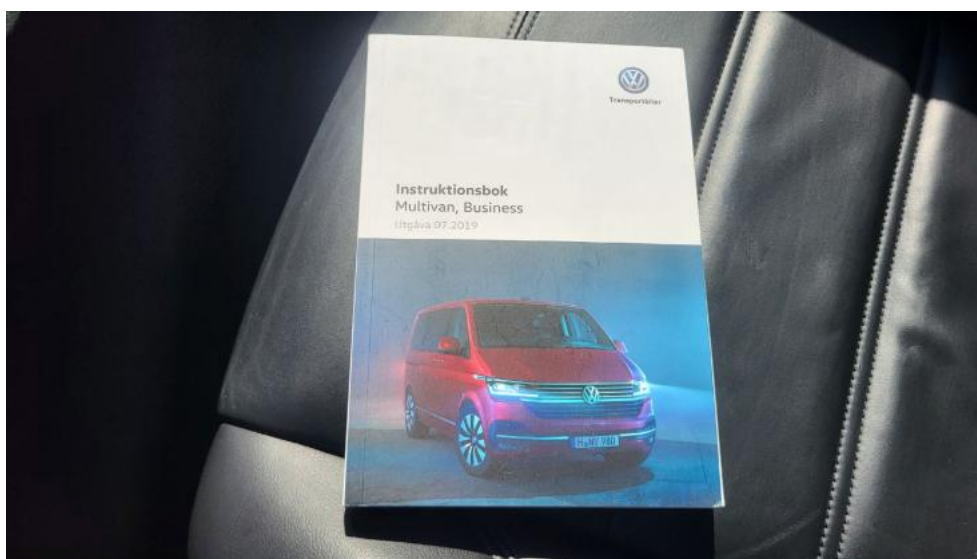


Photo 37.
Instrukcje



Photo 38.
Kluczyki

PHOTOGRAPHIC DOCUMENTATION



Photo 39.
Zdjęcie do protokołu



Photo 40.
Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION

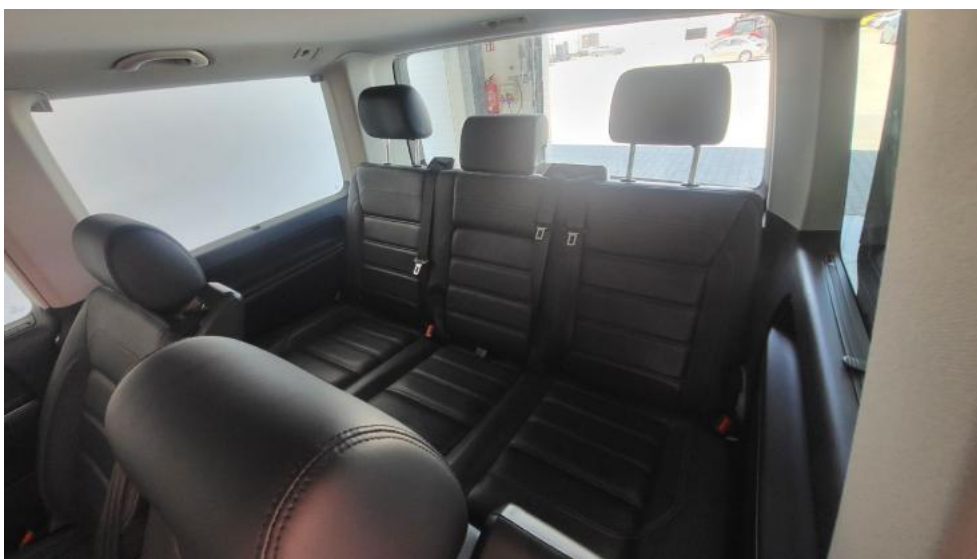


Photo 41.

Zdjęcie do protokołu



Photo 42.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION

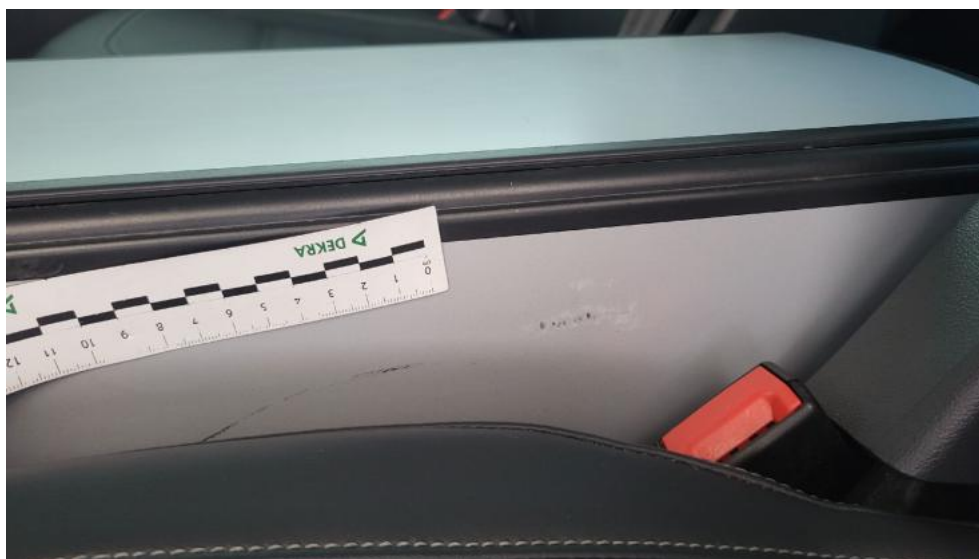


Photo 43.

Zdjęcie do protokołu



Photo 44.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Listwa śr zderzaka przedniego - Inne 1



Photo 46.

Pokrywa komory silnika - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Pokrywa komory silnika - Wgniecenie/odkształcenie 1



Photo 48.

Pokrywa komory silnika - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Zderzak - Rysa/odprysk 1



Photo 50.

Błotnik przedni P - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Felga aluminiowa przednia P - Rysa/odprysk 1



Photo 52.

Reflektor P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Drzwi przednie P - Rysa/odprysk 1



Photo 54.

Drzwi tylne P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Lusterko zew P - Rysa/odprysk 1



Photo 56.

Słupiek przedni P - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Słupek przedni P - Inne 1



Photo 58.

Łotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Felga aluminiowa tylna P - Rysa/odprysk 1



Photo 60.

Pokrywy bagażnika - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Pokrywy bagażnika - Wgniecenie/odkształcenie 2



Photo 62.

Pokrywy bagażnika() - Wgniecenie/odkształcenie 3

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Zderzak tylny - Rysa/odprysk 1



Photo 64.

Zderzak tylny - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Zderzak tylny() - Rysa/odprysk 3



Photo 66.

Błotnik tylny L / Ściana boczna L - zdjęcie pogładowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 67.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1



Photo 68.

Felga aluminiowa tylna L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Drzwi przed L - Rysa/odprysk 1

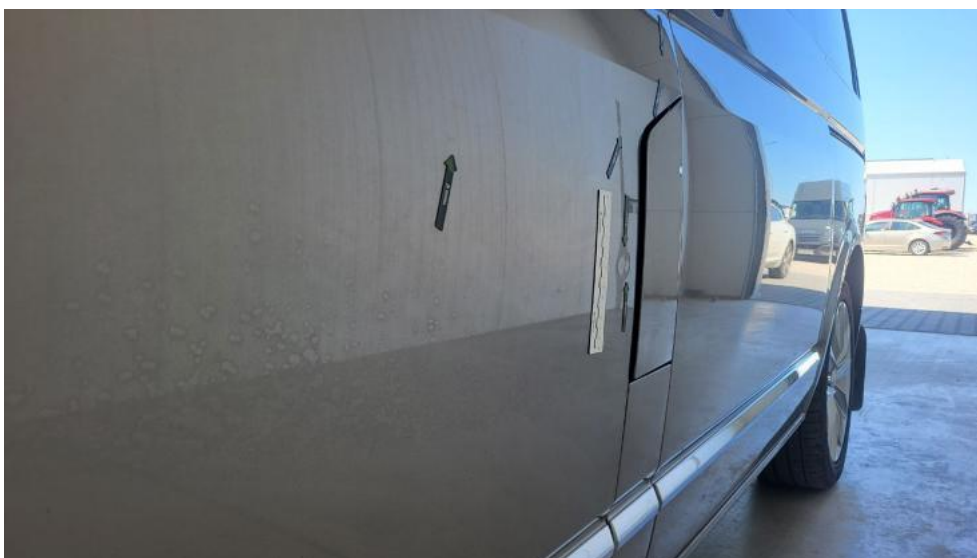


Photo 70.

Drzwi przed L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Drzwi tylne L - Wgniecenie/odkształcenie 1



Photo 72.

Klamka drzwi prz L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 73.

Lusterko zew L - Rysa/odprysk 1



Photo 74.

Słupek przedni L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 75.

Felga Aluminiowa przednia L - Rysa/odprysk 1



Photo 76.

Opona przednia L - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 77.

Gałka dźwigni zmiany biegów - Rysa/odprysk 1



Photo 78.

Koło kierownicy - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 79.

Fotel prz. praw. - Wgniecenie/odkształcenie 1



Photo 80.

Uchwyt drzwi prze L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 81.

Ośłona p/słoneczna lewa - Inne 1



Photo 82.

Wykładzina pokrywy tylnej - Rysa/odprysk 1