

DEKRA's commission No. : PKOL(W)/LODZ/67876/26/07/21
commission/ damage No. : PS22/02298
Date of commission: 21-07-2026

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (WSP)
DEKRA Polska - współpraca O/Warszawa
inż. Józef Orłowski
TU - Włocławek

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0132256
Manufacturer	FORD
Model	Focus Kombi 18-21
Type / version	Focus 1.5 EcoBlue Trend Edition Business
Body type	KOM
Number of doors / seats	5/5
Curb weight [kg]	1395
Gross vehicle weight [kg]	1900
Wheelbase 1/2	2650
Engine type	Automatic ignition
Pollution reduction system	DPF
Engine capacity [ccm]	1498
Engine Power [hp/kW]	95/70
Gearbox	manual 6- gear
Registration /record No.	EL3FM61
VIN / serial number	WF0PXXGCHPKT02299
Date of first registration	19-09-2019
Date of next. tech. test	11-05-2024
Year of manufacture	2019 (year has been verified with the manufacturer's base)
Readout [km]	247 337 (read)
Body color / type of coating	black/UNI

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	KORMORAN, SNOW	205/60 16 92H	3,5 mm
	left	KORMORAN, SNOW	205/60 16 92H	4,0 mm
back	right	KORMORAN, SNOW	205/60 16 92H	5,0 mm
	left	KORMORAN, SNOW	205/60 16 92H	4,0 mm

Standard equipment by Eurotax

- | | |
|--|---|
| 1. Air conditioning | 32. Lane control assistant |
| 2. Armrest (s) front, Extra power outlet, Storage facilities in general | 33. Leather steering wheel |
| 3. Automatic dimlight activation | 34. Light Alloy wheels 16" |
| 4. Bluetooth interface, CD-player, iPod Interface, Navigation system, On board monitor, Radio, Steering wheel with radio operation, USB in | 35. Luggage compartment cover |
| 5. Body-coloured bumpers | 36. Lumbar adjust driver |
| 6. Child seat fixation | 37. On board computer |
| 7. Comfort passenger seat | 38. On board monitor |
| 8. Cornering Headlights, Fog lamps | 39. Other |
| 9. Cruise control | 40. Other |
| 10. Cruise control, Speed limiter | 41. Other |
| 11. Diminished spare wheel | 42. Other |
| 12. Door mirror(s) electrically adjustable in general, Door mirrors heated, Side indicators | 43. Park Distance Control front, Park Distance Control rear |
| 13. Door mirrors electrically foldable, Exterior lighting: other, Other | 44. Passenger seat with adjustable inclination |
| 14. Driver airbag, Passenger airbag | 45. Power steering |
| 15. Driver seat electrically adjustable | 46. Power windows front, Power windows rear |
| 16. Driver seat with adjustable inclination | 47. Pre-Crash System |
| 17. Driver-information-system | 48. Rear seat-backs foldable in two separate parts |
| 18. ESP (Electronical Stabilizing Program), Hill holder, Power assisted brakes, Traction control | 49. Rear spoiler |
| 19. Electric parking brake | 50. Remote controlled central locking |
| 20. Exterior design: other | 51. Roof railing |
| 21. Exterior design: other | 52. Roof: other |
| 22. Exterior design: other | 53. Selectable driveline characteristics |
| 23. Exterior design: other, Exterior lighting: other | 54. Side airbag driver and passenger |
| 24. Extra power outlet | 55. Sport seats front |
| 25. Floor mat | 56. Start/Stop system |
| 26. Fog lamps | 57. Steering wheel manually adjustable |
| 27. Head airbags front, Head airbags rear, Side airbag driver and passenger | 58. Textile upholstery |
| 28. Interior: other | 59. Tyre pressure control (RDC) |
| 29. Interior: other | 60. Uni-Lackierung |
| 30. Interior: other, Leather gearshifter/switch | 61. Vehicle immobilizer |
| 31. LED Daytime running lights | 62. Windows: other |

Dealer's equipment (selected items)

- | | |
|---|---|
| 1. Metallic paint | - |
| 2. Other, Rain sensor, Rear-view mirror autodimming | - |

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

Corrections

First registration

Mileage

Equipment

Tyres

Other

State of the vehicle -
stwierdzone braki i uszkodzenia -

Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 07-2026 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - due to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 26-07-2026

DEKRA's expert:
Kacper Sosnowski (WSP)
inż. Józef Orłowski

Document issued electronically valid without signature.

Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Front left fender	to 150
3	Left front pillar	to 150
4	Front left door	to 150
5	Roof	to 150
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	to 150
9	Rear left fender	to 150
10	Cover/lid	to 150
11	Right rear fender	to 150
12	Right rear door	to 150
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	to 150
16	Right front pillar	to 150
17	Front right fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book of the vehicle was not provided.

Information concerning the origin of the vehicle

Lack of reliable data.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below: ograniczenia parkingowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the

page 5/60

assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

2

Expert comments - regarding valuation

Pierwsza rejestracja w kraju 17-05-2022. Rysy na samochodzie. Widoczne ślady wycieków. Poziom płynu układu chłodniczego poniżej minimum. Poziom oleju silnikowego poniżej minimum. Aktywna kontrolka silnika. Nierówna i głośna praca silnika, do weryfikacji serwisowej. Brak zaślepek w tylnej kanapie. Odpryski na szybie czołowej. Substancja na samochodzie.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.

Przekątna przednia lewa



Photo 2.

Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.

Bok prawy z tyłu



Photo 6.

Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.

Próg lewy (widok od przodu)



Photo 12.

Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa

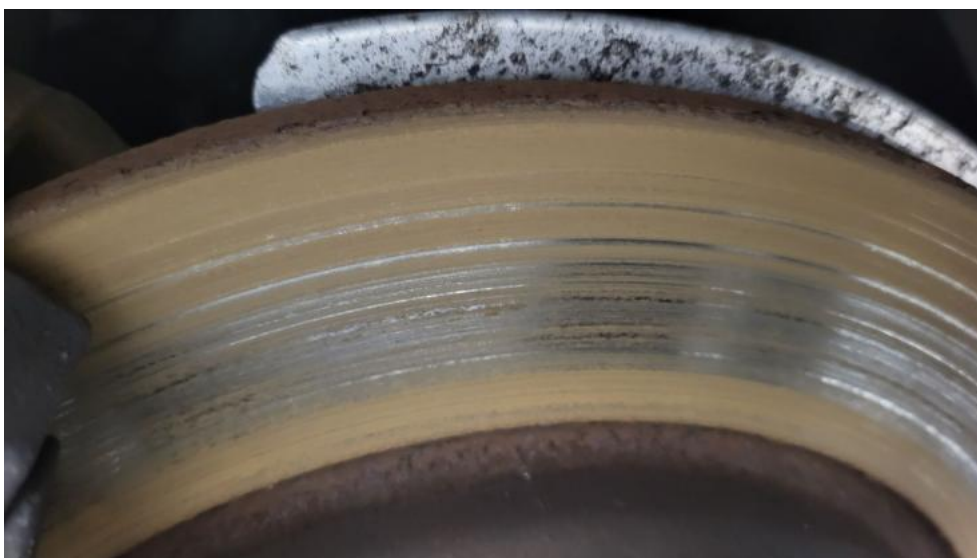


Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa

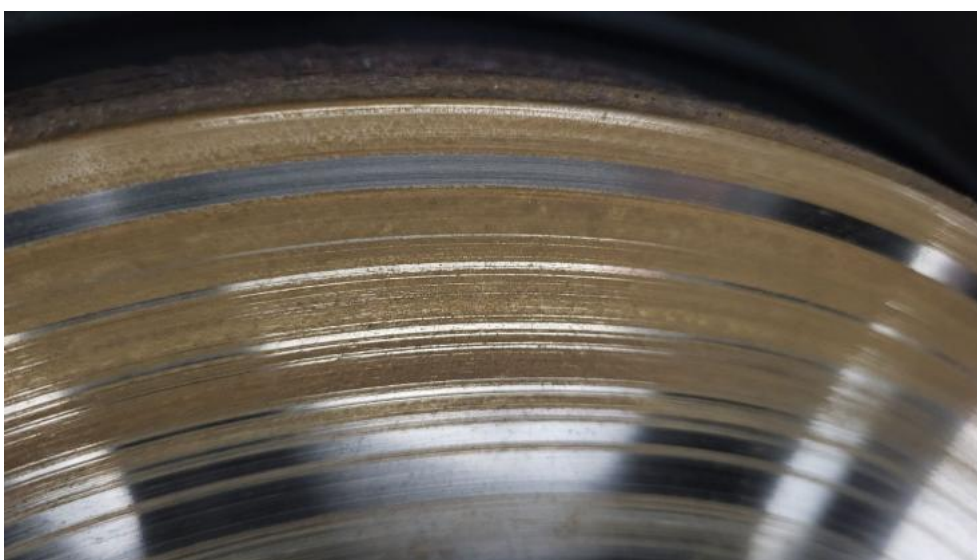


Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika



Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION



Photo 23.

Tabliczka znamionowa



Photo 24.

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Zestaw wskaźników - serwis



Photo 26.

Widok przez otwarte drzwi przednie lewe

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Kierownica z lewej strony



Photo 28.

Widok przez otwarte drzwi tylne lewe

PHOTOGRAPHIC DOCUMENTATION



Photo 29.

Widok z tylnej kanapy na deskę rozd.



Photo 30.

Konsola środkowa

PHOTOGRAPHIC DOCUMENTATION



Photo 31.
Tunel środkowy



Photo 32.
Kierownica (na wprost)

PHOTOGRAPHIC DOCUMENTATION



Photo 33.

Dowód rej. Str. 1



Photo 34.

Dowód rej. str. 2

PHOTOGRAPHIC DOCUMENTATION



Photo 35.

Kluczyki



Photo 36.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 37.
Zdjęcie do protokołu

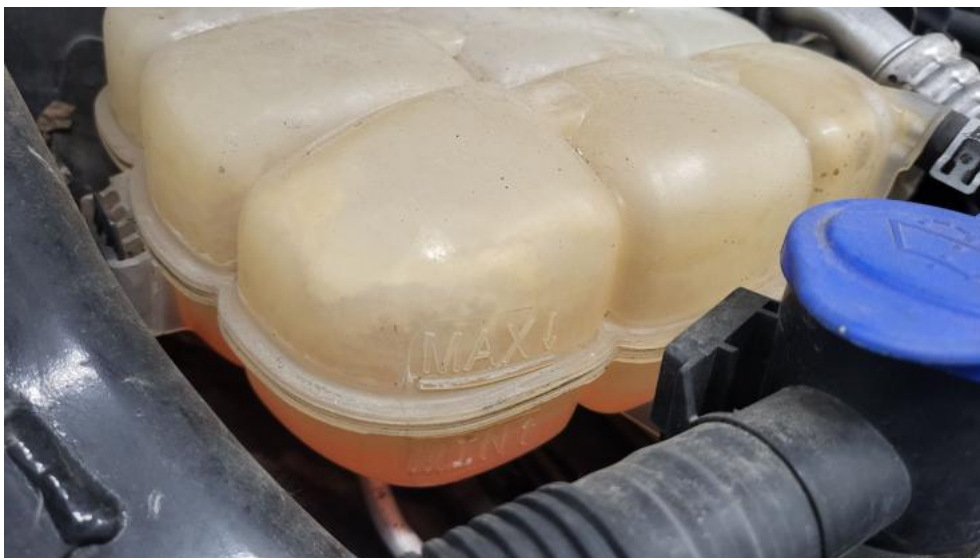


Photo 38.
Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Zdjęcie do protokołu

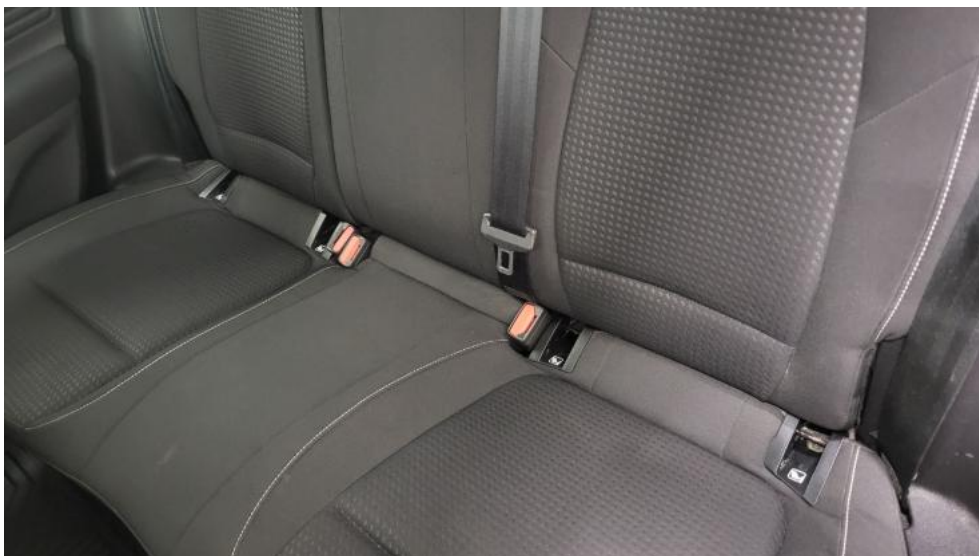


Photo 40.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Pokrywa komory silnika - Rysa/odprysk 1



Photo 42.

Pokrywa komory silnika - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Uszczelka/listwa szyby czołowej - Rysa/odprysk 1



Photo 44.

Wykładzina pokrywy komory silnika - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Zderzak - Rysa/odprysk 1



Photo 46.

Zderzak - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Zderzak() - Rysa/odprysk 3



Photo 48.

Zderzak - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Zderzak - Wgniecenie/odkształcenie 2



Photo 50.

Łotnik przedni P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Felga aluminiowa przednia P - Rysa/odprysk 1



Photo 52.

Drzwi przednie P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Drzwi przednie P - Wgniecenie/odkształcenie 1



Photo 54.

Drzwi przednie P - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Drzwi tylne P - Rysa/odprysk 1

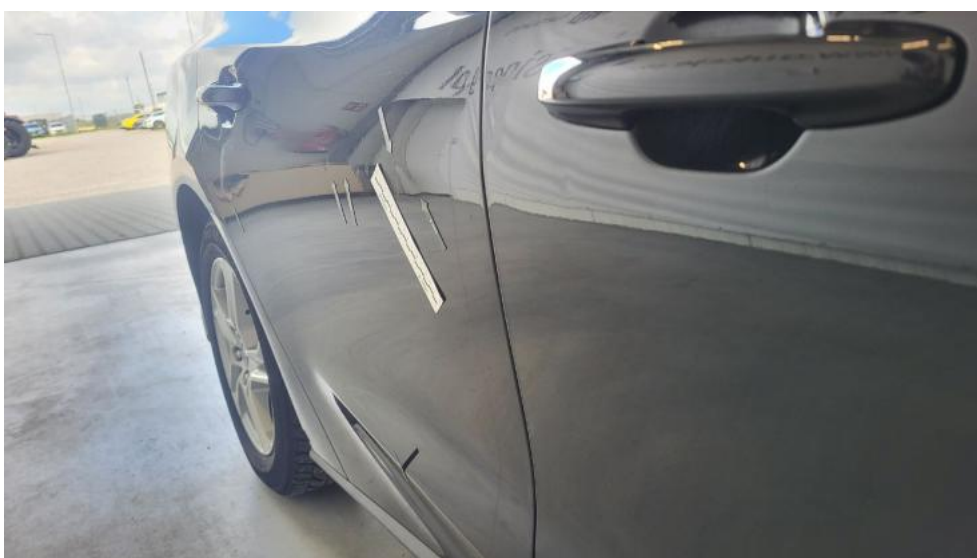


Photo 56.

Drzwi tylne P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Drzwi tylne P - Inne 1



Photo 58.

Klamka drzwi prz P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Klamka drzwi tyl P - Rysa/odprysk 1



Photo 60.

Próg P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Błotnik tylny P / Ściana boczna P - zdjęcie poglądowe 1



Photo 62.

Błotnik tylny P / Ściana boczna P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1

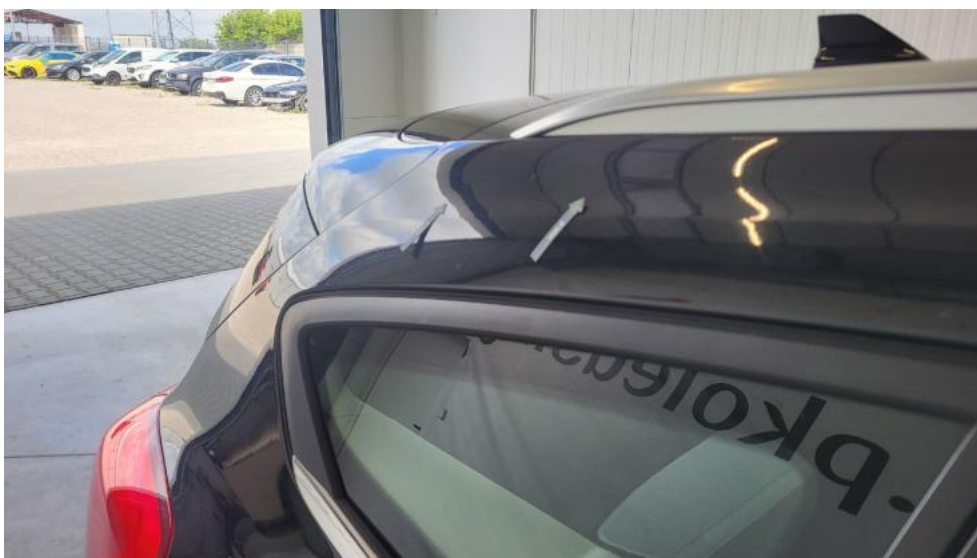


Photo 64.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 2

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Lampa tylna zew P - Rysa/odprysk 1



Photo 66.

Pokrywy bagażnika - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 67.

Pokrywy bagażnika - Wgniecenie/odkształcenie 1



Photo 68.

Pokrywy bagażnika - Inne 1

PHOTOGRAPHIC DOCUMENTATION

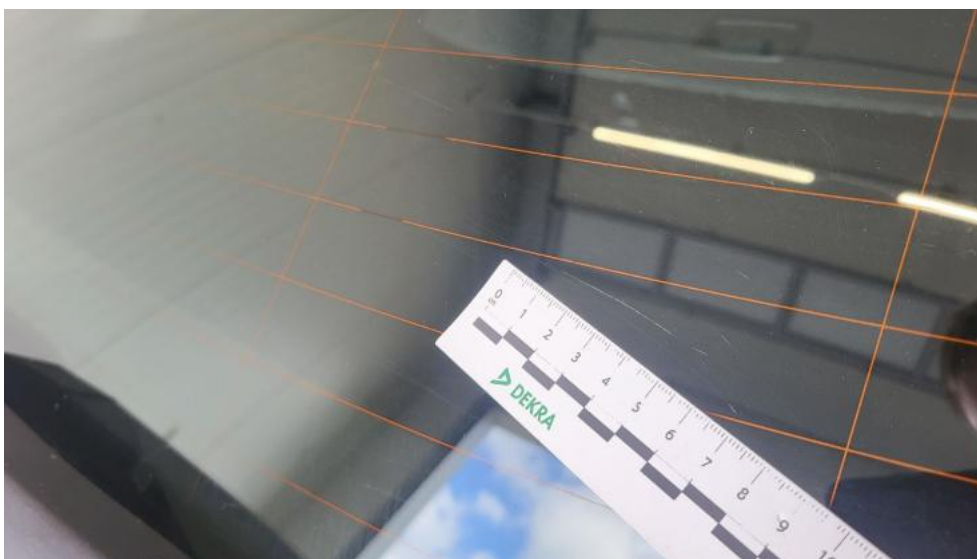


Photo 69.

Szyba tylna - Rysa/odprysk 1



Photo 70.

Zaślepka tyl haka hol. - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Zderzak tylny - Rysa/odprysk 1



Photo 72.

Zderzak tylny - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 73.

Zderzak tylny() - Rysa/odprysk 3



Photo 74.

Zderzak tylny - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 75.

Dach - Wgniecenie/odkształcenie 1

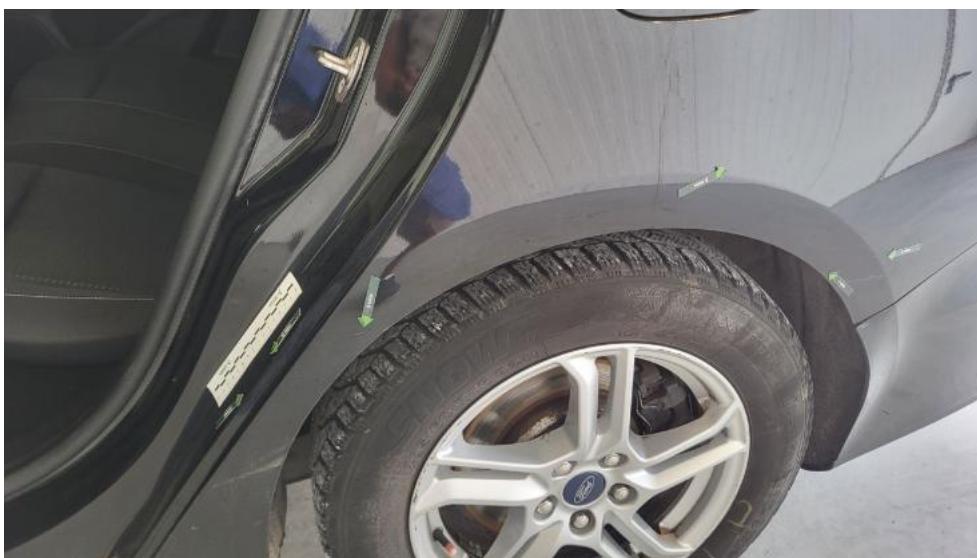


Photo 76.

Łotnik tylny L / Ściana boczna L - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 77.

Błotnik tylny L / Ściana boczna L - Rysa/odprysk 1

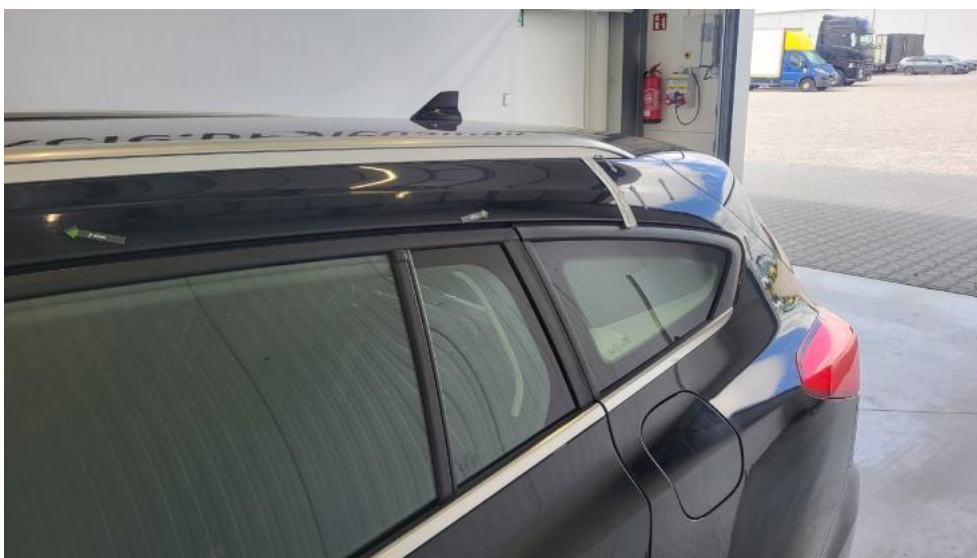


Photo 78.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 79.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 2



Photo 80.

Błotnik tylny L / Ściana boczna L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 81.

Drzwi przed L - Rysa/odprysk 1

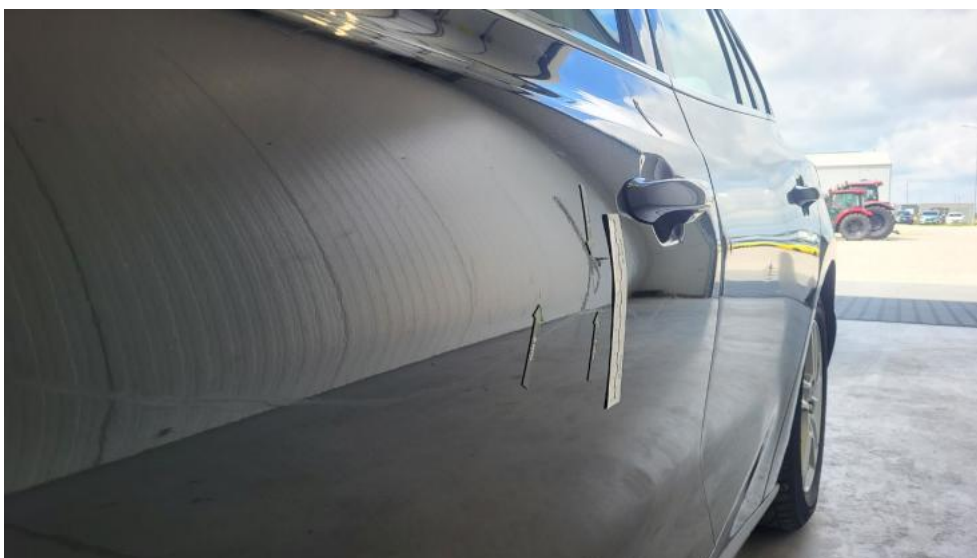


Photo 82.

Drzwi przed L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION

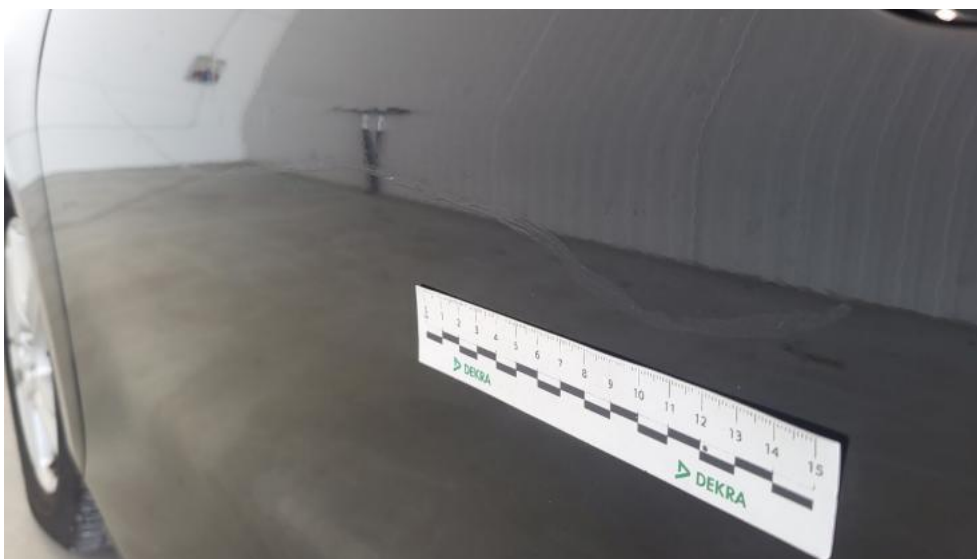


Photo 83.

Drzwi przed L - Inne 1



Photo 84.

Drzwi tylne L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 85.

Drzwi tylne L - Rysa/odprysk 2



Photo 86.

Drzwi tylne L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 87.

Listwa drzwi przednich L - Wgniecenie/odkształcenie 1

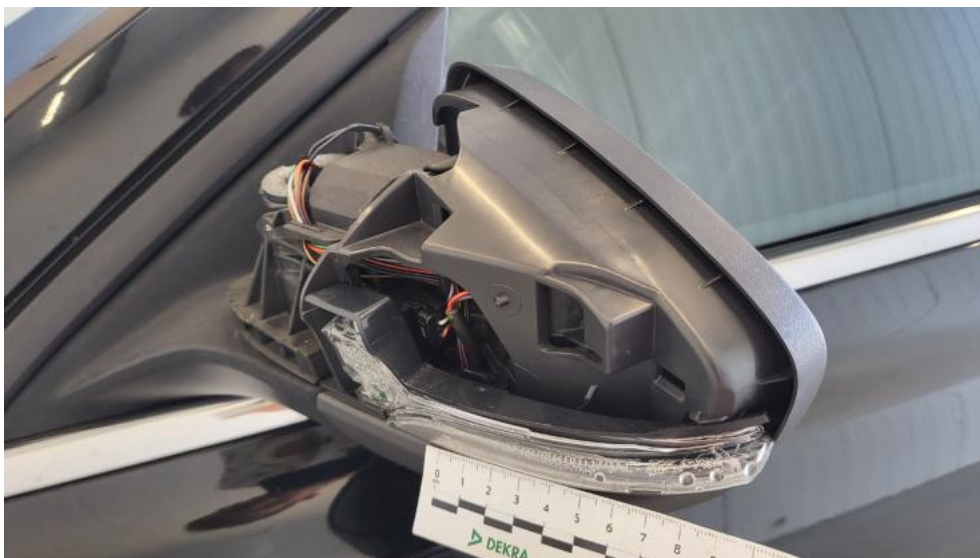


Photo 88.

Lusterko zew L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 89.

Próg L - Rysa/odprysk 1



Photo 90.

Próg L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 91.

Słupki środkowy L - Rysa/odprysk 1

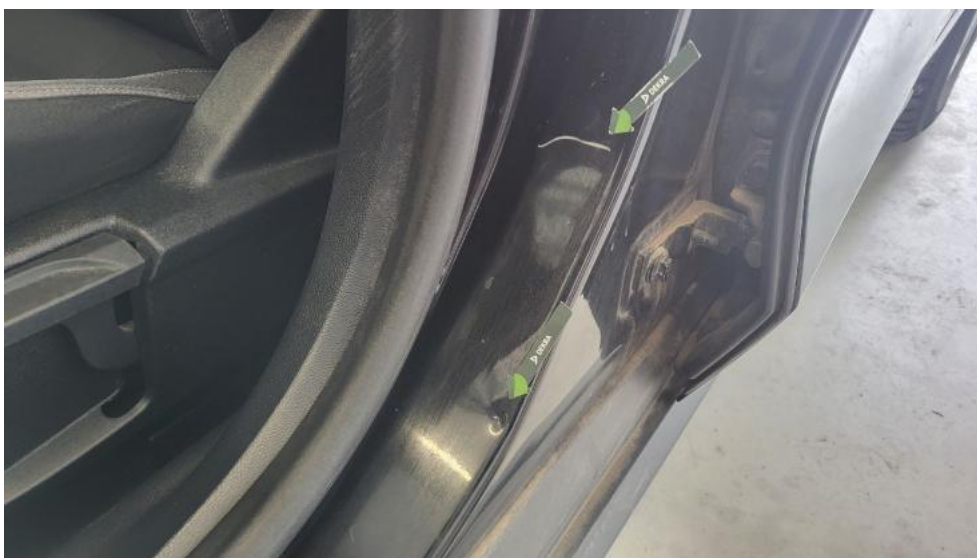


Photo 92.

Słupki środkowy L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 93.

Błotnik przedni L - Rysa/odprysk 1



Photo 94.

Koło kierownicy - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 95.

Konsola środkowa - Rysa/odprysk 1



Photo 96.

Podłokietnik środkowy przedni - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 97.

Fotel prz. lew. - Inne 1

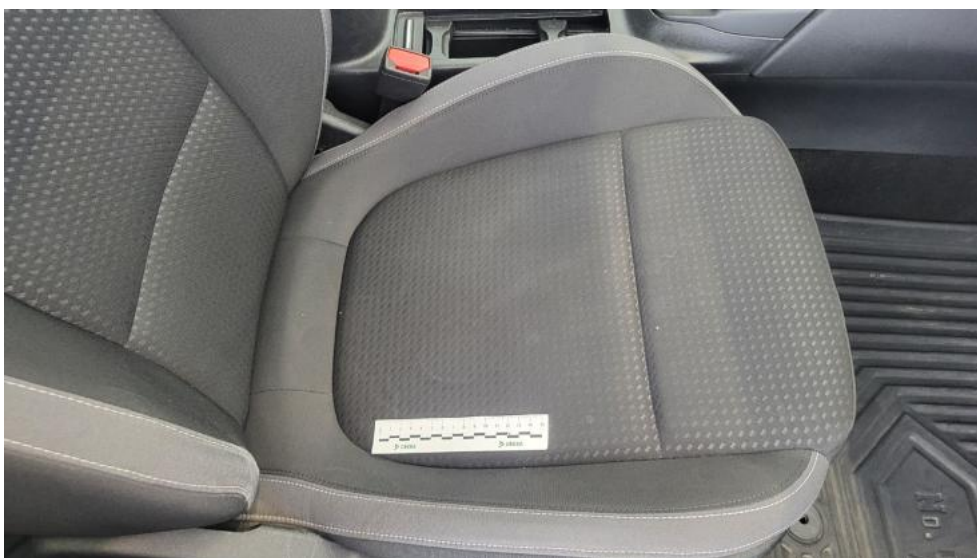


Photo 98.

Fotel prz. praw. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 99.
Kanapa tyl. - Inne 1



Photo 100.
Tapicerka drzwi przednich L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 101.

Tapicerka drzwi przednich P - Rysa/odprysk 1



Photo 102.

Uchwyt drzwi tyl L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 103.

Uszczelka drzwi przednich P - Inne 1

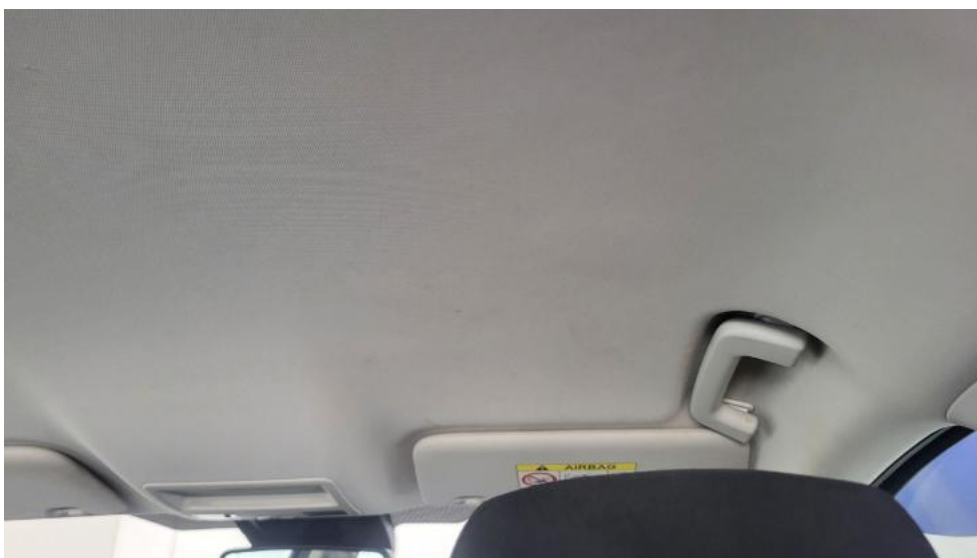


Photo 104.

Podsufitka - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 105.

Wykładzina(y) słupka przedniego P - Rysa/odprysk 1



Photo 106.

Wykładzina podłogi bagażnika - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 107.

Wykładzina pokrywy tylnej - Rysa/odprysk 1