

DEKRA's commission No. : PKOL(W)/LODZ/89518/25/11/19
commission/ damage No. : 23/040509
Date of commission: 19-11-2025

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (NEW)
DEKRA Polska - współpraca O/Warszawa
Tomasz Ziemniak (NEW)
DEKRA Polska - współpraca O/Konin

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0130018
Manufacturer	OPEL
Model	Grandland X 17-21
Type / version	Grandland X 1.5 CDTI Innovation S&S aut
Body type	KOM
Number of doors / seats	5/5
Curb weight [kg]	1300
Gross vehicle weight [kg]	1970
Wheelbase 1/2	2675
Engine type	Automatic ignition
Pollution reduction system	DPF
Engine capacity [ccm]	1499
Engine Power [hp/kW]	130/96
Gearbox	automatic 8- gear
Registration /record No.	KK3907C
VIN / serial number	W0VZCYHZ4KS319365
Date of first registration	16-07-2019
Date of next. tech. test	12-11-2026
Year of manufacture	2019 (year has been verified with the manufacturer's base)
Readout [km]	175 545 (read)
Body color / type of coating	silver/METALIK

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	MICHELIN, CROSSCLIMATE 2	215/65 17 103V	3,0 mm
	left	MICHELIN, CROSSCLIMATE 2	215/65 17 103V	3,0 mm
back	right	MICHELIN, CROSSCLIMATE 2	215/65 17 103V	3,0 mm
	left	MICHELIN, CROSSCLIMATE 2	215/65 17 103V	3,0 mm

Standard equipment by Eurotax

- | | |
|--|---|
| 1. Additional gauges | 21. Interior lights: other accessories |
| 2. Additional heating | 22. Interior lights: other accessories |
| 3. Antilock-Brake-System (ABS), ESP (Electronical Stabilizing Program), Hill holder | 23. LED rear lights |
| 4. Armrest (s) front | 24. Lane control assistant |
| 5. Artificial leather upholstery, Storage facilities in general, Textile upholstery, Upholstery with leather inserts | 25. Leather steering wheel, Multi functional steering wheel, Steering wheel with radio operation |
| 6. Automated High-beam assist | 26. Luggage compartment partitioning |
| 7. Automatic climate control | 27. Lumbar adjust passenger, Passenger seat height adjustable, Passenger seat with adjustable inclination |
| 8. Automatic dimlight activation | 28. Mirror: others |
| 9. Blind spot warning, Other | 29. On board computer |
| 10. Bluetooth interface, Hands-free system, Radio, USB in | 30. On board monitor |
| 11. Central locking | 31. Other |
| 12. Child seat fixation | 32. Park Distance Control front, Park Distance Control rear |
| 13. Cruise control | 33. Rain sensor |
| 14. Door mirror(s) electrically adjustable in general, Door mirrors heated, Exterior design: other | 34. Rear bench foldable in two separate parts |
| 15. Door mirrors electrically foldable | 35. Rear wiper |
| 16. Driver seat height adjustable | 36. Traffic sign recognition |
| 17. Electric parking brake | 37. Tyre pressure control (RDC) |
| 18. Electric tailgate | 38. USB in |
| 19. Exterior design: other | 39. Uni-Lackierung |
| 20. Head airbags front, Side airbag driver and passenger | |

Dealer's equipment (selected items)

- | | |
|--------------------------------------|---|
| 1. Diminished spare wheel | - |
| 2. Fog lamps | - |
| 3. Light alloy wheels from 17" | - |
| 4. Tinted rear windows | - |

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

CorrectionsFirst registrationMileageEquipment

Tyres

Other

Earlier repairs -
Korekta z tytułu uszkodzeń pojazdu -


Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 11-2025 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 24-11-2025

DEKRA's expert:
Kacper Sosnowski (NEW)
Tomasz Ziemniak (NEW)

Document issued electronically valid without signature.

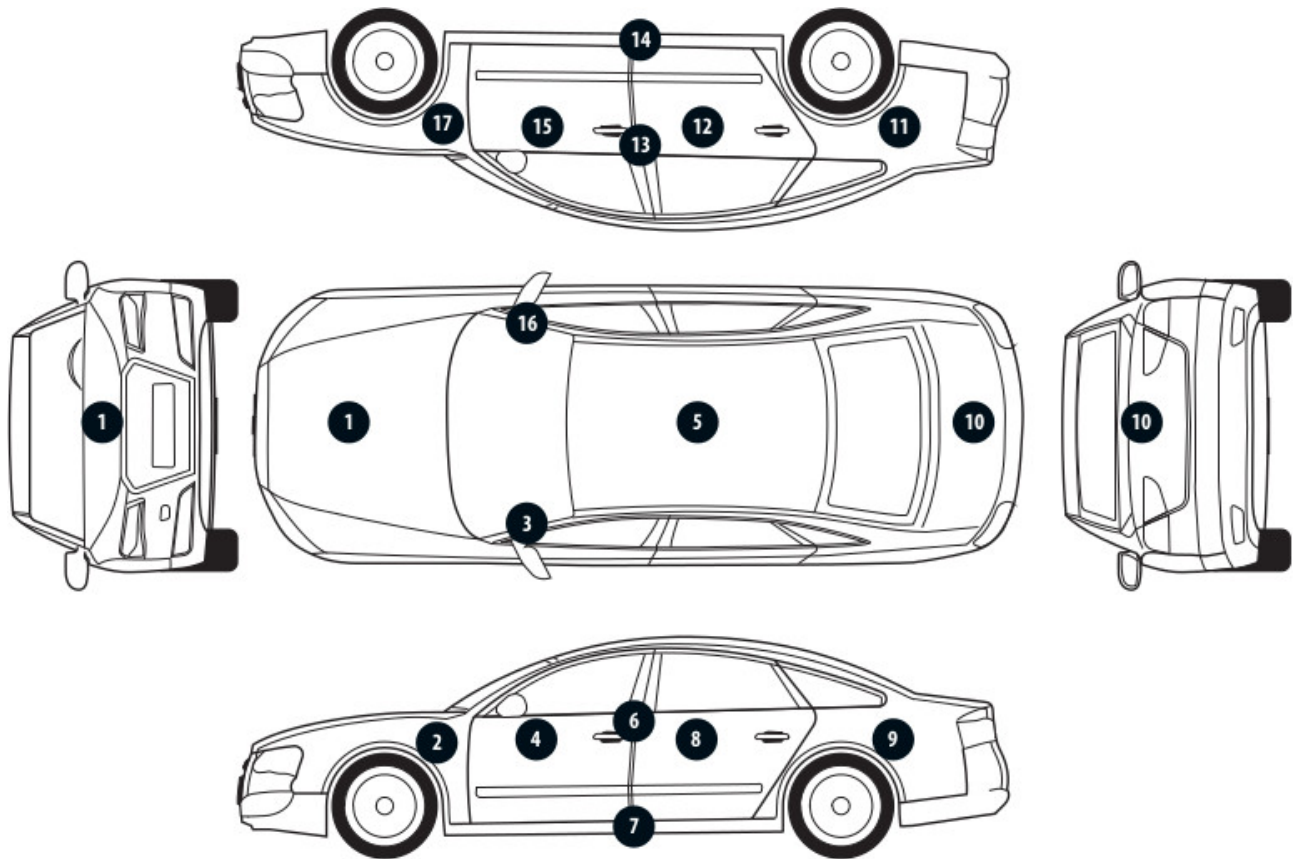Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [µm]
1	Front cover	to 150
2	Front left fender	to 150
3	Left front pillar	to 150
4	Front left door	150 - 200
5	Roof	to 150
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	150 - 200
9	Rear left fender	to 150
10	Cover/lid	to 150
11	Right rear fender	to 150
12	Right rear door	150 - 200
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	150 - 500
16	Right front pillar	to 150
17	Front right fender	150 - 200

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book was presented and its number is given below:

Brak nr

Information concerning the origin of the vehicle

The vehicle imported individually from EU

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

The test drive has been conducted on a distance and in time enabling rough estimation of the technical condition of the vehicle.

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted (with the exception of the year of production) - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.

- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

2

Expert comments - regarding valuation

Rysy na samochodzie. Odpryski na szybie czołowej. Widoczne wady lakiernicze.

Restrictive disclaimer - regarding valuation

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.

Przekątna przednia lewa



Photo 2.

Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.

Bok prawy z tyłu



Photo 6.

Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.
Próg lewy (widok od przodu)



Photo 12.
Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika



Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION



Photo 23.

Tabliczka znamionowa



Photo 24.

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe



Photo 28.

Widok z tylnej kanapy na deskę rozdź.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.
Konsola środkowa

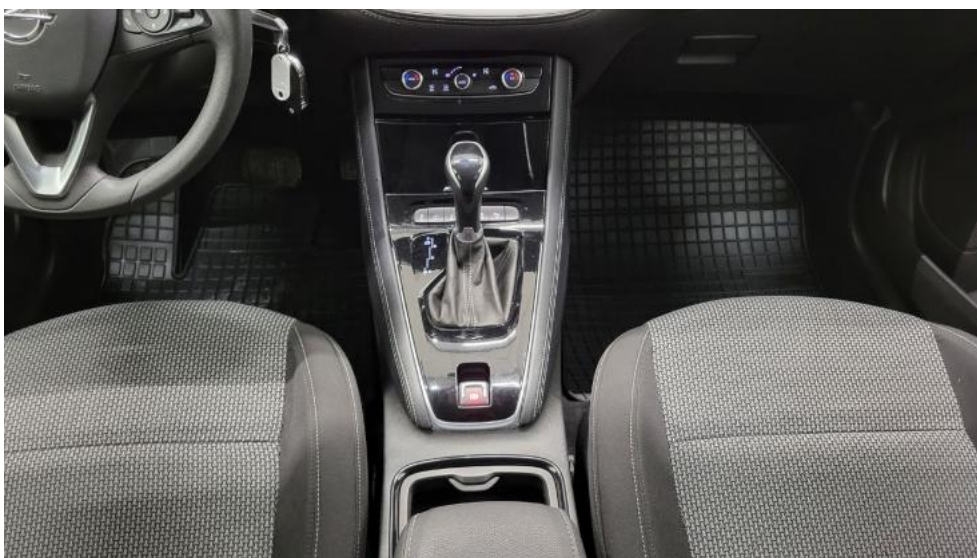


Photo 30.
Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION



Photo 31.

Kierownica (na wprost)

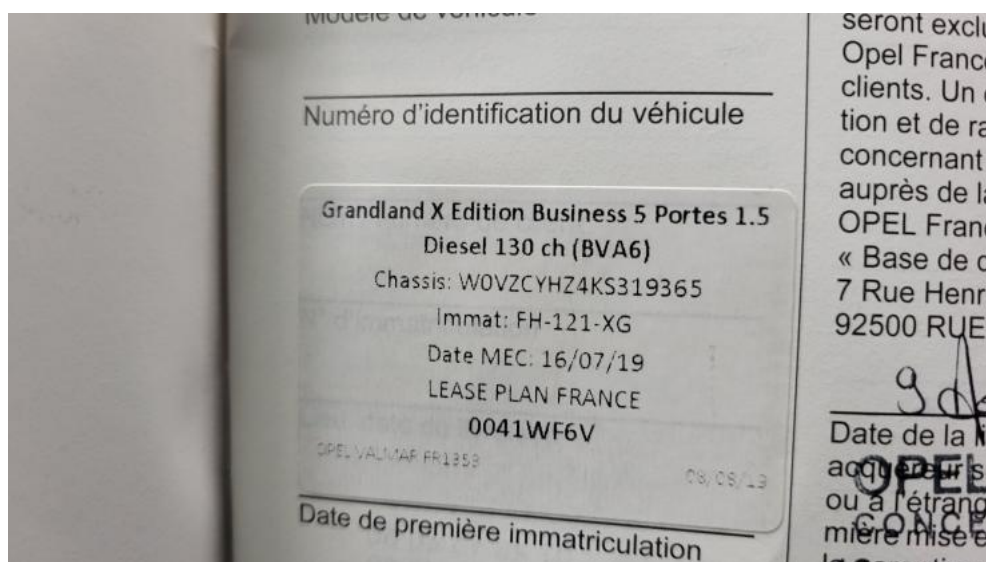


Photo 32.

Dowód rej. Str. 1

PHOTOGRAPHIC DOCUMENTATION**Photo 33.**

Dow. Rej. Str.2 i klucze

**Photo 34.**

Książka serwisowa – dane

PHOTOGRAPHIC DOCUMENTATION



Photo 35.

Książka serwisowa – ostatni przegląd



Photo 36.

Instrukcje

PHOTOGRAPHIC DOCUMENTATION



Photo 37.

Zdjęcie do protokołu



Photo 38.

Atrapa przednia - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Krata zderzaka prz. - Pęknięcie/rozerwanie 1



Photo 40.

Pokrywa komory silnika - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Spoiler zderzaka przedniego - Rysa/odprysk 1



Photo 42.

Wykładzina pokrywy komory silnika - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Błotnik przedni P - Wgniecenie/odkształcenie 1



Photo 44.

Drzwi przednie P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Drzwi tylne P - Rysa/odprysk 1



Photo 46.

Drzwi tylne P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Lusterko zew P - Rysa/odprysk 1



Photo 48.

Słupek środkowy P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1

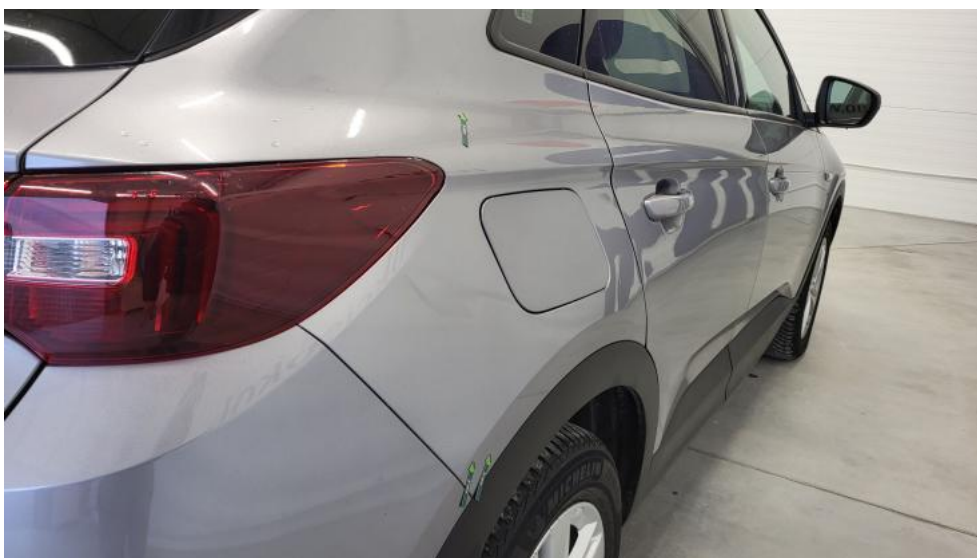


Photo 50.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 2

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Błotnik tylny P / Ściana boczna P() - Wgniecenie/odkształcenie 3



Photo 52.

Felga aluminiowa tylna P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Szyba tylna - Rysa/odprysk 1



Photo 54.

Zderzak tylny cz L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Zderzak tylny cz L - Rysa/odprysk 2



Photo 56.

Zderzak tylny cz L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Dach - Wgniecenie/odkształcenie 1



Photo 58.

Ścianka tylna L / Ścianka boczna L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 2



Photo 60.

Felga aluminiowa tylna L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Drzwi przed L - Rysa/odprysk 1



Photo 62.

Drzwi przed L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Drzwi tylne L - Wgniecenie/odkształcenie 1



Photo 64.

Słupek środkowy L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION

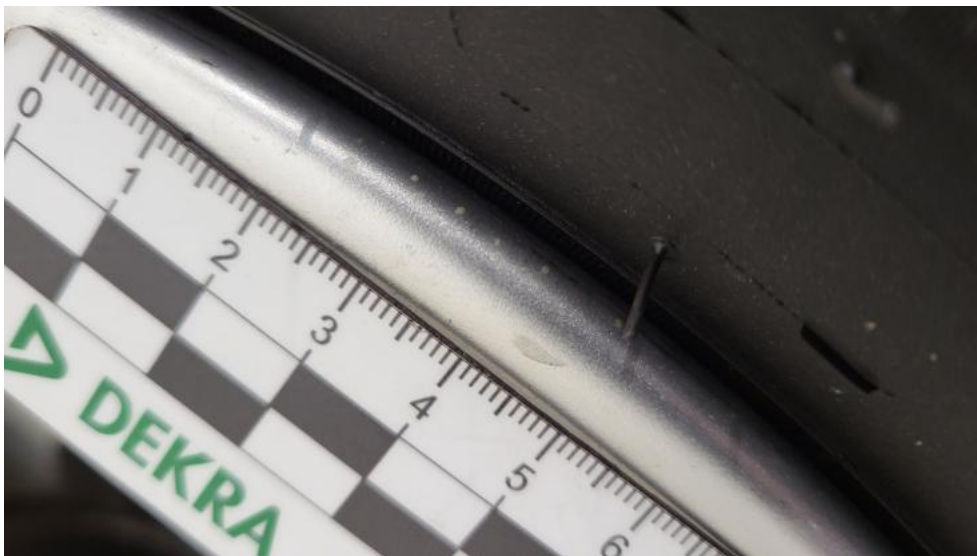


Photo 65.

Felga Aluminiowa przednia L - Rysa/odprysk 1



Photo 66.

Konsola środkowa - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 67.

Konsola środkowa - Pęknięcie/rozerwanie 1



Photo 68.

Kanapa tyl. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Tapicerka drzwi przednich L - Rysa/odprysk 1



Photo 70.

Tapicerka drzwi przednich P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Tapicerka drzwi tylnych L - Rysa/odprysk 1



Photo 72.

Tapicerka drzwi tylnych P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 73.

Tapicerka drzwi tylnych P - Pęknięcie/rozerwanie 1



Photo 74.

Osłona p/słoneczna lewa - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 75.

Podsufitka - Inne 1



Photo 76.

Wykładzina(y) słupka przedniego L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 77.

Wykładzina(y) słupka przedniego P - Rysa/odprysk 1

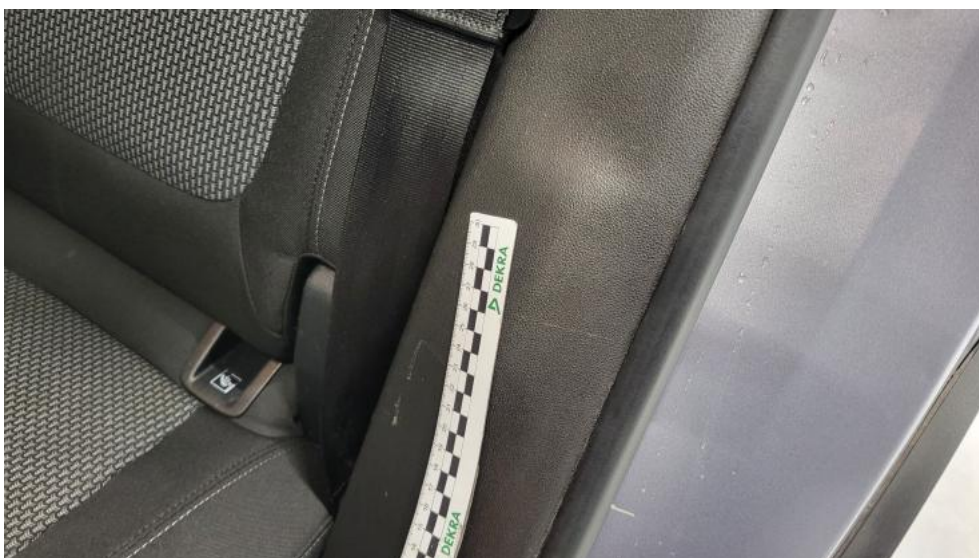


Photo 78.

Wykładzina(y) słupka tylnego L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION

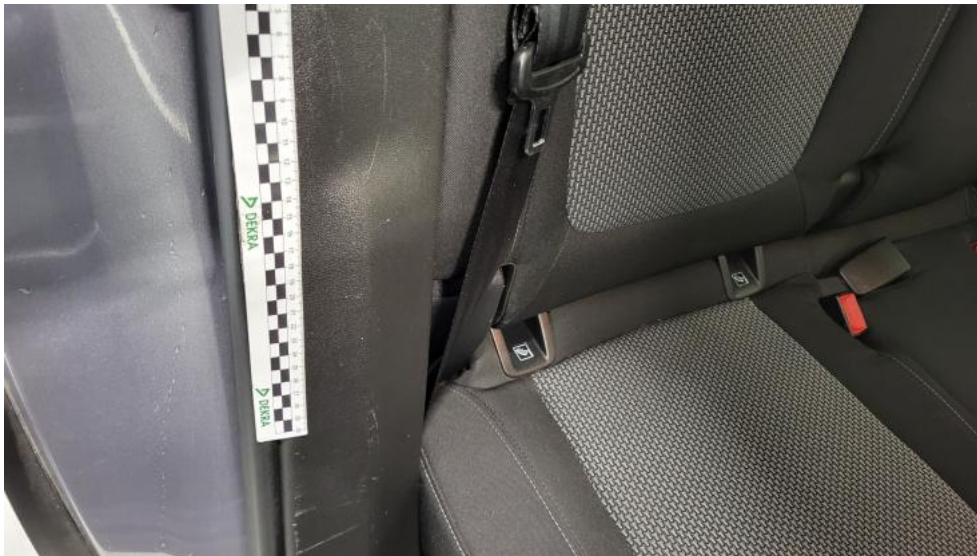


Photo 79.

Wykładzina(y) słupka tylnego P - Rysa/odprysk 1