

DEKRA's commission No. : PKOL(W)/LODZ/81599/26/09/01
commission/ damage No. : 26/010890
Date of commission: 01-09-2026

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (WSP)
DEKRA Polska - współpraca O/Warszawa
inż. Dariusz Pawliszyn
DEKRA Polska - O. Poznań

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0155080
Manufacturer	MAZDA
Model	MX-30 EV 20-
Type / version	MX-30 35.5kWh Exclusive Line
Body type	hatchback
Number of doors / seats	5/5
Curb weight [kg]	1645
Gross vehicle weight [kg]	2119
Wheelbase 1/2	2655
Engine type	elektryczny
Pollution reduction system	-
Engine capacity [ccm]	0
Engine Power [hp/kW]	145/107
Gearbox	automatic 1- gear
Registration /record No.	WGM0706E
VIN / serial number	JMZDR1WBJ00210043
Date of first registration	15-09-2023
Year of manufacture	2023 (year has been verified with the manufacturer's base)
Readout [km]	32 324 (read)
Body color / type of coating	grafitowy/double-layered, metallized

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	BRIDGESTONE, TURANZA T005 A	215/55 18 95H	4,0 mm
	left	BRIDGESTONE, TURANZA T005 A	215/55 18 95H	4,0 mm
back	right	BRIDGESTONE, TURANZA T005 A	215/55 18 95H	4,0 mm
	left	BRIDGESTONE, TURANZA T005 A	215/55 18 95H	4,0 mm

Standard equipment by Eurotax

- | | |
|---|---|
| 1. Adaptive Cruise Control | 34. Interior: other |
| 2. Alarm | 35. Keyless Engine start |
| 3. Android Auto, Apple CarPlay | 36. Keyless go |
| 4. Armrest (s) front | 37. LED Daytime running lights |
| 5. Armrest (s) rear | 38. LED front dim light |
| 6. Automated High-beam assist | 39. LED rear lights |
| 7. Automatic climate control | 40. Lane control assistant |
| 8. Automatic dimlight activation, Rain sensor | 41. Leather gearshifter/switch, Leather steering wheel |
| 9. Bluetooth interface, Hands-free system | 42. Light Alloy wheels 18" |
| 10. Bord communication: other | 43. Mobile Tire System |
| 11. Bord entertainment: other accessories, On board monitor, Radio | 44. Navigation system |
| 12. Brake Assist, Power assisted brakes | 45. On board monitor |
| 13. Central locking | 46. Other |
| 14. DAB radio, Radio | 47. Other |
| 15. Door mirror(s) electrically adjustable in general | 48. Other |
| 16. Door mirrors autodimming | 49. Other |
| 17. Door mirrors electrically foldable | 50. Park Distance Control front, Park Distance Control rear |
| 18. Door mirrors heated | 51. Power windows front |
| 19. Driver airbag, Passenger airbag, Side airbag driver, Side airbag driver and passenger | 52. Rear view camera |
| 20. Driver knee airbag | 53. Rear-view mirror autodimming |
| 21. Driver-information-system | 54. Soundsystem |
| 22. Driver-information-system | 55. Steering wheel heated |
| 23. Dywaniki podłogowe Luxury | 56. Textile upholstery |
| 24. ESP (Electronical Stabilizing Program) | 57. Traffic sign recognition |
| 25. Electric parking brake | 58. Transmission: other |
| 26. Extra power outlet | 59. Tyre pressure control (RDC) |
| 27. Head airbags front | 60. USB in |
| 28. Head-Up Display | 61. Uni-Lackierung |
| 29. Headlamp wash | 62. Vehicle charging cable |
| 30. Heated seat driver, Heated seat passenger | 63. Vehicle charging cable |
| 31. Hill holder | 64. Vehicle immobilizer |
| 32. Interior lights: other accessories | 65. Windscreenwiper: other |
| 33. Interior: other | |

Dealer's equipment (selected items)

1. Metallic paint -

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

CorrectionsFirst registrationMileage

Equipment

Tyres

Other

State of the vehicle -


Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 09-2026 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 08-09-2026

DEKRA's expert:
Kacper Sosnowski (WSP)
inż. Dariusz Pawliszyn

Document issued electronically valid without signature.

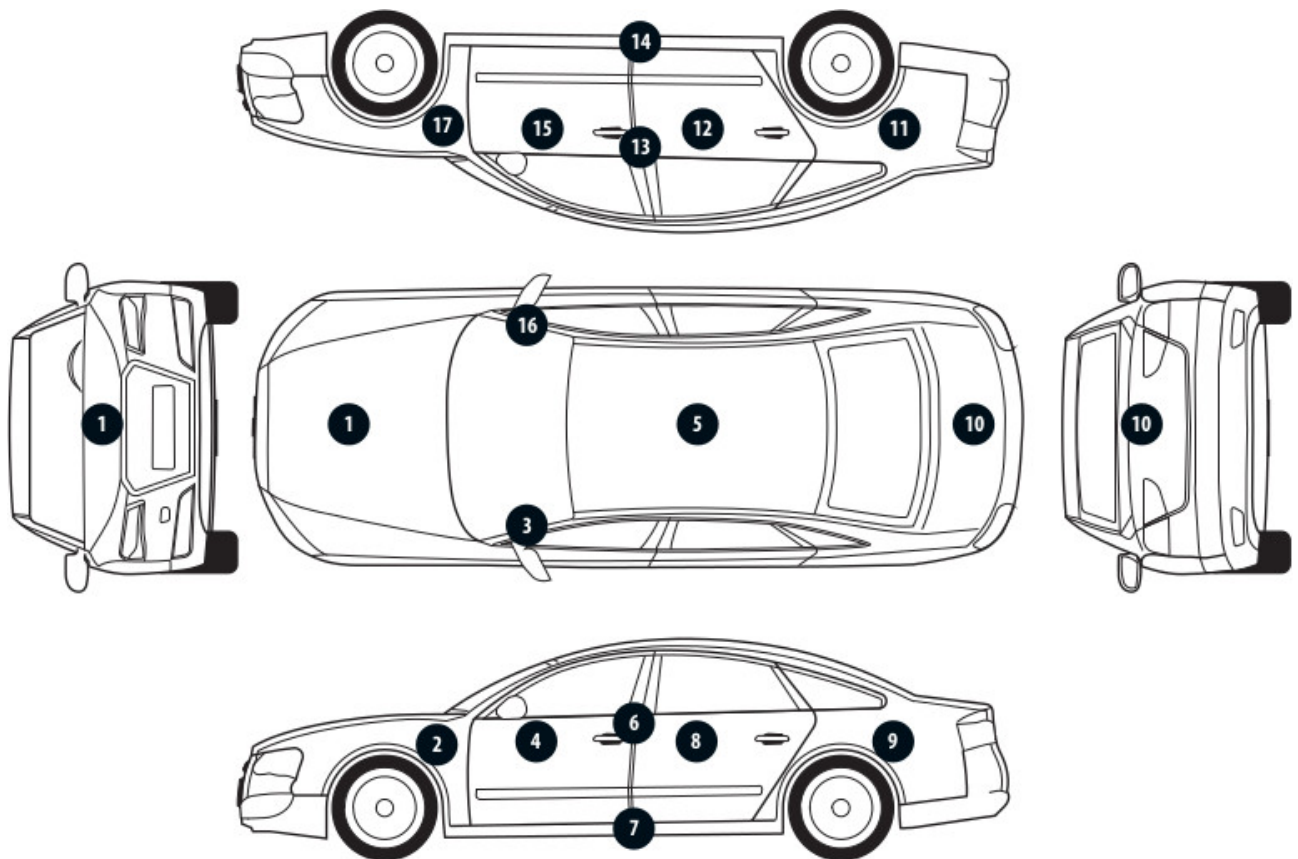Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Front left fender	to 150
3	Left front pillar	to 150
4	Front left door	to 150
5	Roof	to 150
7	Right side sill	to 150
8	Left rear door	to 150
9	Rear left fender	to 150
10	Cover/lid	to 150
11	Right rear fender	to 150
12	Right rear door	to 150
14	Right side sill	to 150
15	Front right door	to 150
16	Right front pillar	to 150
17	Front right fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book of the vehicle was not provided.

Information concerning the origin of the vehicle

The vehicle purchased domestically from an authorized representative of the brand.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below: parking

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the

page 5/37

assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

1

Expert comments - regarding valuation

Pojazd elektryczny. Rysy na samochodzie. Informacja niski poziom naładowania akumulatora wysokonapięciowego. Dostarczono ksero pozwolenia czasowego. Odpryski na szybie czołowej.

Restrictive disclaimer - regarding valuation

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.
Próg lewy (widok od przodu)



Photo 12.
Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa

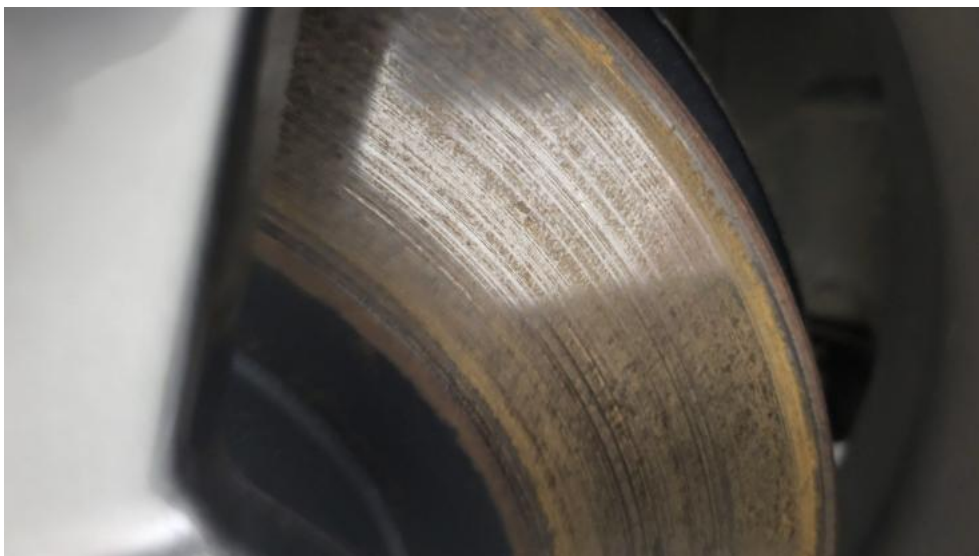


Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Komora silnika

PHOTOGRAPHIC DOCUMENTATION



Photo 21.

Numer identyfikacyjny



Photo 22.

Tabliczka znamionowa

PHOTOGRAPHIC DOCUMENTATION



Photo 23.

Zestaw wskaźników - przebieg



Photo 24.

Zestaw wskaźników - serwis

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe



Photo 28.

Widok z tylnej kanapy na deskę rozd.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.
Konsola środkowa



Photo 30.
Tunel środkowy

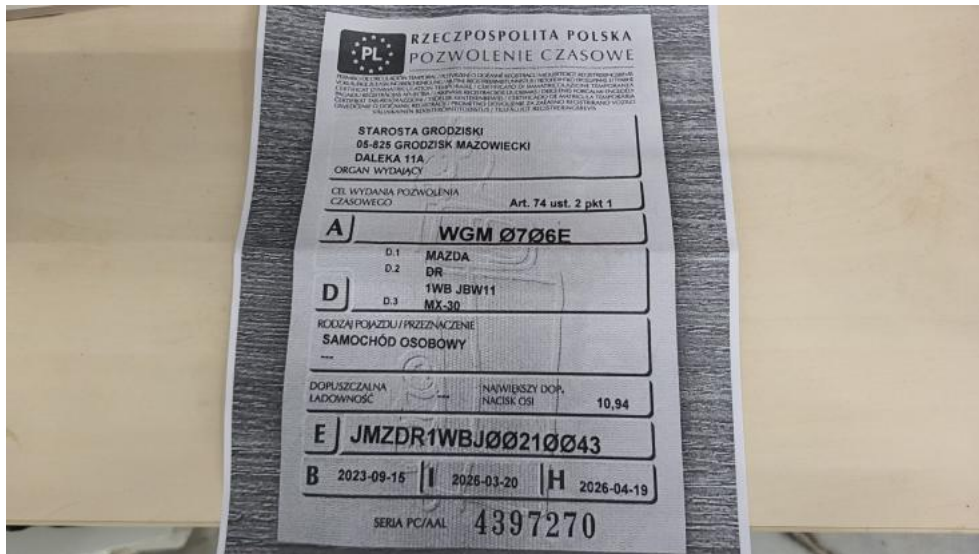
PHOTOGRAPHIC DOCUMENTATION



Photo 31.
Kierownica (na wprost)



Photo 32.
Przewód ładowania baterii trakcyjnej

PHOTOGRAPHIC DOCUMENTATION


RZECZPOSPOLITA POLSKA
POZWOLENIE CZASOWE

STAROSTA GRODZISKI
05-825 GRODZISK MAZOWIECKI
DALEKA 11A
ORGAN WYDAJĄCY

CIT. WYDANA POZWOLENIA CZASOWEGO Art. 74 ust. 2 pkt 1

A) WGM 0706E

0.1 MAZDA
0.2 DR
D) 1WB JBW11
0.3 MX-30

RODZAJ POJAZDU / PRZEZNACZENIE
SAMOCHÓD OSOBOWY

DOPUSZCZALNA ŁADOWNOŚĆ NAWIĘKSZY DOP. NACISK OSI 10,94


E) JMZDR1WBJ00210043

B 2023-09-15 **I** 2026-03-20 **H** 2026-04-19

SERIA PC/AAL 4397270

Photo 33.

Dow. rej. ksero Str. 1

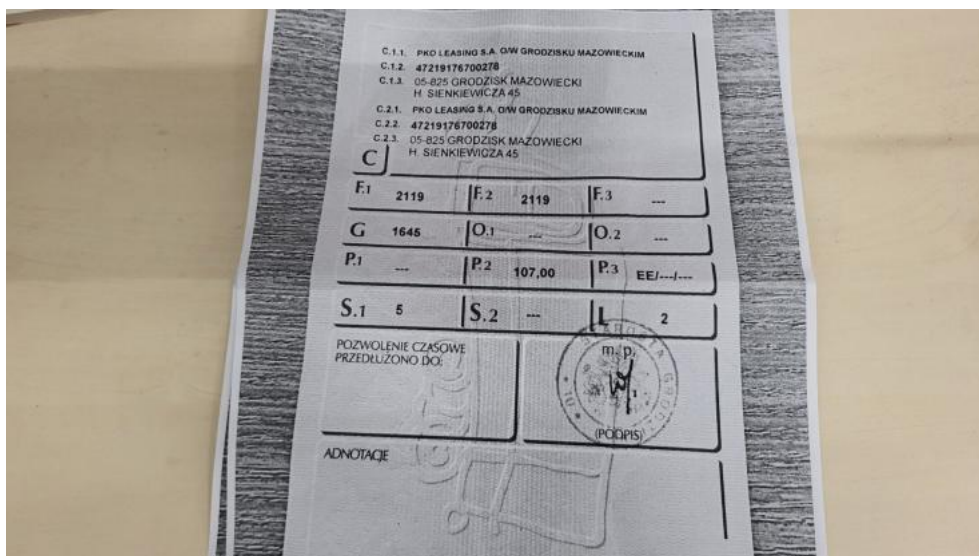

C.1.1. PKO LEASING S.A. O/W GRODZISKU MAZOWIECKIM
C.1.2. 47219176700278
C.1.3. 05-825 GRODZISK MAZOWIECKI
H. SIENKIEWICZA 45
C.2.1. PKO LEASING S.A. O/W GRODZISKU MAZOWIECKIM
C.2.2. 47219176700278
C.2.3. 05-825 GRODZISK MAZOWIECKI
H. SIENKIEWICZA 45

C)

F.1 2119 **F.2** 2119 **F.3** ---
G 1645 **O.1** --- **O.2** ---
P.1 --- **P.2** 107,00 **P.3** EE/---
S.1 5 **S.2** --- **L** 2

POZWOLENIE CZASOWE PRZEDŁUŻONO DO:

ADNOTACJE

PODPIS

Photo 34.

Dow. Rej. ksero Str. 2

PHOTOGRAPHIC DOCUMENTATION



Photo 35.

Gniazdo ładowania / tankowania



Photo 36.

Kluczyki

PHOTOGRAPHIC DOCUMENTATION



Photo 37.

Zdjęcie do protokołu



Photo 38.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Zdjęcie do protokołu



Photo 40.

Zderzak przedni cz dolna - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Zderzak przedni cz górna - Rysa/odprysk 1



Photo 42.

Felga aluminiowa przednia P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Drzwi przednie P - Rysa/odprysk 1



Photo 44.

Listwa drzwi przednich P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Lusterko zew P - Rysa/odprysk 1



Photo 46.

Słupek przedni P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Błotnik tylny P / Ściana boczna P - Rysa/odprysk 1



Photo 48.

Felga aluminiowa tylna P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Listwa krawędzi błotnika tyl P - Rysa/odprysk 1



Photo 50.

Pokrywy bagażnika - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Zderzak tylny - Rysa/odprysk 1

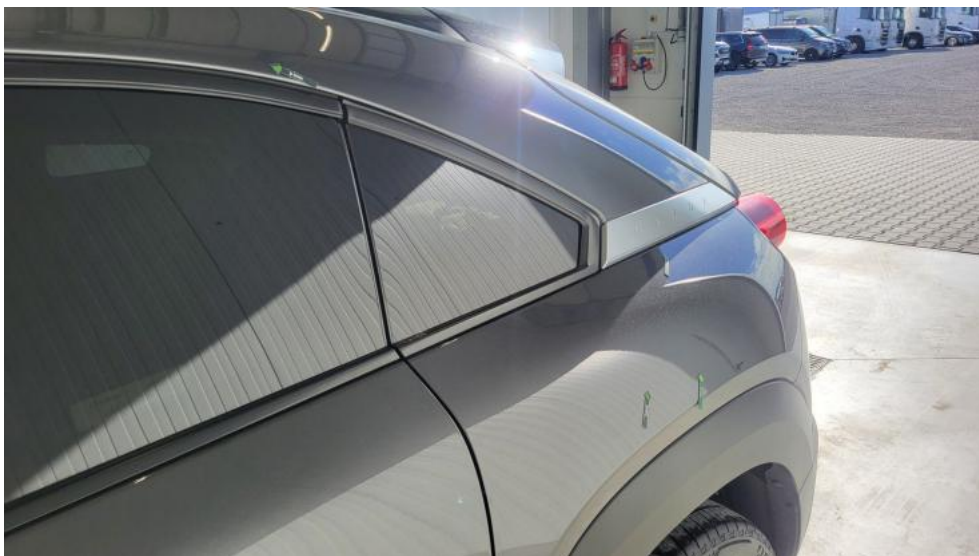


Photo 52.

Błotnik tylny L / Ściana boczna L - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1



Photo 54.

Drzwi przed L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Drzwi tylne L - Wgniecenie/odkształcenie 1



Photo 56.

Listwa drzwi przednich L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.
Próg L - Rysa/odprysk 1



Photo 58.
Felga Aluminiowa przednia L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Koło kierownicy - Rysa/odprysk 1



Photo 60.

Fotel prz. lew. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Wykładzina pokrywy tylnej - Rysa/odprysk 1