

DEKRA's commission No. : PKOL(W)/LODZ/03993/26/01/16
commission/ damage No. : 22/028047
Date of commission: 16-01-2026

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (WSP)
DEKRA Polska - współpraca O/Warszawa
Andrzej Sosnowski
DEKRA Polska - Centrala

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0135123
Manufacturer	TOYOTA
Model	Corolla Hatchback 18-22
Type / version	Corolla 2.0 Hybrid Selection
Body type	hatchback
Number of doors / seats	5/5
Curb weight [kg]	1479
Gross vehicle weight [kg]	1910
Wheelbase 1/2	2640
Engine type	spark ignition
Pollution reduction system	GPF
Engine capacity [ccm]	1986
Engine Power [hp/kW]	152/112
Gearbox	automatic
Registration /record No.	CB897NW
VIN / serial number	SB1K53BE10E034718
Date of first registration	12-11-2019
Date of next. tech. test	11-12-2026
Year of manufacture	2019 (year has been verified with the manufacturer's base)
Readout [km]	155 809 (read)
Body color / type of coating	white/double-layered, metallized

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	NOKIAN, WR D4	225/40 18 92V	3,0 mm
	left	NOKIAN, WR D4	225/40 18 92V	3,0 mm
back	right	ZEETEX, WH1000	225/40 18 92V	5,0 mm
	left	ZEETEX, WH1000	225/40 18 92V	5,0 mm

Standard equipment by Eurotax

- | | |
|--|---|
| 1. Adaptive Cruise Control | 47. Interior: other |
| 2. Additional gauges | 48. Keyless go |
| 3. Alcantara upholstery | 49. Keyless go |
| 4. Android Auto, Apple CarPlay | 50. LED Daytime running lights |
| 5. Antilock-Brake-System (ABS) | 51. LED front dim light |
| 6. Armrest (s) front | 52. LED rear lights |
| 7. Armrest (s) front | 53. Lane control assistant, Other |
| 8. Armrest (s) rear | 54. Leather gearshifter/switch, Leather steering wheel |
| 9. Automated High-beam assist | 55. Light Alloy wheels 18'' |
| 10. Automatic Emergency Call | 56. Lumbar adjust driver electric |
| 11. Automatic antenna/ window-antenna | 57. Mobile Tire System |
| 12. Automatic climate control | 58. Moulded sport seats |
| 13. Automatic dimlight activation | 59. Multi functional steering wheel |
| 14. Bluetooth interface | 60. On board computer |
| 15. Bord climate: other | 61. On board monitor |
| 16. Bord communication: other | 62. Other |
| 17. Bord entertainment: other accessories | 63. Other |
| 18. Bumpers: other, Exterior design: other | 64. Other |
| 19. Child lock manually | 65. Other |
| 20. Child seat fixation | 66. Other |
| 21. Cornering Headlights | 67. Other |
| 22. Distribution of braking force electronically | 68. Park Assistant |
| 23. Door mirror(s) electrically adjustable in general | 69. Park Distance Control front, Park Distance Control rear |
| 24. Door mirrors electrically foldable | 70. Passenger seat height adjustable |
| 25. Door mirrors heated | 71. Power assisted brakes |
| 26. Driver airbag, Passenger airbag | 72. Power windows front, Power windows rear |
| 27. Driver knee airbag | 73. Pre-Crash System |
| 28. Driver seat height adjustable | 74. Radio |
| 29. Duotone colour, Exterior design: other | 75. Rain sensor |
| 30. ESP (Electronical Stabilizing Program) | 76. Rear bench foldable in two separate parts |
| 31. ESP (Electronical Stabilizing Program), Traction control | 77. Rear spoiler |
| 32. Exterior design: other | 78. Rear view camera |
| 33. Exterior design: other | 79. Rear-view mirror autodimming |
| 34. Exterior lighting: other | 80. Remote controlled central locking |
| 35. Extra power outlet | 81. Rev counter |
| 36. Fog lamps | 82. Side airbag driver and passenger |
| 37. Head airbags front | 83. Steering wheel electrically adjustable |
| 38. Headlamp wash | 84. Steering wheel heated |
| 39. Heated seat driver, Heated seat passenger | 85. Steering wheel with gear-switches |
| 40. Hill holder | 86. Tinted rear windows |
| 41. Interior decoration: other | 87. Traffic sign recognition |
| 42. Interior decoration: other | 88. Tyre pressure control (RDC) |
| 43. Interior decoration: other | 89. USB in |
| 44. Interior lights: other accessories | 90. Uni-Lackierung |
| 45. Interior lights: other accessories | 91. Vehicle immobilizer |
| 46. Interior: other | 92. Windscreen heating |

Dealer's equipment (selected items)

1. Metallic paint

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

CorrectionsFirst registrationMileageEquipmentTyresOther

Earlier repairs -


Uszkodzenia stan -

Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 02-2026 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 16-02-2026

DEKRA's expert:
Kacper Sosnowski (WSP)
Andrzej Sosnowski**Document issued electronically valid without signature.**

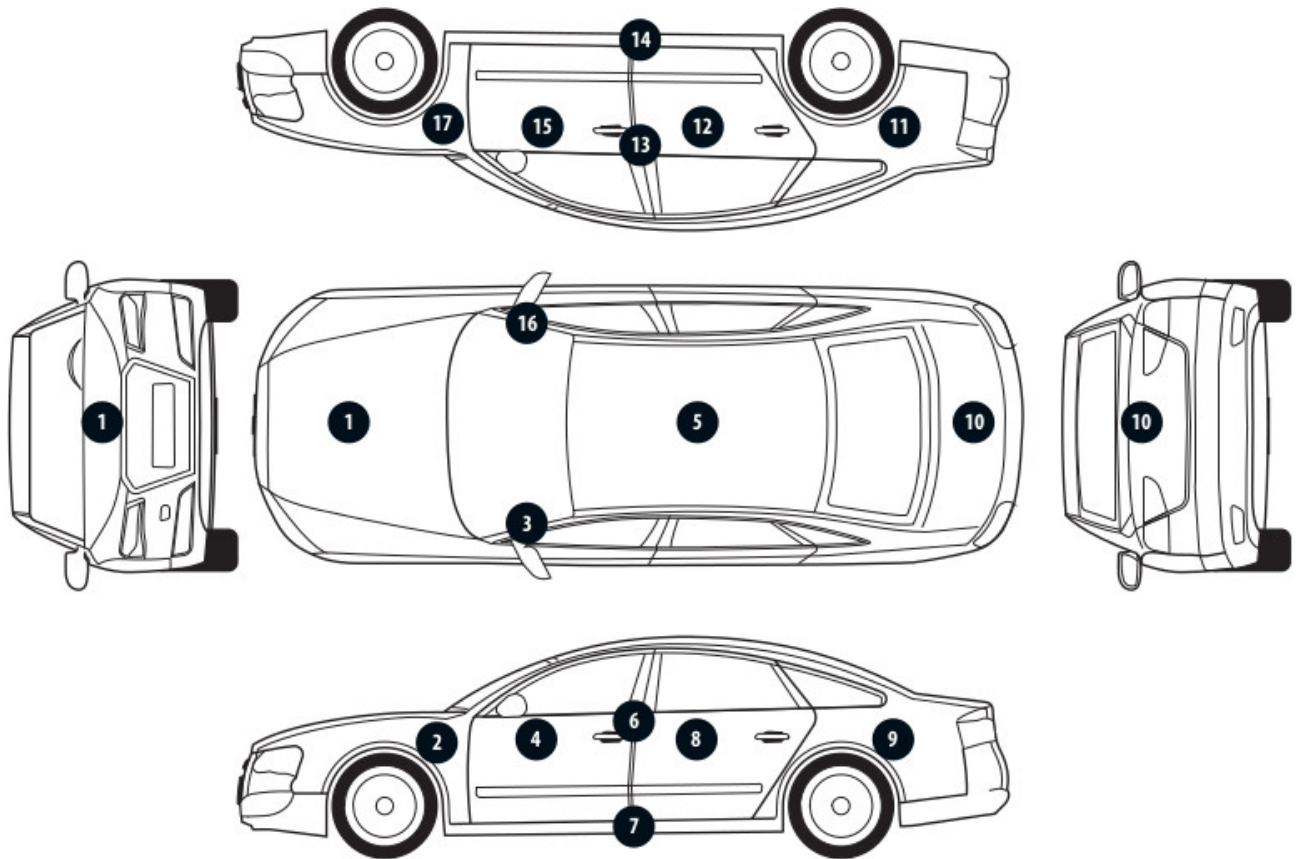Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Front left fender	to 150
3	Left front pillar	150 - 300
4	Front left door	150 - 200
5	Roof	150 - 200
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	150 - 200
9	Rear left fender	150 - 1000
11	Right rear fender	to 150
12	Right rear door	to 150
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	to 150
16	Right front pillar	150 - 200
17	Front right fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book was presented and its number is given below:

.

Information concerning the origin of the vehicle

Lack of reliable data.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below:
ograniczenia placowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of

page 5/48

the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

2

Expert comments - regarding valuation

Rysy na samochodzie. Odpryski na szybie czołowej. Substancja na samochodzie. Widoczne ślady po grafice reklamowej. Widoczne wady lakiernicze.

Rzeczoznawca dokonał oględzin pojazdu w warunkach parkingowych, co mogło ograniczyć pełną ocenę jego stanu technicznego. Dodatkowo, jeżeli jazda próbna została przeprowadzona (informacje w treści raportu), to wykonano ją w warunkach parkingowych, z niewielką prędkością, co może nie odzwierciedlać pełnych warunków eksploatacyjnych. Istnieje możliwość, że w innych okolicznościach ujawnią się dodatkowe uszkodzenia lub usterki, których nie można było wykryć podczas obecnych oględzin. Zalecamy zatem skorzystanie z możliwości oględzin pojazdu we własnym zakresie lub w Autoryzowanej Stacji Obsługi danej marki, co pozwoli na pełniejszą weryfikację stanu technicznego pojazdu przed udziałem w aukcji."

Restrictive disclaimer - regarding valuation

Nie weryfikowano szczegółowo stanu układu napędowego, zawieszenia, kierowniczego, hamulcowego oraz wydechowego. Ocena została wykonana bez użycia podnośnika i specjalistycznego sprzętu diagnostycznego, nie dokonywano demontażu osłon i innych elementów. Ocena określa ogólny stan pojazdu na dzień oględzin w miejscu jego udostępnienia, nie może być zatem traktowana jako kompleksowa ocena stanu technicznego. Specyfikacja wg. programu operacyjnego w zakresie wyposażenia standardowego i dodatkowego nie gwarantuje zgodności ze stanem faktycznym w zakresie możliwym do ustalenia przez rzeczoznawcę podczas oględzin pojazdu.

Pomiar grubości powłoki lakierowej wykonano w miejscach możliwych do ich wykonania pomiary nie gwarantują oryginalności poszczególnych elementów poddanych ocenie.

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.

- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.
Próg lewy (widok od przodu)



Photo 12.
Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika



Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION

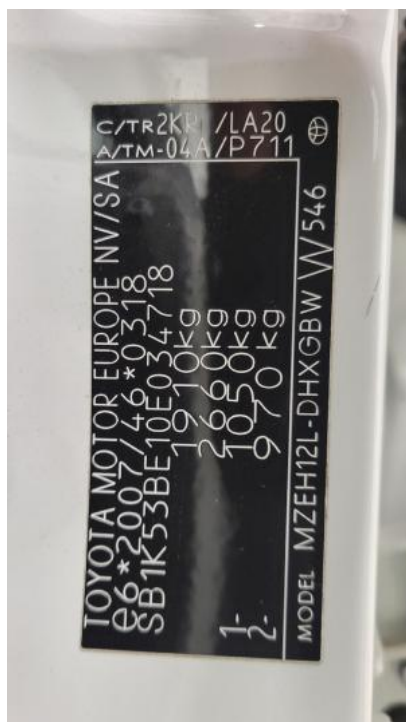


Photo 23.

Tabliczka znamionowa



Photo 24.

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe



Photo 28.

Widok z tylnej kanapy na deskę rozdź.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.

Konsola środkowa



Photo 30.

Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION



Photo 31.

Kierownica (na wprost)



Photo 32.

Dowód rej. Str. 1

PHOTOGRAPHIC DOCUMENTATION**Photo 33.**


Dow. Rej. Str.2 i klucze

Kod	Kod modelu	MZEH12L-DHXGBW
Nr r	Nr VIN	SB1K53BE10E034718
Nr V	Typ/Nr Silnika	M20A 0181974
Nr s	Nr książki gwarancyjnej	C/853969/078
Nr k	Kod koloru	2KR
Kod	Kod koloru tapicerki	LA20
Kod	Data wydania:	12 listopad 2019 r.
Kod	Delivery date:	12 November 2019 y.
Data wydania		


Ze względów bezpieczeństwa Toyota nie zamieszcza w książce gwarancyjnej szczegółowych informacji. Takie postępowanie zabezpiecza

Photo 34.

Książka serwisowa – dane

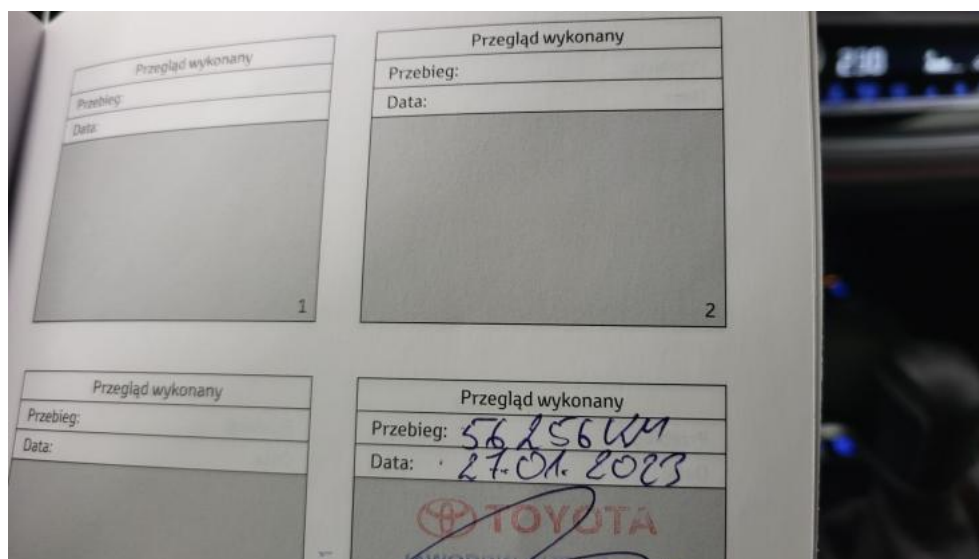PHOTOGRAPHIC DOCUMENTATION**Photo 35.**

Książka serwisowa – ostatni przegląd

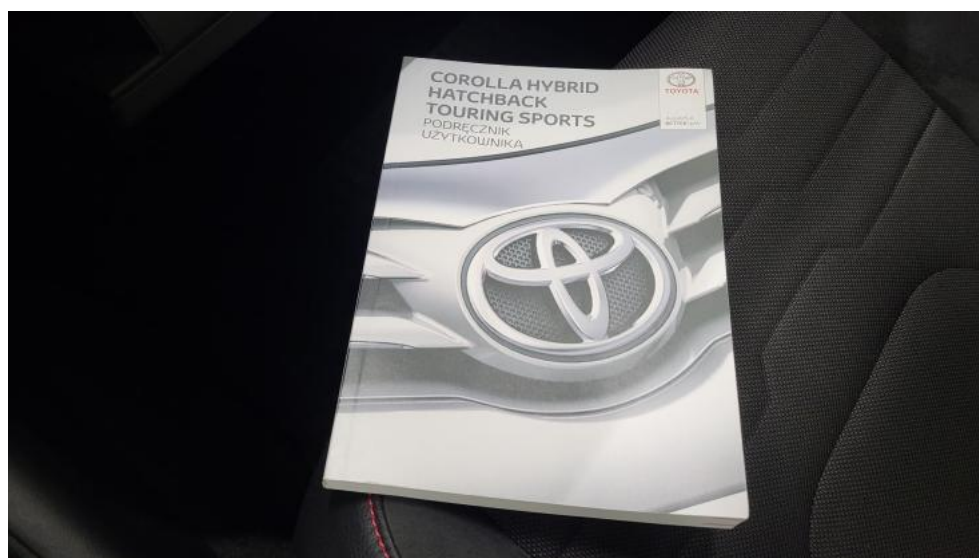**Photo 36.**

Instrukcje

PHOTOGRAPHIC DOCUMENTATION



Photo 37.
Zestaw naprawy koła



Photo 38.
Kratka/zaślepka halogenu L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Kratka/zaślepka halogenu P - Inne 1



Photo 40.

Listwa śr zderzaka przedniego - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Pokrywa komory silnika - Wgniecenie/odkształcenie 1



Photo 42.

Pokrywa komory silnika - Wgniecenie/odkształcenie 2

PHOTOGRAPHIC DOCUMENTATION

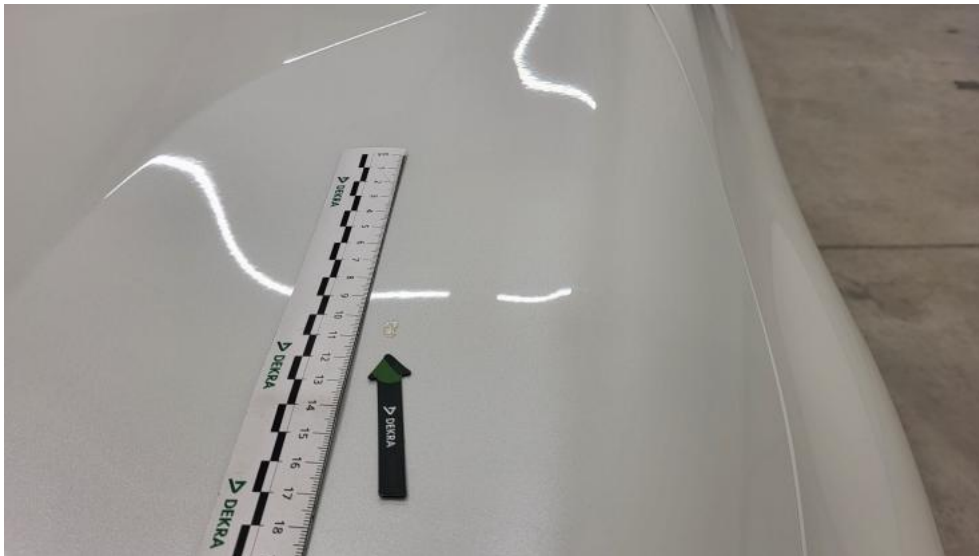


Photo 43.

Pokrywa komory silnika - Inne 1



Photo 44.

Spoiler zderzaka przedniego - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Spoiler zderzaka przedniego - Pęknięcie/rozerwanie 1



Photo 46.

Zderzak - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Zderzak - Rysa/odprysk 2



Photo 48.

Błotnik przedni P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Felga aluminiowa przednia P - Rysa/odprysk 1

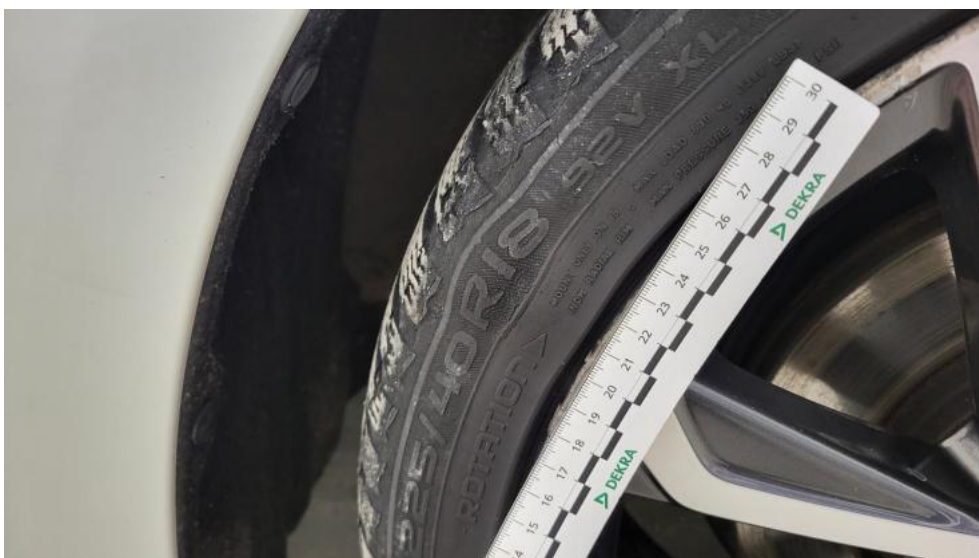


Photo 50.

Opona przednia P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Drzwi przednie P - Rysa/odprysk 1



Photo 52.

Drzwi tylne P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Słupek przedni P - Rysa/odprysk 1



Photo 54.

Słupek przedni P - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Błotnik tylny P / Ściana boczna P - Rysa/odprysk 1



Photo 56.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Felga aluminiowa tylna P - Rysa/odprysk 1



Photo 58.

Opona tylna P - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Pokrywy bagażnika - Rysa/odprysk 1



Photo 60.

Pokrywy bagażnika - Inne 1

PHOTOGRAPHIC DOCUMENTATION

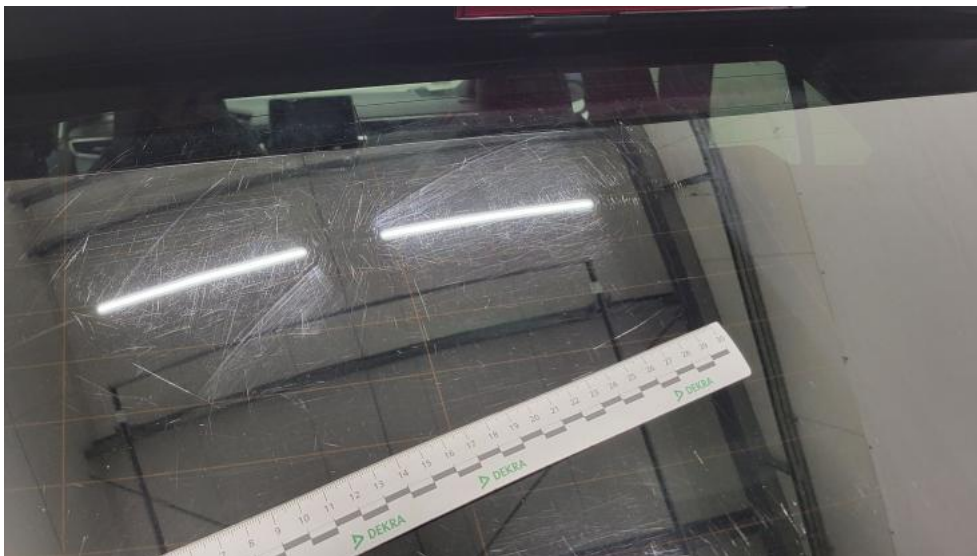


Photo 61.

Szyba tylna - Rysa/odprysk 1



Photo 62.

Zderzak tylny - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Zderzak tylny cz dolna - Rysa/odprysk 1



Photo 64.

Dach - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1

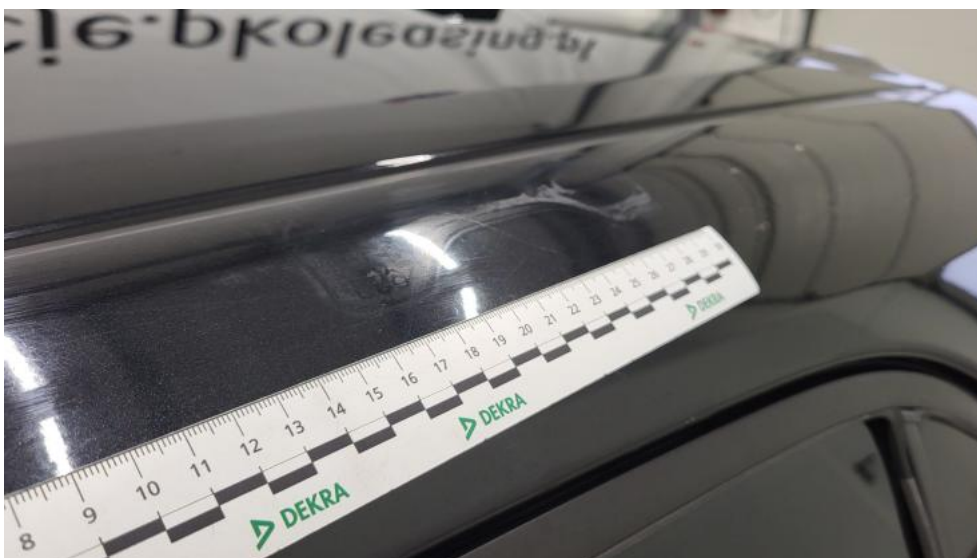


Photo 66.

Błotnik tylny L / Ściana boczna L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 67.

Ścianka tylna L / Ścianka boczna L - Inne 2



Photo 68.

Felga aluminiowa tylna L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Drzwi przed L - Rysa/odprysk 1

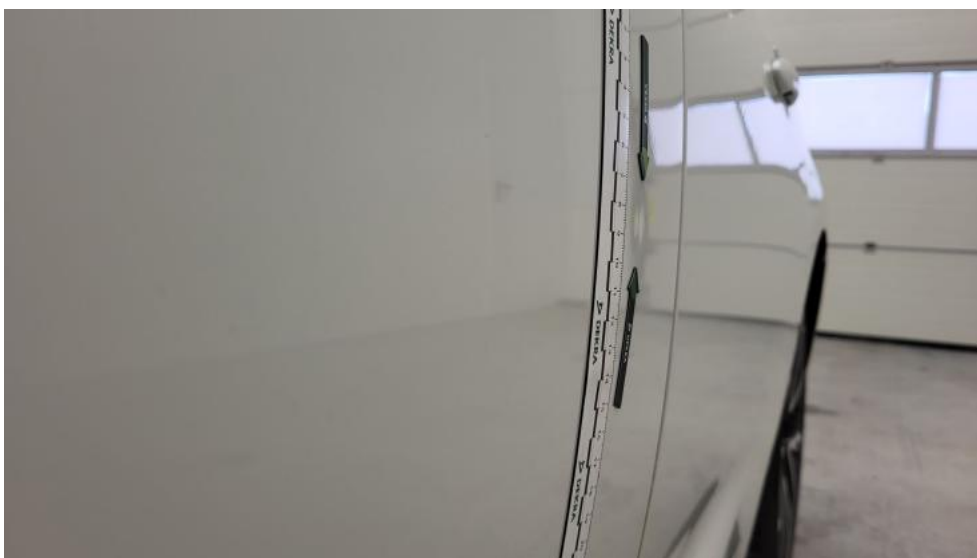


Photo 70.

Drzwi przed L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Drzwi tylne L - Wgniecenie/odkształcenie 1



Photo 72.

Słupek przedni L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION

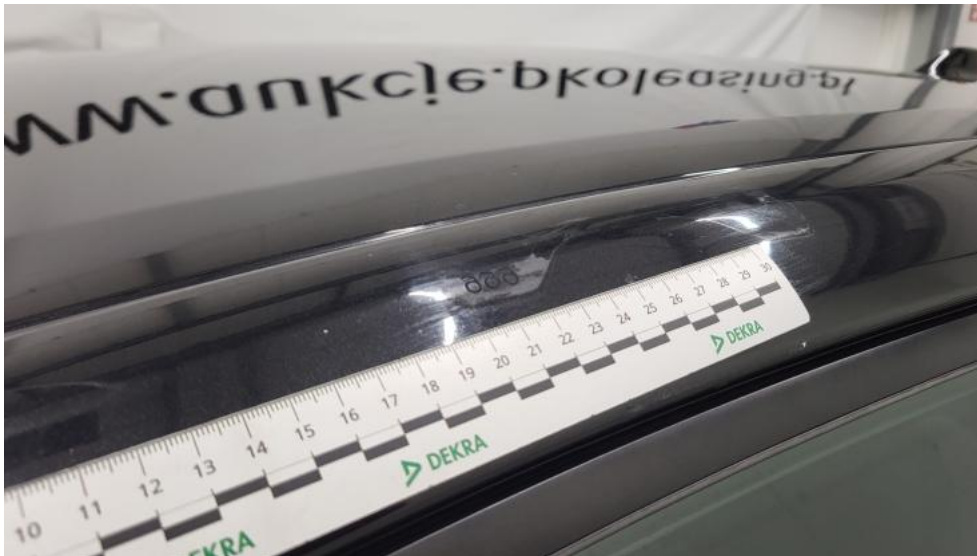


Photo 73.

Słupek przedni L - Inne 1



Photo 74.

Felga Aluminiowa przednia L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 75.

Deska rozdzielcza - Wgniecenie/odkształcenie 1



Photo 76.

Fotel prz. lew. - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 77.

Fotel prz. lew. - Inne 1



Photo 78.

Fotel prz. praw. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 79.

Kanapa tyl. - Inne 1



Photo 80.

Tapicerka drzwi przednich P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 81.

Tapicerka drzwi tylnych L - Rysa/odprysk 1

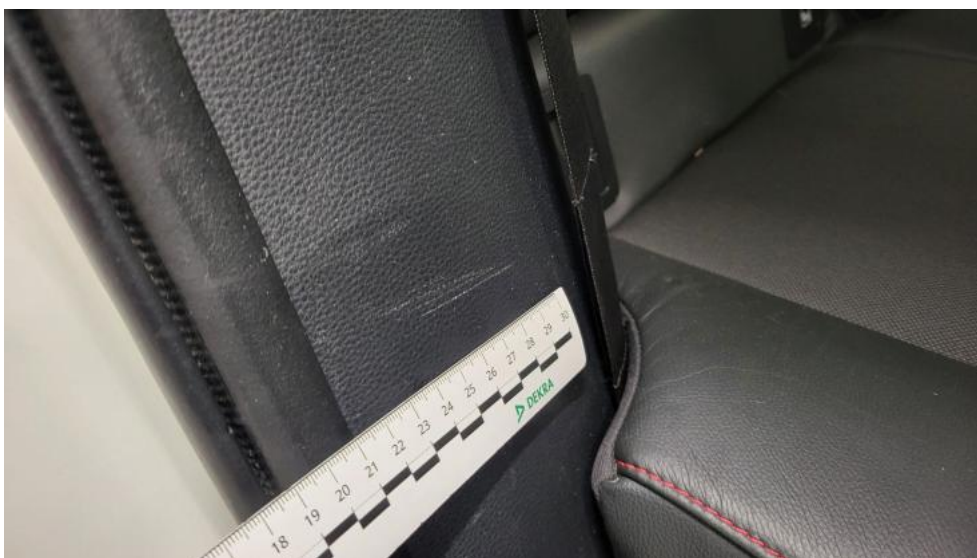


Photo 82.

Wykładzina(y) słupka tylnego P - Rysa/odprysk 1