

DEKRA's commission No. : PKOL(W)/LODZ/99348/26/10/23
commission/ damage No. : 22/026066
Date of commission: 23-10-2026

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (WSP)
DEKRA Polska - współpraca O/Warszawa
inż. Dariusz Pawliszyn
DEKRA Polska - O. Poznań

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0126823
Manufacturer	HYUNDAI
Model	i30 17-20
Type / version	i30 1.4 Comfort
Body type	hatchback
Number of doors / seats	5/5
Curb weight [kg]	1232
Gross vehicle weight [kg]	1750
Wheelbase 1/2	2650
Engine type	spark ignition
Pollution reduction system	three-way catalytic converter
Engine capacity [ccm]	1368
Engine Power [hp/kW]	100/74
Gearbox	manual 6- gear
Registration /record No.	DJA31269
VIN / serial number	TMAH2514ALJ131786
Date of first registration	23-03-2020
Date of next. tech. test	17-08-2027
Year of manufacture	2020 (year has been verified with the manufacturer's base)
Readout [km]	215 454 (read)
Body color / type of coating	beżowy/double-layered, metallized

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	KLEBER, KRISALP HP3	205/55 16 91H	2,0 mm
	left	KLEBER, KRISALP HP3	205/55 16 91H	1,5 mm
back	right	KLEBER, KRISALP HP3	205/55 16 91H	3,5 mm
	left	KLEBER, KRISALP HP3	205/55 16 91H	3,0 mm

Standard equipment by Eurotax

- | | |
|--|--|
| 1. Airbag: other | 34. Hill holder |
| 2. Alarm | 35. Interior lights: other accessories |
| 3. Armrest (s) rear | 36. Interior: other |
| 4. Automatic climate control | 37. Interior: other |
| 5. Bluetooth interface | 38. Interior: other |
| 6. Bluetooth interface | 39. LED Daytime running lights |
| 7. Bord communication: other | 40. Leather gearshifter/switch, Leather steering wheel |
| 8. Bord entertainment: other accessories, Interior: other | 41. Light Alloy wheels 16'' |
| 9. Central locking | 42. Lumbar adjust driver, Lumbar adjust passenger |
| 10. Child seat fixation | 43. Mobile phone preparation |
| 11. City Emergency Brake Assist | 44. On board monitor, Radio, Rear view camera |
| 12. Cornering Headlights | 45. Other |
| 13. Cruise control | 46. Other |
| 14. Daytime running lights | 47. Other |
| 15. Daytime running lights | 48. Other |
| 16. Diminished spare wheel | 49. Other, Power windows front, Power windows rear |
| 17. Door mirrors electrically foldable | 50. Park Distance Control rear |
| 18. Door mirrors heated, Mirror: others | 51. Passenger seat height adjustable |
| 19. Door: other | 52. Power steering |
| 20. Driver airbag, Passenger airbag | 53. Power windows front, Power windows rear |
| 21. Driver seat height adjustable | 54. Radio preparation |
| 22. Driver-information-system | 55. Side airbag driver and passenger |
| 23. ESP (Electronical Stabilizing Program) | 56. Steering wheel with radio operation |
| 24. Exterior design: other | 57. Steering: other |
| 25. Exterior design: other | 58. Storage facilities in general |
| 26. Exterior design: other | 59. Textile upholstery |
| 27. Exterior design: other | 60. Tinted rear windows |
| 28. Exterior lighting: other | 61. Tyre pressure control (RDC) |
| 29. Extra power outlet | 62. USB in |
| 30. Fog lamps | 63. Uni-Lackierung |
| 31. Full Cabin Spoiler | 64. Warranty: 4 years or more |
| 32. Head airbags front, Head airbags rear | 65. Warranty: 4 years or more |
| 33. Heated seat driver, Heated seat passenger, Steering wheel heated | 66. {LKAS - system utrzymania toru jazdy} |

Dealer's equipment (selected items)

1. Metalic paint -

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

Corrections
First registration
Mileage

Equipment

Tyres

Other

State of the vehicle -
Earlier repairs -

Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 10-2026 POL) with regard to technical and market parameters affecting the value of the vehicle.


Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 28-10-2026

DEKRA's expert:
Kacper Sosnowski (WSP)
inż. Dariusz Pawliszyn

Document issued electronically valid without signature.

Measurement of thickness of the vehicle lacquer coating

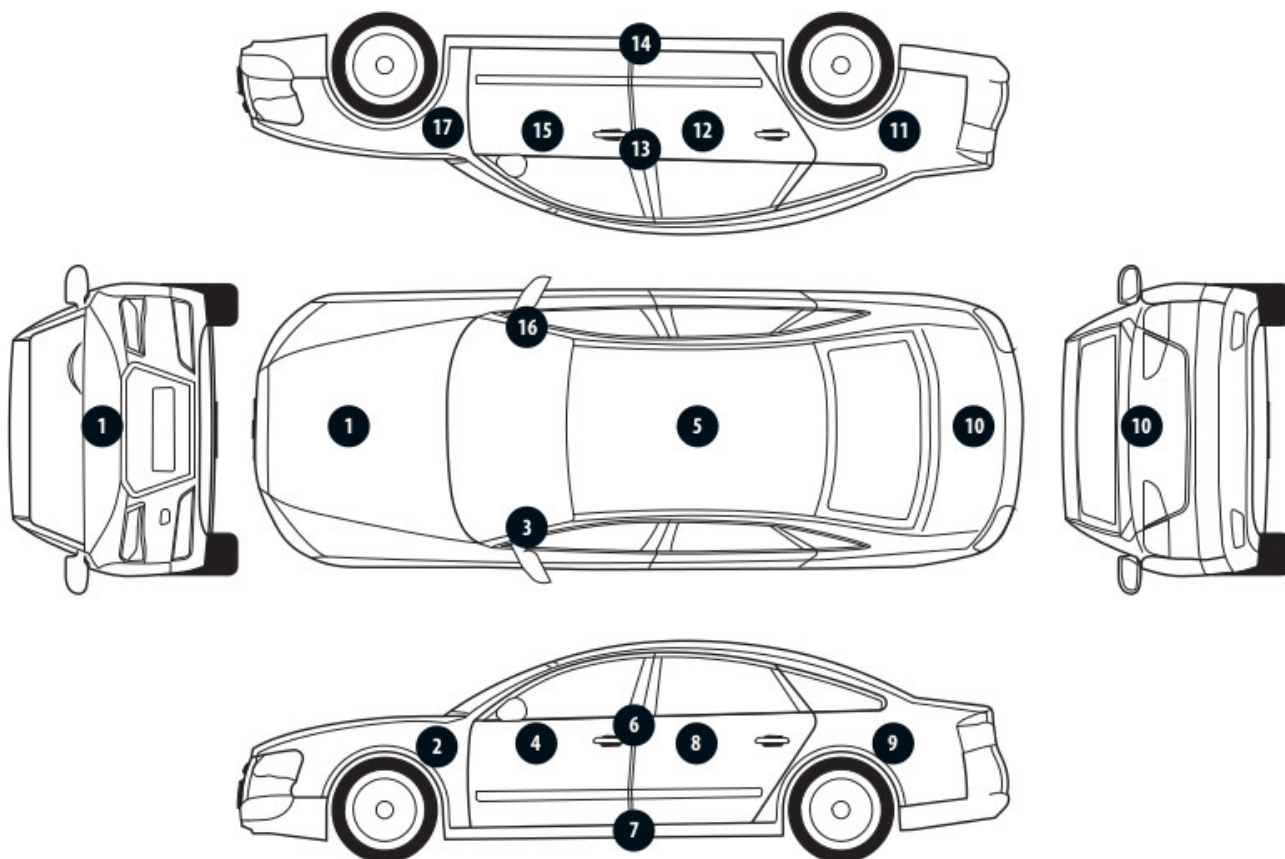

No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Front left fender	to 150
3	Left front pillar	to 150
4	Front left door	to 150
5	Roof	to 150
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	to 150
9	Rear left fender	to 150
10	Cover/lid	to 150
11	Right rear fender	150 - 300
12	Right rear door	to 150
13	Right middle pillar	150 - 200
14	Right side sill	150 - 300
15	Front right door	150 - 300
16	Right front pillar	150 - 200
17	Front right fender	150 - 300

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book of the vehicle was not provided.

Information concerning the origin of the vehicle

The vehicle purchased domestically from an authorized representative of the brand.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below: parking

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the

page 5/51

assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

2

Expert comments - regarding valuation

Rysy na samochodzie. Nieprzyjemny zapach w samochodzie. Utrudnione wysuwanie grota w jednym z kluczyków. Poziom płynu układu chłodniczego poniżej minimum. Poziom oleju silnikowego poniżej minimum. Konieczny przegląd od 69553km. Głośna i nierówna praca silnika, do weryfikacji serwisowej. Brak dekielków felg lewy/prawy przód. Widoczne wady lakiernicze. Odpryski na szybie czołowej.

Restrictive disclaimer - regarding valuation

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raporu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.
Próg lewy (widok od przodu)



Photo 12.
Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika



Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION



Photo 23.

Tabliczka znamionowa



Photo 24.

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Zestaw wskaźników - serwis



Photo 26.

Widok przez otwarte drzwi przednie lewe

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Kierownica z lewej strony



Photo 28.

Widok przez otwarte drzwi tylne lewe

PHOTOGRAPHIC DOCUMENTATION



Photo 29.

Widok z tylnej kanapy na deskę rozd.



Photo 30.

Konsola środkowa

PHOTOGRAPHIC DOCUMENTATION



Photo 31.
Tunel środkowy



Photo 32.
Kierownica (na wprost)

PHOTOGRAPHIC DOCUMENTATION



Photo 33.

Dowód rej. Str. 1

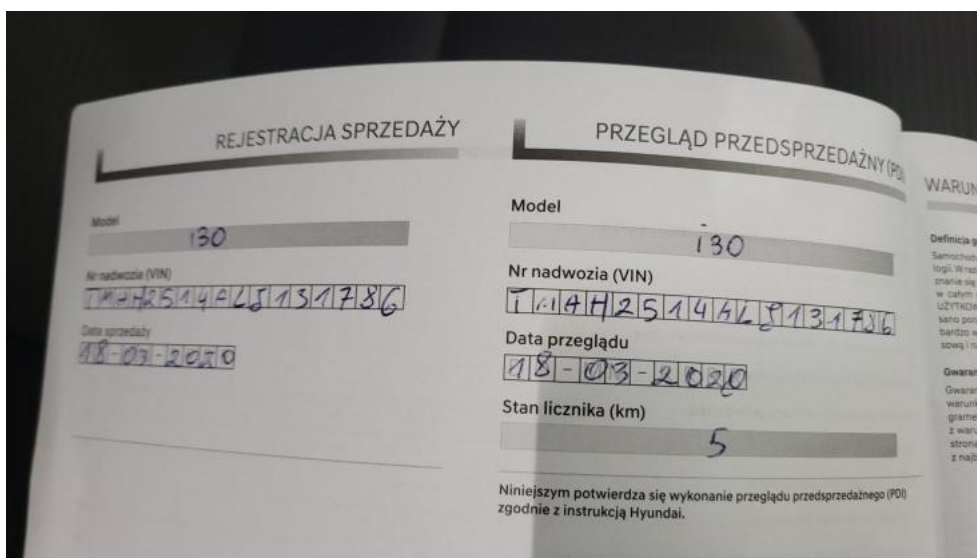
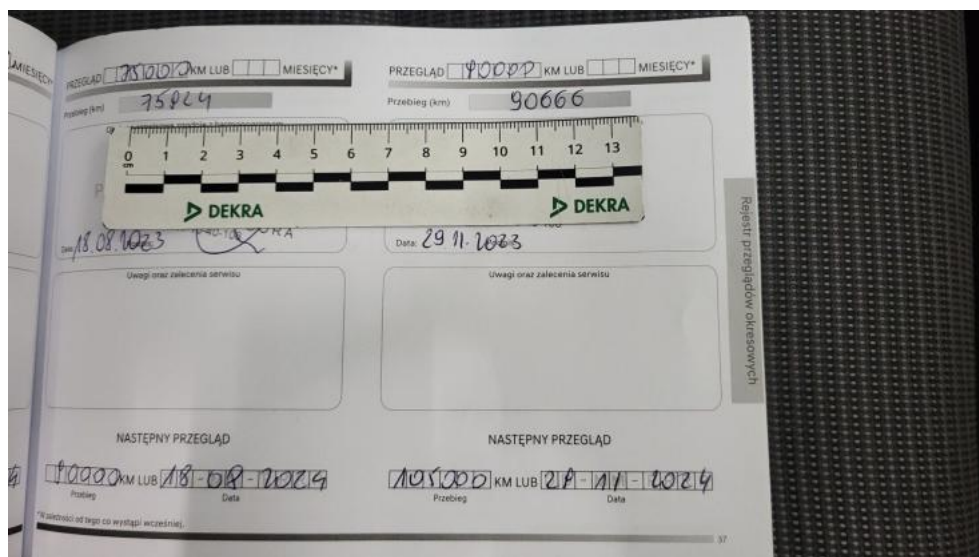


Photo 34.

Książka serwisowa – dane

PHOTOGRAPHIC DOCUMENTATION**Photo 35.**

Książka serwisowa – ostatni przegląd

**Photo 36.**

Dow. Rej. Str. 2

PHOTOGRAPHIC DOCUMENTATION

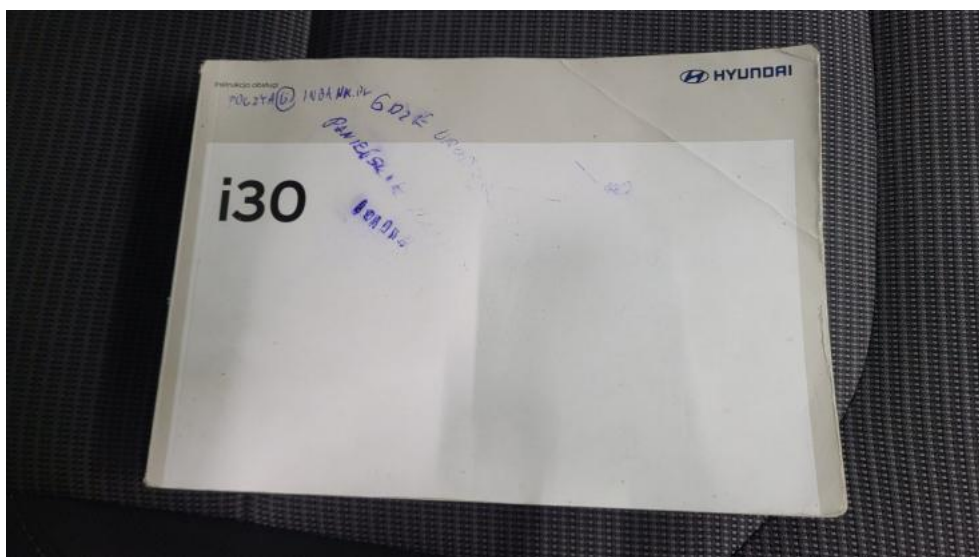


Photo 37.
Instrukcje



Photo 38.
Kluczyki

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Zdjęcie do protokołu



Photo 40.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Pokrywa komory silnika - Wgniecenie/odkształcenie 1

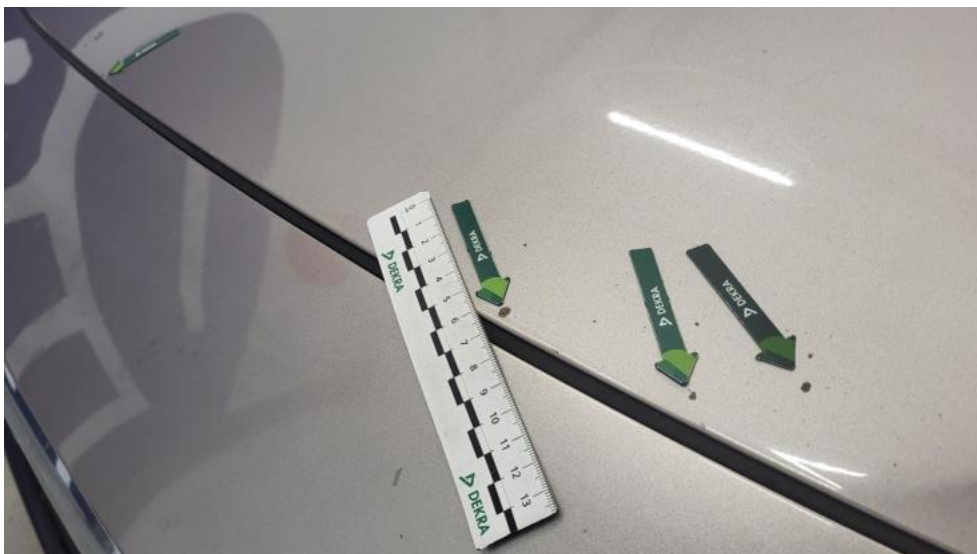


Photo 42.

Pokrywa komory silnika - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Spoiler zderzaka przedniego - Rysa/odprysk 1



Photo 44.

Spoiler zderzaka przedniego - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Zaślepka prz haka hol. - Inne 1



Photo 46.

Zderzak - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Zderzak - Rysa/odprysk 2



Photo 48.

Zderzak - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Zderzak - Pęknięcie/rozerwanie 2



Photo 50.

Zderzak - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.
Zderzak - Inne 2



Photo 52.
Felga aluminiowa przednia P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Felga aluminiowa przednia P - Inne 1



Photo 54.

Drzwi przednie P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Listwa drzwi przednich P - Rysa/odprysk 1



Photo 56.

Słupek środkowy P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Błotnik tylny P / Ściana boczna P - Rysa/odprysk 1



Photo 58.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 2



Photo 60.

Felga aluminiowa tylna P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Pióro wycieraczki szyby tyl - Inne 1



Photo 62.

Pokrywy bagażnika - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Szyba tylna - Rysa/odprysk 1



Photo 64.

Zderzak tylny - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 65.
Dach - Inne 1



Photo 66.
Dach - Inne 2

PHOTOGRAPHIC DOCUMENTATION

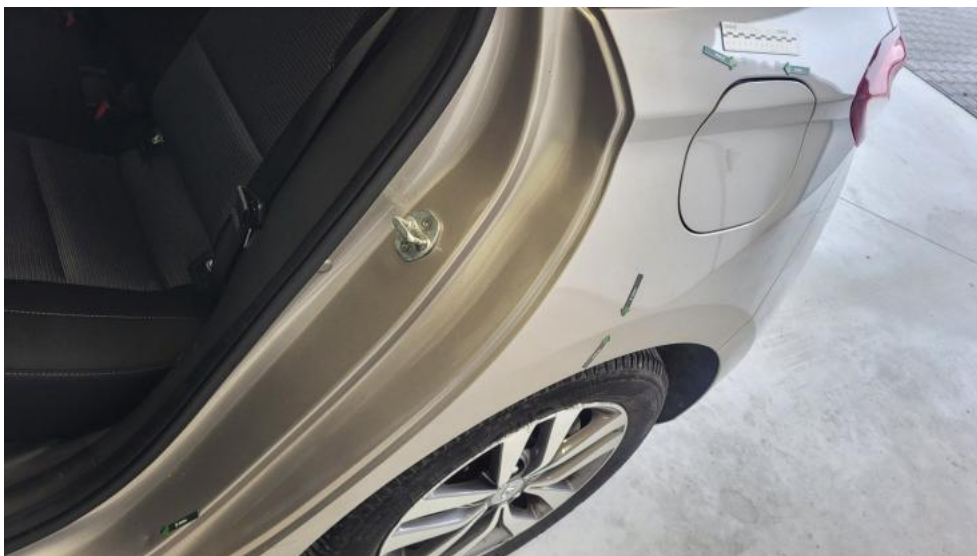


Photo 67.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1

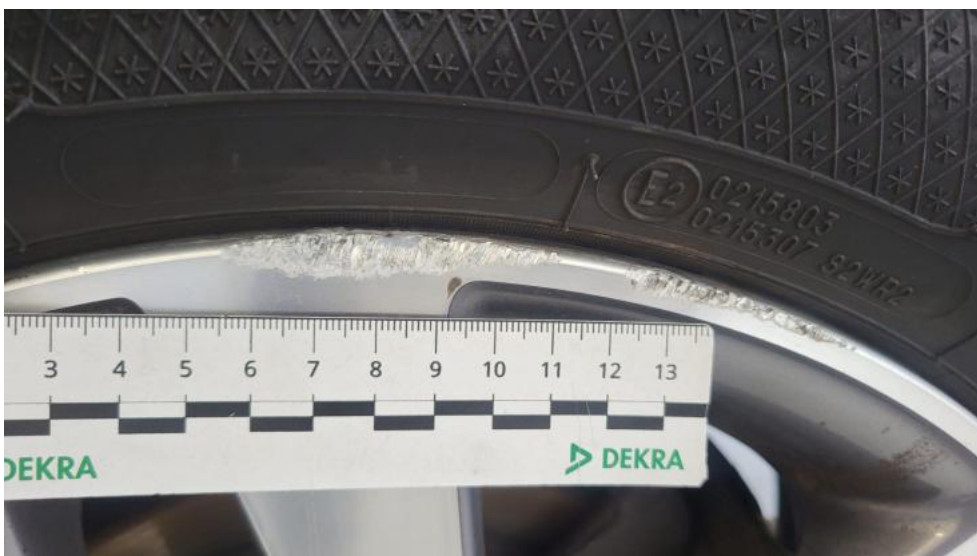


Photo 68.

Felga aluminiowa tylna L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Drzwi przed L - Rysa/odprysk 1



Photo 70.

Drzwi przed L - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Drzwi przed L - Wgniecenie/odkształcenie 1



Photo 72.

Drzwi tylne L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 73.

Drzwi tylne L - Wgniecenie/odkształcenie 1



Photo 74.

Lusterko zew L - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 75.

Lusterko zew L - Inne 1



Photo 76.

Próg L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 77.

Próg L - Wgniecenie/odkształcenie 1

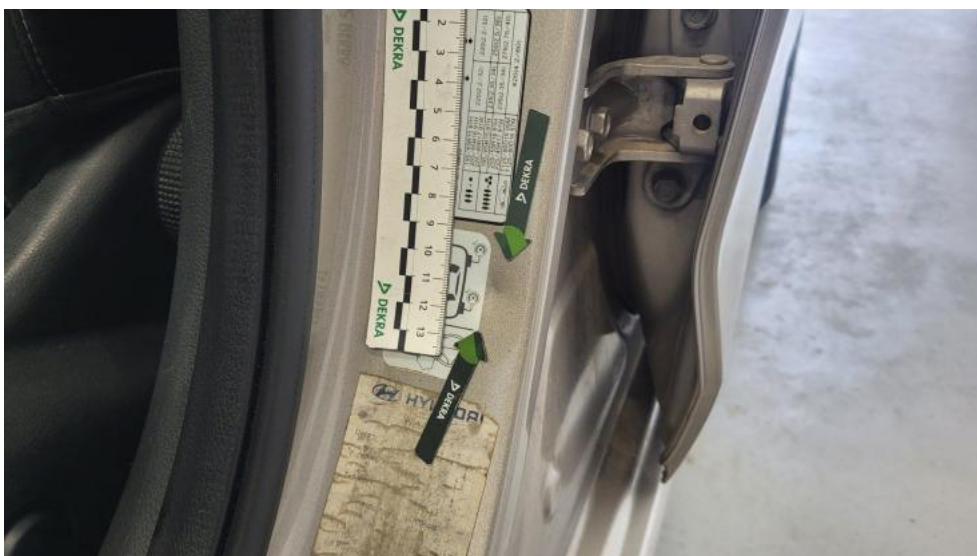


Photo 78.

Słupek środkowy L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 79.

Felga Aluminiowa przednia L - Rysa/odprysk 1

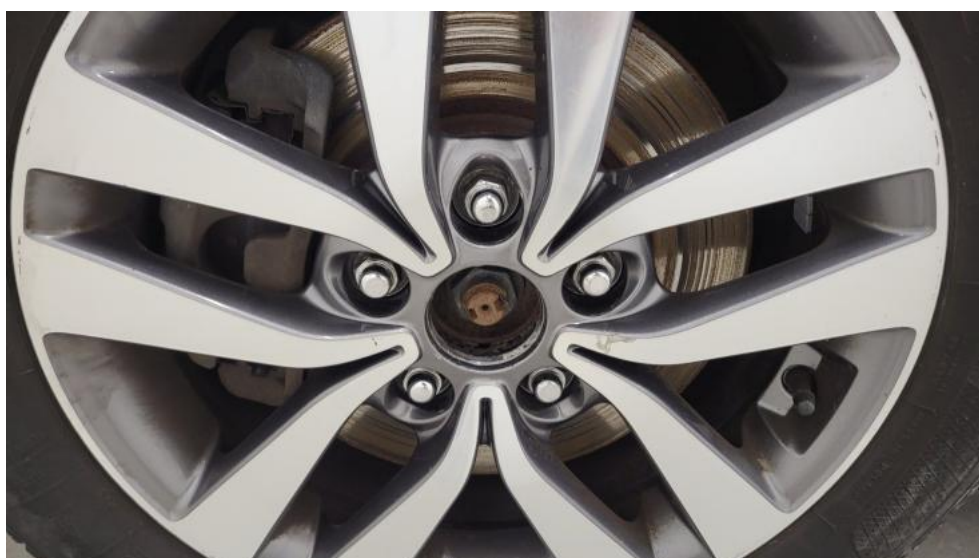


Photo 80.

Felga Aluminiowa przednia L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 81.

Gałka dźwigni zmiany biegów - Pęknięcie/rozerwanie 1



Photo 82.

Koło kierownicy - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 83.

Fotel prz. lew. - Inne 1



Photo 84.

Osłona p/słoneczna lewa - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 85.

Podsufitka - Inne 1



Photo 86.

Wykładzina(y) słupka przedniego L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 87.

Wykładzina(y) słupka tylnego L - Rysa/odprysk 1



Photo 88.

Dywanik prze L - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 89.

Wykładzina podłogi - Pęknięcie/rozerwanie 1



Photo 90.

Wykładzina pokrywy tylnej - Rysa/odprysk 1