

DEKRA's commission No. : PKOL(W)/LODZ/54289/26/06/12
commission/ damage No. : 24/025572
Date of commission: 12-06-2026

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (WSP)
DEKRA Polska - współpraca O/Warszawa
Andrzej Sosnowski
DEKRA Polska - Centrala

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	jeeps
EC code (Eurotax)	0136843
Manufacturer	VOLVO
Model	XC60 17-21
Type / version	XC60 B4 D AWD Momentum Pro aut
Body type	KOM
Number of doors / seats	5/5
Curb weight [kg]	1934
Gross vehicle weight [kg]	2520
Wheelbase 1/2	2865
Engine type	Automatic ignition
Pollution reduction system	-
Engine capacity [ccm]	1969
Engine Power [hp/kW]	197/145
Gearbox	automatic
Registration /record No.	LU703SN
VIN / serial number	YV1UZK5VCL1587008
Date of first registration	09-09-2020
Date of next. tech. test	17-03-2027
Year of manufacture	2020 (year has been verified with the manufacturer's base)
Readout [km]	133 140 (read)
Body color / type of coating	black/double-layered, metallized

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	VREDESTEIN, ULTRAC +	235/60 18 107W	5,0 mm
	left	VREDESTEIN, ULTRAC +	235/60 18 107W	5,0 mm
back	right	VREDESTEIN, ULTRAC +	235/60 18 107W	5,0 mm
	left	VREDESTEIN, ULTRAC +	235/60 18 107W	5,0 mm

Standard equipment by Eurotax

- | | |
|---|---|
| 1. Airbag: other | 41. Lumbar adjust driver, Lumbar adjust passenger |
| 2. Alarm | 42. Metal finish |
| 3. Antilock-Brake-System (ABS) | 43. Navigation system |
| 4. Armrest (s) front | 44. On board computer |
| 5. Armrest (s) rear, Storage facilities in general | 45. On board monitor |
| 6. Bluetooth interface | 46. On board monitor, Radio, Soundsystem |
| 7. Bord climate: other | 47. Other |
| 8. Bord climate: other | 48. Other |
| 9. Bord entertainment: other accessories, iPod Interface | 49. Other |
| 10. Child seat fixation | 50. Other |
| 11. Cruise control | 51. Other |
| 12. DAB radio | 52. Other |
| 13. Distance control | 53. Other |
| 14. Door mirror(s) electrically adjustable in general, Door mirrors heated | 54. Other |
| 15. Door mirrors autodimming, Rear-view mirror autodimming | 55. Other |
| 16. Door mirrors electrically foldable | 56. Other |
| 17. Driver airbag, Head airbags front, Passenger airbag, Side airbag driver, Side airbag driver and passenger | 57. Other |
| 18. Driver knee airbag | 58. Other |
| 19. Dualzone automatic climate control | 59. Other |
| 20. ESP (Electronical Stabilizing Program) | 60. Park Distance Control rear |
| 21. Electric parking brake | 61. Power assisted brakes |
| 22. Exterior design: other | 62. Power assisted brakes |
| 23. Exterior design: other | 63. Rain sensor |
| 24. Exterior thermometer | 64. Rear bench foldable in two separate parts |
| 25. Extra power outlet | 65. Rear headrests electrically adjustable |
| 26. Extra power outlet | 66. Remote controlled central locking |
| 27. Floor mat | 67. Roof railing |
| 28. Fog lamps | 68. Seatbelts vertically adjustable front, Seatbelts vertically adjustable rear |
| 29. Hill holder | 69. Seats: other |
| 30. Interior lights: other accessories, Interior: other | 70. Selectable driveline characteristics |
| 31. Interior: other | 71. Steering wheel with radio operation |
| 32. Internet access | 72. Textile upholstery |
| 33. Keyless go | 73. Traction control |
| 34. LED front dim light | 74. Traffic sign recognition |
| 35. Lane control assistant | 75. Tyre pressure control (RDC) |
| 36. Lane control assistant | 76. Uni-Lackierung |
| 37. Leather gearshifter/switch | 77. Vehicle immobilizer |
| 38. Leather steering wheel | 78. Whiplash-protection-system |
| 39. Light Alloy wheels 18" | 79. {System stabilizacji pojazdu w czasie holowania przyczepy (TSA)} |
| 40. Luggage compartment cover | |

Dealer's equipment (selected items)

- | | |
|---|---|
| 1. 360 view camera | - |
| 2. Diminished spare wheel | - |
| 3. Driver seat electrically adjustable, Memory seat | - |
| 4. Metallic paint | - |
| 5. Windscreen heating | - |

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

CorrectionsFirst registrationMileageEquipmentTyresOther

Current market situation -

Uszkodzenia, stan -

Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 06-2026 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 18-06-2026

DEKRA's expert:
Kacper Sosnowski (WSP)
Andrzej Sosnowski**Document issued electronically valid without signature.**

Measurement of thickness of the vehicle lacquer coating



No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Left front fender	to 150
3	Left front pillar	to 150
4	Left front wall	to 150
5	Roof	to 150
6	Left middle pillar	to 150
7	Left side sill	to 150
8	Left rear wall	to 150
9	Left side wall	to 150
11	Side right wall	to 150
12	Rear right door	to 150
13	Middle right pillar	to 150
14	Front right door	to 150
15	Right side sill	to 150
16	Right front pillar	to 150
17	Right front fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book was presented and its number is given below:
elektroniczna

Information concerning the origin of the vehicle

Lack of reliable data.

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below:
ograniczenia placowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

Anti-theft protection

fabryczne

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.
- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation**Kluczyki**

TAK

2

Expert comments - regarding valuation

Rysy na samochodzie. Brak zaślepek w tylnej kanapie. Odpryski na szybie czołowej. Niesprawne przyciski funkcyjne w jednym z kluczyków grot prawidłowy

Rzeczoznawca dokonał oględzin pojazdu w warunkach parkingowych, co mogło ograniczyć pełną ocenę jego stanu technicznego. Dodatkowo, jeżeli jazda próbna została przeprowadzona (informacje w treści raportu), to wykonano ją w warunkach parkingowych, z niewielką prędkością, co może nie odzwierciedlać pełnych warunków eksploatacyjnych. Istnieje możliwość, że w innych okolicznościach ujawnią się dodatkowe uszkodzenia lub usterki, których nie można było wykryć podczas obecnych oględzin. Zalecamy zatem skorzystanie z możliwości oględzin pojazdu we własnym zakresie lub w Autoryzowanej Stacji Obsługi danej marki, co pozwoli na pełniejszą weryfikację stanu technicznego pojazdu przed udziałem w aukcji."

Restrictive disclaimer - regarding valuation

Nie weryfikowano szczegółowo stanu układu napędowego, zawieszenia, kierowniczego, hamulcowego oraz wydechowego. Ocena została wykonana bez użycia podnośnika i specjalistycznego sprzętu diagnostycznego, nie dokonywano demontażu osłon i innych elementów. Ocena określa ogólny stan pojazdu na dzień oględzin w miejscu jego udostępnienia, nie może być zatem traktowana jako kompleksowa ocena stanu technicznego. Specyfikacja wg. programu operacyjnego w zakresie wyposażenia standardowego i dodatkowego nie gwarantuje zgodności ze stanem faktycznym w zakresie możliwym do ustalenia przez rzeczoznawcę podczas oględzin pojazdu.

Pomiar grubości powłoki lakierowej wykonano w miejscach możliwych do ich wykonania pomiary nie gwarantują oryginalności poszczególnych elementów poddanych ocenie.

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.
Tył



Photo 8.
Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.
Bok lewy z tyłu



Photo 10.
Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.
Próg lewy (widok od przodu)

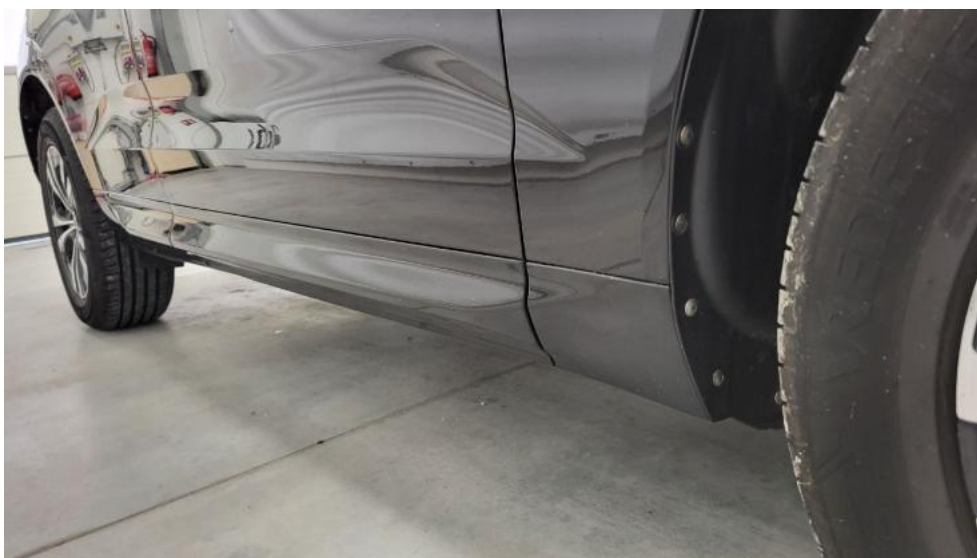


Photo 12.
Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa

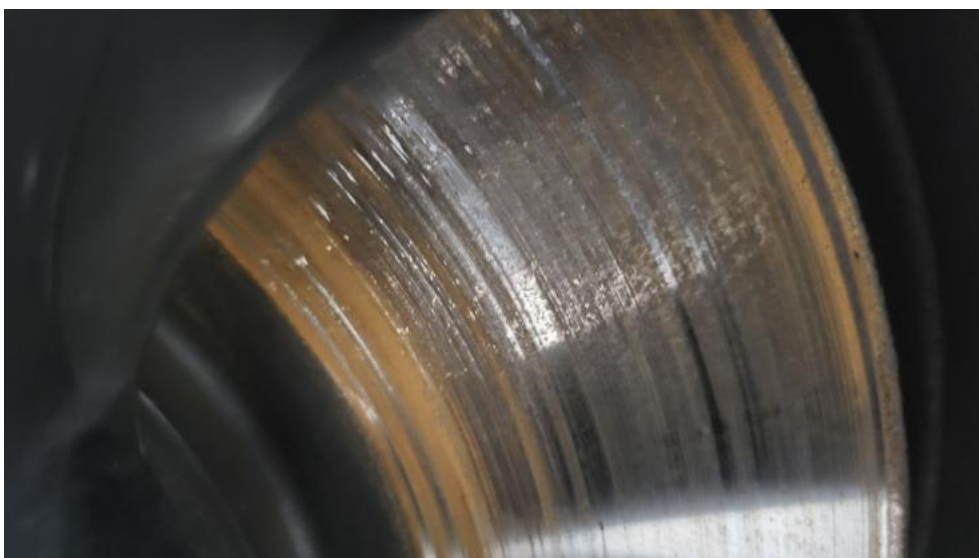


Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika



Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION



Photo 23.
Tabliczka znamionowa



Photo 24.
Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.
Zestaw wskaźników - serwis



Photo 26.
Widok przez otwarte drzwi przednie lewe

PHOTOGRAPHIC DOCUMENTATION



Photo 27.
Kierownica z lewej strony



Photo 28.
Widok przez otwarte drzwi tylne lewe

PHOTOGRAPHIC DOCUMENTATION



Photo 29.

Widok z tylnej kanapy na deskę rozdż.



Photo 30.

Konsola środkowa

PHOTOGRAPHIC DOCUMENTATION



Photo 31.
Tunel środkowy



Photo 32.
Kierownica (na wprost)

PHOTOGRAPHIC DOCUMENTATION



Photo 33.
Dowód rej. Str. 1



Photo 34.
Książka serwisowa – dane

PHOTOGRAPHIC DOCUMENTATION



Photo 35.
Książka serwisowa – ostatni przegląd



Photo 36.
Dowód rej. str. 2

PHOTOGRAPHIC DOCUMENTATION



Photo 37.
Kluczyki



Photo 38.
Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 39.
Zdjęcie do protokołu



Photo 40.
Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 41.
Zdjęcie do protokołu



Photo 42.
Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 43.
Pokrywa komory silnika - Rysa/odprysk 1



Photo 44.
Zderzak - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.
Błotnik przedni P - Rysa/odprysk 1



Photo 46.
Drzwi przednie P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.
Drzwi przednie P - Wgniecenie/odkształcenie 1



Photo 48.
Drzwi tylne P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.
Drzwi tylne P - Wgniecenie/odkształcenie 1



Photo 50.
Próg P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.
Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1



Photo 52.
Pokrywy bagażnika - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION

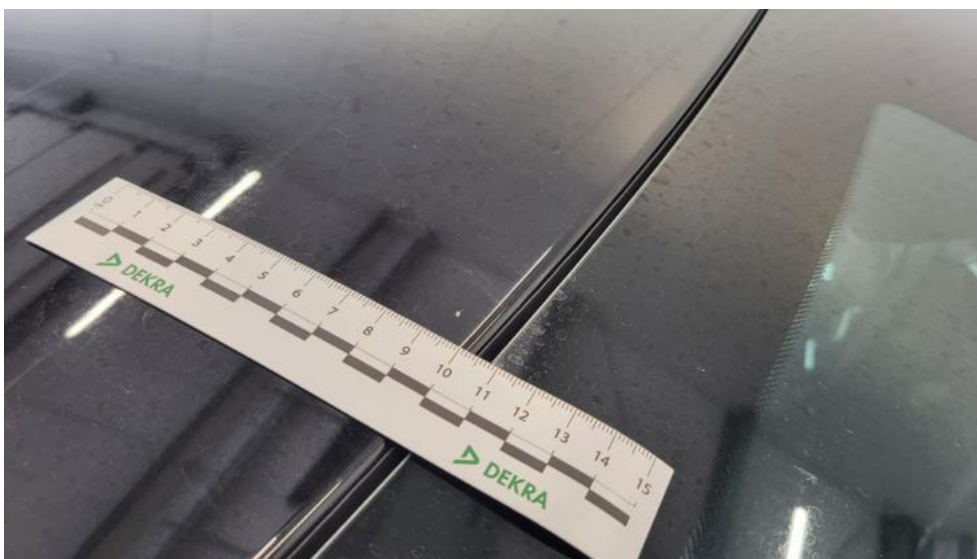


Photo 53.
Dach - Rysa/odprysk 1



Photo 54.
Błotnik tylny L / Ściana boczna L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Uszczelka szyby bocznej tyl L - Rysa/odprysk 1



Photo 56.

Drzwi tylne L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.
Drzwi tylne L - Wgniecenie/odkształcenie 1



Photo 58.
Listwa drzwi tył L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.
Fotel prz. lew. - Inne 1



Photo 60.
Fotel prz. praw. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.
Kanapa tyl. - Inne 1



Photo 62.
Osłona p/słoneczna lewa - Inne 1