

DEKRA's commission No. : PKOL(W)/LODZ/85332/26/09/11
commission/ damage No. : 24/037897
Date of commission: 11-09-2026

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (WSP)
DEKRA Polska - współpraca O/Warszawa
mgr inż. Romuald Bocian (WSP)
DEKRA Polska - współpraca O/Puławy

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0145357
Manufacturer	VOLKSWAGEN
Model	Arteon 20-23
Type / version	Arteon 2.0 TSI Essence DSG
Body type	hatchback
Number of doors / seats	5/5
Curb weight [kg]	1568
Gross vehicle weight [kg]	2160
Wheelbase 1/2	2837
Engine type	spark ignition
Pollution reduction system	GPF
Engine capacity [ccm]	1984
Engine Power [hp/kW]	190/140
Gearbox	automatic 7- gear
Registration /record No.	ST2341Y
VIN / serial number	WVWZZZ3HZNE006279
Date of first registration	28-04-2022
Year of manufacture	2022
Readout [km]	162 576 (read)
Body color / type of coating	black/METALIK

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	TOYO, CELSIUS AS2	225/55 17 101W	2,0 mm
	left	TOYO, CELSIUS AS2	225/55 17 101W	2,0 mm
back	right	TOYO, CELSIUS AS2	225/55 17 101W	3,0 mm
	left	TOYO, CELSIUS AS2	225/55 17 101W	3,0 mm

Standard equipment by Eurotax

- | | |
|---|--|
| 1. Adaptive Cruise Control | 26. Lumbar adjust driver electric, Lumbar adjust passenger electric, Sport seats front |
| 2. Antilock-Brake-System (ABS), Brake Assist, ESP (Electronical Stabilizing Program), Other, Traction control | 27. Metal finish |
| 3. Armrest (s) front, Storage facilities in general | 28. Mirror: others |
| 4. Automated High-beam assist | 29. On board computer |
| 5. Automatic climate control | 30. Other |
| 6. Automatic dimlight activation, Follow me home | 31. Other |
| 7. Automatic headlight elevation control, LED Daytime running lights, LED front dim light | 32. Other |
| 8. Bluetooth interface | 33. Other |
| 9. Bord communication: other | 34. Other |
| 10. Child seat fixation | 35. Other |
| 11. DAB radio | 36. Other |
| 12. Door mirrors autodimming, Door mirrors electrically foldable | 37. Park Distance Control front, Park Distance Control rear |
| 13. Driver airbag, Driver knee airbag, Head airbags front, Passenger airbag, Side airbag driver, Side airbag driver and passenger | 38. Pre-Crash System |
| 14. Electric parking brake | 39. Radio |
| 15. Exterior design: other | 40. Rain sensor |
| 16. Exterior design: other | 41. Rear seat-backs foldable in two separate parts |
| 17. Extra power outlet | 42. Rear-view mirror autodimming |
| 18. Floor mat | 43. Servotronic |
| 19. Interior lights: other accessories | 44. Soundsystem |
| 20. Interior lights: other accessories | 45. Start/Stop system |
| 21. Interior: other | 46. Textile upholstery |
| 22. LED rear lights | 47. Tyre pressure control (RDC) |
| 23. Lane control assistant | 48. USB in |
| 24. Leather gearshifter/switch, Leather steering wheel, Multi functional steering wheel, Steering wheel with gear-switches | 49. Vehicle immobilizer |
| 25. Light alloy wheels from 17" | |

Dealer's equipment (selected items)

- | | |
|--|---|
| 1. Alarm | - |
| 2. Diminished spare wheel | - |
| 3. Extra power outlet, Heated seat driver, Heated seat passenger, Rear seat heating, Trizone automatic climate control, USB in | - |
| Fotele przednie i tylne - podgrzewane | |
| Gniazdo USB | |
| Klimatyzacja automatyczna Air Care Climatronic - 3 strefowa | |
| Gniazdo 230V w konsoli środkowej z tyłu | |
| Gniazdo USB-C, obsługuje iPod/iPhone | |
| 4. Keyless go | - |
| 5. Metallic paint | - |
| 6. Rear view camera | - |

Base value of the vehicle

Base value of the vehicle by Eurotax (net)

CorrectionsFirst registrationMileageEquipmentTyresOther

Earlier repairs -
Stan dbałości o pojazd, uszkodzenia i braki -


Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 09-2026 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 18-09-2026

DEKRA's expert:
Kacper Sosnowski (WSP)
mgr inż. Romuald Bocian (WSP)

Document issued electronically valid without signature.

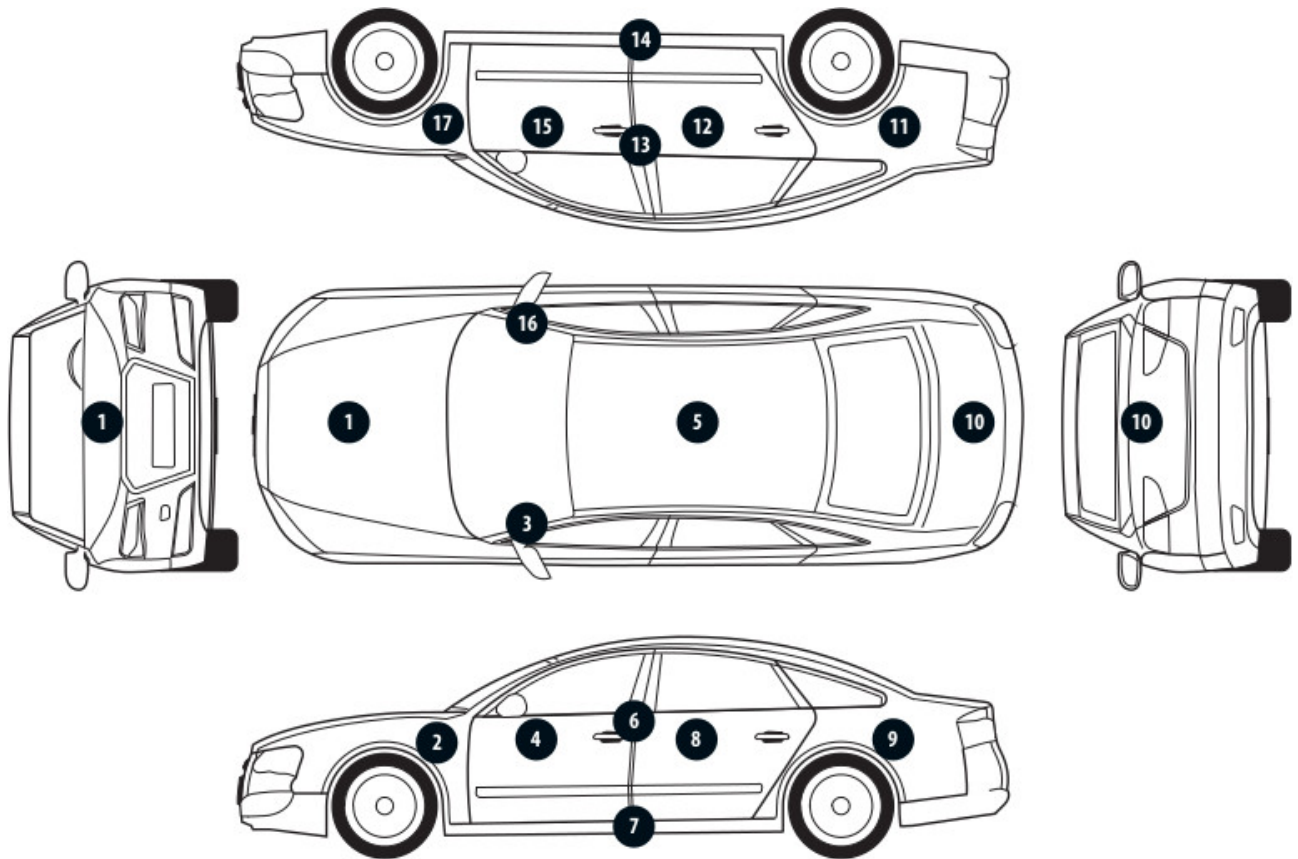Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	150 - 200
2	Front left fender	150 - 200
3	Left front pillar	150 - 200
4	Front left door	150 - 200
5	Roof	150 - 200
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	150 - 200
9	Rear left fender	150 - 200
10	Cover/lid	150 - 200
11	Right rear fender	150 - 2000
12	Right rear door	150 - 500
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	150 - 200
16	Right front pillar	150 - 200
17	Front right fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

Presented the following documents of the vehicle:

Skon PC

During the inspection the service book of the vehicle was not provided.

Information concerning the origin of the vehicle

The vehicle purchased domestically from an authorized representative of the brand.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

alarm

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below:

.

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted (with the exception of the year of production) - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of

the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

1

Restrictive disclaimer - regarding valuation

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.
Próg lewy (widok od przodu)



Photo 12.
Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa

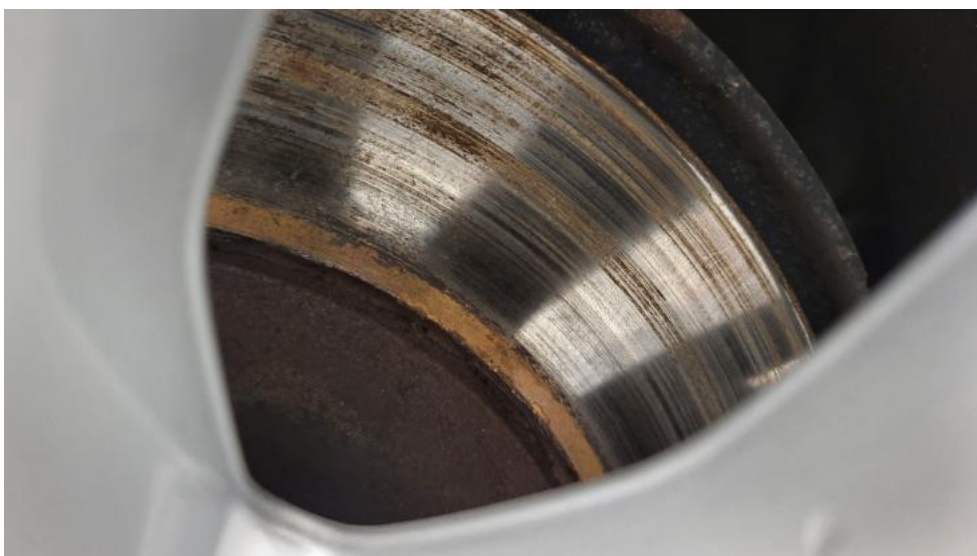


Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION

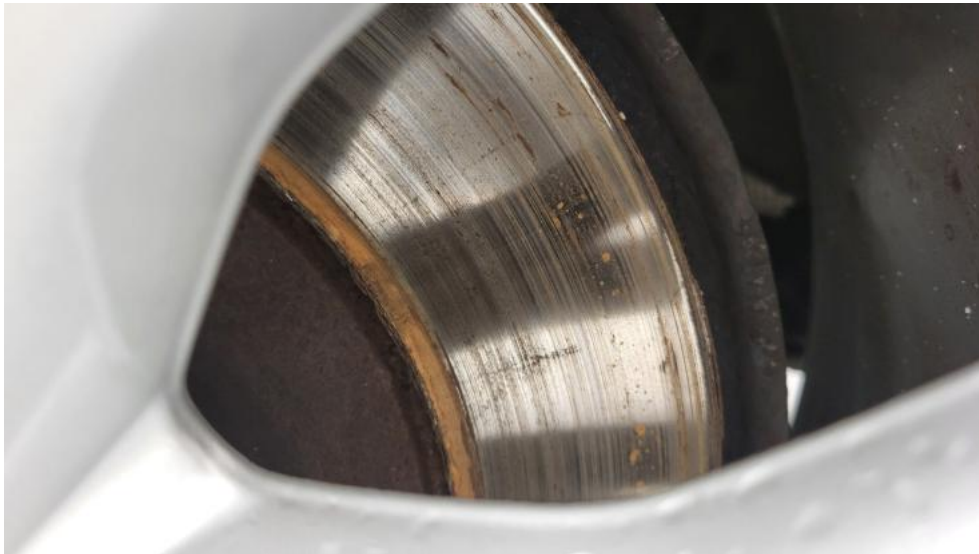


Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik

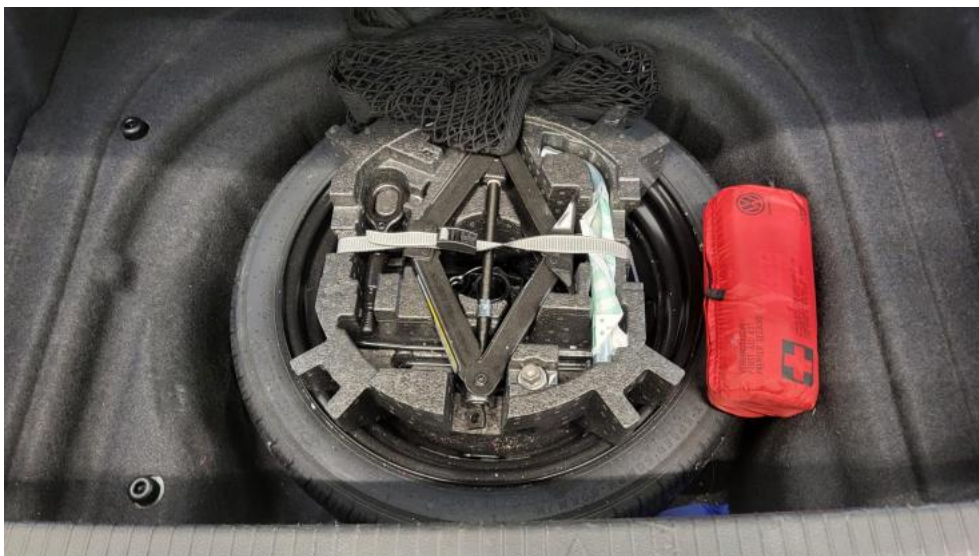


Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION

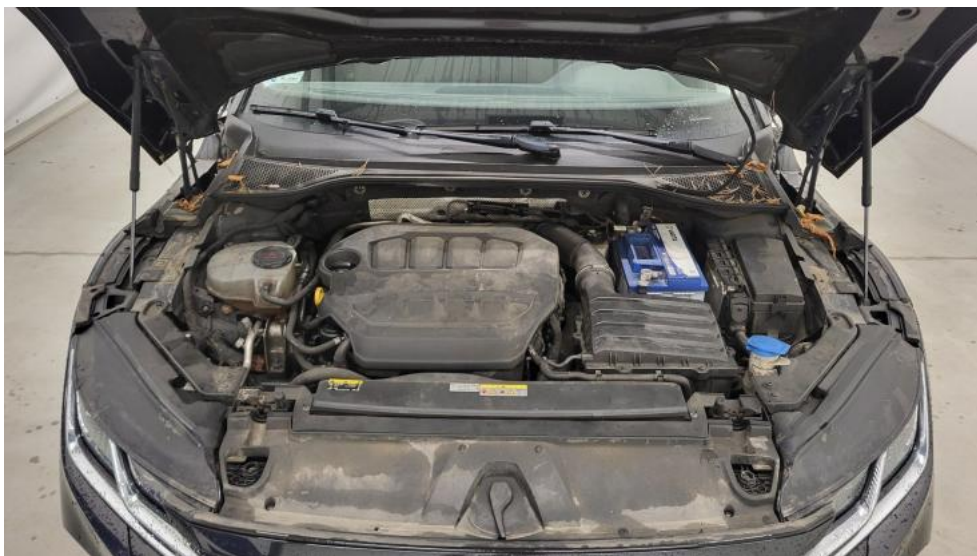


Photo 21.
Komora silnika



Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION



Photo 23.

Tabliczka znamionowa



Photo 24.

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Zestaw wskaźników - serwis



Photo 26.

Widok przez otwarte drzwi przednie lewe

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Kierownica z lewej strony



Photo 28.

Widok przez otwarte drzwi tylne lewe

PHOTOGRAPHIC DOCUMENTATION



Photo 29.

Widok z tylnej kanapy na deskę rozdź.



Photo 30.

Konsola środkowa

PHOTOGRAPHIC DOCUMENTATION



Photo 31.
Tunel środkowy



Photo 32.
Kierownica (na wprost)

PHOTOGRAPHIC DOCUMENTATION

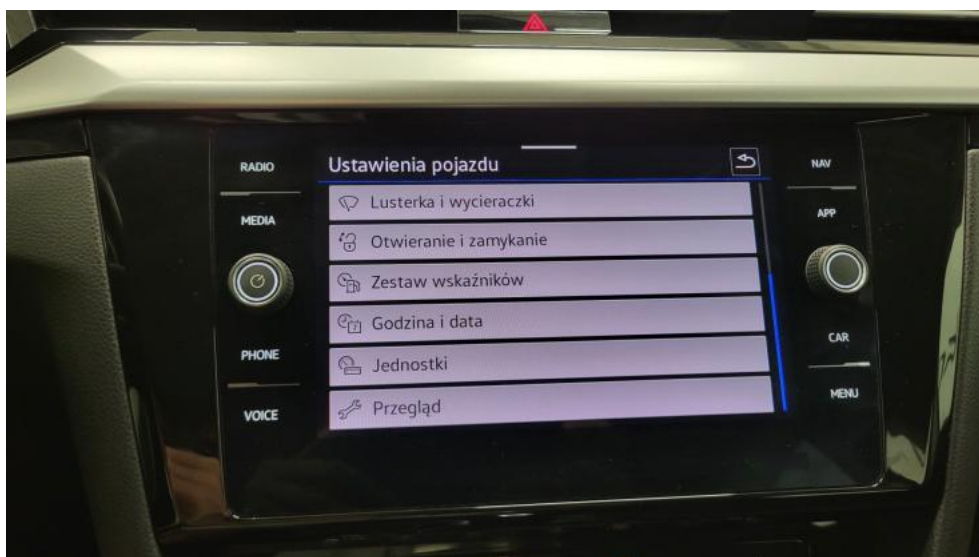


Photo 33.

Książka serwisowa – dane

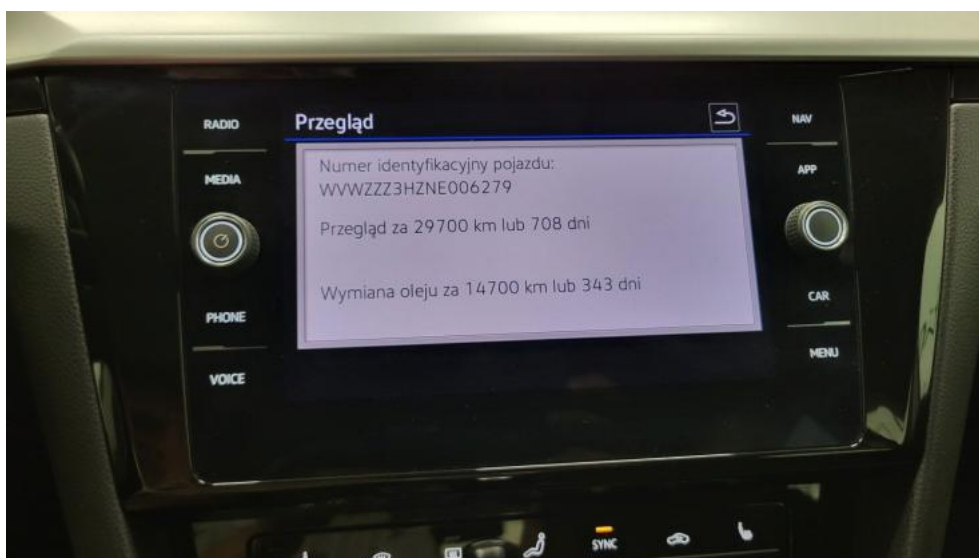
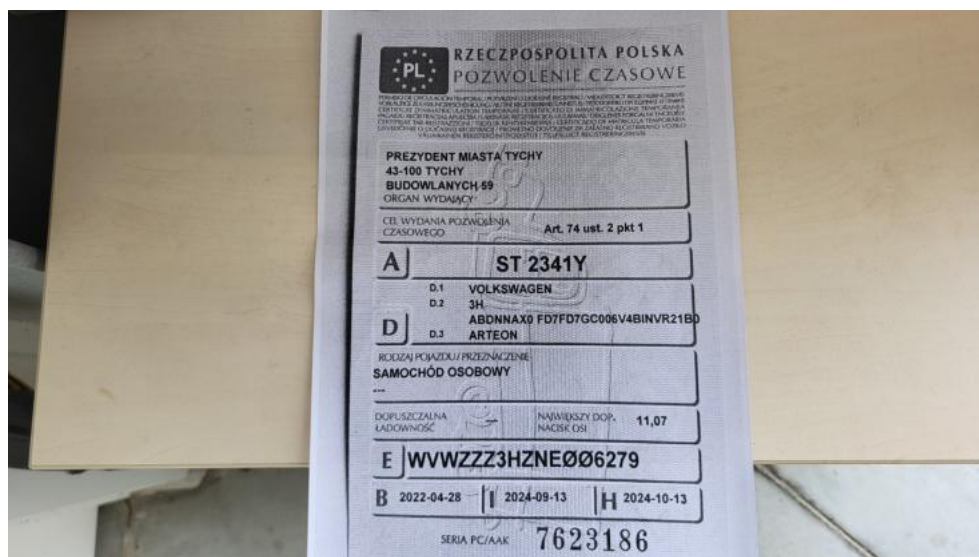
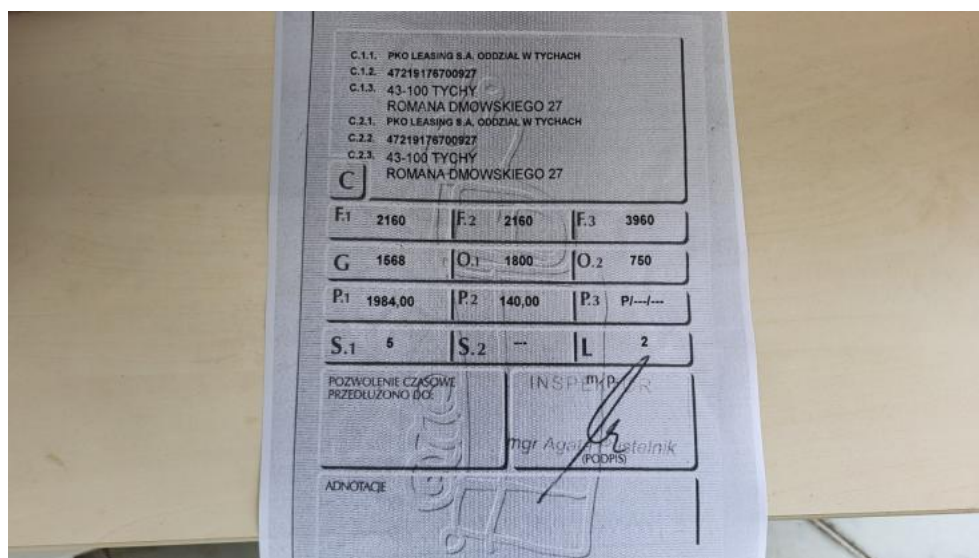


Photo 34.

Książka serwisowa – ostatni przegląd

PHOTOGRAPHIC DOCUMENTATION**Photo 35.**

Dow. rej. ksero Str. 1

**Photo 36.**

Dow. Rej. ksero Str. 2

PHOTOGRAPHIC DOCUMENTATION



Photo 37.

Kluczyki



Photo 38.

Pokrywa komory silnika - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Pokrywa komory silnika - Inne 1



Photo 40.

Felga aluminiowa przednia P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Drzwi przednie P - Rysa/odprysk 1



Photo 42.

Drzwi tylne P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Drzwi tylne P - Wgniecenie/odkształcenie 1



Photo 44.

Lusterko zew P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION

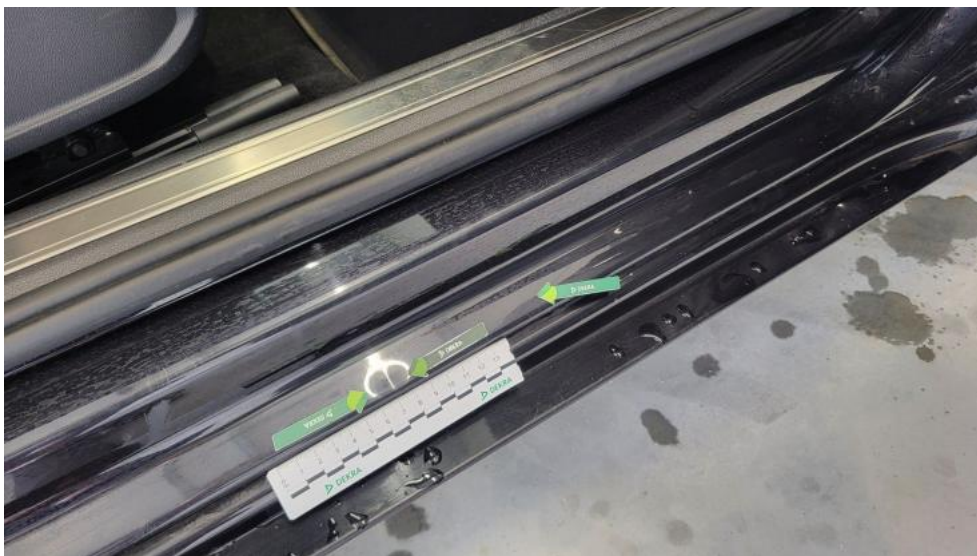


Photo 45.

Próg P - Wgniecenie/odkształcenie 1

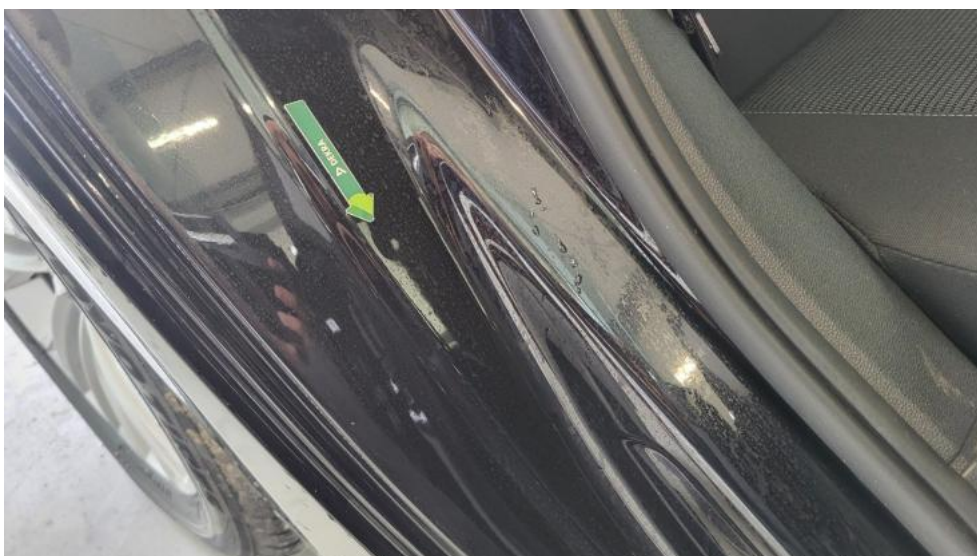


Photo 46.

Ścianka tylna P / Ścianka boczna P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 2



Photo 48.

Pokrywy bagażnika - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Zderzak tylny - Rysa/odprysk 1



Photo 50.

Zderzak tylny - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Zderzak tylny() - Rysa/odprysk 3

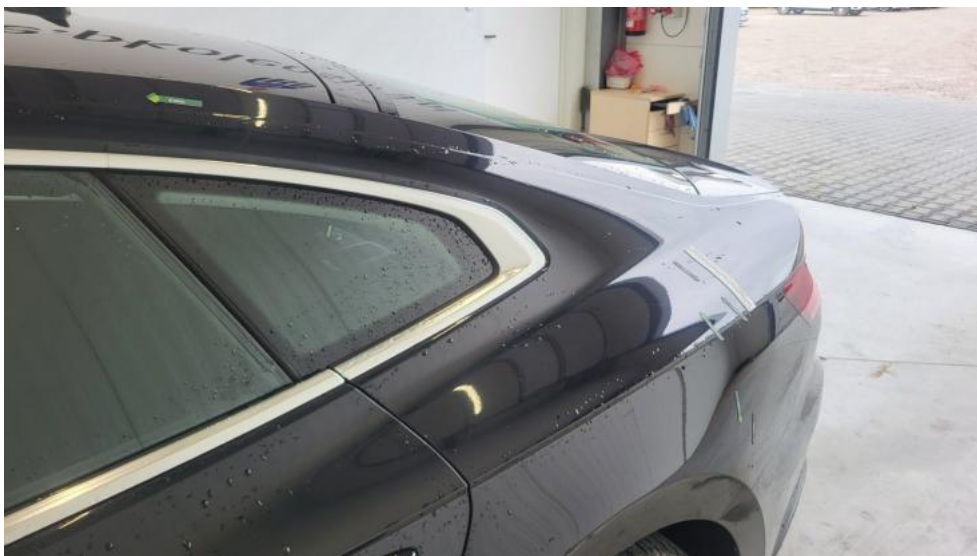


Photo 52.

Błotnik tylny L / Ściana boczna L - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION

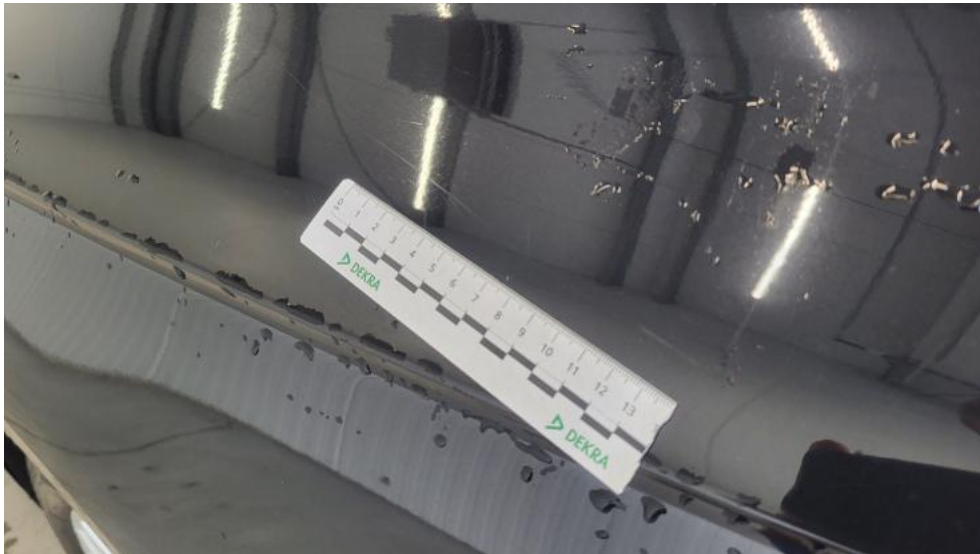


Photo 53.

Błotnik tylny L / Ściana boczna L - Rysa/odprysk 1



Photo 54.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Felga aluminiowa tylna L - Rysa/odprysk 1



Photo 56.

Drzwi przed L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Drzwi przed L - Wgniecenie/odkształcenie 1



Photo 58.

Drzwi przed L - Wgniecenie/odkształcenie 2

PHOTOGRAPHIC DOCUMENTATION

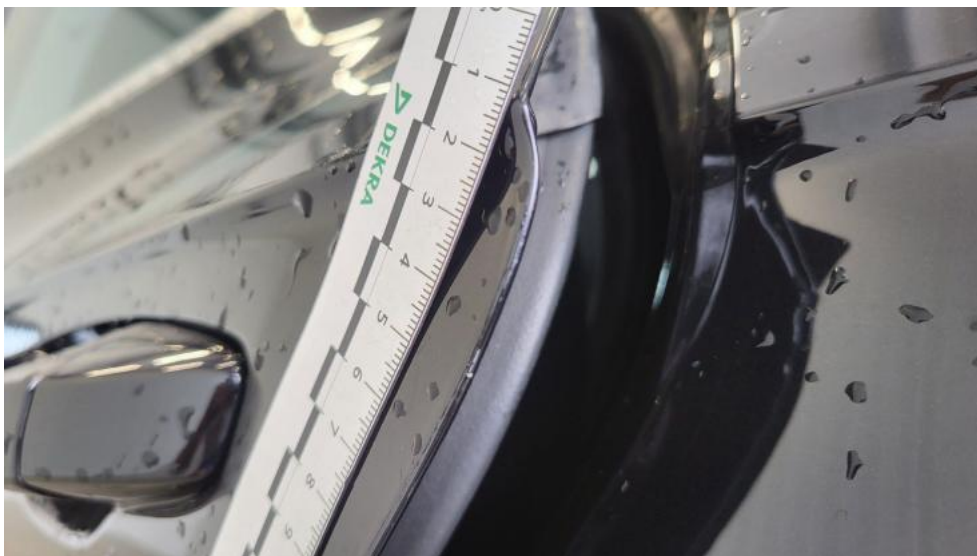


Photo 59.

Drzwi tylne L - Rysa/odprysk 1



Photo 60.

Klamka drzwi prz L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Błotnik przedni L - zdjęcie poglądowe 1



Photo 62.

Błotnik przedni L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Błotnik przedni L - Wgniecenie/odkształcenie 1



Photo 64.

Felga Aluminiowa przednia L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Koło kierownicy - Rysa/odprysk 1



Photo 66.

Podłokietnik środkowy przedni - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 67.

Fotel prz. praw. - Inne 1



Photo 68.

Osłona p/słoneczna lewa - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Podsufitka - Inne 1



Photo 70.

Podsufitka - Inne 2

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Wykładzina(y) słupka przedniego L - Inne 1



Photo 72.

Wykładzina podłogi bagażnika - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 73.

Wykładzina pokrywy tylnej - Rysa/odprysk 1