

DEKRA's commission No. : PKOL(W)/LODZ/61207/26/07/03
commission/ damage No. : 25/013062
Date of commission: 03-07-2026

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (WSP)
DEKRA Polska - współpraca O/Warszawa
Andrzej Sosnowski
DEKRA Polska - Centrala

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0145480
Manufacturer	BMW
Model	Seria 5 Touring [G31] 20-23
Type / version	540d xDrive mHEV M Sport sport-aut
Body type	KOM
Number of doors / seats	5/5
Curb weight [kg]	2000
Gross vehicle weight [kg]	2615
Wheelbase 1/2	2975
Engine type	Automatic ignition
Pollution reduction system	KSC
Engine capacity [ccm]	2993
Engine Power [hp/kW]	340/250
Gearbox	automatic
Registration /record No.	ZSW38393
VIN / serial number	WBA51AJ080CK90023
Date of first registration	04-07-2022
Date of next. tech. test	18-12-2026
Year of manufacture	2022 (year has been verified with the manufacturer's base)
Readout [km]	143 761 (read)
Body color / type of coating	granatowy/double-layered, metallized

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	VREDESTEIN, WINTRAC PRO+	245/45 18 100V	6,0 mm
	left	VREDESTEIN, WINTRAC PRO+	245/45 18 100V	6,0 mm
back	right	VREDESTEIN, WINTRAC PRO+	245/45 18 100V	5,0 mm
	left	VREDESTEIN, WINTRAC PRO+	245/45 18 100V	5,0 mm

Standard equipment by Eurotax

- | | |
|--|---|
| 1. Additional gauges, Bluetooth interface, Digital instruments, Internet access, Navigation system, On board monitor, Radio, Touchscreen monitor, USB in, Voice control for audiosystem, Voice control for navigation system | 34. Follow me home |
| 2. Aerodynamics package, Exterior design: other | 35. Interior decoration: other |
| 3. Air suspension rear axle | 36. Interior lights: other accessories |
| 4. Alarm | 37. Interior: other |
| 5. Android Auto, Apple CarPlay | 38. LED front dim light |
| 6. Armrest (s) front | 39. LED rear lights |
| 7. Armrest (s) rear | 40. Leather steering wheel, Sports steering wheel |
| 8. Artificial leather upholstery | 41. Light Alloy wheels 18" |
| 9. Automatic climate control | 42. Mobile Tire System |
| 10. Automatic dimlight activation, Rain sensor | 43. Mobile phone |
| 11. Bord communication: other | 44. Other |
| 12. Bord communication: other | 45. Other |
| 13. Bord communication: other | 46. Other |
| 14. Bord communication: other | 47. Other |
| 15. Bord entertainment: other accessories | 48. Other |
| 16. Cargo net | 49. Other |
| 17. Child seat fixation | 50. Park Distance Control front, Park Distance Control rear |
| 18. Collision Warning System, Other | 51. Rear seat-backs foldable in two separate parts |
| 19. Colored glass | 52. Rear-view mirror autodimming |
| 20. Cruise control | 53. Roof railing |
| 21. DAB radio | 54. Selectable driveline characteristics |
| 22. Door mirror(s) electrically adjustable in general, Door mirrors heated | 55. Servotronic |
| 23. Door mirrors autodimming | 56. Sport seats front |
| 24. Door mirrors electrically foldable, Mirror: others | 57. Sport suspension |
| 25. Driver airbag, Head airbags front, Head airbags rear, Passenger airbag, Side airbag driver and passenger, Side airbags rear | 58. Start/Stop system |
| 26. Driver seat electrically adjustable, Passenger seat electrically adjustable | 59. Steering wheel manually adjustable |
| 27. ESP (Electronical Stabilizing Program), Traction control | 60. Telematic |
| 28. Electric tailgate | 61. Tie-down ring |
| 29. Exterior design: other | 62. Uni-Lackierung |
| 30. Exterior design: other | 63. Vehicle immobilizer |
| 31. Exterior design: other | 64. Wheel bolt locks |
| 32. Exterior design: other | 65. Windscreen wash-nozzle heated |
| 33. Floor mat | |

Dealer's equipment (selected items)

- | | |
|---|---|
| 1. 4 or more zone automatic climate control, Air condition rear | - |
| 2. Active Emergency Brake Assist, Adaptive Cruise Control, Blind spot warning, Collision Warning System, Distance control, Lane control assistant, Other, Pedestrian Emergency Brake Assist, Rear Cross Traffic Alert | - |
| Asystent unikania kolizji | |
| Ostrzeganie przed ruchem poprzecznym z przodu | |
| Aktywna ochrona przed kolizją boczną | |
| Systemy asystujące kierowcy | |
| Tempomat aktywny z funkcją Stop&Go i ostrzeżeniem przed kolizją, funkcja hamowania | |
| Asystent kierowania i pasa ruchu | |

Asystent zatrzymania awaryjnego	
Asystent korytarza ratunkowego	
3. Automated High-beam assist	-
4. Comfort driver seat, Comfort passenger seat, Memory seat	-
5. Exterior design: other	-
6. Glass tilt/slide sunroof electric	-
7. Head-Up Display	-
8. Heated seat driver, Heated seat passenger	-
9. Leather upholstery	-
10. Other, Tinted rear windows	-
11. Park Assistant, Park Distance Control front, Park Distance Control rear, Rear view camera	-
12. Steering wheel heated	-
13. Towbar removable	-
14. Ventilated front seat	-
15. {Reflektory laserowe BMW}	-

Base value of the vehicle

Base value of the vehicle by Eurotax (gross)	-
--	---

Corrections

First registration

Mileage

Equipment

Tyres

Other

Regularity of service review	-
Current market situation	-
Uszkodzenia, stan, weryfikacja serwisowa	-


Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 07-2026 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - due to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 16-07-2026

DEKRA's expert:
Kacper Sosnowski (WSP)
Andrzej Sosnowski

Document issued electronically valid without signature.

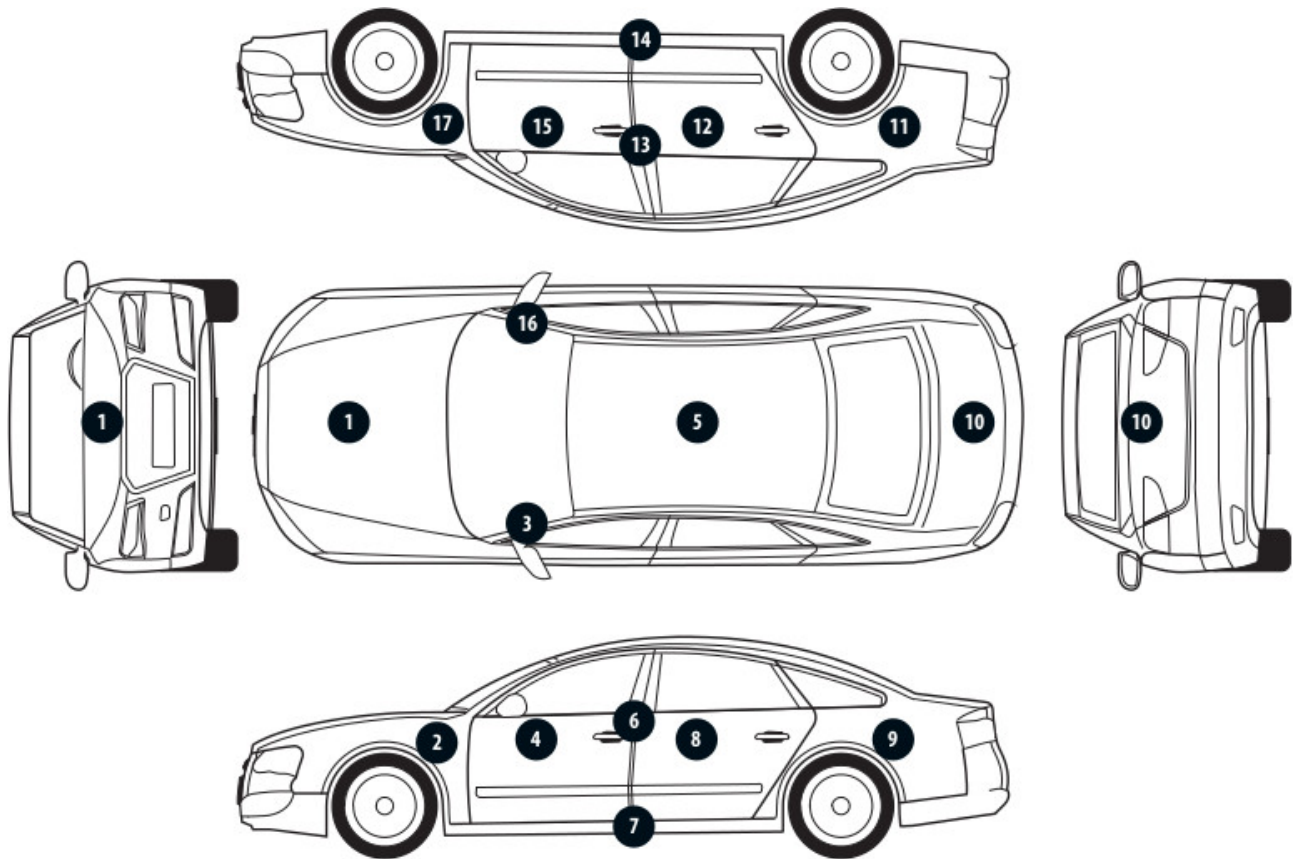Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [µm]
1	Front cover	to 150
2	Front left fender	to 150
3	Left front pillar	to 150
4	Front left door	to 150
5	Roof	to 150
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	to 150
9	Rear left fender	to 150
10	Cover/lid	to 150
11	Right rear fender	to 150
12	Right rear door	to 150
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	to 150
16	Right front pillar	to 150
17	Front right fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book was presented and its number is given below:

.

Information concerning the origin of the vehicle

Lack of reliable data.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below:
ograniczenia placowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of

page 6/43

the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

2

Expert comments - regarding valuation

Rysy na samochodzie. Pierwsza rejestracja w kraju 27-03-2025. Aktywna kontrolka silnika. Minął termin wymiany okładzin hamulcowych od 1600km. Minął termin przeglądu oleju silnikowego od 140km. Odpryski na szybie czołowej. Substancja na samochodzie.

Rzeczoznawca dokonał oględzin pojazdu w warunkach parkingowych, co mogło ograniczyć pełną ocenę jego stanu technicznego. Dodatkowo, jeżeli jazda próbna została przeprowadzona (informacje w treści raportu), to wykonano ją w warunkach parkingowych, z niewielką prędkością, co może nie odzwierciedlać pełnych warunków eksploatacyjnych. Istnieje możliwość, że w innych okolicznościach ujawnią się dodatkowe uszkodzenia lub usterki, których nie można było wykryć podczas obecnych oględzin. Zalecamy zatem skorzystanie z możliwości oględzin pojazdu we własnym zakresie lub w Autoryzowanej Stacji Obsługi danej marki, co pozwoli na pełniejszą weryfikację stanu technicznego pojazdu przed udziałem w aukcji."

Rysy, wgniecenia, ślady użytkowania sadza.

Przedmiotowa ocena określa ogólny stan pojazdu na dzień oględzin, nie może być traktowana jako kompleksowa ocena stanu technicznego.

Podczas oględzin okazano 1 kluczyk, książkę serwisową i instrukcję obsługi. Odpryski i zarysowania w obszarze całego pojazdu. Pojazd przedstawiony do oględzin zabrudzony z brakiem możliwości wykonania szczegółowej oceny powłoki lakierowej.

Restrictive disclaimer - regarding valuation

Nie weryfikowano szczegółowo stanu układu napędowego, zawieszenia, kierowniczego, hamulcowego oraz wydechowego. Ocena została wykonana bez użycia podnośnika i specjalistycznego sprzętu diagnostycznego, nie dokonywano demontażu osłon i innych elementów. Ocena określa ogólny stan pojazdu na dzień oględzin w miejscu jego udostępnienia, nie może być zatem traktowana jako kompleksowa ocena stanu technicznego. Specyfikacja wg. programu operacyjnego w zakresie wyposażenia standardowego i dodatkowego nie gwarantuje zgodności ze stanem faktycznym w zakresie możliwym do ustalenia przez rzeczoznawcę podczas oględzin pojazdu.

Pomiar grubości powłoki lakierowej wykonano w miejscach możliwych do ich wykonania pomiary nie gwarantują oryginalności poszczególnych elementów poddanych ocenie.

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.

- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.

Przekątna przednia lewa



Photo 2.

Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.

Bok prawy z tyłu



Photo 6.

Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.
Próg lewy (widok od przodu)



Photo 12.
Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Komora silnika

PHOTOGRAPHIC DOCUMENTATION

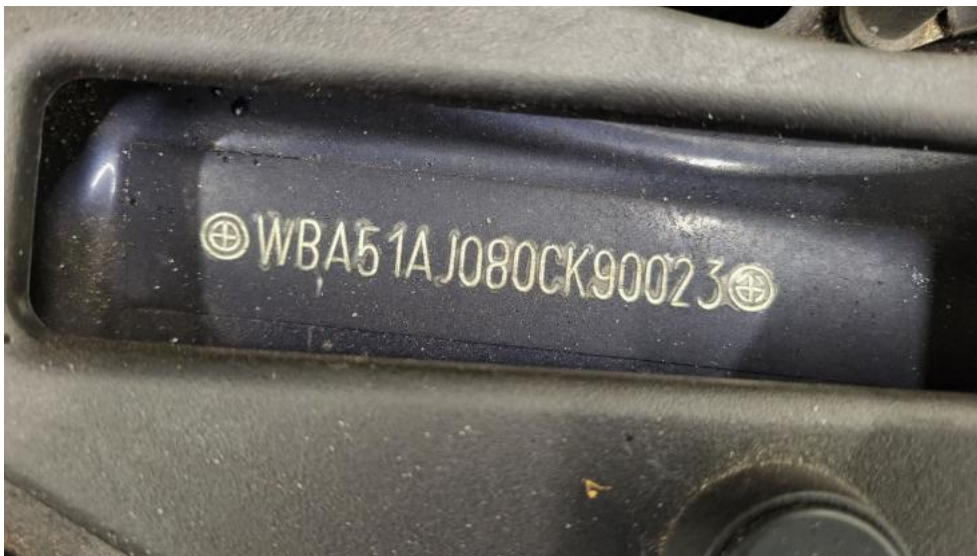


Photo 21.

Numer identyfikacyjny



Photo 22.

Tabliczka znamionowa

PHOTOGRAPHIC DOCUMENTATION



Photo 23.

Zestaw wskaźników - przebieg



Photo 24.

Zestaw wskaźników - serwis

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe



Photo 28.

Widok z tylnej kanapy na deskę rozdz.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.
Konsola środkowa

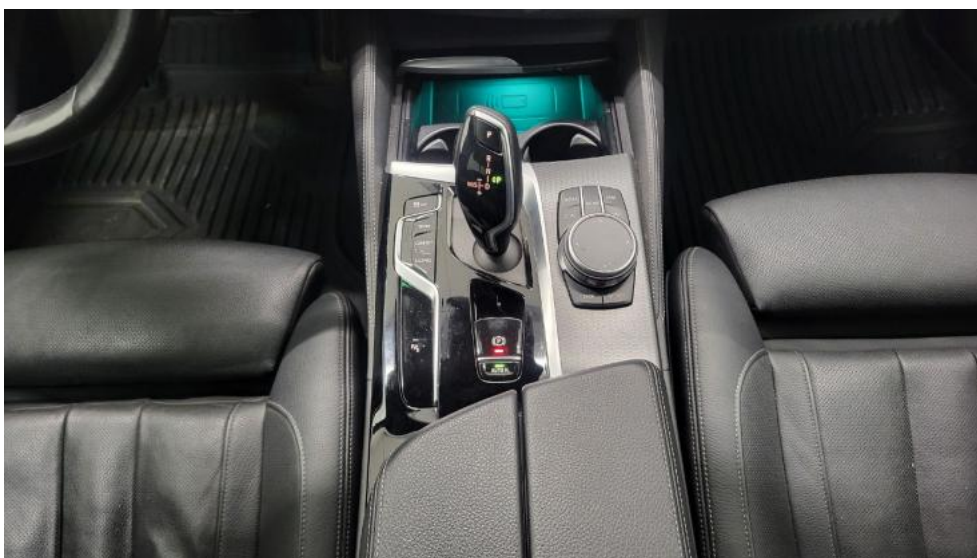


Photo 30.
Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION**Photo 31.**

Kierownica (na wprost)

**Photo 32.**

Dowód rej. Str. 1

PHOTOGRAPHIC DOCUMENTATION

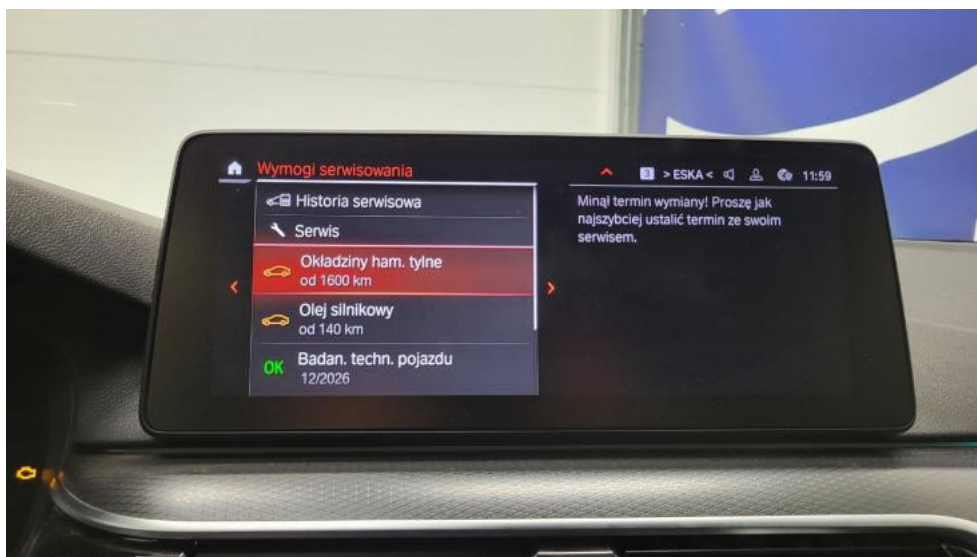


Photo 33.

Książka serwisowa – dane

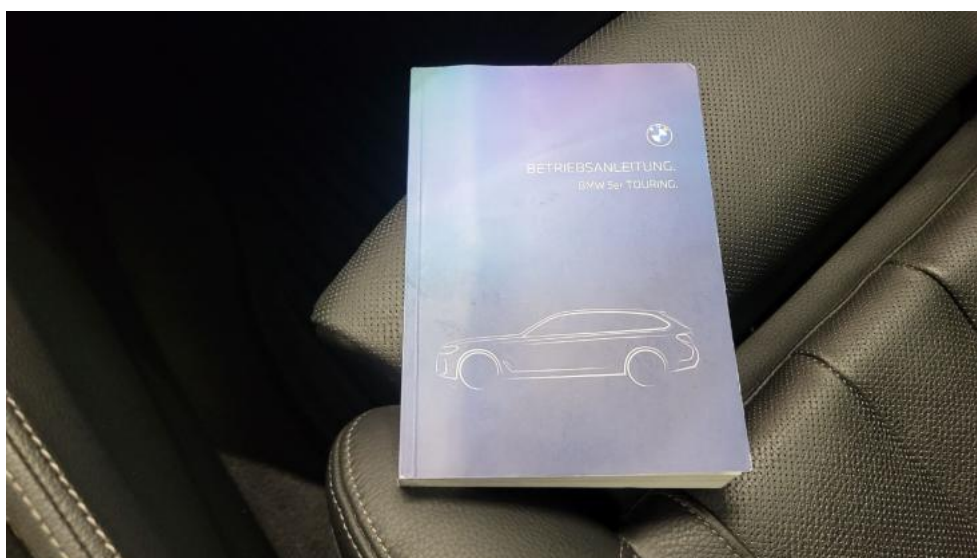


Photo 34.

Książka serwisowa – ostatni przegląd

PHOTOGRAPHIC DOCUMENTATION**Photo 35.**

Dowód rej. str. 2

**Photo 36.**

Instrukcje

PHOTOGRAPHIC DOCUMENTATION



Photo 37.
Zestaw naprawczy koła



Photo 38.
Kluczyki

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Zdjęcie do protokołu



Photo 40.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION

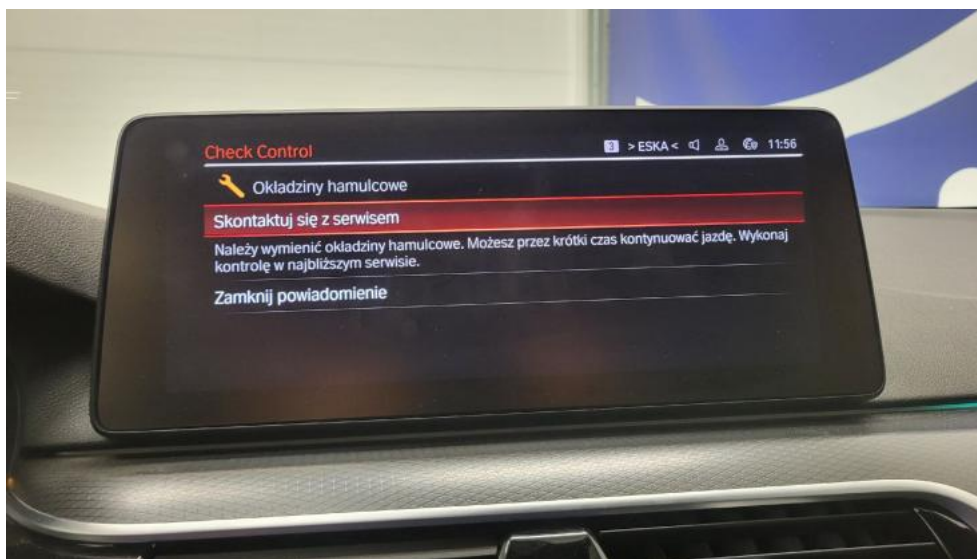


Photo 41.

Zdjęcie do protokołu



Photo 42.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION

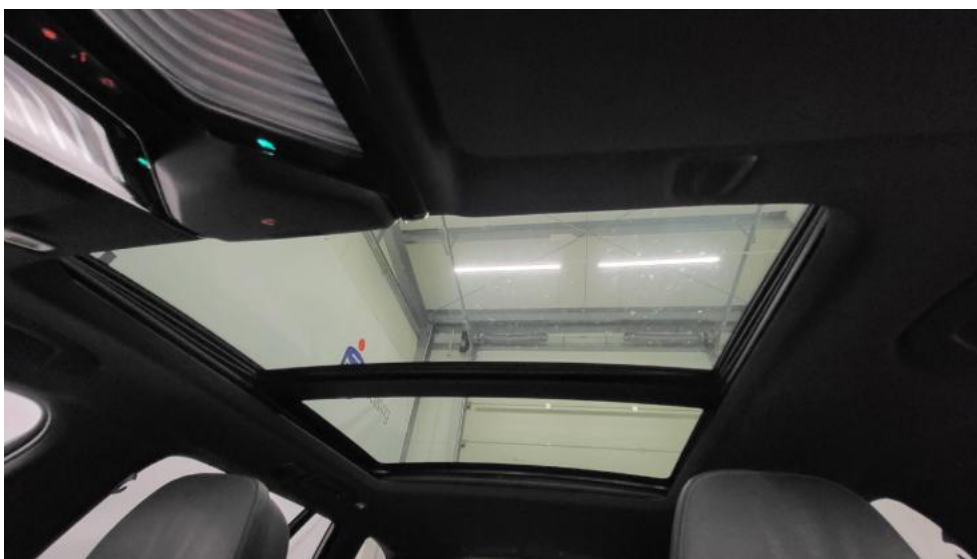


Photo 43.

Zdjęcie do protokołu

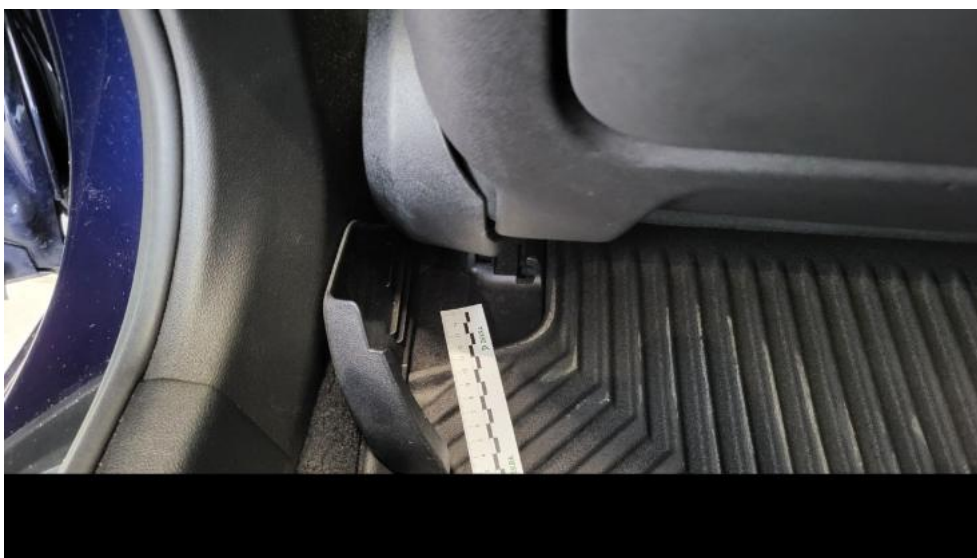


Photo 44.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Zdjęcie do protokołu



Photo 46.

Pokrywa komory silnika - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION

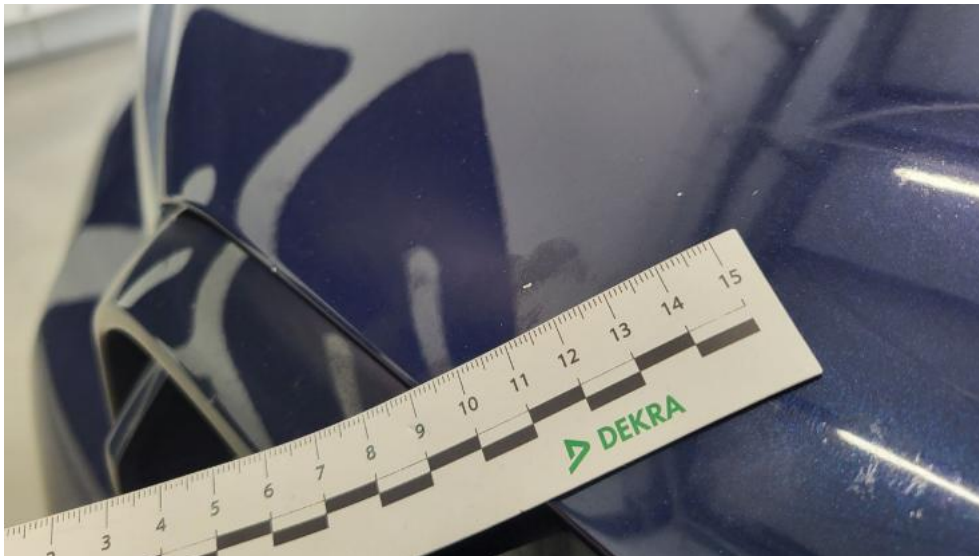


Photo 47.

Pokrywa komory silnika - Rysa/odprysk 2



Photo 48.

Felga aluminiowa przednia P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Drzwi tylne P - Wgniecenie/odkształcenie 1



Photo 50.

Słupek przedni P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1



Photo 52.

Pokrywy bagażnika - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Pokrywy bagażnika - Rysa/odprysk 2



Photo 54.

Szyba tylna - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Zderzak tylny - zdjęcie poglądowe 1



Photo 56.

Zderzak tylny - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Zderzak tylny - Rysa/odprysk 2



Photo 58.

Zderzak tylny - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Zderzak tylny - Wgniecenie/odkształcenie 2



Photo 60.

Dach - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Błotnik tylny L / Ściana boczna L - Rysa/odprysk 1



Photo 62.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Felga aluminiowa tylna L - Rysa/odprysk 1



Photo 64.

Drzwi przed L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Drzwi tylne L - Wgniecenie/odkształcenie 1



Photo 66.

Słupek przedni L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 67.

Błotnik przedni L - Rysa/odprysk 1



Photo 68.

Felga Aluminiowa przednia L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Fotel prz. praw. - Rysa/odprysk 1