

DEKRA's commission No. : PKOL(W)/LODZ/84289/26/09/08
commission/ damage No. : DW/WA/2009/001/D
Date of commission: 08-09-2026

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (WSP)
DEKRA Polska - współpraca O/Warszawa
inż. Józef Orłowski
TU - Włocławek

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0135004
Manufacturer	BMW
Model	Seria 3 Gran Turismo [F34] 16-20
Type / version	320i GPF xDrive aut
Body type	hatchback
Number of doors / seats	5/5
Curb weight [kg]	1675
Gross vehicle weight [kg]	2245
Wheelbase 1/2	2920
Engine type	spark ignition
Pollution reduction system	GPF
Engine capacity [ccm]	1998
Engine Power [hp/kW]	184/135
Gearbox	automatic 8- gear
Registration /record No.	BI142EV
VIN / serial number	WBA8X51070CF51065
Date of first registration	03-02-2021
Date of next. tech. test	16-01-2027
Year of manufacture	2020 (year has been verified with the manufacturer's base)
Readout [km]	121 578 (read)
Body color / type of coating	white/UNI

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	PIRELLI, CINTURATO P7	225/50 18 95W	4,0 mm
	left	PIRELLI, CINTURATO P7	225/50 18 95W	4,5 mm
back	right	PIRELLI, CINTURATO P7	225/50 18 95W	5,0 mm
	left	PIRELLI, CINTURATO P7	225/50 18 95W	5,0 mm

Standard equipment by Eurotax

- | | |
|---|--|
| 1. Airbag: other | 25. LED rear lights |
| 2. Alarm | 26. Leather steering wheel |
| 3. Antilock-Brake-System (ABS) | 27. Light alloy wheels from 17" |
| 4. Armrest (s) front | 28. Mobile Tire System |
| 5. Armrest (s) rear | 29. Multi functional steering wheel |
| 6. Bluetooth interface, Hands-free system, USB in | 30. On board monitor, Other, Radio, Soundsystem |
| 7. Bord communication: other | 31. Other |
| 8. Bord communication: other | 32. Other |
| 9. Child seat fixation | 33. Power steering |
| 10. Colored glass | 34. Power windows front, Power windows rear |
| 11. DAB radio | 35. Rain sensor |
| 12. Driver airbag, Head airbags front, Head airbags rear, Passenger airbag, Side airbag driver and passenger, Side airbags rear | 36. Rear seat-backs foldable in two separate parts |
| 13. Dualzone automatic climate control | 37. Rear spoiler |
| 14. ESP (Electronical Stabilizing Program), Traction control | 38. Selectable driveline characteristics |
| 15. Electric tailgate | 39. Servotronic |
| 16. Exterior design: other | 40. Start/Stop system |
| 17. Exterior design: other | 41. Steering wheel manually adjustable |
| 18. Exterior lighting: other | 42. Telematic |
| 19. Floor mat | 43. Telematic |
| 20. Follow me home | 44. Textile upholstery |
| 21. Interior decoration: other | 45. Uni-Lackierung |
| 22. Keyless Engine start, Keyless go | 46. Wheel bolt locks |
| 23. LED Fog Lamps | 47. Windscreen wash-nozzle heated |
| 24. LED front dim light | |

Dealer's equipment (selected items)

- | | |
|---|---|
| 1. Apple CarPlay | - |
| 2. Automated High-beam assist | - |
| 3. Cruise control | - |
| 4. Exterior design: other | - |
| 5. Exterior design: other | - |
| 6. Heated seat driver, Heated seat passenger | - |
| 7. Interior lights: other accessories | - |
| 8. Interior: other | - |
| 9. Lumbar adjust driver, Lumbar adjust passenger | - |
| 10. Metal finish | - |
| 11. Navigation system | - |
| 12. Park Distance Control front, Park Distance Control rear | - |
| 13. Rear-view mirror autodimming | - |
| 14. Runflat tyres | - |
| 15. Sport seats front | - |
| 16. Sports steering wheel | - |
| 17. Storage facilities in general | - |
| 18. Textile upholstery | - |

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

CorrectionsFirst registrationMileageEquipmentTyresOther

Earlier repairs -
stwierdzone braki i uszkodzenia -


Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 09-2026 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - due to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 13-09-2026

DEKRA's expert:
Kacper Sosnowski (WSP)
inż. Józef Orłowski

Document issued electronically valid without signature.

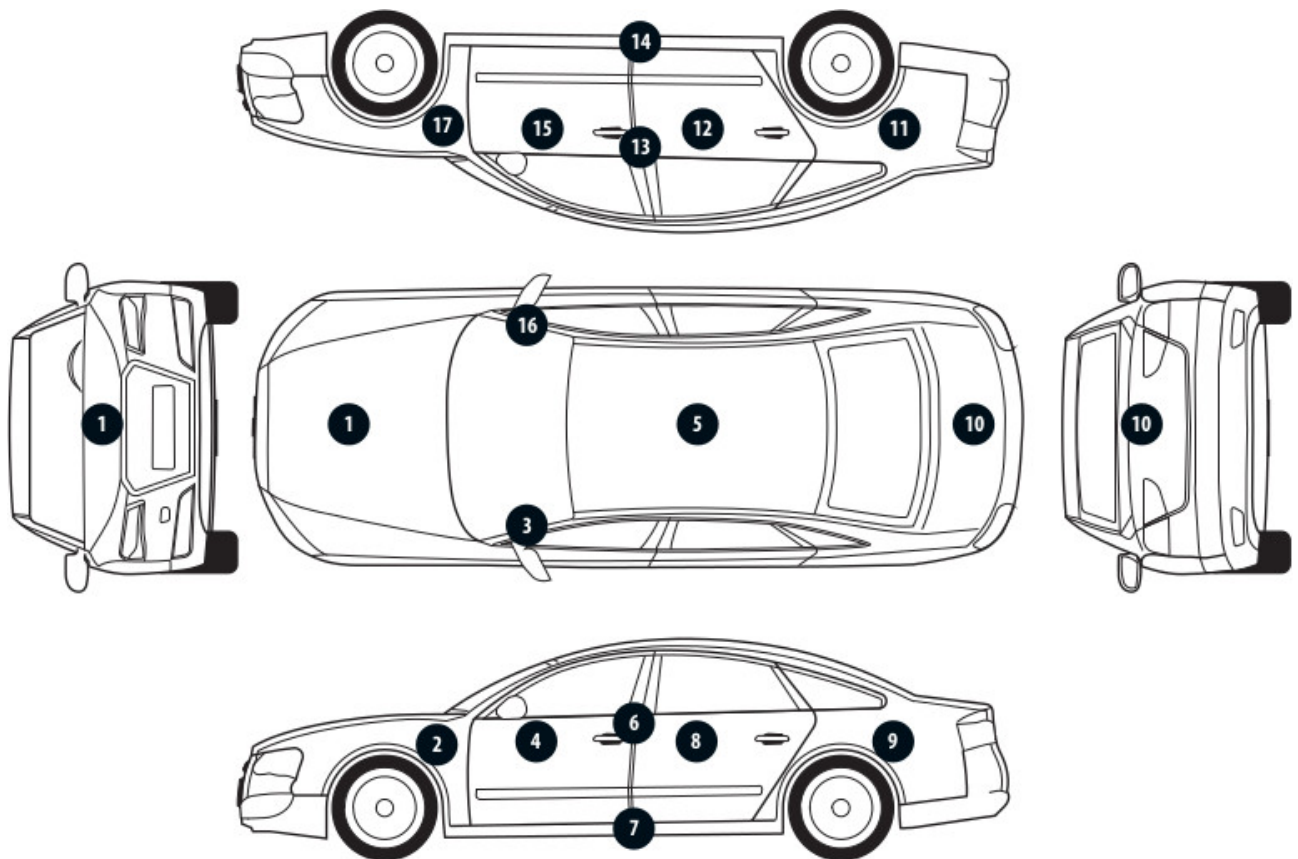Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Front left fender	to 150
3	Left front pillar	to 150
4	Front left door	to 150
5	Roof	to 150
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	to 150
9	Rear left fender	to 150
10	Cover/lid	to 150
11	Right rear fender	150 - 1000
12	Right rear door	150 - 1000
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	150 - 200
16	Right front pillar	to 150
17	Front right fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book was presented and its number is given below:
elektroniczna

Information concerning the origin of the vehicle

The vehicle purchased domestically from an authorized representative of the brand.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below:
ograniczenia parkingowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of

the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

1

Expert comments - regarding valuation

Rysy na samochodzie. Informacja w dowodzie rejestracyjnym końcowa partia produkcji. Brak zaślepki w tylnej kanapie. Aktywna kontrolka ciśnienia w kołach. Widoczne wady lakiernicze. Odpryski na szybie czołowej. Substancja na samochodzie.

Restrictive disclaimer - regarding valuation

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.

Próg lewy (widok od przodu)



Photo 12.

Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Komora silnika

PHOTOGRAPHIC DOCUMENTATION



Photo 21.

Numer identyfikacyjny



Photo 22.

Tabliczka znamionowa

PHOTOGRAPHIC DOCUMENTATION



Photo 23.

Zestaw wskaźników - przebieg



Photo 24.

Zestaw wskaźników - serwis

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe



Photo 28.

Widok z tylnej kanapy na deskę rozdz.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.
Konsola środkowa



Photo 30.
Tunel środkowy

[illegible]

DEKRA Polska Sp. z o.o.
02-673 Warszawa, ul. Konstruktorska 12A
www.dekra.pl

PHOTOGRAPHIC DOCUMENTATION**Photo 33.**

Książka serwisowa – dane

**Photo 34.**

Książka serwisowa – ostatni przegląd

PHOTOGRAPHIC DOCUMENTATION**Photo 35.**

Dow. Rej. Str. 2

**Photo 36.**

Instrukcje

PHOTOGRAPHIC DOCUMENTATION



Photo 37.

Kluczyki

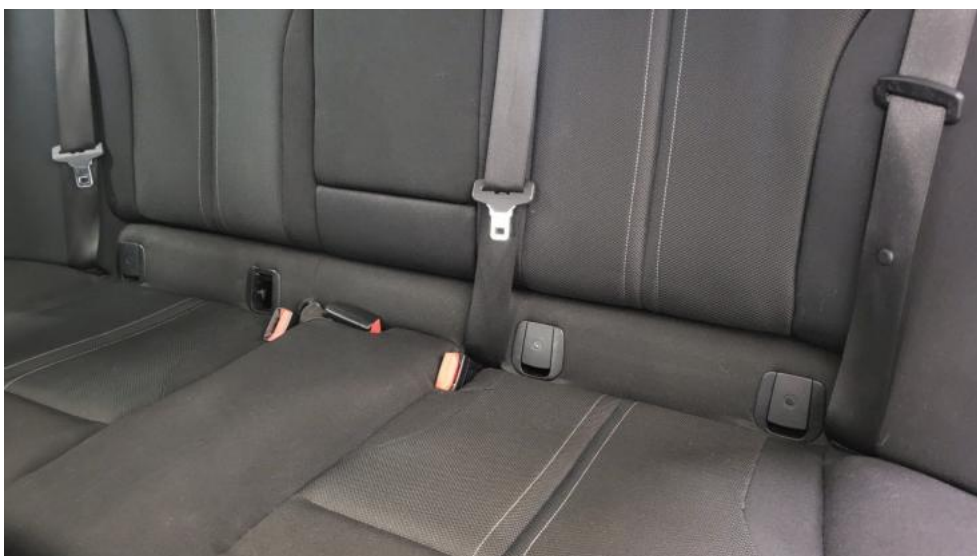


Photo 38.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Pokrywa komory silnika - Rysa/odprysk 1

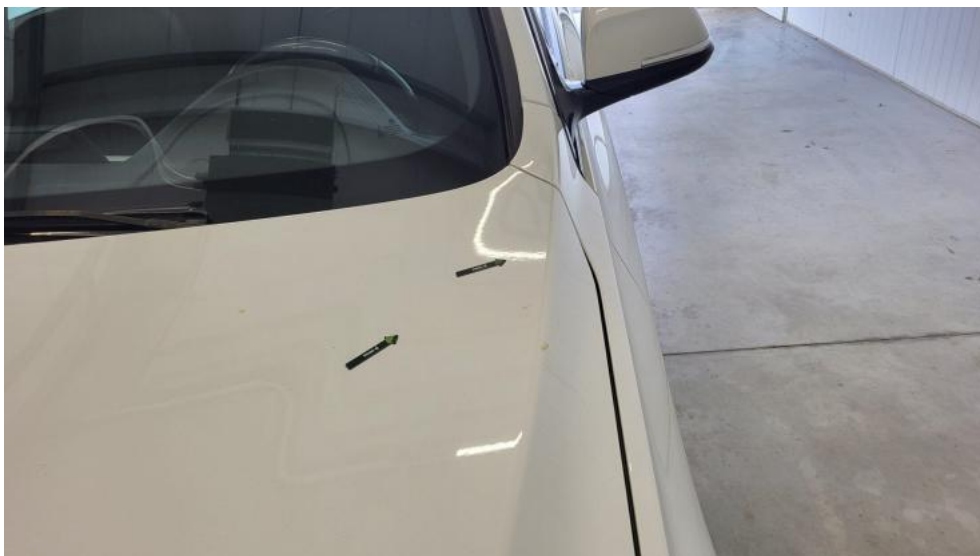


Photo 40.

Pokrywa komory silnika - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Pokrywa komory silnika - Inne 1



Photo 42.

Uszczelka/listwa szyby czołowej - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Wykładzina pokrywy komory silnika - Pęknięcie/rozerwanie 1



Photo 44.

Błotnik przedni P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Błotnik przedni P - Wgniecenie/odkształcenie 1



Photo 46.

Felga aluminiowa przednia P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Drzwi przednie P - Rysa/odprysk 1



Photo 48.

Drzwi przednie P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Drzwi tylne P - zdjęcie pogładowe 1



Photo 50.

Drzwi tylne P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Lusterko zew P - Rysa/odprysk 1



Photo 52.

Próg P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Próg P - Wgniecenie/odkształcenie 1



Photo 54.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Felga aluminiowa tylna P - Rysa/odprysk 1



Photo 56.

Opona tylna P - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Emblemat tylny - Inne 1



Photo 58.

Pokrywy bagażnika - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Zderzak tylny - Rysa/odprysk 1



Photo 60.

Zderzak tylny - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Zderzak tylny - Wgniecenie/odkształcenie 1



Photo 62.

Zderzak tylny cz dolna - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Zderzak tylny cz dolna - Inne 1



Photo 64.

Dach - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Błotnik tylny L / Ściana boczna L - Rysa/odprysk 1

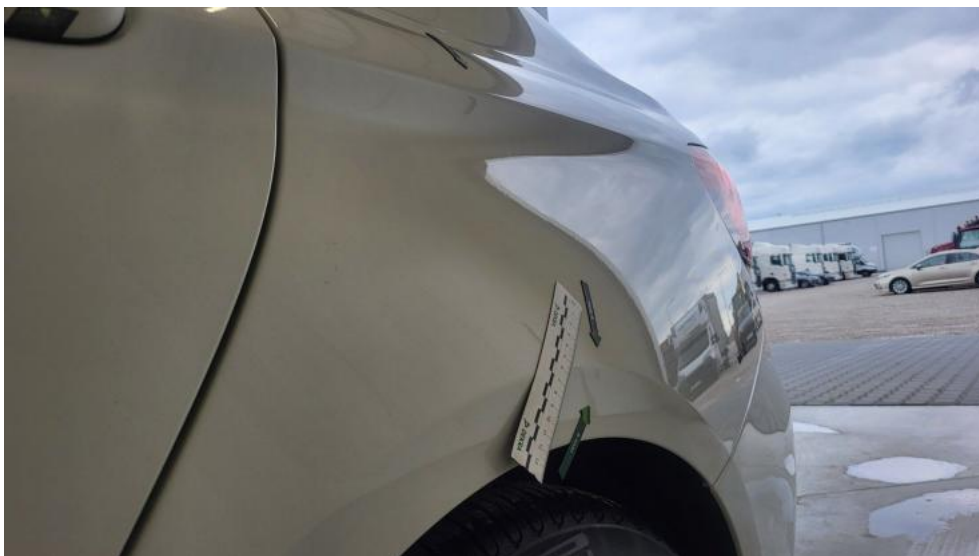


Photo 66.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION

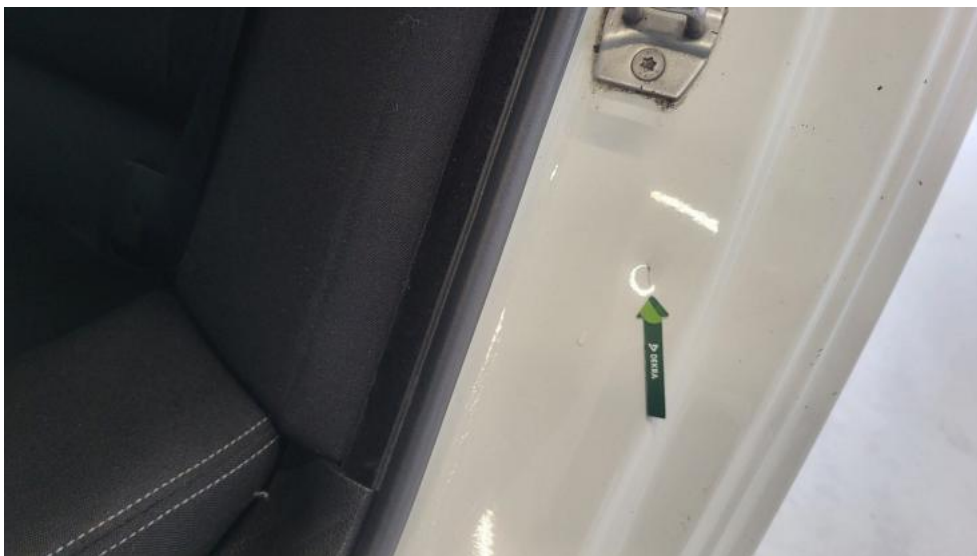


Photo 67.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 2



Photo 68.

Felga aluminiowa tylna L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Drzwi przed L - Rysa/odprysk 1



Photo 70.

Drzwi przed L - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Drzwi przed L - Wgniecenie/odkształcenie 1



Photo 72.

Drzwi tylne L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 73.

Drzwi tylne L - Wgniecenie/odkształcenie 1

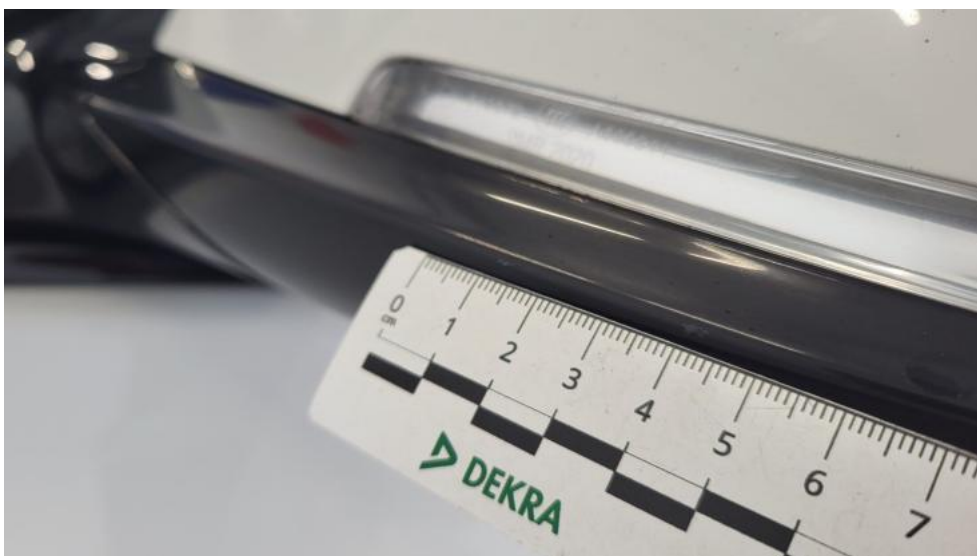


Photo 74.

Lusterko zew L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION

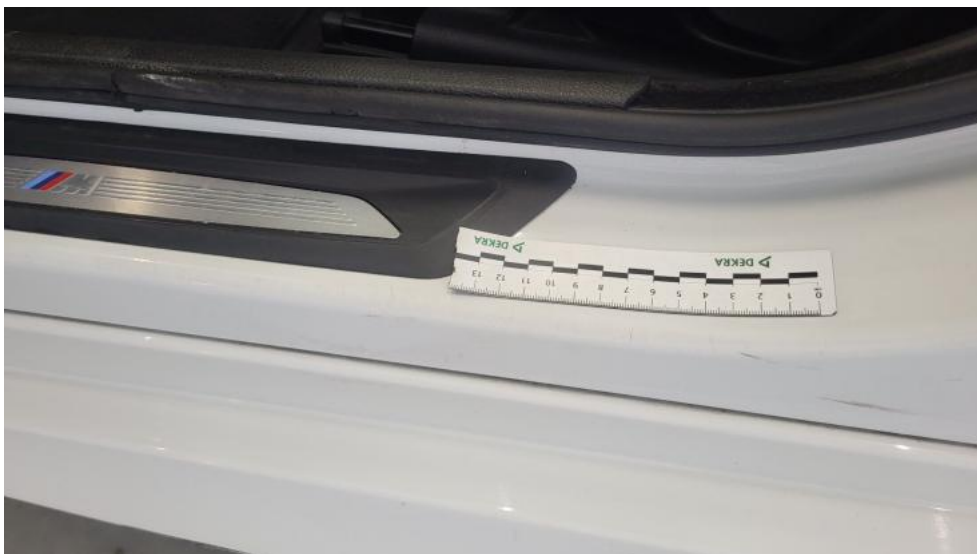


Photo 75.
Próg L - Rysa/odprysk 1



Photo 76.
Felga Aluminiowa przednia L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 77.

Fotel prz. lew. - Inne 1



Photo 78.

Fotel prz. praw. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 79.
Kanapa tyl. - Inne 1



Photo 80.
Tapicerka drzwi tylnych L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 81.

Uchwyt drzwi prze L - Rysa/odprysk 1



Photo 82.

Uchwyt drzwi prze P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 83.

Uchwyt drzwi tyl L - Rysa/odprysk 1



Photo 84.

Uchwyt drzwi tyl P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 85.

Uszczelka drzwi przednich L - Pęknięcie/rozerwanie 1



Photo 86.

Uszczelka drzwi tylnych L - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 87.

Wykładzina(y) słupka przedniego L - Inne 1