

DEKRA's commission No. : PKOL(W)/LODZ/92961/25/11/28
commission/ damage No. : 20/052783
Date of commission: 28-11-2025

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (NEW)
DEKRA Polska - współpraca O/Warszawa
Andrzej Sosnowski
DEKRA Polska - Centrala

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0143693
Manufacturer	FORD
Model	Focus Kombi 18-21
Type / version	Focus 1.5 EcoBlue Connected
Body type	KOM
Number of doors / seats	5/5
Curb weight [kg]	1320
Gross vehicle weight [kg]	1955
Wheelbase 1/2	2650
Engine type	Automatic ignition
Pollution reduction system	DPF
Engine capacity [ccm]	1499
Engine Power [hp/kW]	120/88
Gearbox	manual 6- gear
Registration /record No.	WZ466CC
VIN / serial number	WF0PXXGCHPLK02516
Date of first registration	07-12-2020
Date of next. tech. test	07-12-2025
Year of manufacture	2020 (year has been verified with the manufacturer's base)
Readout [km]	175 447 (read)
Body color / type of coating	blue/double-layered, metallized

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	GOLD-GUM, ALPRSI	205/60 16 92S	6,0 mm
	left	GOLD-GUM, ALPRSI	205/60 16 92S	6,5 mm
back	right	GOLD-GUM, ALPRSI	205/60 16 92S	7,0 mm
	left	GOLD-GUM, ALPRSI	205/60 16 92S	7,0 mm

Standard equipment by Eurotax

- | | |
|--|---|
| 1. Air conditioning | 35. Lane control assistant |
| 2. Armrest (s) front, Extra power outlet, Storage facilities in general | 36. Leather steering wheel |
| 3. Automatic dimlight activation | 37. Light Alloy wheels 16" |
| 4. Bluetooth interface, CD-player, iPod Interface, Navigation system, On board monitor, Radio, Steering wheel with radio operation, USB in | 38. Luggage compartment cover |
| 5. Body-coloured bumpers | 39. Lumbar adjust driver |
| 6. Brake Assist, Collision Warning System, Pedestrian Emergency Brake Assist, Pre-Crash System | 40. Mobile Tire System |
| 7. Child seat fixation | 41. On board computer |
| 8. Comfort passenger seat | 42. On board monitor |
| 9. Cornering Headlights, Fog lamps | 43. Other |
| 10. Cruise control | 44. Other |
| 11. Cruise control, Speed limiter | 45. Other |
| 12. Door mirror(s) electrically adjustable in general, Door mirrors heated, Side indicators | 46. Other |
| 13. Door: other, Navigation system, Other | 47. Other, Wireless device charging |
| 14. Driver airbag, Passenger airbag | 48. Park Distance Control front, Park Distance Control rear |
| 15. Driver seat electrically adjustable | 49. Passenger seat with adjustable inclination |
| 16. Driver seat with adjustable inclination | 50. Power steering |
| 17. Driver-information-system | 51. Power windows front, Power windows rear |
| 18. ESP (Electronical Stabilizing Program), Hill holder, Power assisted brakes, Traction control | 52. Rear seat-backs foldable in two separate parts |
| 19. Electric parking brake | 53. Rear spoiler |
| 20. Exterior design: other | 54. Rear view camera |
| 21. Exterior design: other | 55. Remote controlled central locking |
| 22. Exterior design: other | 56. Roof railing |
| 23. Exterior design: other | 57. Roof: other |
| 24. Exterior design: other | 58. Selectable driveline characteristics |
| 25. Extra power outlet | 59. Side airbag driver and passenger |
| 26. Floor mat | 60. Sport seats front |
| 27. Fog lamps | 61. Start/Stop system |
| 28. Head airbags front, Head airbags rear | 62. Steering wheel manually adjustable |
| 29. Interior decoration: other | 63. Textile upholstery |
| 30. Interior: other | 64. Tyre pressure control (RDC) |
| 31. Interior: other | 65. Uni-Lackierung |
| 32. Interior: other, Leather gearshifter/switch | 66. Vehicle immobilizer |
| 33. LED Daytime running lights | 67. Windows: other |
| 34. LED front dim light | |

Dealer's equipment (selected items)

- | | |
|--|---|
| 1. Bluetooth interface, CD-player, iPod Interface, On board monitor, Radio, USB in | - |
| 2. Diminished spare wheel | - |
| 3. LED Daytime running lights, LED front dim light, LED rear lights | - |
| 4. Metallic paint | - |

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

CorrectionsFirst registrationMileageEquipmentTyresOther

Earlier repairs -
Braki, uszkodzenia stan, weryfikacja serwisowa -

Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 12-2025 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - due to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 10-12-2025

DEKRA's expert:
Kacper Sosnowski (NEW)
Andrzej Sosnowski

Document issued electronically valid without signature.

Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Front left fender	to 150
3	Left front pillar	150 - 200
4	Front left door	to 150
5	Roof	to 150
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	150 - 500
9	Rear left fender	150 - 300
10	Cover/lid	to 150
11	Right rear fender	to 150
12	Right rear door	to 150
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	to 150
16	Right front pillar	to 150
17	Front right fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book of the vehicle was not provided.

Information concerning the origin of the vehicle

Lack of reliable data.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below:
ograniczenia placowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the

page 5/46

assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

1

Expert comments - regarding valuation

Aktywna kontrolka ciśnienia w kołach. Nierówna i głośna praca silnika. Aktywna kontrolka silnika. Informacja wymiana oleju konieczna. Głośna praca drzwi przednich lewych. Rysy na samochodzie. Odpryski na szybie czołowej. Widoczne wady lakiernicze. Nieprzyjemny zapach w samochodzie.

Rzeczoznawca dokonał oględzin pojazdu w warunkach parkingowych, co mogło ograniczyć pełną ocenę jego stanu technicznego. Dodatkowo, jeżeli jazda próbna została przeprowadzona (informacje w treści raportu), to wykonano ją w warunkach parkingowych, z niewielką prędkością, co może nie odzwierciedlać pełnych warunków eksploatacyjnych. Istnieje możliwość, że w innych okolicznościach ujawnią się dodatkowe uszkodzenia lub usterki, których nie można było wykryć podczas obecnych oględzin. Zalecamy zatem skorzystanie z możliwości oględzin pojazdu we własnym zakresie lub w Autoryzowanej Stacji Obsługi danej marki, co pozwoli na pełniejszą weryfikację stanu technicznego pojazdu przed udziałem w aukcji."

Restrictive disclaimer - regarding valuation

Nie weryfikowano szczegółowo stanu układu napędowego, zawieszenia, kierowniczego, hamulcowego oraz wydechowego. Ocena została wykonana bez użycia podnośnika i specjalistycznego sprzętu diagnostycznego, nie dokonywano demontażu osłon i innych elementów. Ocena określa ogólny stan pojazdu na dzień oględzin w miejscu jego udostępnienia, nie może być zatem traktowana jako kompleksowa ocena stanu technicznego. Specyfikacja wg. programu operacyjnego w zakresie wyposażenia standardowego i dodatkowego nie gwarantuje zgodności ze stanem faktycznym w zakresie możliwym do ustalenia przez rzeczoznawcę podczas oględzin pojazdu.

Pomiar grubości powłoki lakierowej wykonano w miejscach możliwych do ich wykonania pomiary nie gwarantują oryginalności poszczególnych elementów poddanych ocenie.

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.

- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.

Bok prawy z tyłu



Photo 6.

Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.

Próg lewy (widok od przodu)



Photo 12.

Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa

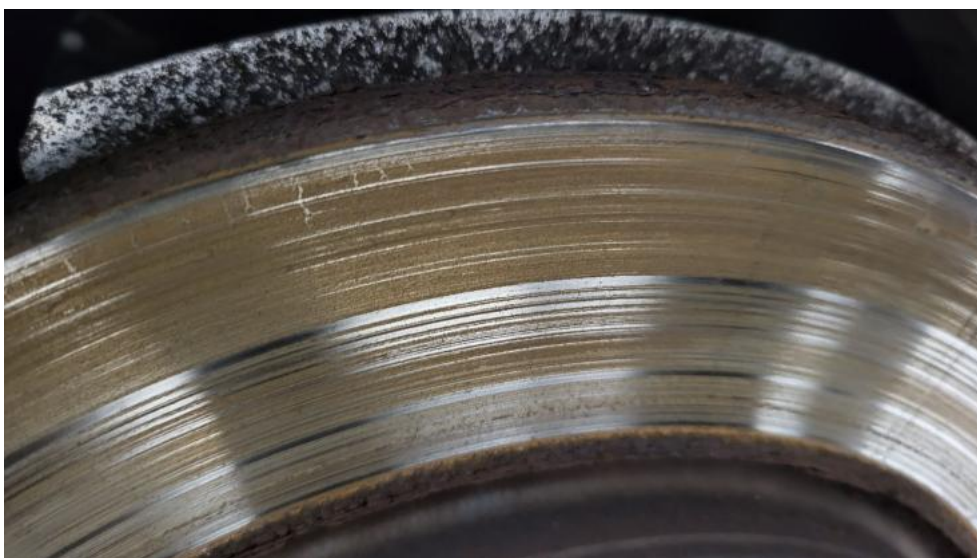


Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa

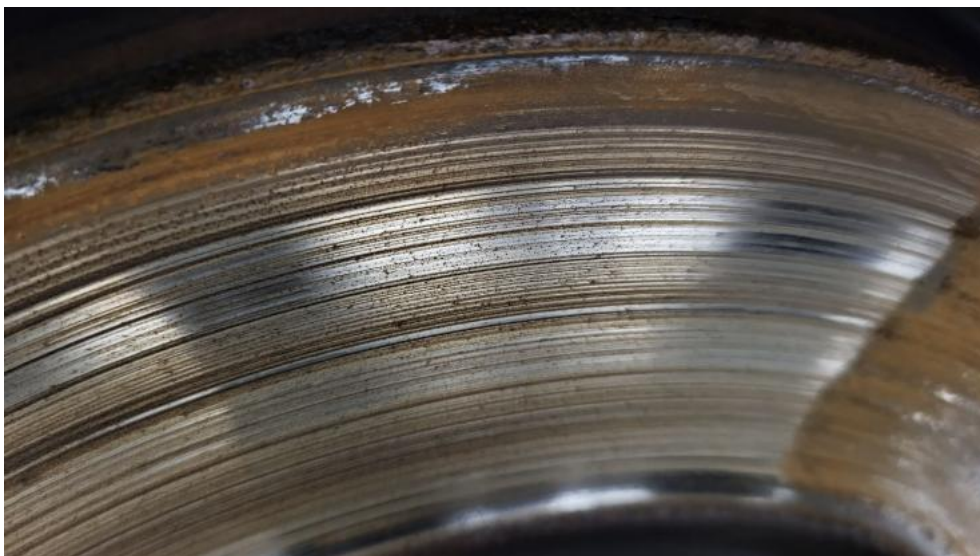


Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika



Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION



Photo 23.

Tabliczka znamionowa



Photo 24.

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe



Photo 28.

Widok z tylnej kanapy na deskę rozdz.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.

Konsola środkowa

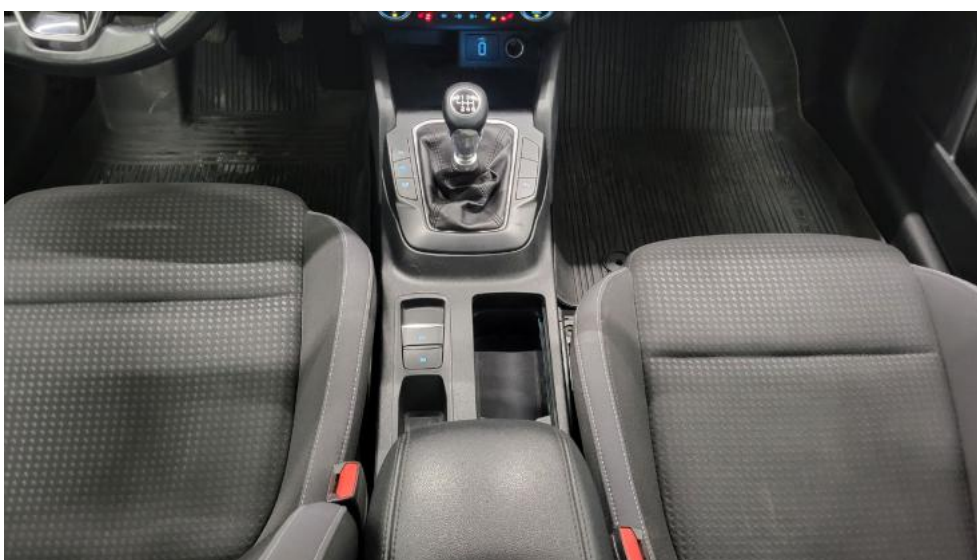


Photo 30.

Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION



Photo 31.

Kierownica (na wprost)



Photo 32.

Dowód rej. Str. 1

PHOTOGRAPHIC DOCUMENTATION



Photo 33.

Dow. Rej. Str.2 i klucze

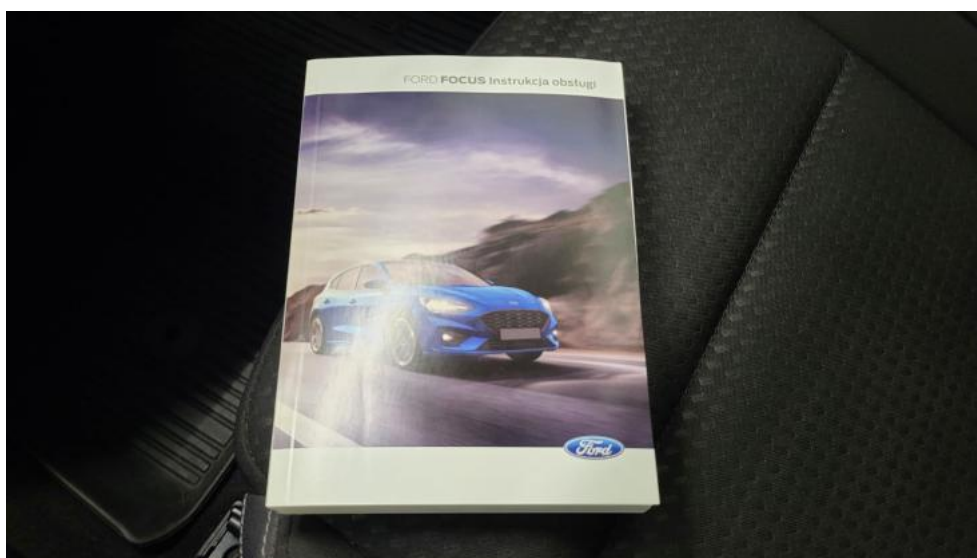


Photo 34.

Instrukcje

PHOTOGRAPHIC DOCUMENTATION



Photo 35.

Zdjęcie do protokołu

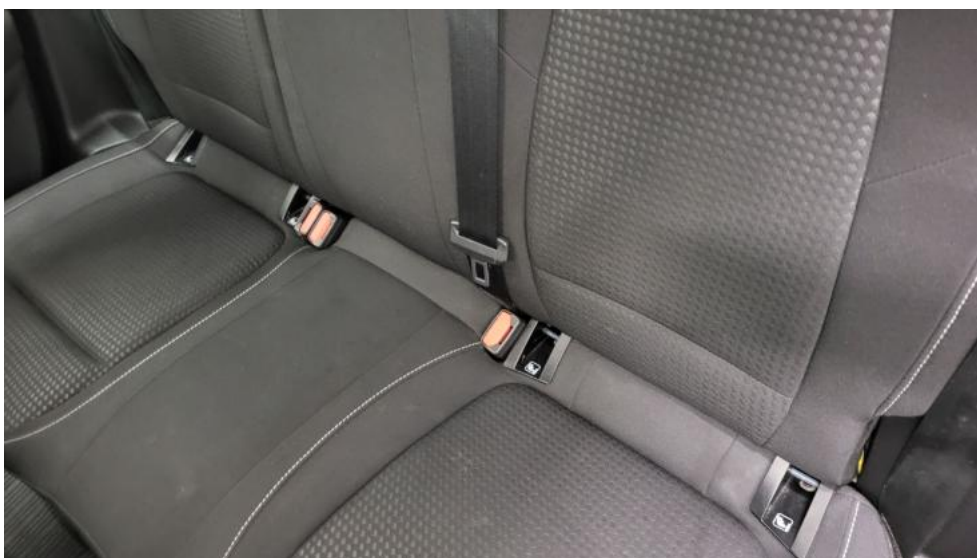


Photo 36.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 37.

Pokrywa komory silnika - zdjęcie poglądowe 1



Photo 38.

Pokrywa komory silnika - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION

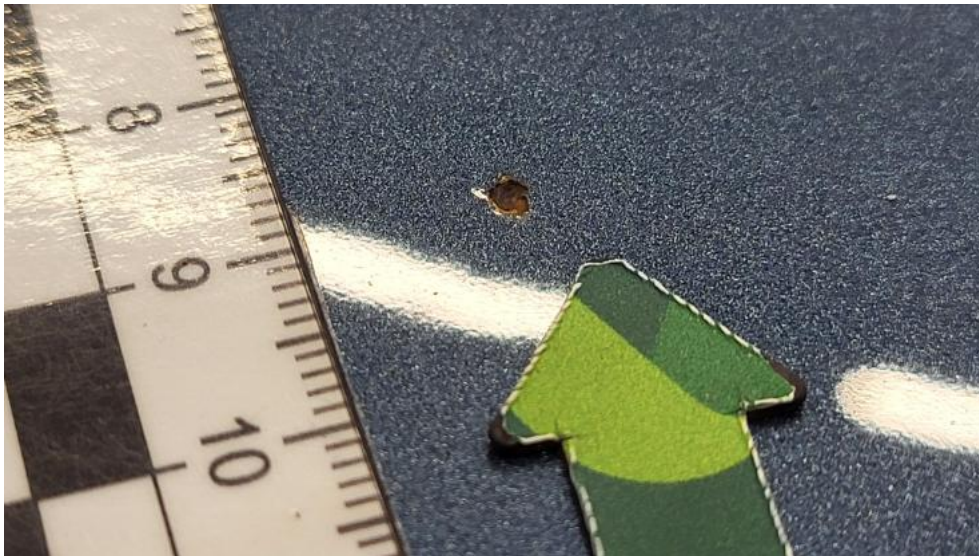


Photo 39.

Pokrywa komory silnika - Inne 1



Photo 40.

Felga aluminiowa przednia P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Listwa zderzaka prz P - Inne 1



Photo 42.

Drzwi przednie P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Drzwi tylne P - Wgniecenie/odkształcenie 1



Photo 44.

Próg P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Błotnik tylny P / Ściana boczna P - zdjęcie pogładowe 1



Photo 46.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION

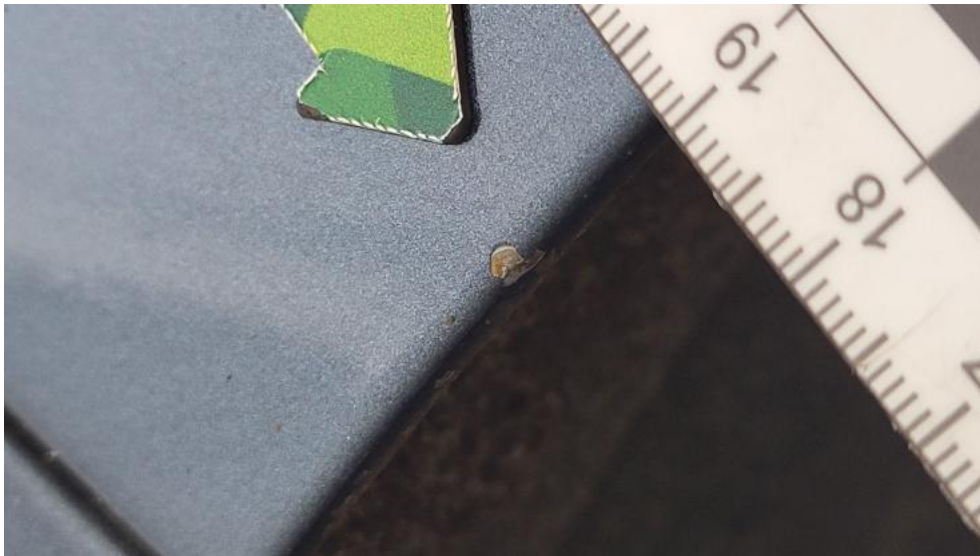


Photo 47.

Błotnik tylny P / Ściana boczna P - Inne 1



Photo 48.

Pokrywy bagażnika - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Zderzak tylny - Rysa/odprysk 1

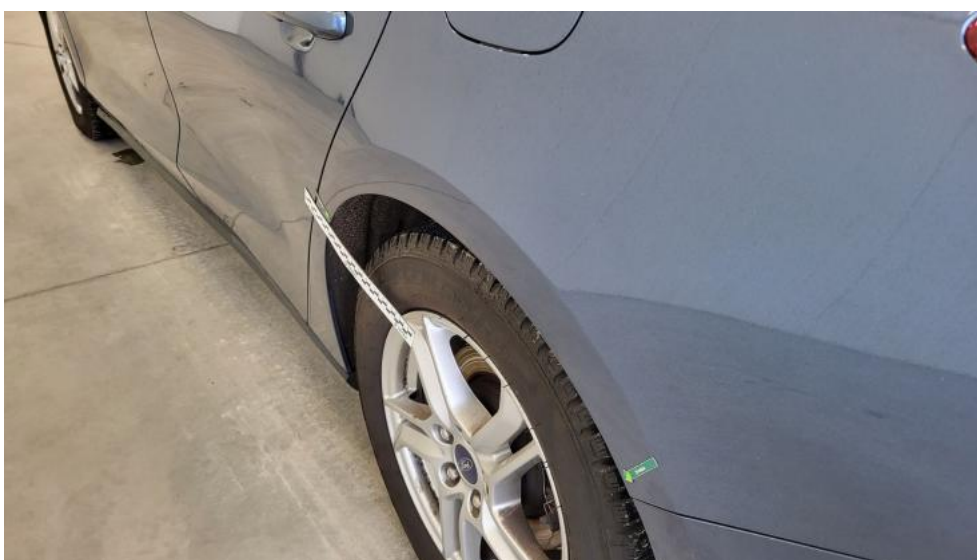


Photo 50.

Błotnik tylny L / Ściana boczna L - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1

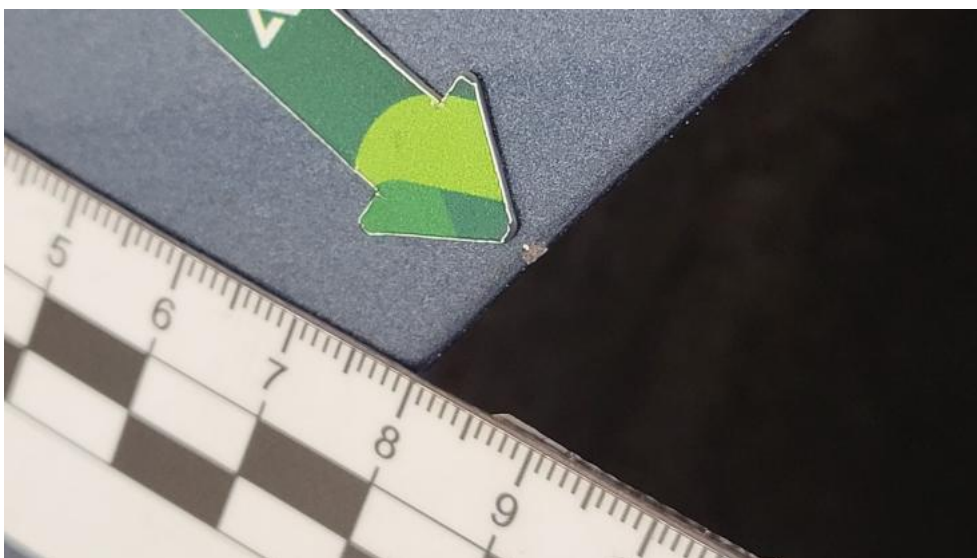


Photo 52.

Błotnik tylny L / Ściana boczna L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Drzwi przed L - Rysa/odprysk 1



Photo 54.

Drzwi tylne L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Drzwi tylne L - Wgniecenie/odkształcenie 1



Photo 56.

Drzwi tylne L - Wgniecenie/odkształcenie 2

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Koło kierownicy - Inne 1



Photo 58.

Konsola tunelu śr. - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Fotel prz. lew. - zdjęcie poglądowe 1



Photo 60.

Fotel prz. lew. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Fotel prz. lew. - Inne 2

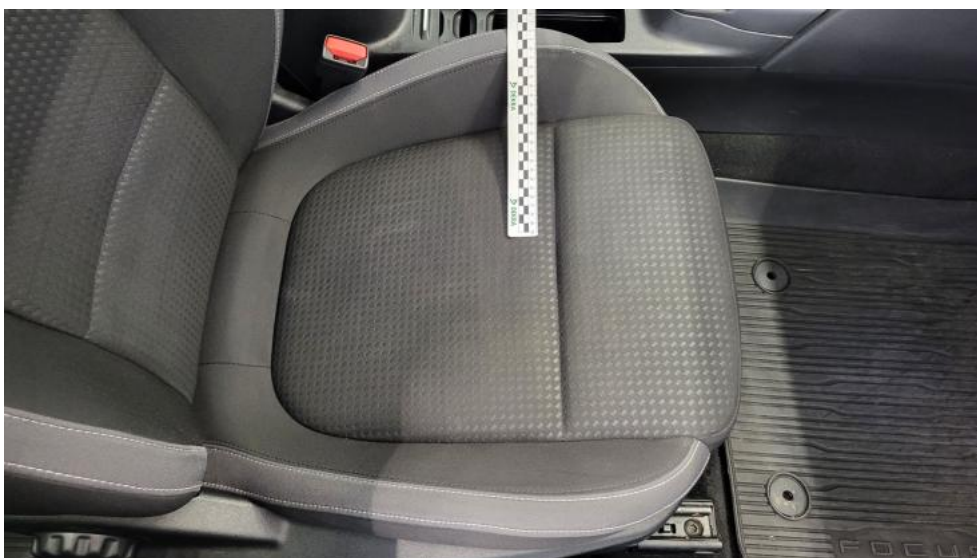


Photo 62.

Fotel prz. praw. - Inne 1

PHOTOGRAPHIC DOCUMENTATION

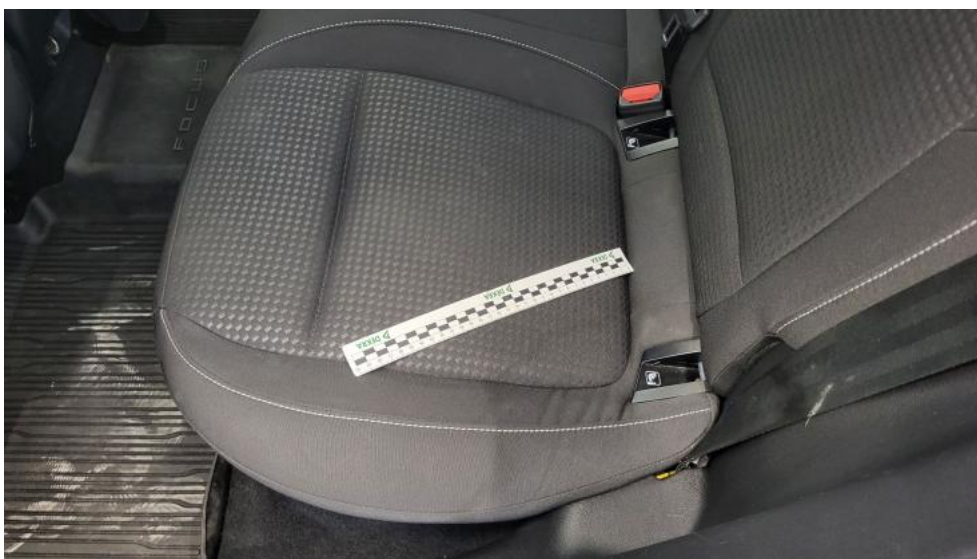


Photo 63.
Kanapa tyl. - Inne 1

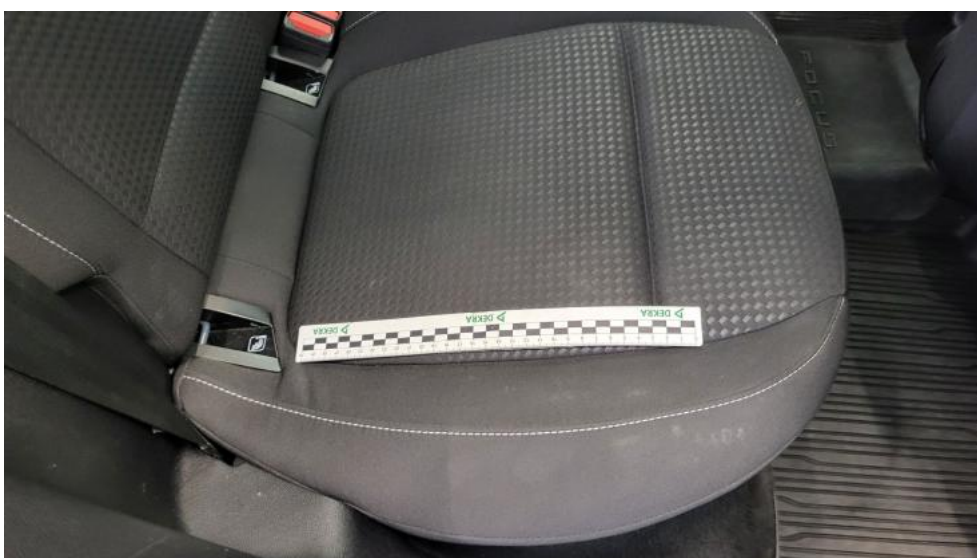


Photo 64.
Kanapa tyl. - Inne 2

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Tapicerka drzwi przednich L - Inne 1



Photo 66.

Tapicerka drzwi przednich L - Inne 2

PHOTOGRAPHIC DOCUMENTATION



Photo 67.

Tapicerka drzwi przednich P - Inne 1



Photo 68.

Osłona p/słoneczna lewa - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Osłona p/słoneczna prawa - Inne 1



Photo 70.

Podsufitka - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Podsufitka - Pęknięcie/rozerwanie 1

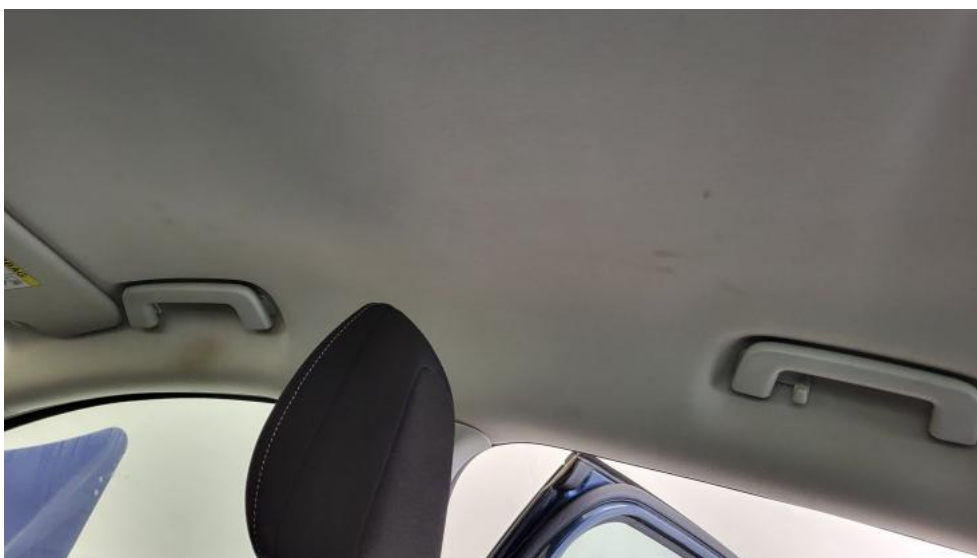


Photo 72.

Podsufitka - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 73.

Wykładzina podłogi - Inne 1



Photo 74.

Wykładzina pokrywy tylnej - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 75.

Wykładzina pokrywy tylnej - Inne 1



Photo 76.

Wykładzina przestrzeni bagażowej - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 77.

Wykładzina przestrzeni bagażowej - Inne 2