

DEKRA's commission No. : PKOL(W)/LODZ/95836/25/12/05
commission/ damage No. : 22/023205
Date of commission: 05-12-2025

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (NEW)
DEKRA Polska - współpraca O/Warszawa
Bartłomiej Chodakowski (NEW)
DEKRA Polska - współpraca O/Wrocław

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0136542
Manufacturer	HYUNDAI
Model	i30 Wagon 17-20
Type / version	i30 1.4 T-GDI GPF Comfort DCT
Body type	KOM
Number of doors / seats	5/5
Curb weight [kg]	1365
Gross vehicle weight [kg]	1880
Wheelbase 1/2	2650
Engine type	spark ignition
Pollution reduction system	GPF
Engine capacity [ccm]	1353
Engine Power [hp/kW]	140/103
Gearbox	automatic 7- gear
Registration /record No.	WGM0746G
VIN / serial number	TMAH3813GLJ072482
Date of first registration	30-07-2020
Date of next. tech. test	29-07-2023
Year of manufacture	2020 (year has been verified with the manufacturer's base)
Readout [km]	156 522 (read)
Body color / type of coating	black/UNI

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	KLEBER, QUADRAXER 2	205/55 16 94V	3,0 mm
	left	KLEBER, QUADRAXER 2	205/55 16 94V	3,0 mm
back	right	KLEBER, QUADRAXER 2	205/55 16 94V	5,0 mm
	left	KLEBER, QUADRAXER 2	205/55 16 94V	5,0 mm

Standard equipment by Eurotax

- | | |
|--|--|
| 1. 7-speed automatic transmission, Other | 37. Interior lights: other accessories |
| 2. Airbag: other | 38. Interior: other |
| 3. Alarm | 39. Interior: other |
| 4. Armrest (s) rear | 40. Interior: other |
| 5. Automatic climate control | 41. LED Daytime running lights |
| 6. Bluetooth interface | 42. Leather gearshifter/switch, Leather steering wheel |
| 7. Bluetooth interface | 43. Light Alloy wheels 16" |
| 8. Bord communication: other | 44. Luggage compartment cover |
| 9. Bord entertainment: other accessories, Interior: other | 45. Lumbar adjust driver, Lumbar adjust passenger |
| 10. Cargo lattice | 46. Mobile phone preparation |
| 11. Central locking | 47. On board monitor, Radio, Rear view camera |
| 12. Child seat fixation | 48. Other |
| 13. City Emergency Brake Assist | 49. Other |
| 14. Cornering Headlights | 50. Other |
| 15. Cruise control | 51. Other |
| 16. Daytime running lights | 52. Other, Power windows front, Power windows rear |
| 17. Daytime running lights | 53. Park Distance Control rear |
| 18. Diminished spare wheel | 54. Passenger seat height adjustable |
| 19. Door mirrors electrically foldable | 55. Power steering |
| 20. Door mirrors heated, Mirror: others | 56. Power windows front, Power windows rear |
| 21. Door: other | 57. Radio preparation |
| 22. Driver airbag, Passenger airbag | 58. Roof railing |
| 23. Driver seat height adjustable | 59. Selectable driveline characteristics |
| 24. Driver-information-system | 60. Side airbag driver and passenger |
| 25. ESP (Electronical Stabilizing Program) | 61. Steering wheel with radio operation |
| 26. Exterior design: other | 62. Steering: other |
| 27. Exterior design: other | 63. Storage facilities in general |
| 28. Exterior design: other | 64. Textile upholstery |
| 29. Exterior design: other | 65. Tinted rear windows |
| 30. Exterior lighting: other | 66. Tyre pressure control (RDC) |
| 31. Extra power outlet | 67. USB in |
| 32. Fog lamps | 68. Uni-Lackierung |
| 33. Full Cabin Spoiler | 69. Warranty: 4 years or more |
| 34. Head airbags front, Head airbags rear | 70. Warranty: 4 years or more |
| 35. Heated seat driver, Heated seat passenger, Steering wheel heated | 71. {LKAS - system utrzymania toru jazdy} |
| 36. Hill holder | |

Base value of the vehicle

Base value of the vehicle by Eurotax (net)

CorrectionsFirst registrationMileage

Tyres

Other

State of the vehicle -
Earlier repairs -

Above figure was estimated on the basis of price quotations of used cars on the Polish market taking into account the technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - due to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 15-12-2025

DEKRA's expert:
Kacper Sosnowski (NEW)
Bartłomiej Chodakowski (NEW)

Document issued electronically valid without signature.

Measurement of thickness of the vehicle lacquer coating



No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [µm]
1	Front cover	to 150
2	Front left fender	to 150
3	Left front pillar	150 - 300
4	Front left door	to 150
5	Roof	to 150
6	Left middle pillar	to 150
7	Right side sill	150 - 300
8	Left rear door	150 - 200
9	Rear left fender	150 - 500
10	Cover/lid	to 150
11	Right rear fender	150 - 500
12	Right rear door	to 150
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	150 - 500
16	Right front pillar	150 - 200
17	Front right fender	150 - 200

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book of the vehicle was not provided.

Information concerning the origin of the vehicle

Lack of reliable data.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below:
Warunki parkingowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the

page 5/40

assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

2

Expert comments - regarding valuation

Brak aktualnych badań technicznych. Rysy na samochodzie. Odpryski na szybie czołowej. Nieprawny prawy reflektor. Konieczny przegląd od 4712km. Informacja sprawdź reflektory. Widoczne wady lakiernicze.

Restrictive disclaimer - regarding valuation

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.

Bok prawy z tyłu



Photo 6.

Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.

Próg lewy (widok od przodu)

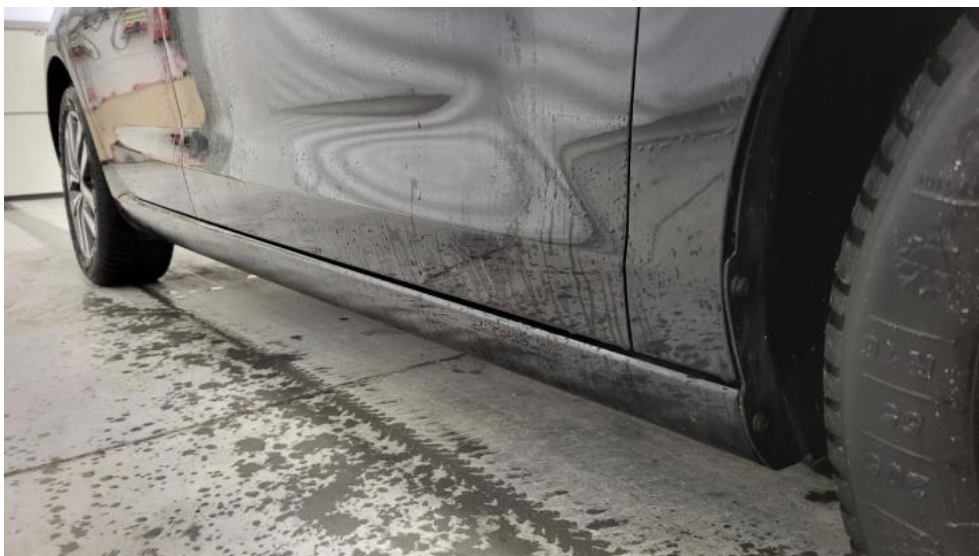


Photo 12.

Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa

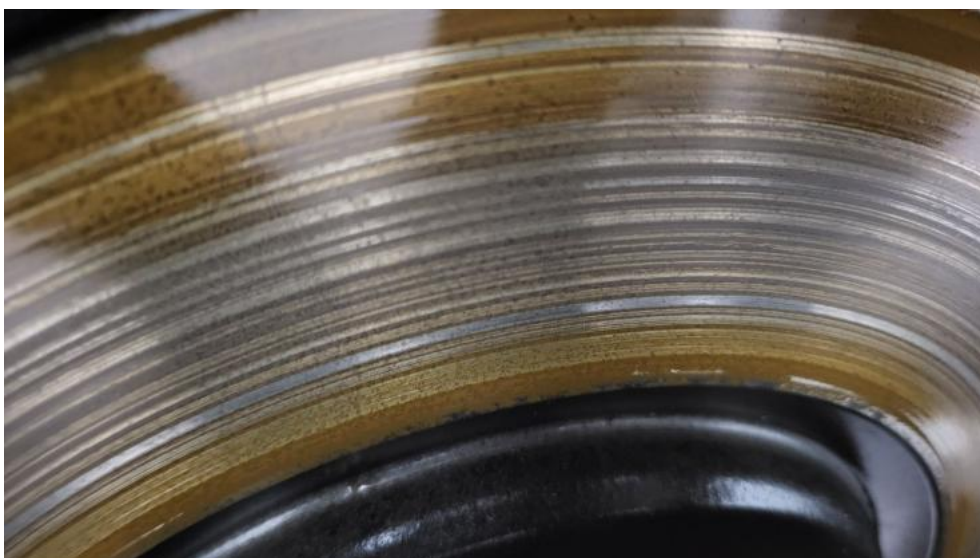


Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika



Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION



Photo 23.

Tabliczka znamionowa



Photo 24.

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe



Photo 28.

Widok z tylnej kanapy na deskę rozd.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.

Konsola środkowa



Photo 30.

Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION



Photo 31.

Kierownica (na wprost)



Photo 32.

Dowód rej. Str. 1

PHOTOGRAPHIC DOCUMENTATION



Photo 33.

Dow. Rej. Str.2 i klucze



Photo 34.

Instrukcje

PHOTOGRAPHIC DOCUMENTATION



Photo 35.

Zdjęcie do protokołu



Photo 36.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 37.

Pokrywa komory silnika - Rysa/odprysk 1



Photo 38.

Pokrywa komory silnika - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Spoiler zderzaka przedniego - Rysa/odprysk 1



Photo 40.

Spoiler zderzaka przedniego - Inne 1

PHOTOGRAPHIC DOCUMENTATION

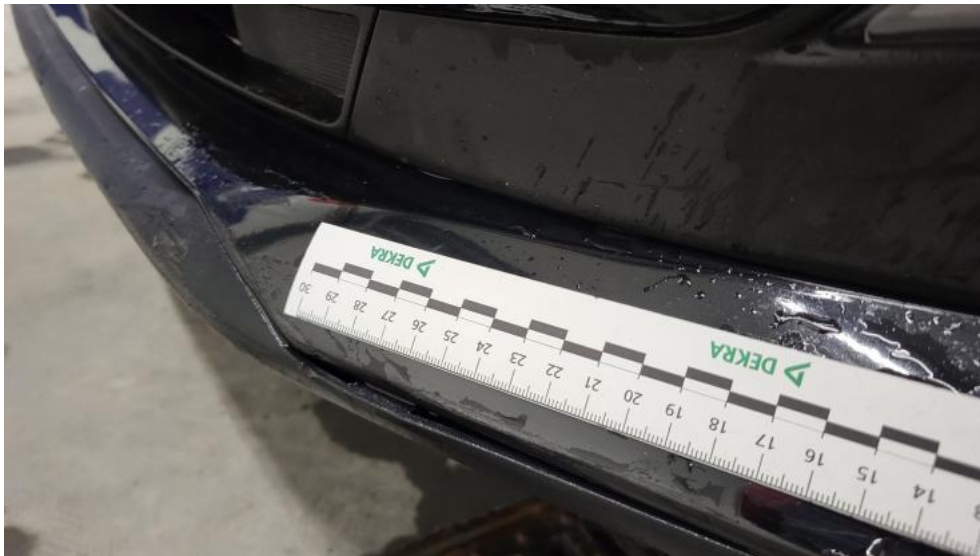


Photo 41.

Zderzak - Rysa/odprysk 1

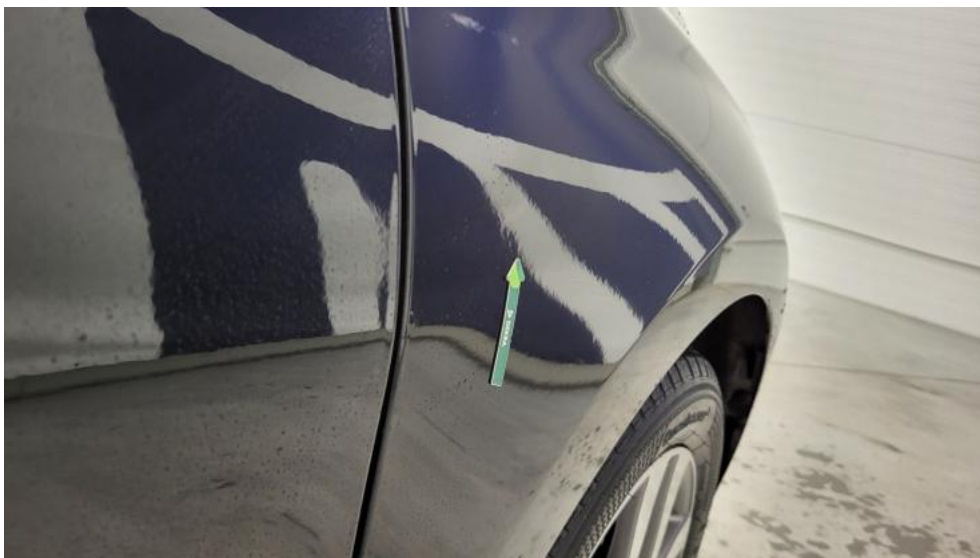


Photo 42.

Łotnik przedni P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Felga aluminiowa przednia P - Rysa/odprysk 1



Photo 44.

Drzwi przednie P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Drzwi tylne P - Wgniecenie/odkształcenie 1

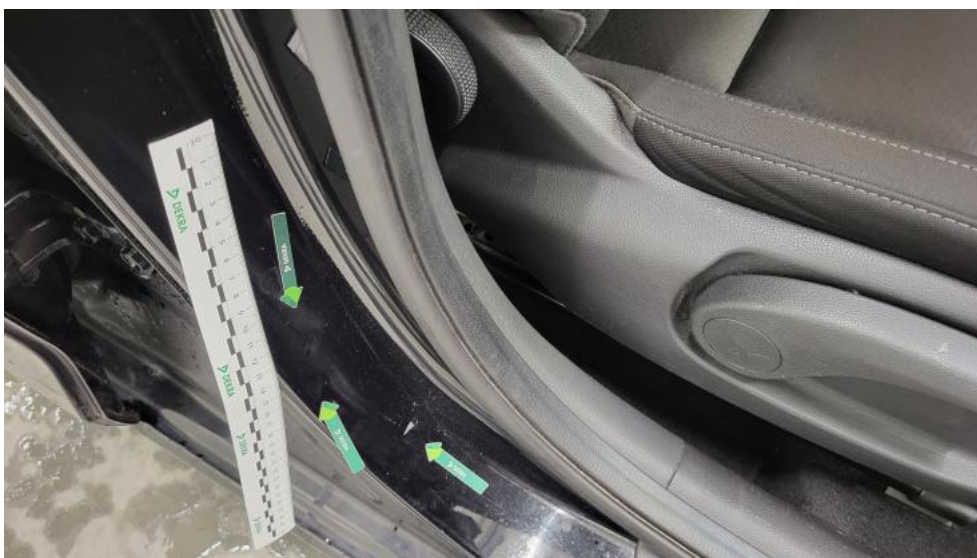


Photo 46.

Słupek środkowy P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION

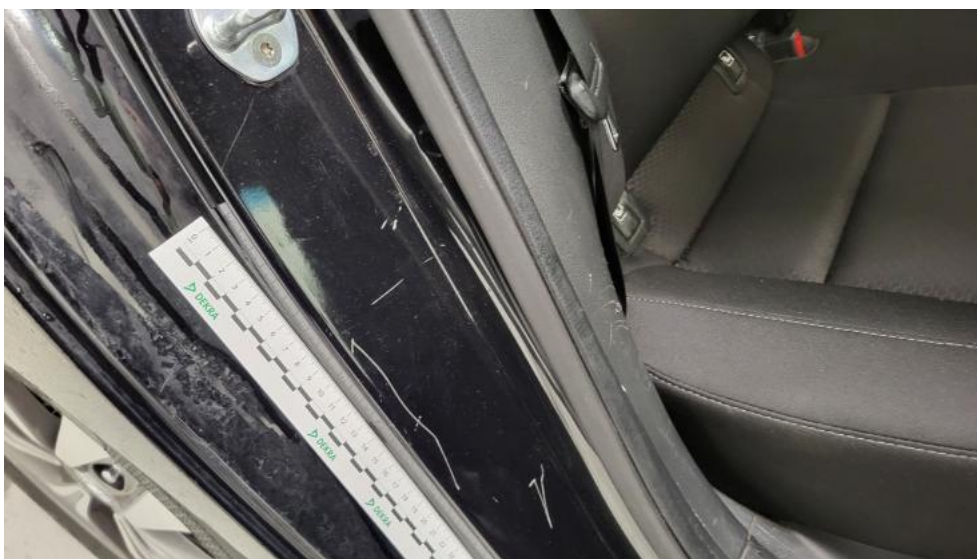


Photo 47.

Błotnik tylny P / Ściana boczna P - Rysa/odprysk 1



Photo 48.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Felga aluminiowa tylna P - Rysa/odprysk 1

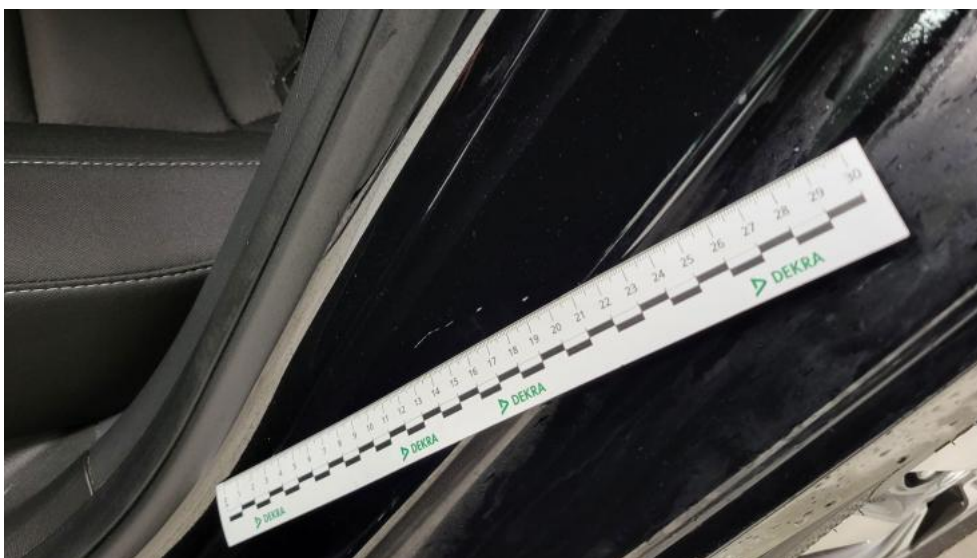


Photo 50.

Ścianka tylna L / Ścianka boczna L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1



Photo 52.

Felga aluminiowa tylna L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Drzwi przed L - Rysa/odprysk 1

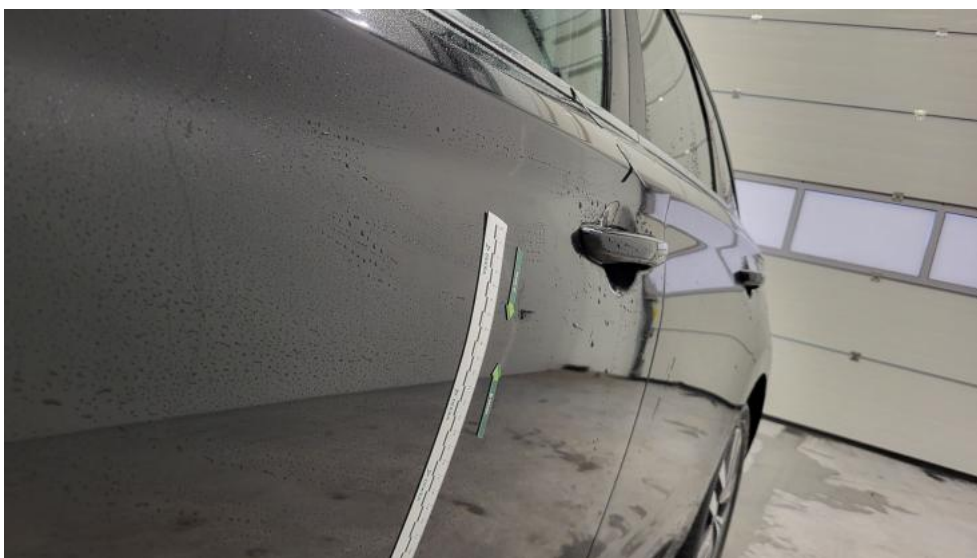


Photo 54.

Drzwi przed L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Drzwi tylne L - Rysa/odprysk 1



Photo 56.

Drzwi tylne L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Próg L - Wgniecenie/odkształcenie 1

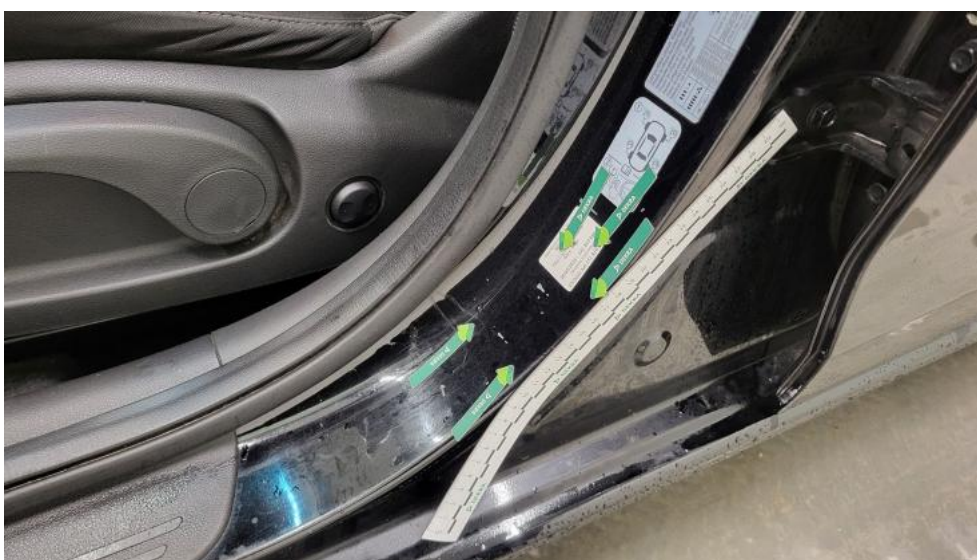


Photo 58.

Słupek środkowy L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Błotnik przedni L - Rysa/odprysk 1



Photo 60.

Reflektor L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Tapicerka drzwi przednich P - Wgniecenie/odkształcenie 1



Photo 62.

Tapicerka drzwi tylnych L - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Tapicerka drzwi tylnych P - Pęknięcie/rozerwanie 1



Photo 64.

Osłona p/słoneczna lewa - Inne 1

PHOTOGRAPHIC DOCUMENTATION

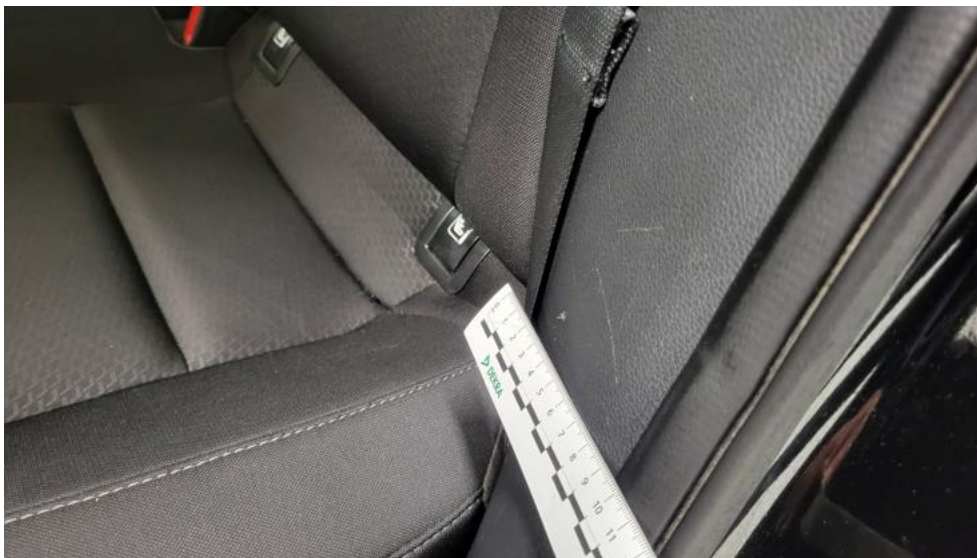


Photo 65.

Wykładzina(y) słupka tylnego L - Rysa/odprysk 1



Photo 66.

Wykładzina(y) słupka tylnego P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 67.

Wykładzina pokrywy tylnej - Rysa/odprysk 1