

DEKRA's commission No. : PKOL(W)/LODZ/80666/24/10/17  
commission/ damage No. : 23/019977  
Date of commission: 17-10-2024

**DEKRA Poland - Headquarters**  
02-673 Warszawa, ul. Konstruktorska 12A

**Client :**

PKO Leasing SA  
Świętokrzyska 36  
00-116 Warszawa

**Expert:**

**Kacper Sosnowski (NEW)**  
DEKRA Polska - współpraca O/Warszawa  
**mgr inż. Andrzej Szymkowiak**  
DEKRA Polska - O. Wrocław

**NOTE:**

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

**Vehicle data**

Group of objects (Eurotax)	jeeps
EC code (Eurotax)	0156357
Manufacturer	LEXUS
Model	RX 22-
Type / version	RX 500h F Sport
Body type	KOM
Number of doors / seats	5/5
Curb weight [kg]	2140
Gross vehicle weight [kg]	2750
Wheelbase 1/2	2850
Engine type	spark ignition
Pollution reduction system	GPF
Emission standard	EURO 6
Engine capacity [ccm]	2393
Engine Power [hp/kW]	272/200
Gearbox	automatic 6- gear
Registration /record No.	SK383XY
VIN / serial number	JTJCM BHA902001322
Date of first registration	13-07-2023
Date of next. tech. test	13-07-2026
Year of manufacture	2023 (year has been verified with the manufacturer's base)
Readout [km]	53 693 (read)
Body color / type of coating	black/METALIK

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	Michelin, PILOT SPORT 4 SUV	235/50 R21 101W	4,0 mm
	left	Michelin, PILOT SPORT 4 SUV	235/50 R21 101W	5,0 mm
back	right	Michelin, PILOT SPORT 4 SUV	235/50 R21 101W	5,0 mm

left      Michelin, PILOT SPORT 4      235/50 R21 101W      4,0 mm  
SUV

Standard equipment by Eurotax

- |   |  |
|---|--|
| 1. 360 view camera  | 48. Light Allow wheels over 21''   |
| 2. Active body control, Electronic controlled suspension                                    | 49. Lumbar adjust driver, Lumbar adjust passenger  |
| 3. Active speed sign recognition, Adaptive Cruise Control, Distance control                 | 50. Lusterko zewn. elektrochromatyczne (kierowca) automatycznie składane, podgrzewane i ułatwiające cof. |
| 4. Adaptive light   | 51. Metal finish   |
| 5. Android Auto, Apple CarPlay  | 52. Metallic paint   |
| 6. Antilock-Brake-System (ABS)  | 53. Mirror: others   |
| 7. Armrest (s) front  | 54. Nawigacja chmurowa (z usługami Connected przez 4 lata)   |
| 8. Armrest (s) rear, Other  | 55. Obsługa Bluetooth  |
| 9. Asystent głosowy inteligentny Lexus Concierge z usługami Connected - na 4 lata           | 56. Other  |
| 10. Blind spot warning, Other   | 57. Other  |
| 11. Cabin air filter  | 58. Other  |
| 12. Central locking   | 59. Other  |
| 13. Child seat(s)   | 60. Park Distance Control front, Park Distance Control rear, Rear Cross Traffic Alert                    |
| 14. Collision Warning System, Pre-Crash System  | 61. Power assisted brakes  |
| 15. Cornering Headlights  | 62. Power windows front, Power windows rear  |
| 16. DAB radio, Navigation system, On board monitor, Radio, Soundsystem, Touchscreen monitor | 63. Projektor kolorowy 10" wyświetlający dane na przedniej szybie samochodu (HUD)                        |
| 17. Door mirror with memory, Memory seat  | 64. Rain sensor, Windscreenwiper: other  |
| 18. Door mirrors electrically foldable, Door mirrors heated                                 | 65. Rear bench foldable in two separate parts  |
| 19. Driver airbag, Passenger airbag   | 66. Rear transversal curtain airbag, Side airbag driver and passenger, Side airbags rear                 |
| 20. Driver conditioning monitoring  | 67. Rear-view mirror autodimming   |
| 21. Driver knee airbag, Passenger knee airbag   | 68. Roof railing   |
| 22. Driver seat electrically adjustable, Passenger seat electrically adjustable             | 69. Selectable driveline characteristics   |
| 23. Dywaniki tekstylne  | 70. Servotronic  |
| 24. ESP (Electronical Stabilizing Program)  | 71. Side airbag driver and passenger   |
| 25. Electric parking brake  | 72. Side indicators  |
| 26. Electric tailgate   | 73. Side indicators  |
| 27. Exit Assist   | 74. Steering wheel electrically adjustable   |
| 28. Exterior lighting: other  | 75. Steering wheel heated  |
| 29. Exterior lighting: other  | 76. Steering wheel with gear-switches  |
| 30. Exterior lighting: other, Keyless entry, Keyless go                                     | 77. Steering: other  |
| 31. Exterior lighting: other, Other   | 78. System ostrzegania o niskim ciśnieniu w oponach (TPMS)   |
| 32. Gwarancja na napęd hybrydowy i baterię, 5 lat lub limit 100.000 km                      | 79. System rozdzielający siłę hamowania (EBD)  |
| 33. Gwarancja na pojazd, 3 lata lub limit 100.000 km  | 80. System wspomagania wjazdu pod górę HAC   |
| 34. Headlamp wash   | 81. Tinted rear windows  |
| 35. Heated seat driver, Heated seat passenger   | 82. Traction control   |
| 36. Interior lights: other accessories  | 83. Traffic sign recognition   |
| 37. Interior: other   | 84. Trizone automatic climate control  |
| 38. Interior: other   | 85. Tuner DAB  |
| 39. Intersection Assist   | 86. USB in   |
| 40. Keyless Engine start  | 87. Uciąż 2.000 kg   |
| 41. Keyless entry   | 88. Usługi łączności Connected pozwalające na sterowanie otwieraniem, zamykaniem auta                    |
| 42. LED Daytime running lights, LED front dim light   | 89. Vehicle immobilizer  |

- |  |   |
|--|---|
| 43. LED rear lights  | 90. Ventilated front seat   |
| 44. Lampy przeciwmgielne LED, przód  | 91. Ventilated rear seat  |
| 45. Leather gearshifter/switch   | 92. Wireless device charging                                      |
| 46. Leather steering wheel, Multi functional steering wheel, Steering wheel with radio operation | 93. {Asystent utrzymywania pasa ruchu (LKA) z korektą toru jazdy} |
| 47. Leather upholstery   |   |

Dealer's equipment (selected items)

1. Roof: other, Top: other ..... -

**Base value of the vehicle**

Base value of the vehicle by Eurotax (net) ..... -

**Corrections**

First registration

Mileage

Equipment

Tyres

Other

State of the vehicle ..... -  
 Current market situation ..... -  
 Stwierdzone braki, uszkodzenia (szacunkowo) ..... -

Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 10-2024 POL) with regard to technical and market parameters affecting the value of the vehicle.


Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 25-10-2024

DEKRA's expert:  
 Kacper Sosnowski (NEW)  
 mgr inż. Andrzej Szymkowiak

**Document issued electronically valid without signature.**

Measurement of thickness of the vehicle lacquer coating

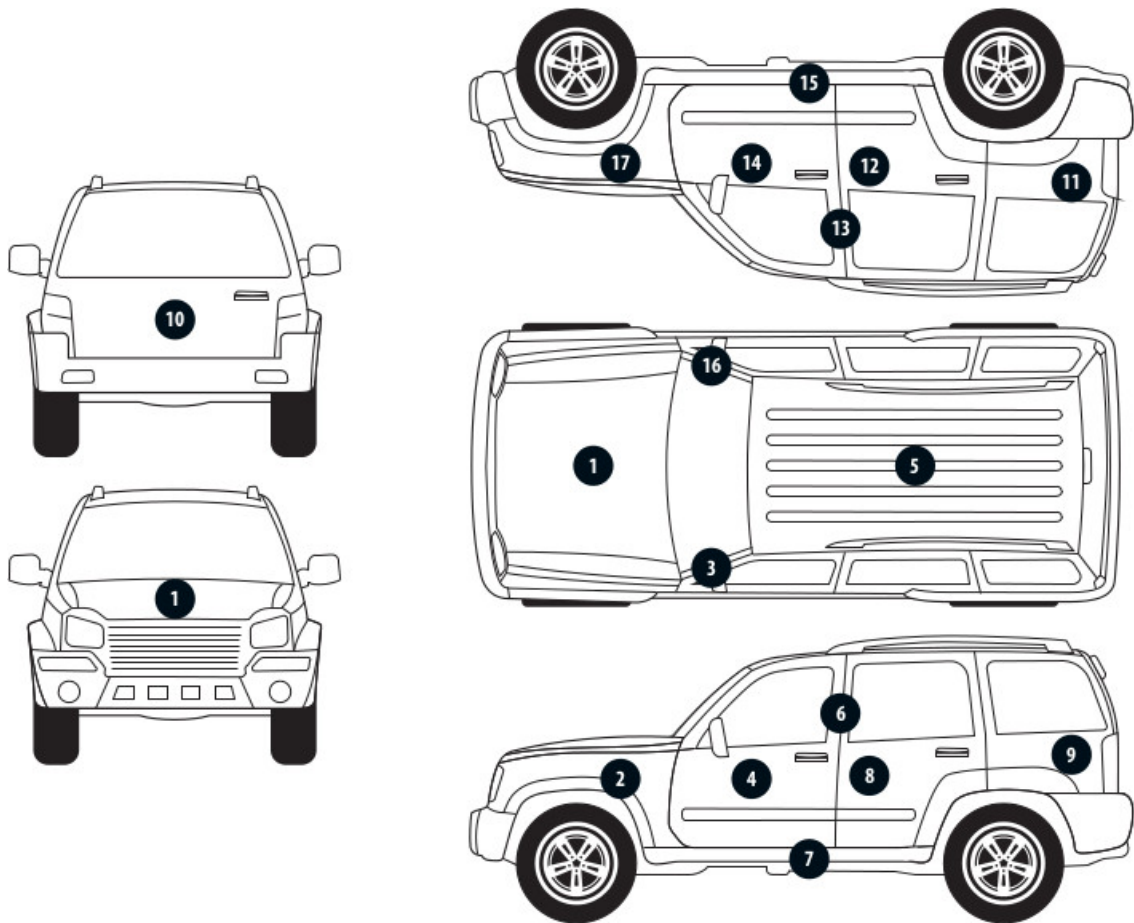

No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [ $\mu\text{m}$ ]
1	Front cover	to 150
2	Left front fender	to 150
3	Left front pillar	to 150
4	Left front wall	to 150
5	Roof	to 150
6	Left middle pillar	to 150
7	Left side sill	to 150
8	Left rear wall	to 150
9	Left side wall	to 150
10	Cover/tailgate	to 150
11	Side right wall	to 150
12	Rear right door	to 150
13	Middle right pillar	to 150
14	Front right door	to 150
15	Right side sill	to 150
16	Right front pillar	to 150
17	Right front fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book of the vehicle was not provided.

**Information concerning the origin of the vehicle**

The vehicle purchased domestically from an authorized representative of the brand.

**Additional comments on the car:**

Not applicable.

**Test drive**

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below: pojazd udostępiono w warunkach parkingowych

**Checking of the correctness and / or construction of identification / serial numbers of the object:**

Not tested

**Verification of the accuracy of the object data, including year of production, and other.**

Not conducted - adopted according to the documents presented and indicated sources.

**Anti-theft protection**

fabryczne

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.
- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation**Kluczyki**

TAK

2

Expert comments - regarding valuation

Rysy na samochodzie. Brak grota w jednym z kluczyków.

Restrictive disclaimer - regarding valuation

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.



PHOTOGRAPHIC DOCUMENTATION



**Photo 1.**  
Przekątna przednia lewa



**Photo 2.**  
Przód



PHOTOGRAPHIC DOCUMENTATION



**Photo 3.**  
Przekątna przednia prawa



**Photo 4.**  
Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



**Photo 5.**  
Bok prawy z tyłu



**Photo 6.**  
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



**Photo 7.**  
Tyl



**Photo 8.**  
Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



**Photo 9.**  
Bok lewy z tyłu



**Photo 10.**  
Bok lewy z przodu



PHOTOGRAPHIC DOCUMENTATION



**Photo 11.**  
Próg lewy (widok od przodu)



**Photo 12.**  
Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



**Photo 13.**  
Spód pojazdu przód



**Photo 14.**  
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



**Photo 15.**

Tarcza hamulcowa przednia prawa



**Photo 16.**

Tarcza hamulcowa tylna prawa



PHOTOGRAPHIC DOCUMENTATION



**Photo 17.**

Tarcza hamulcowa tylna lewa



**Photo 18.**

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



**Photo 19.**  
Bagażnik



**Photo 20.**  
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



**Photo 21.**  
Komora silnika



**Photo 22.**  
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION



**Photo 23.**  
Tabliczka znamionowa



**Photo 24.**  
Zestaw wskaźników - przebieg



PHOTOGRAPHIC DOCUMENTATION



**Photo 25.**

Widok przez otwarte drzwi przednie lewe



**Photo 26.**

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



**Photo 27.**

Widok przez otwarte drzwi tylne lewe




**Photo 28.**

Widok z tylnej kanapy na deskę rozdź.

PHOTOGRAPHIC DOCUMENTATION



**Photo 29.**  
Konsola środkowa

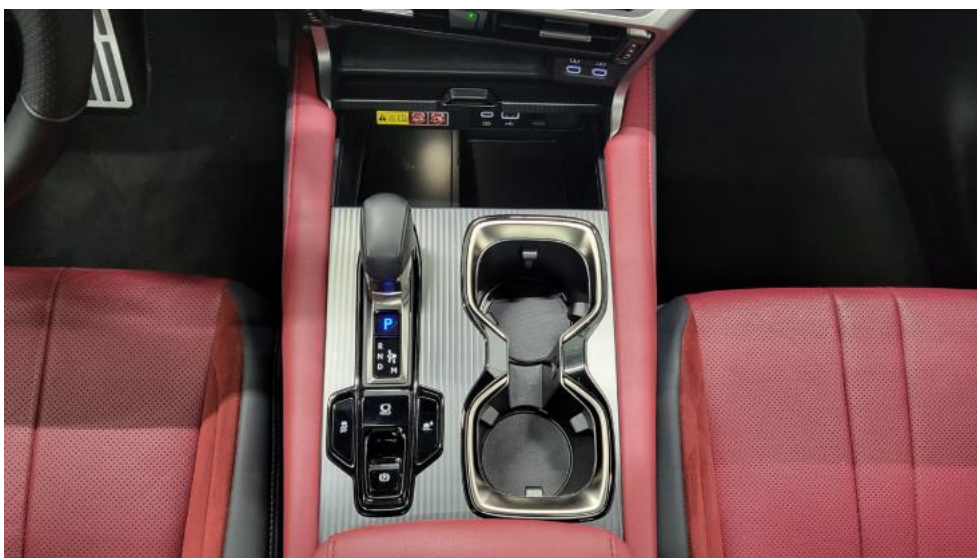

**Photo 30.**  
Tunel środkowy





PHOTOGRAPHIC DOCUMENTATION



**Photo 33.**  
Dow. Rej. Str.2 i klucze



**Photo 34.**  
Zestaw naprawy koła

PHOTOGRAPHIC DOCUMENTATION



**Photo 35.**  
Zdjęcie do protokołu



**Photo 36.**  
Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



**Photo 37.**  
Zdjęcie do protokołu



**Photo 38.**  
Zdjęcie do protokołu



PHOTOGRAPHIC DOCUMENTATION



**Photo 39.**  
Zdjęcie do protokołu



**Photo 40.**  
Pokrywa komory silnika - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



**Photo 41.**  
Szyba czołowa - zdjęcie poglądowe 1



**Photo 42.**  
Szyba czołowa - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



**Photo 43.**  
Szyba czołowa - Rysa/odprysk 2



**Photo 44.**  
Zderzak - Rysa/odprysk 1



PHOTOGRAPHIC DOCUMENTATION



**Photo 45.**  
Drzwi przednie P - Rysa/odprysk 1



**Photo 46.**  
Drzwi przednie P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



**Photo 47.**  
Drzwi przednie P - Wgniecenie/odkształcenie 2



**Photo 48.**  
Drzwi przednie P() - Wgniecenie/odkształcenie 3

PHOTOGRAPHIC DOCUMENTATION



**Photo 49.**  
Drzwi tylne P - Wgniecenie/odkształcenie 1



**Photo 50.**  
Drzwi tylne P - Wgniecenie/odkształcenie 2

PHOTOGRAPHIC DOCUMENTATION



**Photo 51.**  
Drzwi tylne P() - Wgniecenie/odkształcenie 3



**Photo 52.**  
Zderzak tylny - Rysa/odprysk 1



PHOTOGRAPHIC DOCUMENTATION



**Photo 53.**  
Zderzak tylny - Rysa/odprysk 2



**Photo 54.**  
Kanapa tyl. - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



**Photo 55.**  
Kanapa tyl. - Inne 1



**Photo 56.**  
Kanapa tyl. - Inne 2

PHOTOGRAPHIC DOCUMENTATION



**Photo 57.**

Tapicerka drzwi tylnych P - Pęknięcie/rozerwanie 1