

DEKRA's commission No. : PKOL(W)/LODZ/87484/26/09/17
commission/ damage No. : 23/007880
Date of commission: 17-09-2026

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (WSP)
DEKRA Polska - współpraca O/Warszawa
mgr inż. Romuald Bocian (WSP)
DEKRA Polska - współpraca O/Puławy

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0139183
Manufacturer	BMW
Model	Seria 8 Gran Coupe [G16] 19-22
Type / version	M850i xDrive
Body type	sedan
Number of doors / seats	4/5
Curb weight [kg]	1995
Gross vehicle weight [kg]	2600
Wheelbase 1/2	3023
Engine type	spark ignition
Pollution reduction system	GPF
Engine capacity [ccm]	4395
Engine Power [hp/kW]	530/390
Gearbox	automatic 8- gear
Registration /record No.	Z7BTC
VIN / serial number	WBAGV81050CD48257
Date of first registration	28-01-2020
Date of next. tech. test	11-02-2027
Year of manufacture	2019 (year has been verified with the manufacturer's base)
Readout [km]	124 839 (read)
Body color / type of coating	black/METALIK

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	MICHELIN, PILOT SPORT 4S	255/30 21 93Y	2,0 mm
	left	MICHELIN, PILOT SPORT 4S	255/30 21 93Y	2,0 mm
back	right	MICHELIN, PILOT SPORT 4S	295/25 21 96Y	3,0 mm
	left	MICHELIN, PILOT SPORT 4S	295/25 21 96Y	3,0 mm

Standard equipment by Eurotax

- | | |
|--|---|
| 1. Active speed sign recognition | 35. Intersection Assist, Rear Cross Traffic Alert |
| 2. Additional gauges, Bluetooth interface, Head-Up Display, Navigation system, Other | 36. Keyless Engine start, Keyless go |
| 3. Aerodynamics package, Exterior design: other | 37. Keyless entry, Keyless go |
| 4. Alarm | 38. Lane control assistant |
| 5. Antilock-Brake-System (ABS) | 39. Leather finish dashbord |
| 6. Armrest (s) front | 40. Leather steering wheel, Multi functional steering wheel, Sports steering wheel |
| 7. Automated High-beam assist | 41. Leather upholstery |
| 8. Automatic dimlight activation, Rain sensor | 42. Lumbar adjust passenger, Passenger seat height adjustable, Passenger seat with adjustable inclination, Seats: other |
| 9. Blind spot warning | 43. Mobile phone, Wireless device charging |
| 10. Bord communication: other | 44. Other |
| 11. Brake Assist, Collision Warning System, Pedestrian Emergency Brake Assist | 45. Other |
| 12. Chassis: other | 46. Other |
| 13. Child seat fixation | 47. Other |
| 14. Collision Warning System | 48. Other |
| 15. Cruise control | 49. Other |
| 16. Door mirror(s) electrically adjustable in general, Door mirrors heated | 50. Park Assistant |
| 17. Driver airbag, Passenger airbag, Side airbag driver and passenger | 51. Park Distance Control front, Park Distance Control rear |
| 18. Dualzone automatic climate control | 52. Pre-Crash System |
| 19. ESP (Electronical Stabilizing Program), Traction control | 53. Rear view camera |
| 20. Electric tailgate | 54. Remote controlled central locking |
| 21. Exterior design: other | 55. Selectable central differential characteristics |
| 22. Exterior design: other | 56. Selectable driveline characteristics |
| 23. Exterior design: other | 57. Servotronic |
| 24. Exterior design: other | 58. Servotronic, Steering: other |
| 25. Extra power outlet | 59. Soundsystem |
| 26. Floor mat | 60. Sport suspension |
| 27. Follow me home | 61. Sports steering wheel |
| 28. Follow me home | 62. Start/Stop system |
| 29. Free service 4 years or more, more than 60000 km | 63. Steering wheel electrically adjustable |
| 30. Gesture control for multimedia, Gesture control for vehicle functions | 64. Telematic |
| 31. Headlamp wash, LED front dim light | 65. Telematic |
| 32. Heated seat driver, Heated seat passenger | 66. Wheel bolt locks |
| 33. Interior lights: other accessories | 67. Windscreen wash-nozzle heated |
| 34. Interior: other | 68. Windstop |

Dealer's equipment (selected items)

- | | |
|---|---|
| 1. 360 view camera, Park Assistant, Park Distance Control front, Park Distance Control rear, Rear view camera | - |
| 2. Active Emergency Brake Assist, Adaptive Cruise Control, Lane control assistant, Pre-Crash System | - |
| Tempomat aktywny z funkcją Stop&Go | |
| Asystent unikania kolizji | |
| Ostrzeganie przed ruchem poprzecznym z przodu | |
| Aktywna ochrona przed kolizją boczną | |
| 3. Adaptive light | - |
| 4. Door: other | - |
| 5. Exterior design: other | - |

6. Interior decoration: other	-
7. Interior: other	-
8. Interior: other, Leather upholstery	-
9. Metallic paint	-
10. Other, Tinted rear windows	-
11. Sport seats front	-
12. Sport suspension	-
13. Ventilated front seat	-

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

Corrections

First registration

Mileage

Equipment

Tyres

Other

Earlier repairs	-
Stan dbałości o pojazd, uszkodzenia	-
Weryfikacja warsztatowa usterek	-


Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 09-2026 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - due to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 24-09-2026

DEKRA's expert:
Kacper Sosnowski (WSP)
mgr inż. Romuald Bocian (WSP)

Document issued electronically valid without signature.

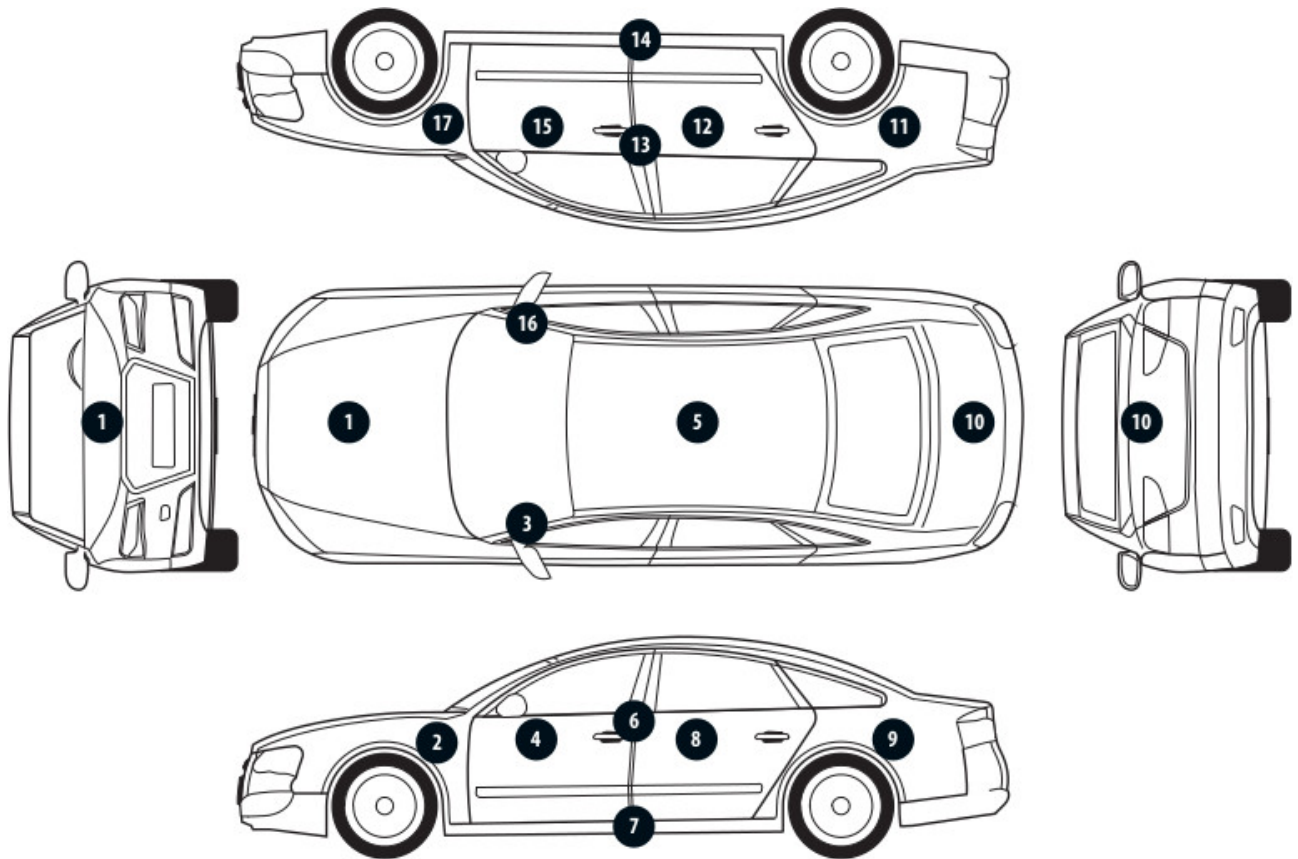Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	150 - 1000
2	Front left fender	150 - 300
3	Left front pillar	150 - 300
4	Front left door	150 - 300
5	Roof	150 - 300
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	150 - 300
9	Rear left fender	150 - 300
11	Right rear fender	150 - 300
12	Right rear door	150 - 300
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	150 - 300
16	Right front pillar	150 - 300
17	Front right fender	150 - 300

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book was presented and its number is given below:
elektroniczna

Information concerning the origin of the vehicle

The vehicle purchased domestically from an authorized representative of the brand.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

alarm

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below:

.

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted (with the exception of the year of production) - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.

- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

2

Expert comments - regarding valuation

Dodatkowe elementy w bagażniku, brak możliwości weryfikacji z jakiego pojazdu. Nierówna praca silnika, do weryfikacji serwisowej. Aktywna kontrolka silnika. Nieprawidłowa praca układu wydechowego, do weryfikacji serwisowej. Nadmierne dymienie układu wydechowego, do weryfikacji serwisowej. Pojazd oklejony folią, pomiar lakieru wykonany na folii oprócz elementów: próg lewy/prawy, słupki środkowy lewy/prawy. Reflektory i lampy tylne oklejone folią. Odpryski na szybie czołowej.

Restrictive disclaimer - regarding valuation

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.
Próg lewy (widok od przodu)



Photo 12.
Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Komora silnika

PHOTOGRAPHIC DOCUMENTATION



Photo 21.

Numer identyfikacyjny



Photo 22.

Tabliczka znamionowa

PHOTOGRAPHIC DOCUMENTATION



Photo 23.

Zestaw wskaźników - przebieg



Photo 24.

Zestaw wskaźników - serwis

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe



Photo 28.

Widok z tylnej kanapy na deskę rozdz.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.
Konsola środkowa



Photo 30.
Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION

Photo 31.
Kierownica (na wprost)



PHOTOGRAPHIC DOCUMENTATION

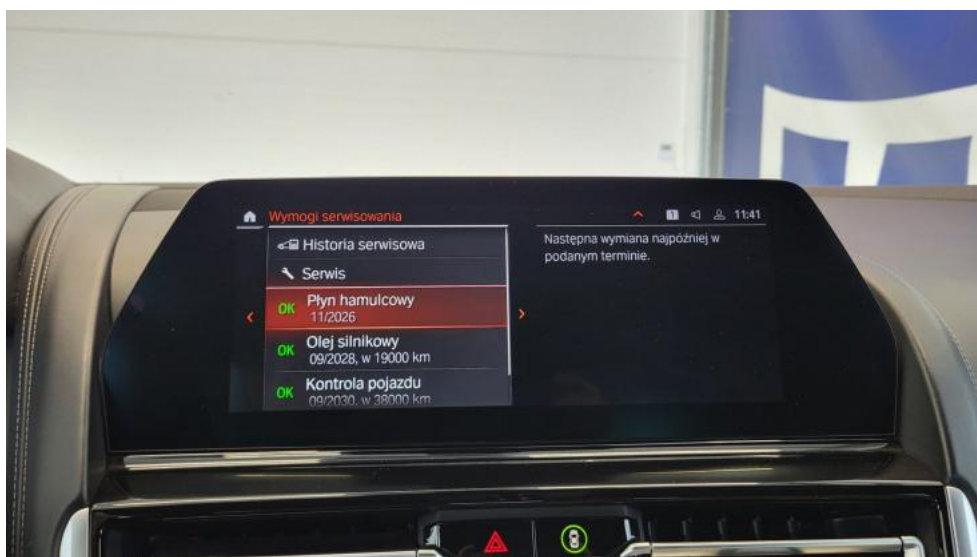


Photo 33.
Książka serwisowa – dane

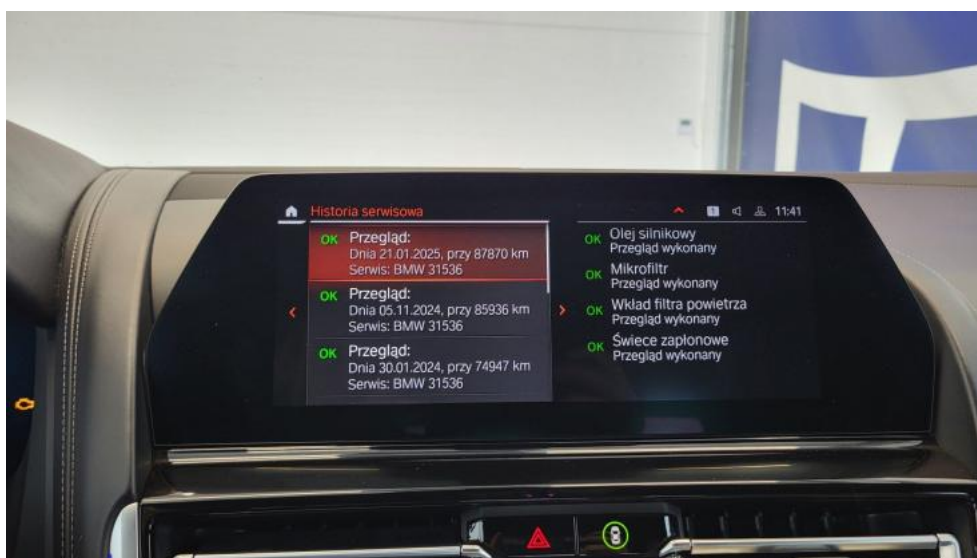


Photo 34.
Książka serwisowa – ostatni przegląd

PHOTOGRAPHIC DOCUMENTATION



Photo 35.
Dow. Rej. Str. 2



Photo 36.
Instrukcje

PHOTOGRAPHIC DOCUMENTATION



Photo 37.
Kluczyki



Photo 38.
Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 39.
Zdjęcie do protokołu



Photo 40.
Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 41.
Zdjęcie do protokołu



Photo 42.
Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Zdjęcie do protokołu



Photo 44.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Zdjęcie do protokołu



Photo 46.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Zdjęcie do protokołu



Photo 48.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Zdjęcie do protokołu



Photo 50.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Zdjęcie do protokołu



Photo 52.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Zdjęcie do protokołu



Photo 54.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Pokrywa komory silnika - Wgniecenie/odkształcenie 1



Photo 56.

Spoiler zderzaka przedniego - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Spoiler zderzaka przedniego - Inne 2



Photo 58.

Wykładzina pokrywy komory silnika - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Felga aluminiowa przednia P - Rysa/odprysk 1



Photo 60.

Opona przednia P - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Błotnik tylny P / Ściana boczna P - zdjęcie pogładowe 1



Photo 62.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Felga aluminiowa tylna P - Rysa/odprysk 1



Photo 64.

Opona tylna P - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Pokrywy bagażnika - Inne 1

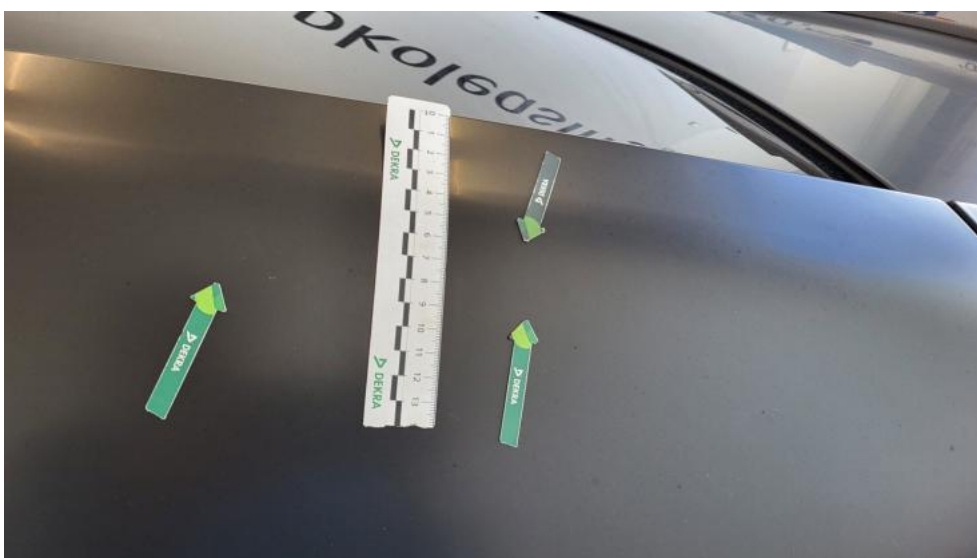


Photo 66.

Łotnik tylny L / Ściana boczna L - zdjęcie pogładowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 67.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1



Photo 68.

Felga aluminiowa tylna L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Opona tylna L - Pęknięcie/rozerwanie 1



Photo 70.

Drzwi tylne L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Listwa drzwi tylnych L - zdjęcie poglądowe 1



Photo 72.

Listwa drzwi tylnych L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 73.

Felga Aluminiowa przednia L - Rysa/odprysk 1



Photo 74.

Opona przednia L - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 75.

Fotel prz. lew. - Rysa/odprysk 1



Photo 76.

Fotel prz. lew. - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 77.

Fotel prz. praw. - Rysa/odprysk 1



Photo 78.

Uchwyt drzwi prze L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 79.

Uszczelka drzwi przednich L - Rysa/odprysk 1



Photo 80.

Listwy progowe lew. - Rysa/odprysk 1