

DEKRA's commission No. : PKOL(W)/LODZ/37030/25/05/22
commission/ damage No. : 23/014456
Date of commission: 22-05-2025

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (NEW)
DEKRA Polska - współpraca O/Warszawa
Paweł Szwabowicz
DEKRA Polska - O. Lubin

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	jeeps
EC code (Eurotax)	0154902
Manufacturer	LAND ROVER
Model	Range Rover 21-
Type / version	Range Rover 3.0 P510e PHEV SV
Body type	KOM
Number of doors / seats	5/5
Curb weight [kg]	3044
Gross vehicle weight [kg]	3450
Wheelbase 1/2	2997
Engine type	spark ignition
Pollution reduction system	GPF
Emission standard	EURO 6
Engine capacity [ccm]	2996
Engine Power [hp/kW]	400/294
Gearbox	automatic 8- gear
Registration /record No.	WU8503P
VIN / serial number	SALKA9B41PA049621
Date of first registration	29-05-2023
Date of next. tech. test	28-05-2026
Year of manufacture	2023 (year has been verified with the manufacturer's base)
Readout [km]	110 847 (read)
Body color / type of coating	gray/2-warstwowy metalik

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	PIRELLI, SCORPION ZERO ALLSEASON	285/45 22 114Y	5,0 mm
	left	PIRELLI, SCORPION ZERO ALLSEASON	285/45 22 114Y	5,0 mm
back	right	PIRELLI, SCORPION ZERO ALLSEASON	285/45 22 114Y	5,5 mm

left PIRELLI, SCORPION ZERO 285/45 22 114Y
ALLSEASON

5,5 mm

Standard equipment by Eurotax

- | | |
|---|---|
| 1. 360 view camera | 34. Interior lights: other accessories |
| 2. 4 or more zone automatic climate control | 35. Interior lights: other accessories |
| 3. Active Emergency Brake Assist | 36. Interior lights: other accessories, Interior: other |
| 4. Adaptive Cruise Control, Distance control | 37. Interior: other |
| 5. Air suspension, Electronic controlled suspension | 38. Interior: other |
| 6. Alarm | 39. LED front dim light |
| 7. Android Auto | 40. Lane control assistant |
| 8. Apple CarPlay | 41. Leather steering wheel |
| 9. Armrest (s) front | 42. Leather upholstery |
| 10. Blind spot warning | 43. Luggage compartment cover |
| 11. Bord climate: other | 44. Mobile Tire System |
| 12. Bord entertainment: other accessories | 45. Other |
| 13. Brak instalacji pod hak holowniczy | 46. Other |
| 14. Brak pakietu Entertainment | 47. Other |
| 15. Brak pakietu dla palących | 48. Pakiet stylistyczny zewnętrzny SV |
| 16. Collision Warning System | 49. Park Assistant |
| 17. Collision Warning System | 50. Park Distance Control front, Park Distance Control rear |
| 18. DAB radio | 51. Pre-Crash System |
| 19. Driver conditioning monitoring | 52. Przełączniki White Ceramic |
| 20. Driver seat electrically adjustable, Electrically adjustable rear seats, Front seat with massage, Heated seat driver, Heated seat passenger, Passenger seat electrically adjustable, Rear seat heating, Ventilated front seat, Ventilated rear seat | 53. Rear-view mirror autodimming |
| 21. Drzwi zamykania elektrycznie | 54. Side indicators |
| 22. Electric tailgate | 55. Soundsystem |
| 23. Exterior design: other | 56. Steering wheel heated |
| 24. Exterior design: other | 57. Sunblind rear side door electric |
| 25. Exterior design: other | 58. Touchscreen monitor |
| 26. Felgi aluminiowe 22 7-ramienne (wzór 7023) | 59. Traffic sign recognition |
| 27. Floor mat | 60. Trizone automatic climate control |
| 28. Floor mat | 61. Tyre pressure control (RDC) |
| 29. Fog lamps | 62. Vehicle charging cable |
| 30. Glass tilt/slide sunroof electric | 63. Windows: other |
| 31. Head-Up Display | 64. Windscreen heating |
| 32. Headlamp wash nozzle heated | 65. Wykończenie wnętrza, wstawki Natural Cream Walnut Burr |
| 33. Heat reflecting windows | 66. Zewnętrzne oznaczenie wersji SV |

Dealer's equipment (selected items)

- | | |
|---|---|
| 1. Cooler box | - |
| 2. Exterior design: other, Roof: other | - |
| 3. Leather/wooden steering wheel | - |
| 4. Metallic paint | - |
| 5. Tapicerka ze skóry SV Interpid Semi-Aniline Perlino, wnętrze Perlino | - |
| 6. Tinted rear windows | - |
| 7. Towbar removable | - |

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

CorrectionsFirst registrationMileageEquipmentOther

Regularity of service review -
State of the vehicle -
Braki i uszkodzenia -


Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 05-2025 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 28-05-2025

DEKRA's expert:
Kacper Sosnowski (NEW)
Paweł Szwabowicz

Document issued electronically valid without signature.

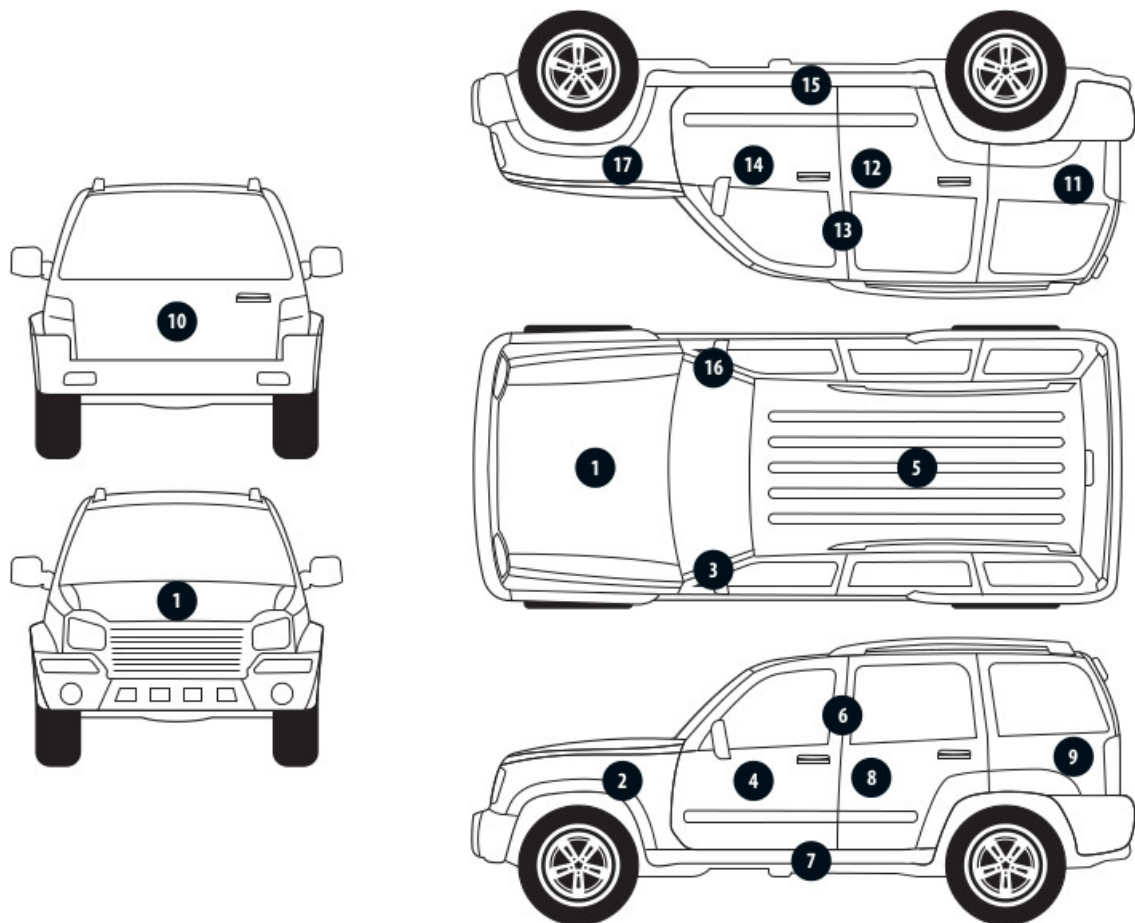Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [µm]
1	Front cover	150 - 500
2	Left front fender	150 - 500
3	Left front pillar	to 150
4	Left front wall	150 - 300
5	Roof	150 - 200
6	Left middle pillar	to 150
7	Left side sill	150 - 300
8	Left rear wall	150 - 300
9	Left side wall	150 - 300
10	Cover/tailgate	150 - 200
11	Side right wall	150 - 300
12	Rear right door	150 - 300
13	Middle right pillar	to 150
14	Front right door	150 - 300
15	Right side sill	150 - 300
16	Right front pillar	to 150
17	Right front fender	150 - 500

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book of the vehicle was not provided.

Information concerning the origin of the vehicle

The vehicle purchased domestically from an authorized representative of the brand.

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below:
Warunki parkingowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

Anti-theft protection

Immobiliser, alarm

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.
- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation**Kluczyki**

TAK

2

Expert comments - regarding valuation

Rysy na samochodzie. Informacja o wymaganym pełnym przeglądzie. Pomiar lakieru wykonany na folii, elementy: pokrywa przednia, próg lewy/prawy, błotnik przedni lewy/prawy. Odpryski na szybie czołowej.

Restrictive disclaimer - regarding valuation

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.

Próg lewy (widok od przodu)



Photo 12.

Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika

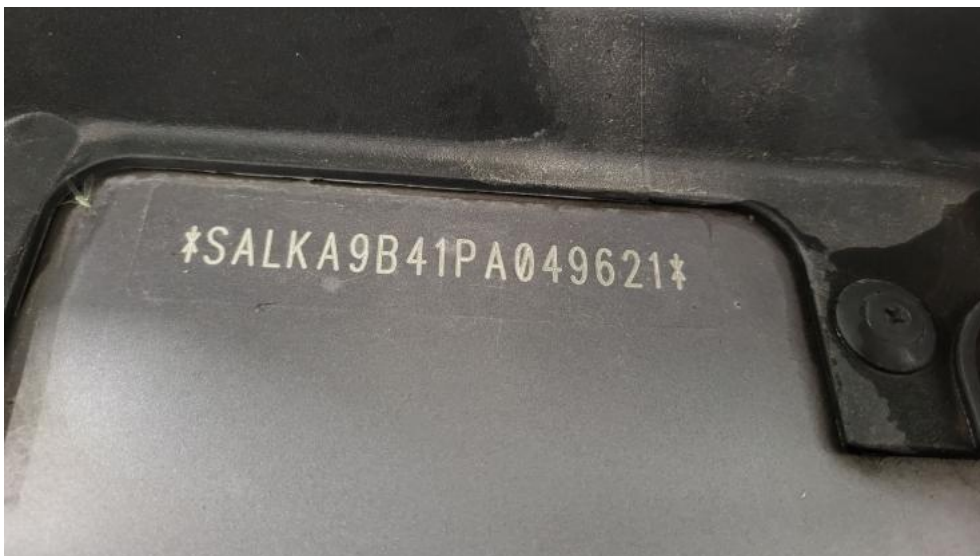


Photo 22.
Numer identyfikacyjny

A close-up photograph of a Jaguar Land Rover VIN plate. The plate is rectangular with a black background and white text. It features the Jaguar and Land Rover logos at the top left. The text on the plate includes the manufacturer name 'JAGUAR LAND ROVER LTD', the VIN 'e9*2018J858*11120', the model 'SALKA9B41PA049621', and the weight '3450 kg'. It also lists the primary colour reference '10F / 10F GREY' and the NRE number 'NRE2-4383-AA'. A QR code is visible in the bottom right corner of the plate.

Tabliczka znamionowa



Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe

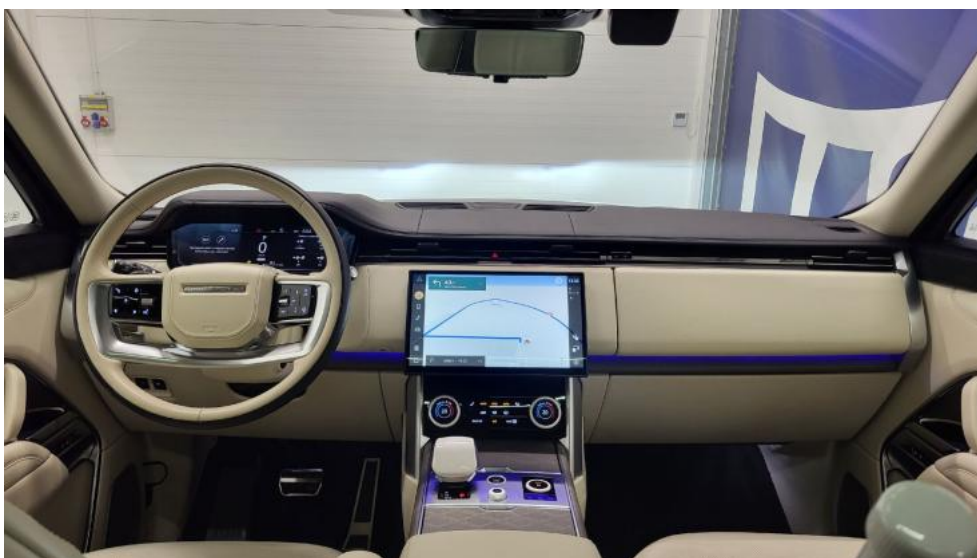


Photo 28.

Widok z tylnej kanapy na deskę rozdziel.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.
Konsola środkowa



Photo 30.
Tunel środkowy

A detailed view of the Volvo XC90's interior from the driver's perspective. The steering wheel is light-colored leather with a silver trim and the Volvo logo. Behind it is a large digital instrument cluster. To the right is a large infotainment screen displaying a navigation map. Below the screen is a circular climate control knob and various buttons. The interior is finished with light-colored leather and wood trim.

[illegible]

DEKRA Polska Sp. z o.o.
02-673 Warszawa, ul. Konstruktorska 12A
www.dekra.pl

PHOTOGRAPHIC DOCUMENTATION



Photo 33.

Dow. Rej. Str.2 i klucze



Photo 34.

Książka serwisowa – dane

PHOTOGRAPHIC DOCUMENTATION

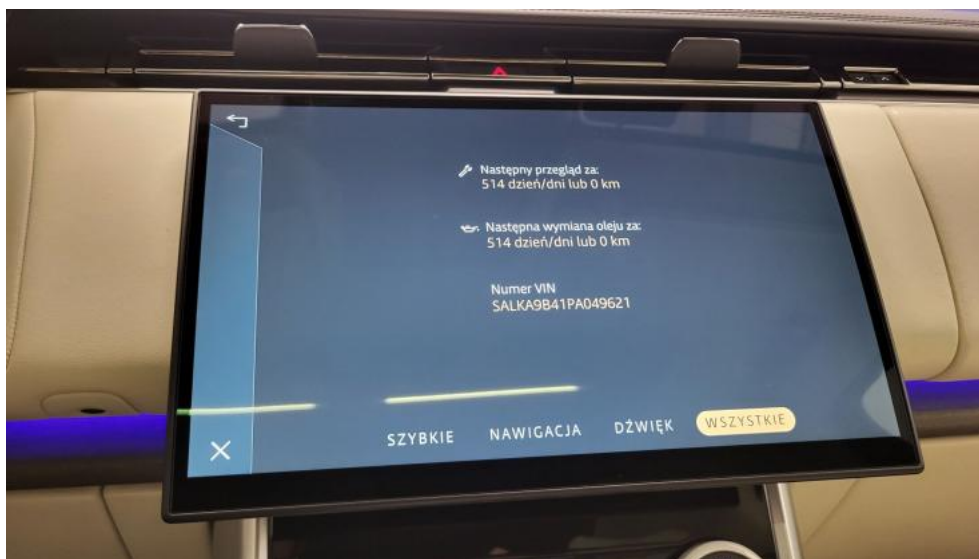


Photo 35.

Książka serwisowa – ostatni przegląd



Photo 36.

Przewód ładowania baterii trakcyjnej

PHOTOGRAPHIC DOCUMENTATION



Photo 37.

Instrukcje



Photo 38.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Zdjęcie do protokołu



Photo 40.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Zdjęcie do protokołu



Photo 42.

Zdjęcie do protokołu

[illegible]

DEKRA Polska Sp. z o.o.
02-673 Warszawa, ul. Konstruktorska 12A
www.dekra.pl

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Zdjęcie do protokołu



Photo 46.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Zdjęcie do protokołu



Photo 48.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Zdjęcie do protokołu



Photo 50.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Zdjęcie do protokołu

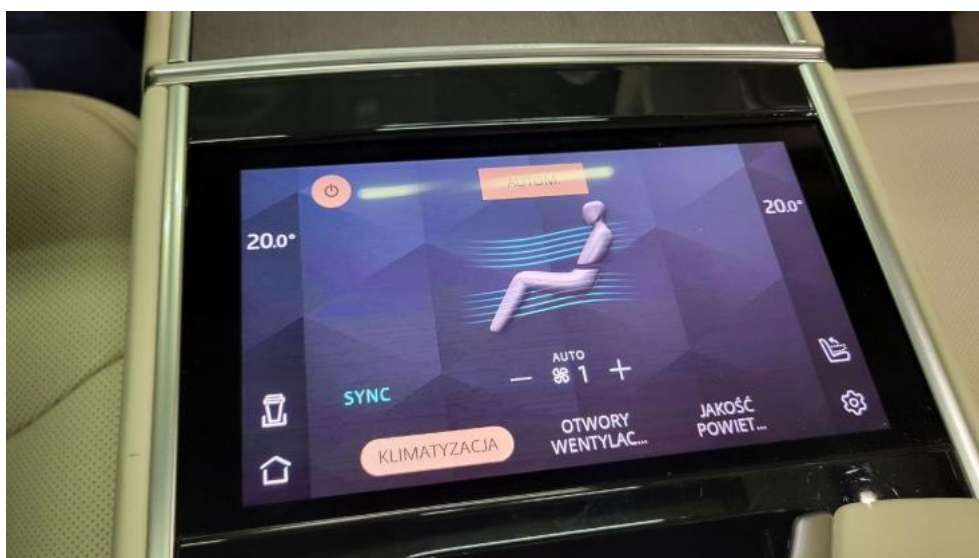


Photo 52.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Zdjęcie do protokołu

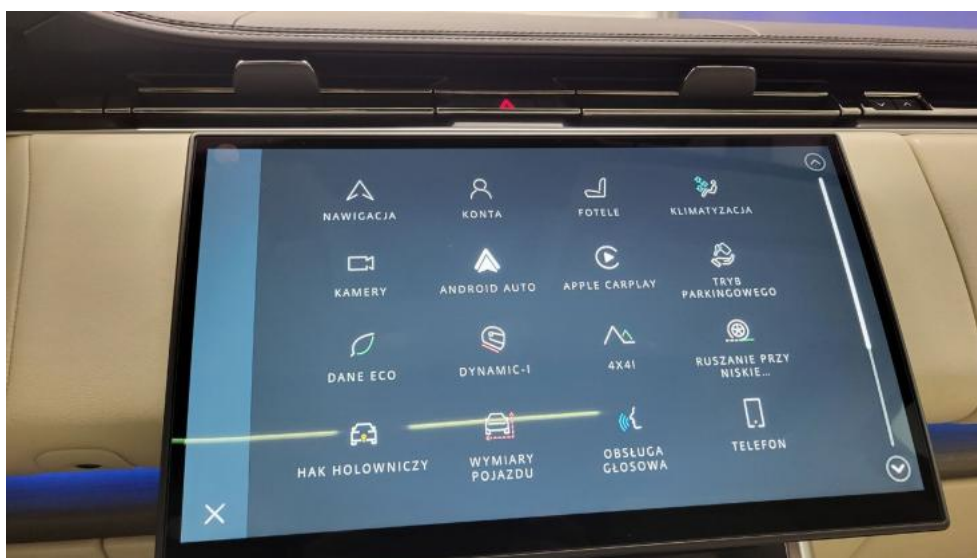


Photo 54.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION

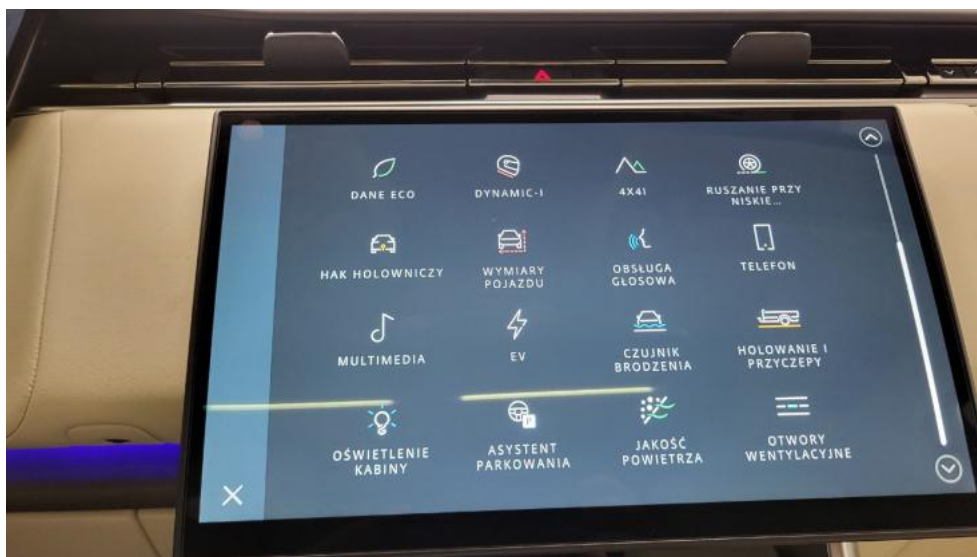


Photo 55.

Zdjęcie do protokołu



Photo 56.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Zdjęcie do protokołu



Photo 58.

Pokrywa komory silnika - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Spoiler zderzaka przedniego - Inne 1



Photo 60.

Zderzak - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.
Zderzak - Inne 1



Photo 62.
Felga aluminiowa przednia P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Drzwi tylne P - Rysa/odprysk 1



Photo 64.

Drzwi tylne P - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Listwa drzwi przednich P - Rysa/odprysk 1

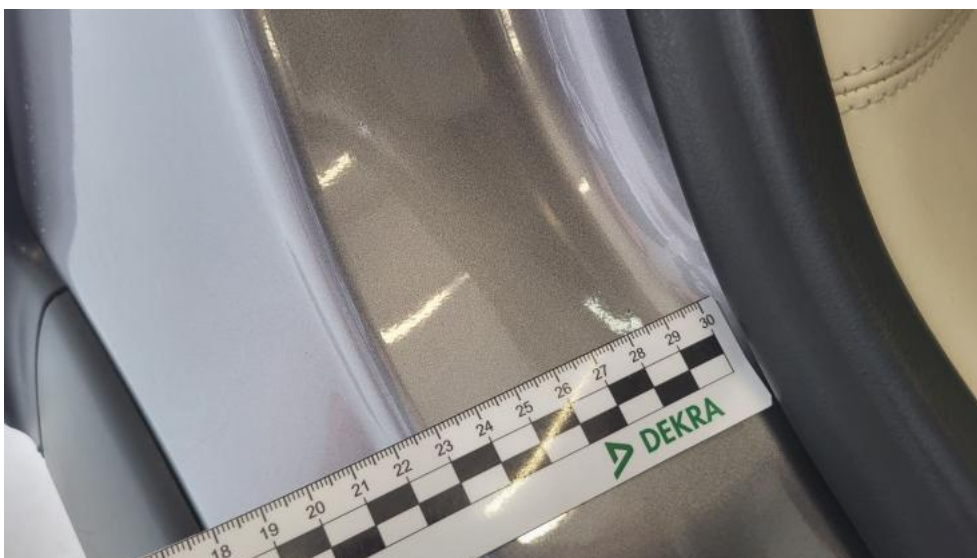


Photo 66.

Ścianka tylna P / Ścianka boczna P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 67.

Błotnik tylny P / Ściana boczna P - Rysa/odprysk 2



Photo 68.

Błotnik tylny P / Ściana boczna P() - Rysa/odprysk 3

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Pokrywy bagażnika - Rysa/odprysk 1



Photo 70.

Pokrywy bagażnika - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Zderzak tylny - Rysa/odprysk 1



Photo 72.

Drzwi przed L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 73.

Drzwi tylne L - Rysa/odprysk 1



Photo 74.

Błotnik przedni L - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 75.

Błotnik przedni L - Rysa/odprysk 1



Photo 76.

Fotel prz. lew. - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 77.

Fotel prz. lew. - Inne 1



Photo 78.

Kanapa tyl. - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 79.

Tapicerka drzwi przednich L - Inne 1



Photo 80.

Tapicerka drzwi tylnych L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 81.

Uszczelka drzwi przednich L - Rysa/odprysk 1

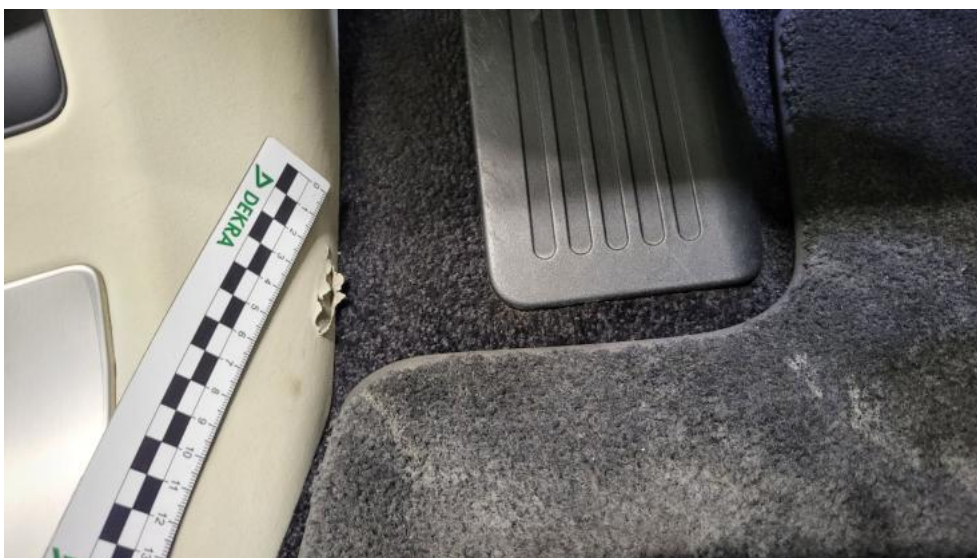


Photo 82.

Listwy progowe lew. - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 83.

Listwy progowe lew. - Pęknięcie/rozerwanie 2