

DEKRA's commission No. : PKOL(W)/LODZ/90125/26/09/25
commission/ damage No. : 23/038830
Date of commission: 25-09-2026

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (WSP)
DEKRA Polska - współpraca O/Warszawa
mgr inż. Michał Świątek
DEKRA Polska - Centrala

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0132235
Manufacturer	CITROEN
Model	SpaceTourer 16-22
Type / version	SpaceTourer 2.0 BlueHDi XL Business Lounge Aut.
Body type	KOM
Number of doors / seats	5/7
Curb weight [kg]	1994
Gross vehicle weight [kg]	2860
Wheelbase 1/2	3275
Engine type	Automatic ignition
Supercompression	turbocompressor with intercooler
Pollution reduction system	KSC
Emission standard	EURO 6
Engine capacity [ccm]	1997
Engine Power [hp/kW]	177/130
Gearbox	automatic 8- gear
Registration /record No.	WP2307S
VIN / serial number	VF7VEEHZ7PZ045168
Date of first registration	29-09-2023
Date of next. tech. test	29-09-2026
Year of manufacture	2023 (year has been verified with the manufacturer's base)
Readout [km]	79 337 (read)
Body color / type of coating	black/double-layered, metallized

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	NEXEN, N FERA PRIMUS	225/55 R17 101W	4,5 mm
	left	NEXEN, N FERA PRIMUS	225/55 R17 101W	4,5 mm
back	right	NEXEN, N FERA PRIMUS	225/55 R17 101W	5,0 mm
	left	NEXEN, N FERA PRIMUS	225/55 R17 101W	5,0 mm

Standard equipment by Eurotax

- | | |
|--|---|
| 1. Airbag: other | 25. Leather steering wheel, Multi functional steering wheel |
| 2. Antilock-Brake-System (ABS) | 26. Leather upholstery |
| 3. Automatic climate control | 27. Mobile Tire System |
| 4. Automatic dimlight activation, Rain sensor | 28. Other |
| 5. Blind spot warning, Park Distance Control front, Park Distance Control rear, Rear view camera | 29. Other |
| 6. Bord climate: other | 30. Other |
| 7. Bord climate: other | 31. Power assisted brakes |
| 8. Colored glass, Double glazing | 32. Rear swing door with window, Rear wiper |
| 9. Cruise control | 33. Rear-view mirror autodimming |
| 10. DAB radio, Navigation system | 34. Remote controlled central locking |
| 11. Door mirror(s) electrically adjustable in general, Door mirrors heated | 35. Seats: other |
| 12. Door mirrors electrically foldable | 36. Side airbag driver and passenger |
| 13. Electric parking brake | 37. Sliding door right electric |
| 14. Extra power outlet | 38. Soundsystem |
| 15. Extra power outlet | 39. Steering wheel manually adjustable |
| 16. Floor mat | 40. Storage facilities in general |
| 17. Fog lamps | 41. Sunblind rear side door manual |
| 18. Head-Up Display | 42. Tinted rear windows |
| 19. Heated seat driver, Heated seat passenger | 43. Traction control |
| 20. Hill holder | 44. Tyre pressure control (RDC) |
| 21. Interior decoration: other | 45. Windows: other |
| 22. Interior: other | 46. Windows: other |
| 23. Keyless go | 47. Xenon-light |
| 24. LED Daytime running lights | |

Dealer's equipment (selected items)

- | | |
|---|---|
| 1. Adaptive Cruise Control, Additional gauges, Collision Warning System, Distance control, Other, Radio, Windows: other | - |
| Szyba przednia atermiczna | |
| Tempomat aktywny | |
| Citroën Connect Radio | |
| System ostrzegania przed kolizją | |
| Kamera w przedniej szybie | |
| Zegary z kolorową matrycą | |
| System aktywnego hamowania (Active Safety Brake) | |
| 2. Additional gauges, Distance control, Exterior lighting: other, Lane control assistant, Other | - |
| AFIL - alarm w przypadku niezamierzonej zmiany pasa ruchu | |
| System monitorowania ograniczeń prędkości | |
| System automatycznego przełączania świateł (CAFR) | |
| Kamera w przedniej szybie | |
| Zegary z kolorową matrycą | |
| 3. Bluetooth interface | - |
| 4. Glass tilt/slide sunroof electric | - |
| 5. Head airbags rear | - |
| 6. Independent vehicle heater | - |
| 7. Interior: other | - |
| 8. Interior: other | - |
| 9. Light alloy wheels from 17" | - |
| 10. Metallic paint | - |
| 11. Rear swing door with window, Rear wiper | - |
| 12. Seats: other | - |
| 13. Towbar | - |

Base value of the vehicle

Base value of the vehicle (net) -

CorrectionsFirst registrationEquipmentTyresOther

Necessary repairs -
Braki i uszkodzenia -
Aktualna sytuacja rynkowa -


Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 10-2026 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 02-10-2026

DEKRA's expert:
Kacper Sosnowski (WSP)
mgr inż. Michał Świątek

Document issued electronically valid without signature.

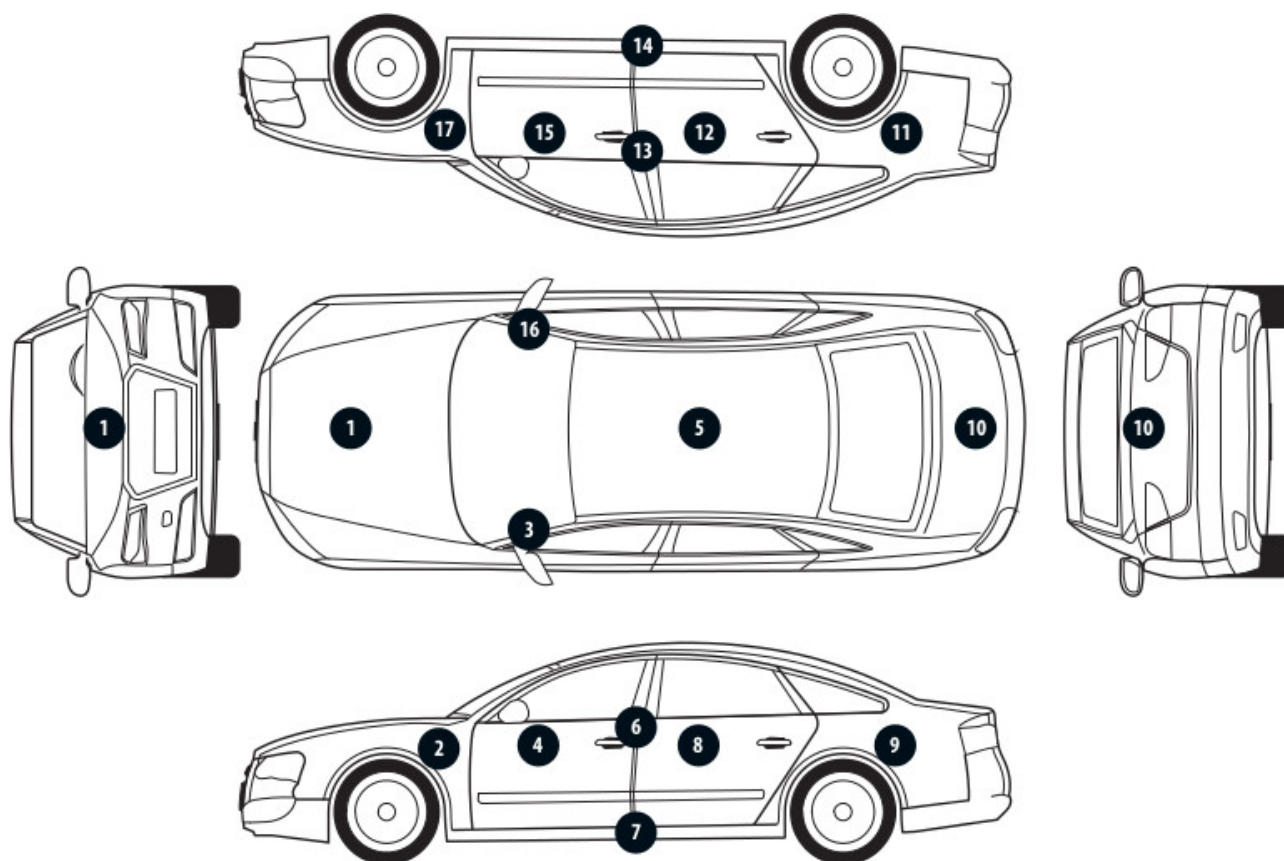Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Front left fender	to 150
3	Left front pillar	to 150
4	Front left door	to 150
5	Roof	to 150
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	to 150
9	Rear left fender	to 150
10	Cover/lid	to 150
11	Right rear fender	to 150
12	Right rear door	to 150
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	to 150
16	Right front pillar	to 150
17	Front right fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book of the vehicle was not provided.

Information concerning the origin of the vehicle

The vehicle purchased domestically from an authorized representative of the brand.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below:

.

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.

- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.

- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.

- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.

- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.

- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the

page 5/47

assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

1

Expert comments - regarding valuation

Widoczne ślady użytkowania pojazdu: drobne rysy, odpryski, wgniecenia, zaplamienia.
Aktywne wezwanie serwisowe.
Brak aktualnych badań technicznych.

Restrictive disclaimer - regarding valuation

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przekątna przednia lewa



Photo 2.
Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.

Próg lewy (widok od przodu)



Photo 12.

Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION

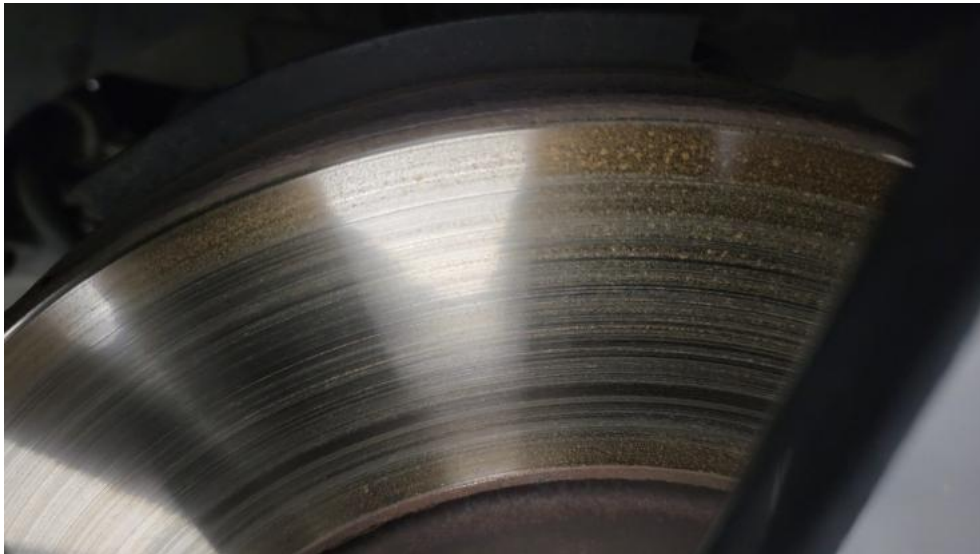


Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Komora silnika

PHOTOGRAPHIC DOCUMENTATION



Photo 21.

Numer identyfikacyjny



Photo 22.

Tabliczka znamionowa

PHOTOGRAPHIC DOCUMENTATION



Photo 23.

Zestaw wskaźników - przebieg



Photo 24.

Zestaw wskaźników - serwis

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe

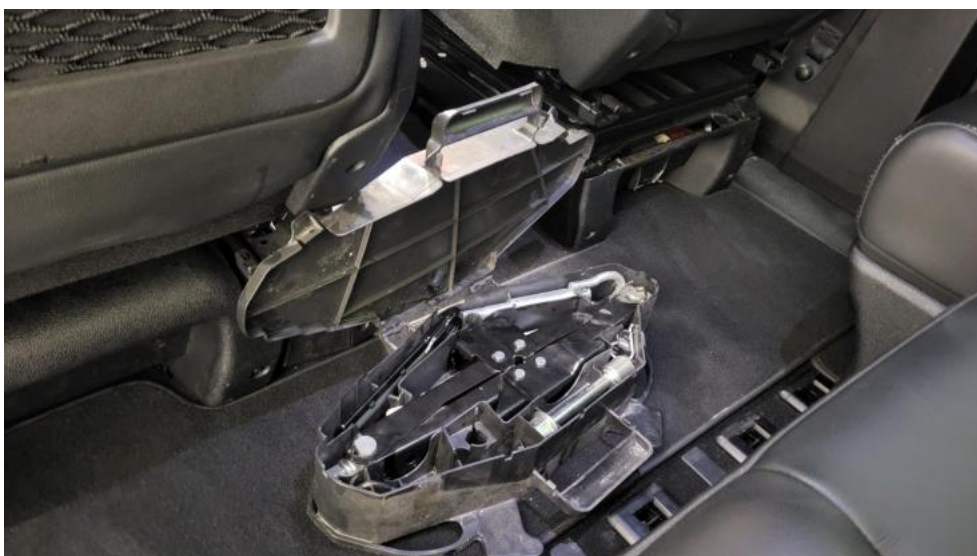


Photo 26.

Wyposażenie

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Kierownica z lewej strony



Photo 28.

Widok przez otwarte drzwi tylne lewe

PHOTOGRAPHIC DOCUMENTATION



Photo 29.

Widok z tylnej kanapy na deskę rozd.



Photo 30.

Konsola środkowa

PHOTOGRAPHIC DOCUMENTATION

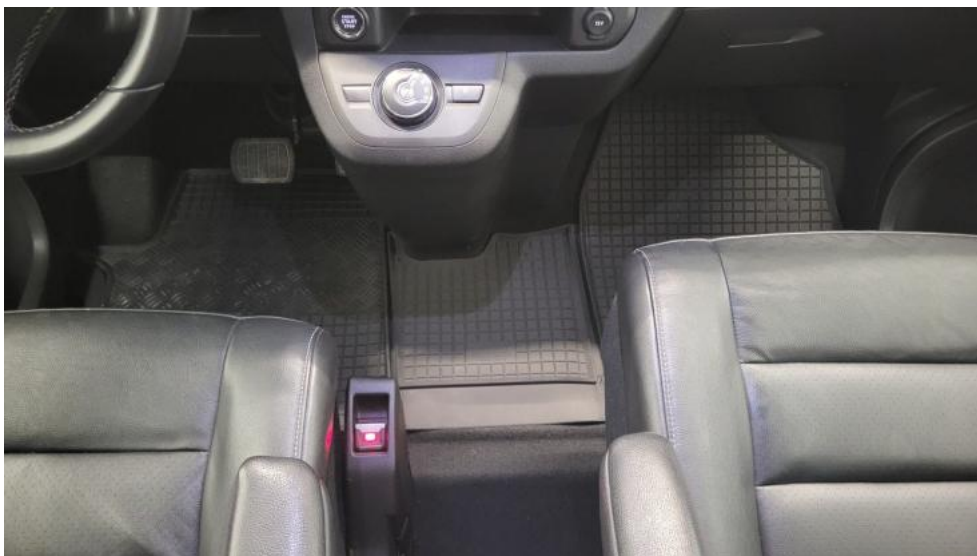


Photo 31.
Tunel środkowy



Photo 32.
Kierownica (na wprost)

PHOTOGRAPHIC DOCUMENTATION

Photo 33.

Dowód rej. Str. 1



Photo 34.

Dow. Rej. Str. 2

PHOTOGRAPHIC DOCUMENTATION



Photo 35.

Kluczyki



Photo 36.

Wyposażenie

PHOTOGRAPHIC DOCUMENTATION



Photo 37.
Wyposażenie



Photo 38.
Wyposażenie

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Zdjęcie do protokołu



Photo 40.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 41.

Zdjęcie do protokołu



Photo 42.

Pokrywa komory silnika - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Szyba czołowa - zdjęcie poglądowe 1

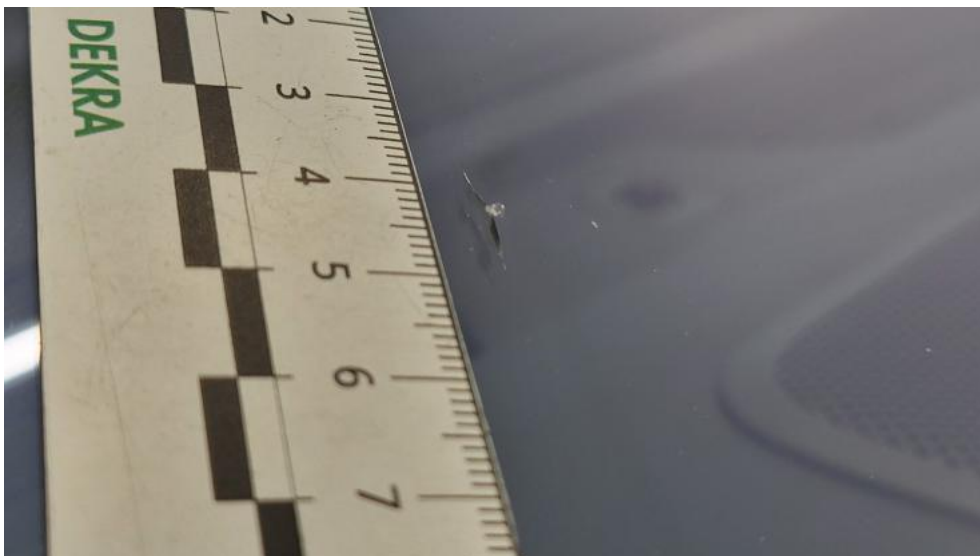


Photo 44.

Szyba czołowa - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Zderzak - Rysa/odprysk 1

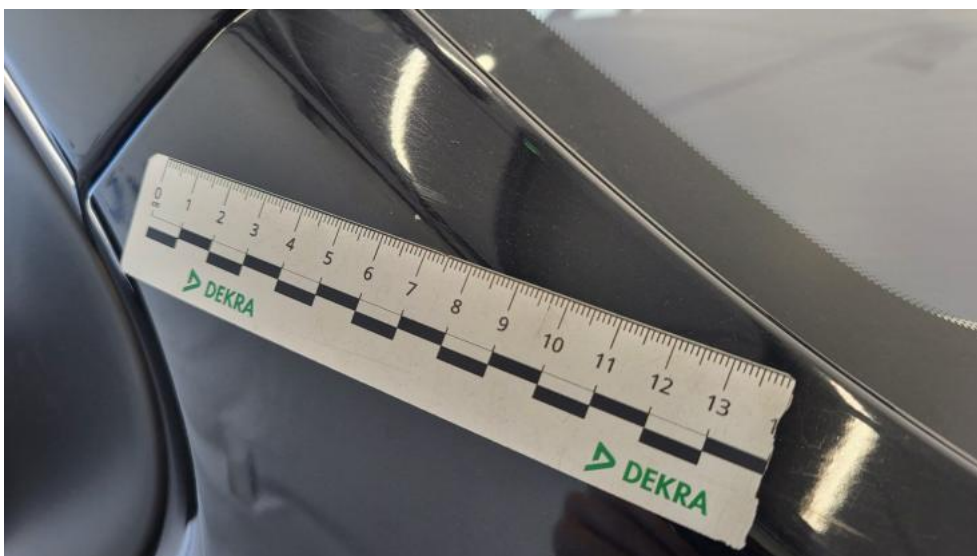


Photo 46.

Błotnik przedni P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Błotnik przedni P - Wgniecenie/odkształcenie 1



Photo 48.

Felga aluminiowa przednia P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Reflektor P - Rysa/odprysk 1



Photo 50.

Drzwi przednie P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Drzwi przednie P - Wgniecenie/odkształcenie 1



Photo 52.

Drzwi przednie P - Wgniecenie/odkształcenie 2

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Drzwi tylne P - zdjęcie pogładowe 1



Photo 54.

Drzwi tylne P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Drzwi tylne P - Wgniecenie/odkształcenie 1



Photo 56.

Listwa drzwi przednich P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Listwa drzwi przednich P - Wgniecenie/odkształcenie 1



Photo 58.

Listwa drzwi tylnych P - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Lusterko zew P - Pęknięcie/rozerwanie 1



Photo 60.

Ścianka tylna P / Ścianka boczna P - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1



Photo 62.

Felga aluminiowa tylna P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 63.

Pokrywy bagażnika - Rysa/odprysk 1



Photo 64.

Pokrywy bagażnika - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Zderzak tylny - Wgniecenie/odkształcenie 1



Photo 66.

Zderzak tylny cz P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 67.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1



Photo 68.

Felga aluminiowa tylna L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Drzwi przed L - Rysa/odprysk 1



Photo 70.

Drzwi przed L - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Drzwi przed L - Wgniecenie/odkształcenie 1



Photo 72.

Drzwi tylne L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 73.

Klamka drzwi tyl L - Rysa/odprysk 1



Photo 74.

Listwa drzwi przednich L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 75.
Próg L - Rysa/odprysk 1



Photo 76.
Słupek przedni L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 77.

Błotnik przedni L - Wgniecenie/odkształcenie 1



Photo 78.

Felga Aluminiowa przednia L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 79.

Podsufitka - Inne 1



Photo 80.

Wykładzina pokrywy tylnej - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 81.

Wykładzina przestrzeni bagażowej - Rysa/odprysk 1