

DEKRA's commission No. : PKOL(W)/LODZ/89097/26/09/22(60760)
commission/ damage No. : 21/020341
Date of commission: 22-09-2026 12:29:13

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Andrzej Sosnowski
DEKRA Polska - Centrala

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0136936
Manufacturer	FORD
Model	Mustang Fastback 18-24
Type / version	Mustang 5.0 V8 Bullitt
Body type	CPE
Number of doors / seats	3/4
Curb weight [kg]	1751
Gross vehicle weight [kg]	2105
Wheelbase 1/2	2720
Engine type	spark ignition
Pollution reduction system	GPF
Engine capacity [ccm]	5038
Engine Power [hp/kW]	460/338
Gearbox	manual 6- gear
Registration /record No.	OP4498P
VIN / serial number	1FA6P8K05L5580909
Date of first registration	12-11-2020
Date of next. tech. test	23-12-2026
Year of manufacture	2019 (year has been verified with the manufacturer's base)
Readout [km]	102 712 (read)
Body color / type of coating	black/double-layered, metallized

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	YOKOHAMA, BLUEARTH WINTER V905	255/40 19 100V	3,5 mm
	left	YOKOHAMA, BLUEARTH WINTER V905	255/40 19 100V	4,0 mm
back	right	YOKOHAMA, BLUEARTH WINTER V905	275/40 19 105W	2,5 mm
	left	YOKOHAMA, BLUEARTH WINTER V905	275/40 19 105W	2,5 mm

Standard equipment by Eurotax

- | | |
|---|---|
| 1. Adaptive Cruise Control | 34. LED front dim light, LED rear lights |
| 2. Alarm | 35. Lane control assistant |
| 3. Antilock-Brake-System (ABS) | 36. Leather gearshifter/switch, Leather steering wheel, Steering wheel heated |
| 4. Automated High-beam assist, Automatic dimlight activation | 37. Leather upholstery |
| 5. Automatic Emergency Call, Bluetooth interface, DAB radio, Hands-free system, Navigation system, Soundsystem, Steering wheel with radio operation, USB in | 38. Light Alloy wheels 19" |
| 6. Automatic dimlight activation | 39. Metallic paint |
| 7. Bumpers: other | 40. Mobile Tire System |
| 8. Bumpers: other, Exterior design: other | 41. Navigation system |
| 9. Child seat fixation | 42. On board monitor |
| 10. Daytime running lights, Fog lamps | 43. Other |
| 11. Distribution of braking force electronically | 44. Other |
| 12. Door mirror(s) electrically adjustable in general | 45. Other |
| 13. Door mirrors electrically foldable, Exterior lighting: other | 46. Other |
| 14. Door mirrors heated | 47. Other |
| 15. Driver airbag, Head airbags front, Passenger airbag, Side airbag driver and passenger | 48. Park Distance Control rear |
| 16. Driver knee airbag | 49. Passenger seat electrically adjustable |
| 17. Driver seat electrically adjustable | 50. Power steering |
| 18. Driver-information-system, Other | 51. Power windows front, Power windows rear |
| 19. Dualzone automatic climate control | 52. Pre-Crash System |
| 20. ESP (Electronical Stabilizing Program), Power assisted brakes, Traction control | 53. Rear bench foldable in two separate parts |
| 21. Exterior design: other | 54. Rear bench foldable in two separate parts |
| 22. Exterior design: other | 55. Rear view camera |
| 23. Exterior design: other | 56. Rear-view mirror autodimming |
| 24. Exterior design: other | 57. Remote controlled central locking |
| 25. Floor mat | 58. Selectable driveline characteristics |
| 26. Heated seat driver, Heated seat passenger, Ventilated front seat | 59. Selectable driveline characteristics |
| 27. Hill holder | 60. Side indicators |
| 28. Interior lights: other accessories | 61. Sport seats front |
| 29. Interior: other | 62. Storage facilities in general |
| 30. Interior: other | 63. Tyre pressure control (RDC) |
| 31. Interior: other, Storage facilities in general | 64. Vehicle immobilizer |
| 32. Keyless go | 65. Wheels: other |
| 33. Keyless go | 66. Windscreenwiper: other |

Dealer's equipment (selected items)

1. Metallic paint -

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

CorrectionsFirst registrationMileageEquipmentTyresOther


Braki uszkodzenia, weryfikacja serwisowa. -
Aktualna sytuacja rynkowa -
Długotrwały postój, brak zainteresowania -

Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 09-2026 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 23-09-2026DEKRA's expert:
Andrzej Sosnowski**Document issued electronically valid without signature.**

Measurement of thickness of the vehicle lacquer coating

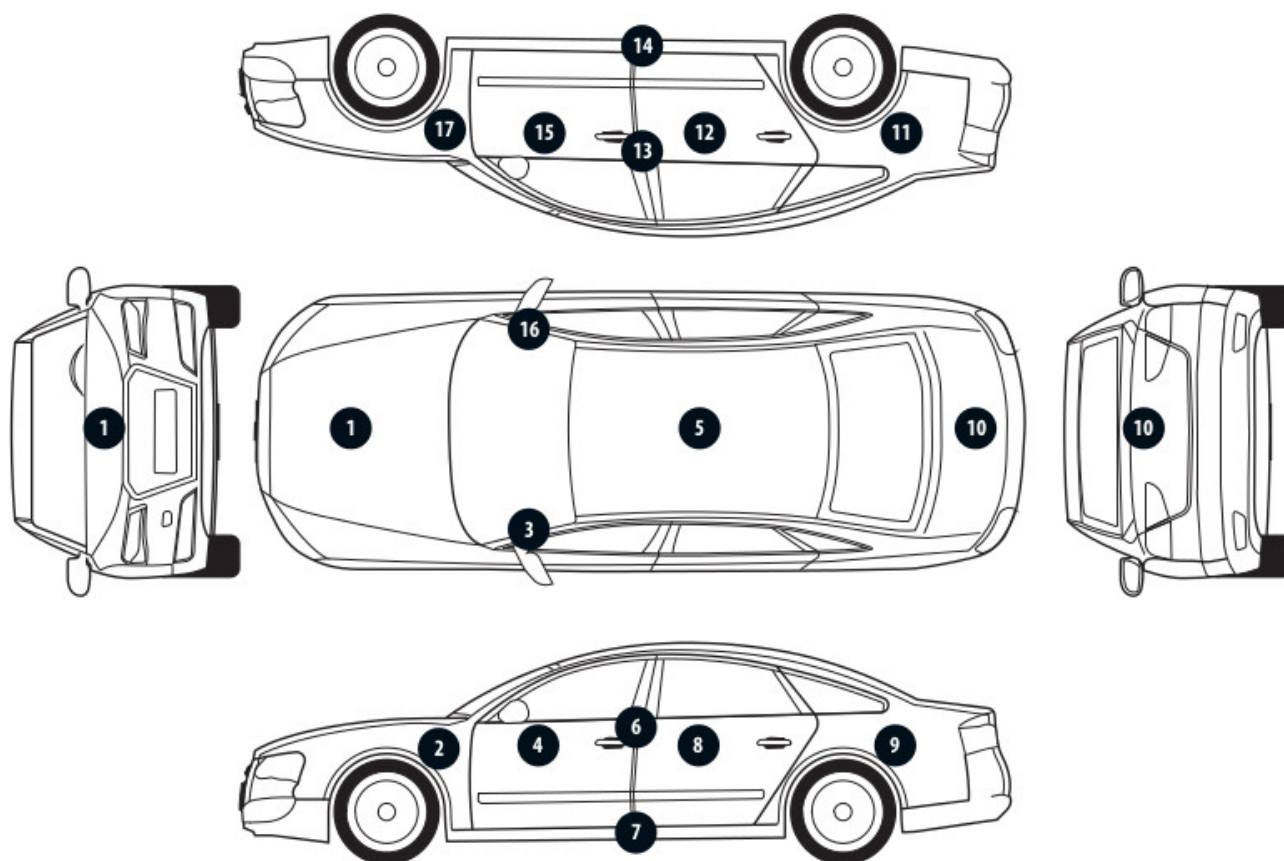

No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	to 150
2	Front left fender	to 150
3	Left front pillar	150 - 200
4	Front left door	to 150
5	Roof	to 150
6	Left middle pillar	to 150
7	Right side sill	to 150
9	Rear left fender	150 - 200
10	Cover/lid	to 150
11	Right rear fender	to 150
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	150 - 300
16	Right front pillar	to 150
17	Front right fender	to 150

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book of the vehicle was not provided.

Information concerning the origin of the vehicle

Lack of reliable data.

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below: ograniczenia placowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the

page 5/37

assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

2

Expert comments - regarding valuation

Rysy na samochodzie. Niesprawne przyciski funkcyjne w jednym z kluczyków, grot prawidłowy. Wymiana oleju konieczna. Informacja filtr DPF przekroczony limit, wymagany serwis. Odpryski na szybie czołowej. Długotrwały rozruch, do weryfikacji serwisowej. Poziom oleju poniżej minimum, zalecane weryfikacja serwisowa. Silnik nierówna praca.

Rzeczoznawca dokonał oględzin pojazdu w warunkach parkingowych, co mogło ograniczyć pełną ocenę jego stanu technicznego. Dodatkowo, jeżeli jazda próbna została przeprowadzona (informacje w treści raportu), to wykonano ją w warunkach parkingowych, z niewielką prędkością, co może nie odzwierciedlać pełnych warunków eksploatacyjnych. Istnieje możliwość, że w innych okolicznościach ujawnią się dodatkowe uszkodzenia lub usterki, których nie można było wykryć podczas obecnych oględzin. Zalecamy zatem skorzystanie z możliwości oględzin pojazdu we własnym zakresie lub w Autoryzowanej Stacji Obsługi danej marki, co pozwoli na pełniejszą weryfikację stanu technicznego pojazdu przed udziałem w aukcji."

PHOTOGRAPHIC DOCUMENTATION



Photo 1.

Przekątna przednia lewa



Photo 2.

Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.

Próg lewy (widok od przodu)



Photo 12.

Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Komora silnika

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Numer identyfikacyjny



Photo 22.
Tabliczka znamionowa

PHOTOGRAPHIC DOCUMENTATION



Photo 23.



Photo 24.

Zestaw wskaźników - serwis

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Widok przez otwarte drzwi przednie lewe



Photo 26.

Kierownica z lewej strony

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Widok przez otwarte drzwi tylne lewe



Photo 28.

Widok z tylnej kanapy na deskę rozd.

PHOTOGRAPHIC DOCUMENTATION



Photo 29.
Konsola środkowa

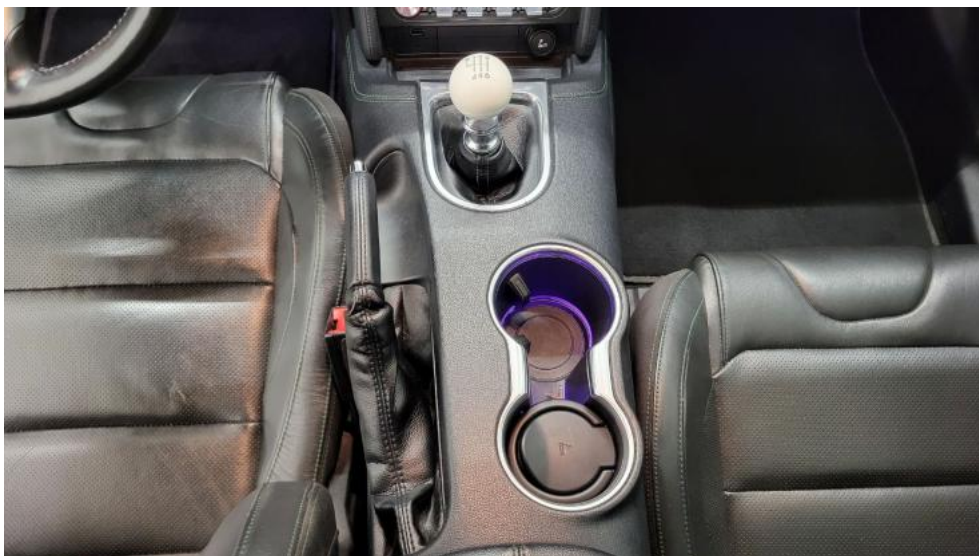


Photo 30.
Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION



Photo 31.
Kierownica (na wprost)



Photo 32.
Dowód rej. Str. 1

PHOTOGRAPHIC DOCUMENTATION



Photo 33.

Dowód rej. str. 2



Photo 34.

Kluczyki

PHOTOGRAPHIC DOCUMENTATION



Photo 35.

Zdjęcie do protokołu



Photo 36.

Pokrywa komory silnika - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 37.

Pokrywa komory silnika - Rysa/odprysk 2

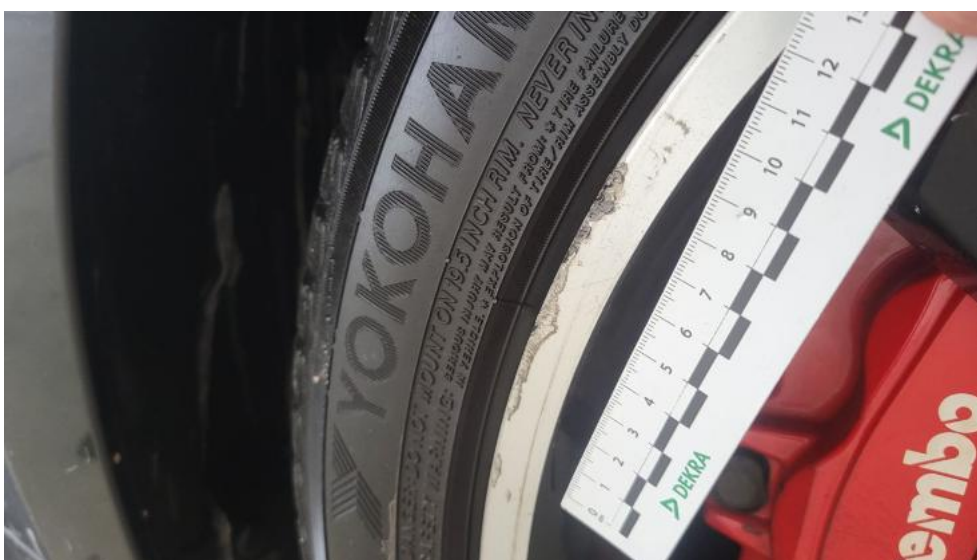


Photo 38.

Felga aluminiowa przednia P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Drzwi przednie P - Rysa/odprysk 1



Photo 40.

Drzwi przednie P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION

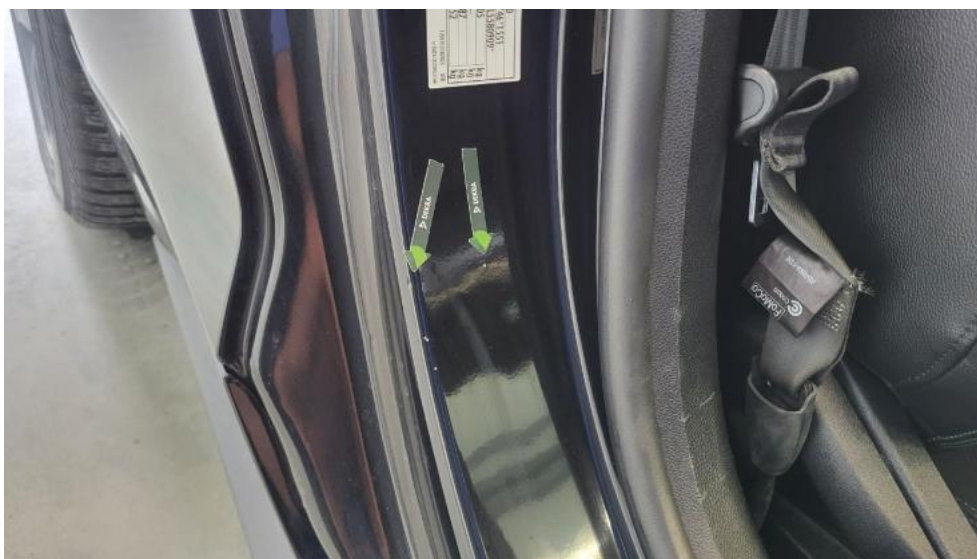


Photo 41.

Słupek środkowy P - Wgniecenie/odkształcenie 1



Photo 42.

Łotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Felga aluminiowa tylna P - Rysa/odprysk 1



Photo 44.

Emblemat tylny - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 45.

Zderzak tylny - Rysa/odprysk 1



Photo 46.

Zderzak tylny - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 47.

Zderzak tylny - Wgniecenie/odkształcenie 2



Photo 48.

Dach - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1



Photo 50.

Felga aluminiowa tylna L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Drzwi przed L - Rysa/odprysk 1



Photo 52.

Drzwi przed L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Lusterko zew L - Rysa/odprysk 1



Photo 54.

Słupek przedni L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Błotnik przedni L - zdjęcie poglądowe 1



Photo 56.

Błotnik przedni L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Felga Aluminiowa przednia L - Rysa/odprysk 1



Photo 58.

Fotel prz. lew. - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Fotel prz. lew. - Pęknięcie/rozerwanie 1



Photo 60.

Listwy progowe praw. - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 61.

Komunikat wymiany oleju



Photo 62.

Niski poziom oleju silnikowego.