

DEKRA's commission No. : PKOL(W)/LODZ/01743/21/01/12
commission/ damage No. : 16/023769
Date of commission: 12-01-2021

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing Finance
PKO Leasing SA
Al. Śmigłego-Rydza 20
93-281 Łódź

Expert:

Sylwester Kowalski
DEKRA Polska - Centrala
Norbert Kutyla
DEKRA Polska - Centrala

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	cars
EC code (Eurotax)	0112947
Manufacturer	VOLVO
Model	S60 13-19
Type / version	S60 D2 Drive-E Momentum aut
Body type	sedan
Number of doors / seats	4/5
Curb weight [kg]	1566
Gross vehicle weight [kg]	2090
Wheelbase 1/2	2776
Engine type	Automatic ignition
Pollution reduction system	DPF
Engine capacity [ccm]	1969
Engine Power [hp/kW]	120/88
Gearbox	automatic 6- gear
Registration /record No.	SK413KG
VIN / serial number	YV1FS78C0G2397217
Date of first registration	09-07-2015
Year of manufacture	2015
Readout [km]	183 883 (read)
Body color / type of coating	red/double-layered, metallized

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	Fortuna, Winet-max A1	215/50 17 95V	7,5 mm
	left	Fortuna, Winet-max A1	215/50 17 95V	6,0 mm
back	right	Fortuna, Winet-max A1	215/50 17 95V	6,0 mm
	left	Fortuna, Winet-max A1	215/50 17 95V	7,0 mm

Standard equipment by Eurotax

- | | |
|---|---|
| 1. Additional heating | 27. LED Daytime running lights |
| 2. Alarm | 28. Leather gearshifter/switch |
| 3. Antilock-Brake-System (ABS) | 29. Leather steering wheel |
| 4. Armrest (s) front | 30. Light alloy wheels from 17" |
| 5. Artificial leather upholstery, Textile upholstery | 31. Lumbar adjust driver electric, Lumbar adjust passenger electric |
| 6. Automatic climate control | 32. Metal finish |
| 7. Bluetooth interface, Bord entertainment: other accessories, CD-player, Radio, USB in | 33. On board computer |
| 8. Bord climate: other | 34. Other |
| 9. Cabin air filter | 35. Other |
| 10. Child seat fixation | 36. Other |
| 11. Colored glass | 37. Other |
| 12. Cruise control | 38. Park Distance Control rear |
| 13. Distribution of braking force electronically | 39. Power assisted brakes |
| 14. Door mirror(s) electrically adjustable in general | 40. Power assisted brakes |
| 15. Door mirrors electrically foldable, Exterior lighting: other | 41. Power windows front, Power windows rear |
| 16. Driver airbag, Head airbags front, Passenger airbag, Side airbag driver and passenger | 42. Rain sensor |
| 17. ESP (Electronical Stabilizing Program), Traction control | 43. Rear bench foldable in two separate parts |
| 18. Exterior lighting: other | 44. Rear-view mirror autodimming |
| 19. Exterior lighting: other | 45. Remote controlled central locking |
| 20. Exterior thermometer | 46. Start/Stop system |
| 21. Floor mat | 47. Steering wheel manually adjustable |
| 22. Hill holder | 48. Steering wheel with radio operation |
| 23. Hill holder | 49. Traction control |
| 24. Interior lights: other accessories | 50. Uni-Lackierung |
| 25. Interior lights: other accessories, Mirror: others | 51. Whiplash-protection-system |
| 26. Interior: other | |

Dealer's equipment (selected items)

- | | |
|--|---|
| 1. Exterior design: other | - |
| 2. Navigation system, Radio | - |
| 3. On board monitor | - |
| 4. Park Distance Control front, Park Distance Control rear | - |
| 5. Wheels: other | - |

Base value of the vehicle

Base value of the vehicle (net) -

CorrectionsFirst registrationMileage

Equipment

Tyres

Other

Earlier repairs -
Stan dbałości o pojazd, uszkodzenia, braki -

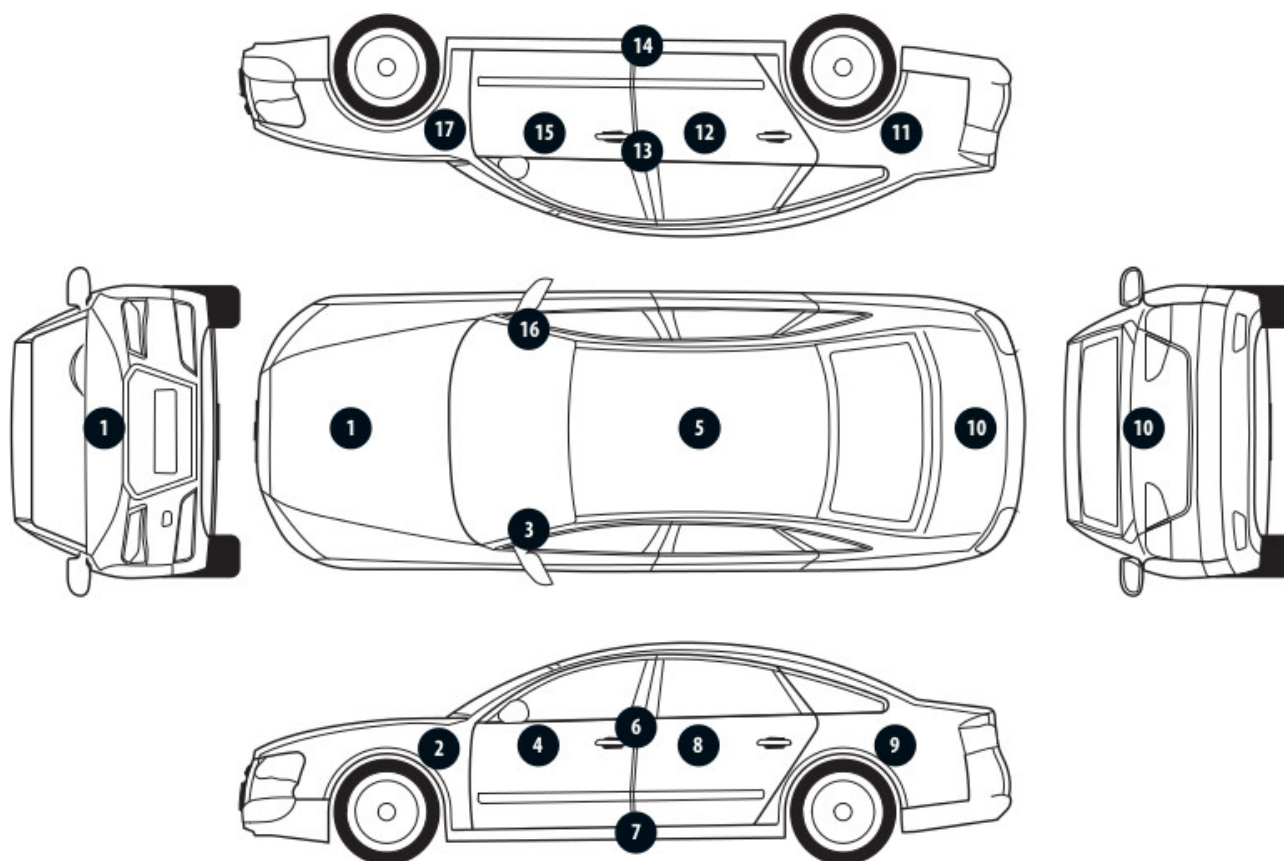
Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 01-2021 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 15-01-2021

DEKRA's expert:
Sylwester Kowalski
Norbert Kutyla

Document issued electronically valid without signature.

Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [μm]
1	Front cover	150 - 300
2	Front left fender	150 - 500
3	Left front pillar	150 - 300
4	Front left door	150 - 200
5	Roof	150 - 300
6	Left middle pillar	to 150
7	Right side sill	to 150
8	Left rear door	150 - 300
9	Rear left fender	150 - 200
10	Cover/lid	to 150
11	Right rear fender	150 - 300
12	Right rear door	150 - 200
13	Right middle pillar	to 150
14	Right side sill	to 150
15	Front right door	150 - 200
16	Right front pillar	150 - 300
17	Front right fender	150 - 300

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

Presented the following documents of the vehicle:

Skan pozwolenia czasowego.

During the inspection the service book of the vehicle was not provided.

Information concerning the origin of the vehicle

The vehicle imported individually from EU

Anti-theft protection - immobilizer

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

Anti-theft protection - other:

not found

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below:
Ograniczenia parkingowe.

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Additional verification of the production year was conducted.

<https://domvolvo.volvocars-partner.pl/kontakt/>

Dom Volvo

Puławska 558/560

02-884 Warszawa

Tel: (22) 777 00 00

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.

- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.
- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

2.

Expert comments - regarding valuation

Słaba bateria w kluczyku.

Restrictive disclaimer - regarding valuation

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.
Przód



Photo 2.
Prawy bok przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.
Prawy bok tył



Photo 4.
Tył

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Lewy bok tył



Photo 6.
Lewy bok przód

PHOTOGRAPHIC DOCUMENTATION



Photo 7.
Pole numerowe



Photo 8.
Tabliczka

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Wskaźniki /przebieg/paliwo



Photo 10.

Widok przez lewe przednie drzwi

PHOTOGRAPHIC DOCUMENTATION



Photo 11.

Widok przez lewe tylne drzwi



Photo 12.

Widok z tylnego siedzenia

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Konsola środkowa

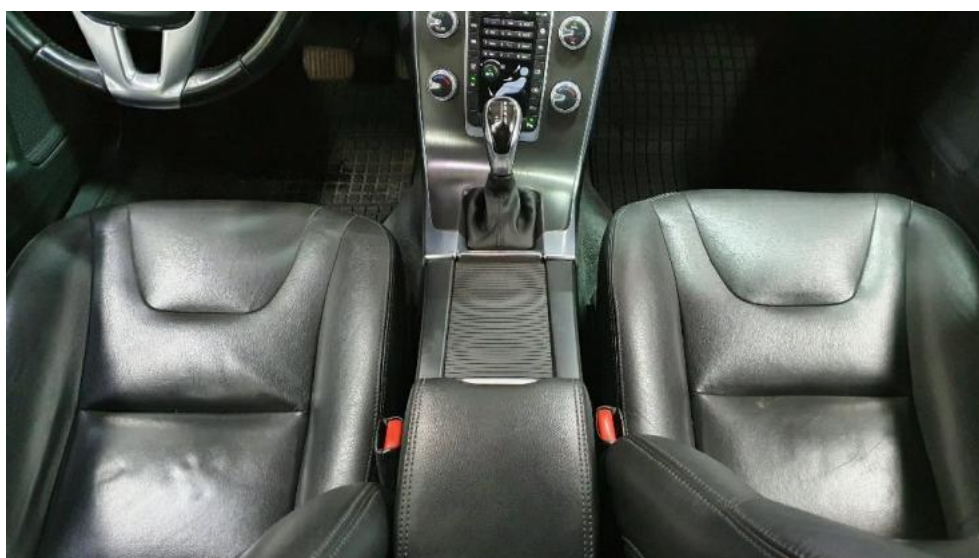


Photo 14.
Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Kierownica widok z lewej strony (widoczne przełączniki)



Photo 16.

Komora silnika

PHOTOGRAPHIC DOCUMENTATION



Photo 17.
Bagażnik



Photo 18.
Koło zapasowe/trójkąt/gaśnica

PHOTOGRAPHIC DOCUMENTATION

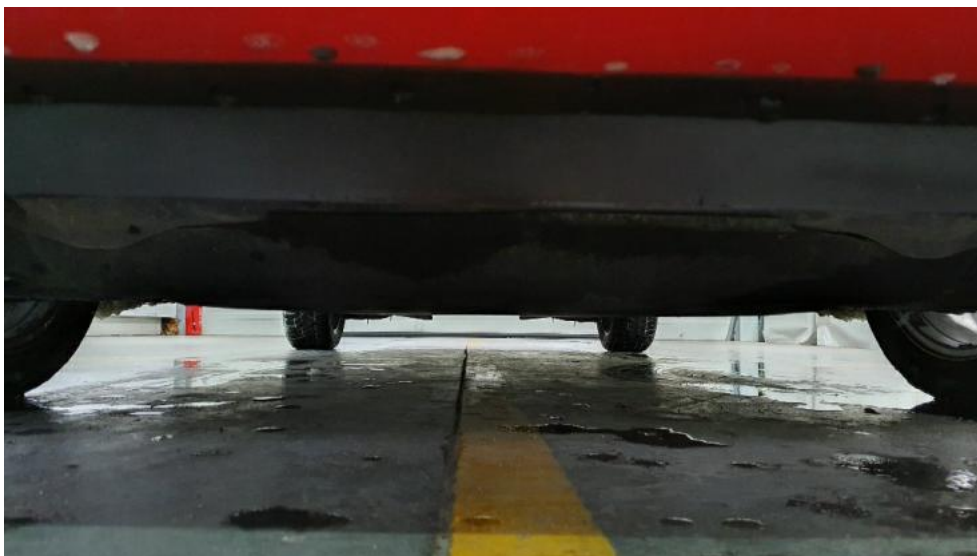


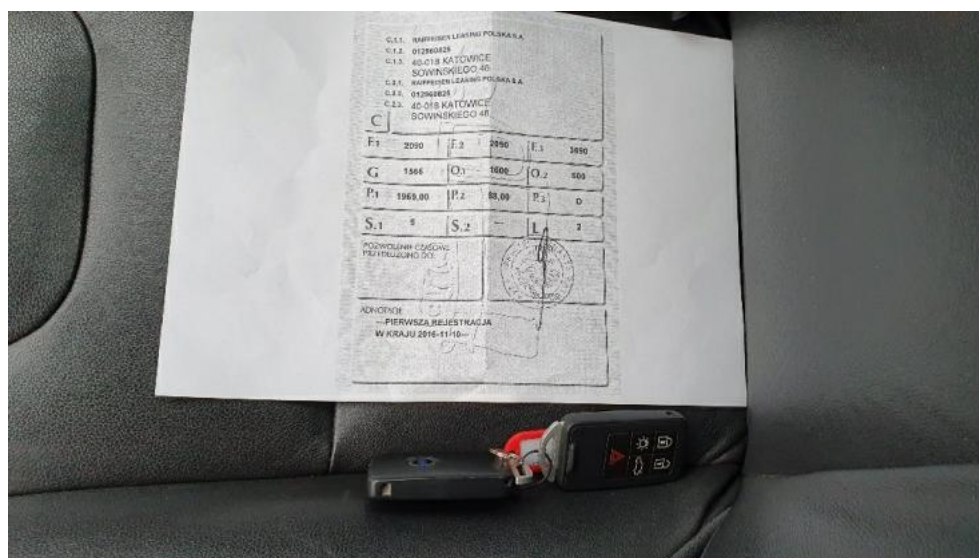
Photo 19.
Spód pojazdu przód



Photo 20.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION**Photo 21.**

Dowód rejestracyjny 1. strona

**Photo 22.**

Dowód rejestracyjny 2. strona / klucze

PHOTOGRAPHIC DOCUMENTATION



Photo 23.

Błotnik tylny prawy/ściana boczna prawa (Rysa/Odprysk)



Photo 24.

Drzwi tylne lewe (Rysa/Odprysk)

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Drzwi przednie lewe (Rysa/Odprysk)



Photo 26.

Tapicerka drzwi przednich lewych (Przetarcie)

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Pas bezpieczeństwa przedni lewy (Przetarcie)



Photo 28.

Konsola środkowa (Rysa/Odprysk)

PHOTOGRAPHIC DOCUMENTATION



Photo 29.
Poziom oleju



Photo 30.
Bateria kluczyka do wymiany

PHOTOGRAPHIC DOCUMENTATION



Photo 31.

Nawigacja