

DEKRA's commission No. : PKOL(W)/LODZ/72842/25/09/26  
commission/ damage No. : 22/024399  
Date of commission: 26-09-2025

**DEKRA Poland - Headquarters**  
02-673 Warszawa, ul. Konstruktorska 12A

**Client :**

PKO Leasing SA  
Świętokrzyska 36  
00-116 Warszawa

**Expert:**

**Kacper Sosnowski (NEW)**  
DEKRA Polska - współpraca O/Warszawa  
**Andrzej Sosnowski**  
DEKRA Polska - Centrala

**NOTE:**

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

**Vehicle data**

|                              |                                                            |
|------------------------------|------------------------------------------------------------|
| Group of objects (Eurotax)   | cars                                                       |
| EC code (Eurotax)            | 0145354                                                    |
| Manufacturer                 | BMW                                                        |
| Model                        | Seria 5 [G30/F90] 20-23                                    |
| Type / version               | 530d mHEV M Sport sport-aut                                |
| Body type                    | sedan                                                      |
| Number of doors / seats      | 4/5                                                        |
| Curb weight [kg]             | 1760                                                       |
| Gross vehicle weight [kg]    | 2440                                                       |
| Wheelbase 1/2                | 2975                                                       |
| Engine type                  | Automatic ignition                                         |
| Pollution reduction system   | KSC                                                        |
| Engine capacity [ccm]        | 2993                                                       |
| Engine Power [hp/kW]         | 286/210                                                    |
| Gearbox                      | automatic                                                  |
| Registration /record No.     | TK956CC                                                    |
| VIN / serial number          | WBA11AH090CK72120                                          |
| Date of first registration   | 29-07-2022                                                 |
| Date of next. tech. test     | 29-07-2027                                                 |
| Year of manufacture          | 2022 (year has been verified with the manufacturer's base) |
| Readout [km]                 | 162 509 (read)                                             |
| Body color / type of coating | granatowy/double-layered, metallized                       |

**Tyres**

| axle  | Wheel | Manufacturer, type            | Size           | Measured profile |
|-------|-------|-------------------------------|----------------|------------------|
| Front | right | GOODYEAR, EAGLE F1 ASYMETRIC6 | 245/40 19 98Y  | 4,0 mm           |
|       | left  | GOODYEAR, EAGLE F1 ASYMETRIC6 | 245/40 19 98Y  | 4,0 mm           |
| back  | right | GOODYEAR, EAGLE F1 ASYMETRIC6 | 275/35 19 100Y | 3,5 mm           |
|       | left  | GOODYEAR, EAGLE F1 ASYMETRIC6 | 275/35 19 100Y | 3,5 mm           |

Standard equipment by Eurotax

- |                                                                                                                                 |                                                             |
|---------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------|
| 1. Additional gauges, Navigation system, On board monitor, Touchscreen monitor                                                  | 31. Interior decoration: other                              |
| 2. Aerodynamics package, Exterior design: other                                                                                 | 32. Interior lights: other accessories                      |
| 3. Alarm                                                                                                                        | 33. Interior: other                                         |
| 4. Android Auto, Apple CarPlay                                                                                                  | 34. LED front dim light                                     |
| 5. Armrest (s) front                                                                                                            | 35. LED rear lights                                         |
| 6. Armrest (s) rear                                                                                                             | 36. Leather steering wheel, Sports steering wheel           |
| 7. Artificial leather upholstery                                                                                                | 37. Light Alloy wheels 18"                                  |
| 8. Automatic climate control                                                                                                    | 38. Mobile Tire System                                      |
| 9. Automatic dimlight activation, Rain sensor                                                                                   | 39. Mobile phone                                            |
| 10. Bord communication: other                                                                                                   | 40. Multi functional steering wheel                         |
| 11. Bord communication: other                                                                                                   | 41. Other                                                   |
| 12. Bord communication: other                                                                                                   | 42. Other                                                   |
| 13. Bord communication: other                                                                                                   | 43. Other                                                   |
| 14. Bord entertainment: other accessories                                                                                       | 44. Other                                                   |
| 15. Child seat fixation                                                                                                         | 45. Other                                                   |
| 16. Collision Warning System, Other                                                                                             | 46. Other                                                   |
| 17. Colored glass                                                                                                               | 47. Park Distance Control front, Park Distance Control rear |
| 18. Cruise control                                                                                                              | 48. Rear seat-backs foldable in two separate parts          |
| 19. DAB radio                                                                                                                   | 49. Rear-view mirror autodimming                            |
| 20. Door mirror(s) electrically adjustable in general, Door mirrors heated                                                      | 50. Selectable driveline characteristics                    |
| 21. Door mirrors autodimming                                                                                                    | 51. Servotronic                                             |
| 22. Door mirrors electrically foldable                                                                                          | 52. Sport seats front                                       |
| 23. Driver airbag, Head airbags front, Head airbags rear, Passenger airbag, Side airbag driver and passenger, Side airbags rear | 53. Sport suspension                                        |
| 24. Driver seat electrically adjustable, Passenger seat electrically adjustable                                                 | 54. Start/Stop system                                       |
| 25. ESP (Electronical Stabilizing Program), Traction control                                                                    | 55. Steering wheel manually adjustable                      |
| 26. Exterior design: other                                                                                                      | 56. Telematic                                               |
| 27. Exterior design: other                                                                                                      | 57. Tie-down ring                                           |
| 28. Exterior design: other                                                                                                      | 58. Tyre pressure control (RDC)                             |
| 29. Floor mat                                                                                                                   | 59. Uni-Lackierung                                          |
| 30. Follow me home                                                                                                              | 60. Windscreen wash-nozzle heated                           |

Dealer's equipment (selected items)

- |                                                                                                                                                                                                                    |   |
|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---|
| 1. Active Emergency Brake Assist, Blind spot warning, Collision Warning System, Cruise control, Distance control, Lane control assistant, Other, Pedestrian Emergency Brake Assist, Rear Cross Traffic Alert ..... | - |
| Aktywna ochrona przed kolizją boczną                                                                                                                                                                               |   |
| Asystent kierowania i pasa ruchu                                                                                                                                                                                   |   |
| Asystent korytarza ratunkowego                                                                                                                                                                                     |   |
| Asystent unikania kolizji                                                                                                                                                                                          |   |
| Asystent zatrzymania awaryjnego                                                                                                                                                                                    |   |
| Ostrzeganie przed ruchem poprzecznym z przodu                                                                                                                                                                      |   |
| Systemy asystujące kierowcy                                                                                                                                                                                        |   |
| Tempomat aktywny z funkcją Stop&Go i ostrzeżeniem przed kolizją, funkcja hamowania                                                                                                                                 |   |
| 2. Automated High-beam assist .....                                                                                                                                                                                | - |
| 3. Chassis: other .....                                                                                                                                                                                            | - |
| 4. Driver seat electrically adjustable, Memory seat, Passenger seat electrically adjustable .....                                                                                                                  | - |
| 5. Exterior design: other .....                                                                                                                                                                                    | - |
| 6. Head-Up Display .....                                                                                                                                                                                           | - |
| 7. Heated seat driver, Heated seat passenger .....                                                                                                                                                                 | - |
| 8. Interior decoration: other .....                                                                                                                                                                                | - |

|                                                                                                     |   |
|-----------------------------------------------------------------------------------------------------|---|
| 9. Leather upholstery .....                                                                         | - |
| 10. Light Alloy wheels 19" .....                                                                    | - |
| 11. Metallic paint .....                                                                            | - |
| 12. Other, Tinted rear windows .....                                                                | - |
| 13. Park Assistant, Park Distance Control front, Park Distance Control rear, Rear view camera ..... | - |
| 14. Steering wheel heated .....                                                                     | - |
| 15. Towbar removable .....                                                                          | - |
| 16. {Reflektory laserowe BMW} .....                                                                 | - |

### Base value of the vehicle

|                                                  |   |
|--------------------------------------------------|---|
| Base value of the vehicle by Eurotax (net) ..... | - |
|--------------------------------------------------|---|

### Corrections

First registration

Mileage

Equipment

Tyres

Other

|                                |   |
|--------------------------------|---|
| Current market situation ..... | - |
| Uszkodzenia, stan .....        | - |


Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 10-2025 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 08-10-2025

DEKRA's expert:  
Kacper Sosnowski (NEW)  
Andrzej Sosnowski

**Document issued electronically valid without signature.**

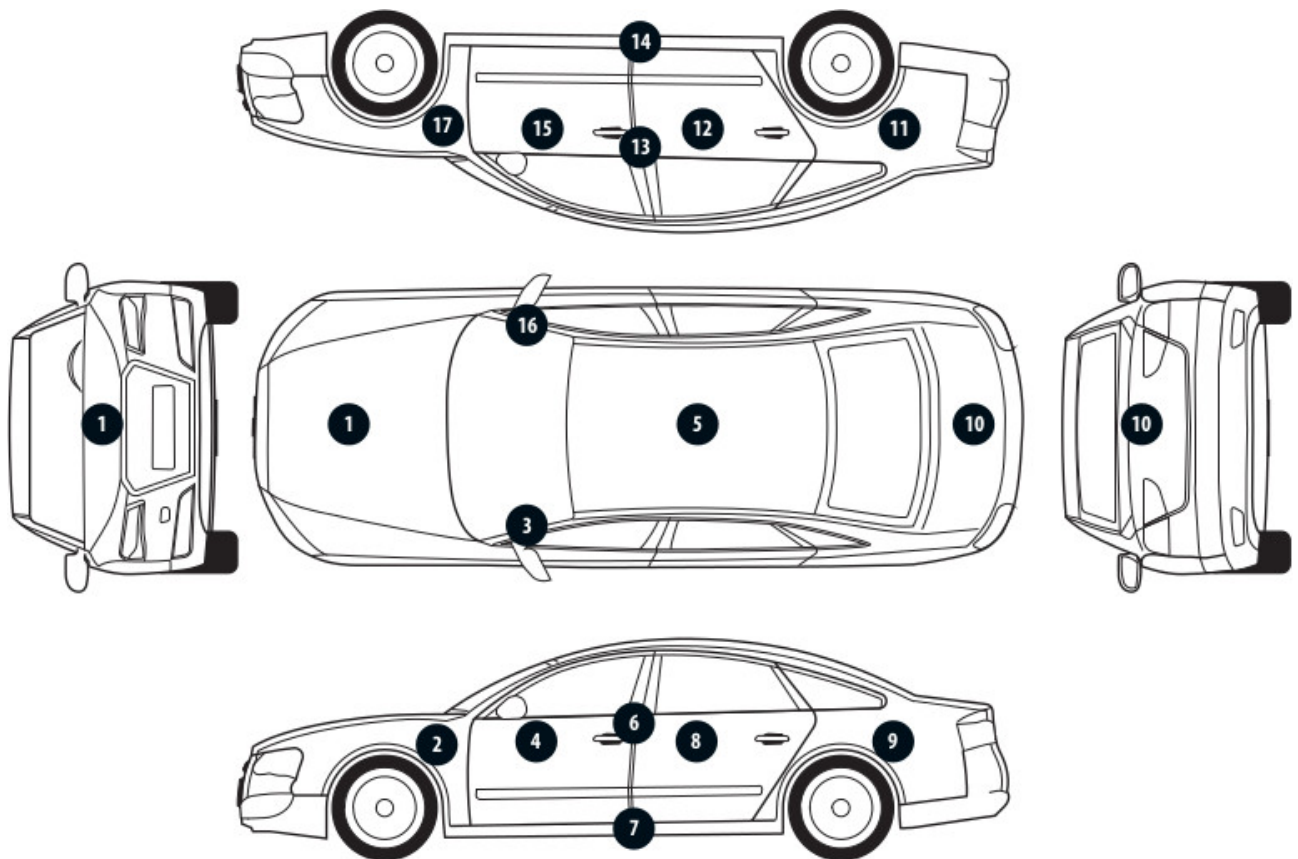Measurement of thickness of the vehicle lacquer coating


| No. of controlled item | Controlled item     | Measured range of thickness of the lacquer coat [µm] |
|------------------------|---------------------|------------------------------------------------------|
| 1                      | Front cover         | to 150                                               |
| 2                      | Front left fender   | to 150                                               |
| 3                      | Left front pillar   | to 150                                               |
| 4                      | Front left door     | to 150                                               |
| 5                      | Roof                | to 150                                               |
| 6                      | Left middle pillar  | to 150                                               |
| 7                      | Right side sill     | to 150                                               |
| 8                      | Left rear door      | to 150                                               |
| 9                      | Rear left fender    | to 150                                               |
| 10                     | Cover/lid           | to 150                                               |
| 11                     | Right rear fender   | to 150                                               |
| 12                     | Right rear door     | to 150                                               |
| 13                     | Right middle pillar | to 150                                               |
| 14                     | Right side sill     | to 150                                               |
| 15                     | Front right door    | to 150                                               |
| 16                     | Right front pillar  | to 150                                               |
| 17                     | Front right fender  | to 150                                               |

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book was presented and its number is given below:

.

**Information concerning the origin of the vehicle**

Lack of reliable data.

**Anti-theft protection - immobilizer**

- as a result of the inspection of the vehicle found no malfunctions of the immobilizer in the extent possible to determine during the inspection of the vehicle in the non- workshop conditions.

**Anti-theft protection - other:**

not found

**Additional comments on the car:**

Not applicable.

**Test drive**

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below:  
ograniczenia placowe

**Checking of the correctness and / or construction of identification / serial numbers of the object:**

Not tested

**Verification of the accuracy of the object data, including year of production, and other.**

Not conducted - adopted according to the documents presented and indicated sources.

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of

page 5/37

the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.

- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

---

#### Comments to the commission - regarding valuation

##### **Kluczyki**

TAK

2

---

#### Expert comments - regarding valuation

Niesprawne przyciski funkcyjne w jednym z kluczyków, grot prawidłowy. Aktywna kontrolka ciśnienia w kołach. Minął termin badania technicznego pojazdu od 06.2025. Rysy na samochodzie.

Rzeczoznawca dokonał oględzin pojazdu w warunkach parkingowych, co mogło ograniczyć pełną ocenę jego stanu technicznego. Dodatkowo, jeżeli jazda próbna została przeprowadzona (informacje w treści raportu), to wykonano ją w warunkach parkingowych, z niewielką prędkością, co może nie odzwierciedlać pełnych warunków eksploatacyjnych. Istnieje możliwość, że w innych okolicznościach ujawnią się dodatkowe uszkodzenia lub usterki, których nie można było wykryć podczas obecnych oględzin. Zalecamy zatem skorzystanie z możliwości oględzin pojazdu we własnym zakresie lub w Autoryzowanej Stacji Obsługi danej marki, co pozwoli na pełniejszą weryfikację stanu technicznego pojazdu przed udziałem w aukcji."

#### Restrictive disclaimer - regarding valuation

Nie weryfikowano szczegółowo stanu układu napędowego, zawieszenia, kierowniczego, hamulcowego oraz wydechowego. Ocena została wykonana bez użycia podnośnika i specjalistycznego sprzętu diagnostycznego, nie dokonywano demontażu osłon i innych elementów. Ocena określa ogólny stan pojazdu na dzień oględzin w miejscu jego udostępnienia, nie może być zatem traktowana jako kompleksowa ocena stanu technicznego. Specyfikacja wg. programu operacyjnego w zakresie wyposażenia standardowego i dodatkowego nie gwarantuje zgodności ze stanem faktycznym w zakresie możliwym do ustalenia przez rzeczoznawcę podczas oględzin pojazdu.

Pomiar grubości powłoki lakierowej wykonano w miejscach możliwych do ich wykonania pomiary nie gwarantują oryginalności poszczególnych elementów poddanych ocenie.

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.

- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.



PHOTOGRAPHIC DOCUMENTATION



**Photo 1.**

Przekątna przednia lewa



**Photo 2.**

Przód



PHOTOGRAPHIC DOCUMENTATION



**Photo 3.**

Przekątna przednia prawa



**Photo 4.**

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



**Photo 5.**  
Bok prawy z tyłu



**Photo 6.**  
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



**Photo 7.**

Tył



**Photo 8.**

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



**Photo 9.**

Bok lewy z tyłu



**Photo 10.**

Bok lewy z przodu



PHOTOGRAPHIC DOCUMENTATION



**Photo 11.**

Próg lewy (widok od przodu)



**Photo 12.**

Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



**Photo 13.**  
Spód pojazdu przód



**Photo 14.**  
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



**Photo 15.**

Tarcza hamulcowa przednia prawa



**Photo 16.**

Tarcza hamulcowa tylna prawa



PHOTOGRAPHIC DOCUMENTATION



**Photo 17.**

Tarcza hamulcowa tylna lewa



**Photo 18.**

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



**Photo 19.**

Bagażnik




**Photo 20.**

Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



**Photo 21.**  
Komora silnika

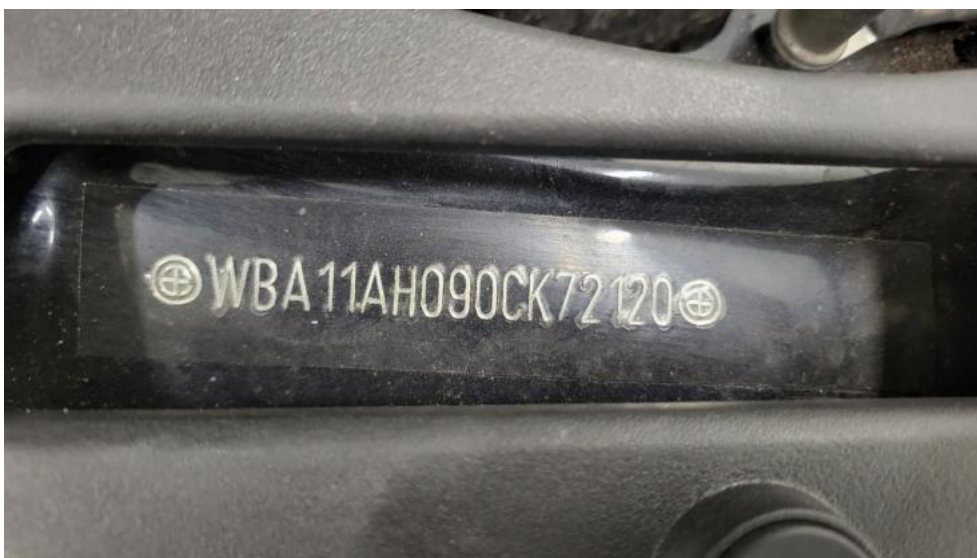

**Photo 22.**  
Numer identyfikacyjny



PHOTOGRAPHIC DOCUMENTATION



**Photo 23.**

Tabliczka znamionowa



**Photo 24.**

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



**Photo 25.**

Widok przez otwarte drzwi przednie lewe



**Photo 26.**

Kierownica z lewej strony



PHOTOGRAPHIC DOCUMENTATION



**Photo 27.**

Widok przez otwarte drzwi tylne lewe



**Photo 28.**


Widok z tylnej kanapy na deskę rozd.

PHOTOGRAPHIC DOCUMENTATION



**Photo 29.**

Konsola środkowa

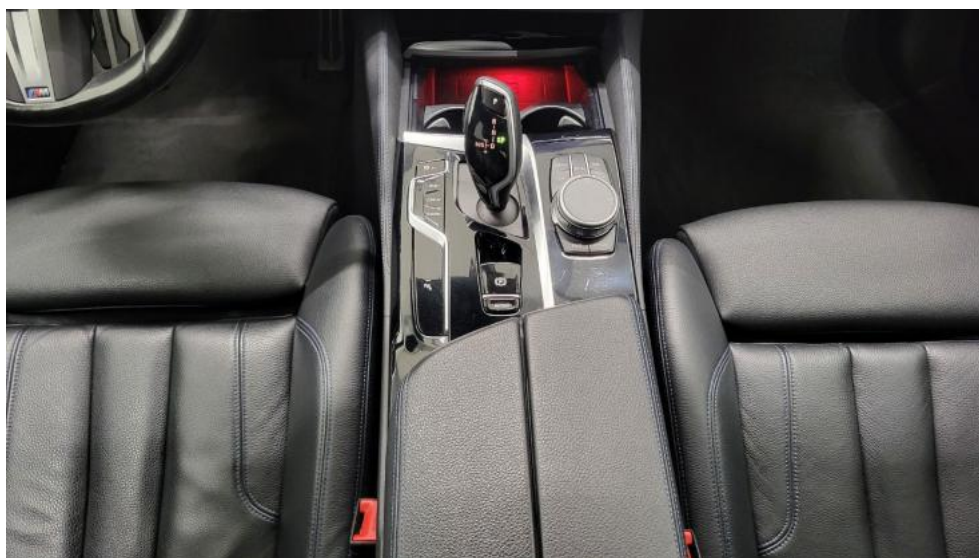

**Photo 30.**

Tunel środkowy

## A detailed view of the driver's side interior of a BMW M3. The steering wheel is black with silver accents and the BMW logo in the center. The instrument cluster is a digital display showing various driving metrics. The infotainment screen displays a navigation map. The interior features black leather upholstery with red stitching and a red M3 badge on the steering wheel.

|                                                                                     |  |                                               |  |                      |  |                                        |  |
|-------------------------------------------------------------------------------------|--|-----------------------------------------------|--|----------------------|--|----------------------------------------|--|
| KRAJOWY REJESTR<br><b>SAMOCHÓD OSOBOWY</b>                                          |  | C.1.1 PKO LEASING S. A. ODDZIAŁ W<br>KIELCACH |  | C.1.2 47219176700396 |  | C.1.3 25-303 KIELCE<br>SOLIDARNOSCI 34 |  |
| ADRES MIEJSCOWOŚCI<br>---                                                           |  | C.2.1 PKO LEASING S. A. ODDZIAŁ W<br>KIELCACH |  | C.2.2 47219176700396 |  | C.2.3 25-303 KIELCE<br>SOLIDARNOSCI 34 |  |
| KRAJOWY REJESTR<br>2822                                                             |  | C.3                                           |  | E.1 2440 kg          |  | E.2 2440 kg                            |  |
| KRAJOWY REJESTR<br>---                                                              |  | C.4                                           |  | F.1 4440 kg          |  | F.2 4440 kg                            |  |
| KRAJOWY REJESTR<br>13, 23 KN                                                        |  | G.1 1760 kg                                   |  | G.2 1760 kg          |  | G.3 1760 kg                            |  |
| KRAJOWY REJESTR<br>AAD4964980                                                       |  | H.1 2000 kg                                   |  | H.2 2000 kg          |  | H.3 2000 kg                            |  |
|  |  | I.1 210,00 km                                 |  | I.2 210,00 km        |  | I.3 210,00 km                          |  |
| SERIA DRY BAS 2807030                                                               |  | J.1 210,00 km                                 |  | J.2 210,00 km        |  | J.3 210,00 km                          |  |
| SERIA DRY BAS 2807030                                                               |  | K.1 210,00 km                                 |  | K.2 210,00 km        |  | K.3 210,00 km                          |  |
| SERIA DRY BAS 2807030                                                               |  | L.1 210,00 km                                 |  | L.2 210,00 km        |  | L.3 210,00 km                          |  |
| SERIA DRY BAS 2807030                                                               |  | M.1 210,00 km                                 |  | M.2 210,00 km        |  | M.3 210,00 km                          |  |
| SERIA DRY BAS 2807030                                                               |  | N.1 210,00 km                                 |  | N.2 210,00 km        |  | N.3 210,00 km                          |  |
| SERIA DRY BAS 2807030                                                               |  | O.1 210,00 km                                 |  | O.2 210,00 km        |  | O.3 210,00 km                          |  |
| SERIA DRY BAS 2807030                                                               |  | P.1 210,00 km                                 |  | P.2 210,00 km        |  | P.3 210,00 km                          |  |
| SERIA DRY BAS 2807030                                                               |  | Q.1 210,00 km                                 |  | Q.2 210,00 km        |  | Q.3 210,00 km                          |  |
| SERIA DRY BAS 2807030                                                               |  | R.1 210,00 km                                 |  | R.2 210,00 km        |  | R.3 210,00 km                          |  |
| SERIA DRY BAS 2807030                                                               |  | S.1 210,00 km                                 |  | S.2 210,00 km        |  | S.3 210,00 km                          |  |
| SERIA DRY BAS 2807030                                                               |  | T.1 210,00 km                                 |  | T.2 210,00 km        |  | T.3 210,00 km                          |  |
| SERIA DRY BAS 2807030                                                               |  | U.1 210,00 km                                 |  | U.2 210,00 km        |  | U.3 210,00 km                          |  |
| SERIA DRY BAS 2807030                                                               |  | V.1 210,00 km                                 |  | V.2 210,00 km        |  | V.3 210,00 km                          |  |
| SERIA DRY BAS 2807030                                                               |  | W.1 210,00 km                                 |  | W.2 210,00 km        |  | W.3 210,00 km                          |  |
| SERIA DRY BAS 2807030                                                               |  | X.1 210,00 km                                 |  | X.2 210,00 km        |  | X.3 210,00 km                          |  |
| SERIA DRY BAS 2807030                                                               |  | Y.1 210,00 km                                 |  | Y.2 210,00 km        |  | Y.3 210,00 km                          |  |
| SERIA DRY BAS 2807030                                                               |  | Z.1 210,00 km                                 |  | Z.2 210,00 km        |  | Z.3 210,00 km                          |  |

**DEKRA Polska Sp. z o.o.**  
02-673 Warszawa, ul. Konstruktorska 12A  
www.dekra.pl




PHOTOGRAPHIC DOCUMENTATION



**Photo 33.**

Dow. Rej. Str.2 i klucze

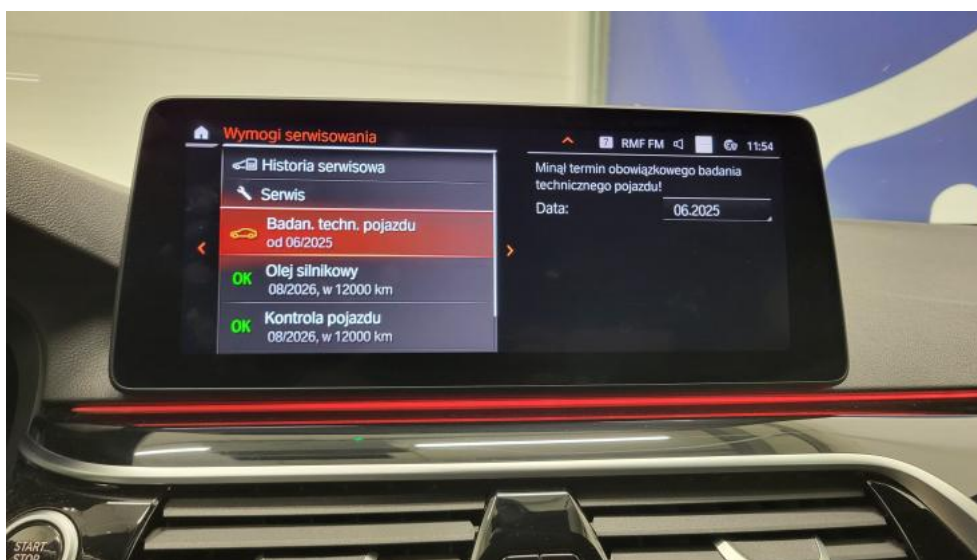

**Photo 34.**

Książka serwisowa – dane




PHOTOGRAPHIC DOCUMENTATION



**Photo 35.**

Książka serwisowa – ostatni przegląd

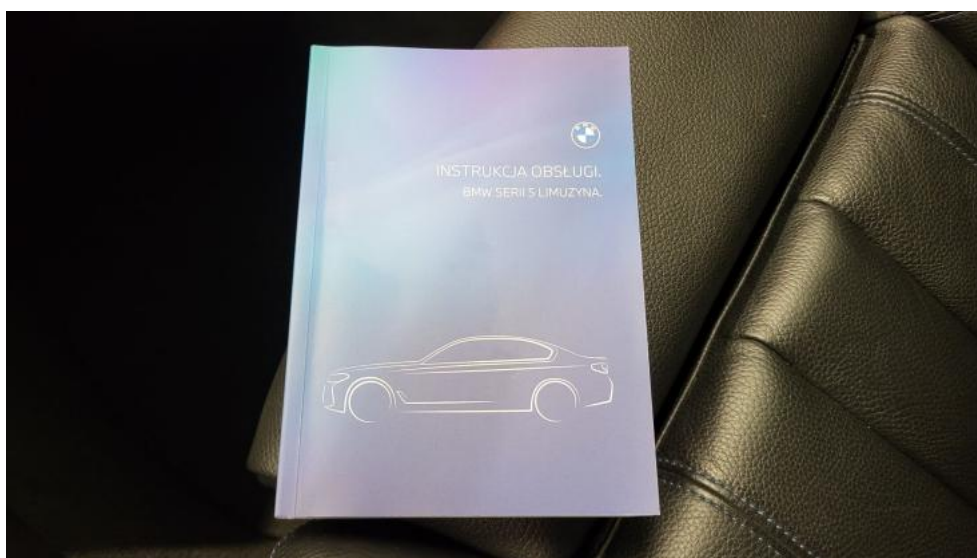

**Photo 36.**

Instrukcje

PHOTOGRAPHIC DOCUMENTATION



**Photo 37.**

Zestaw naprawczy koła



**Photo 38.**

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



**Photo 39.**

Zdjęcie do protokołu



**Photo 40.**

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



**Photo 41.**

Zdjęcie do protokołu




**Photo 42.**

Pokrywa komory silnika - Rysa/odprysk 1



PHOTOGRAPHIC DOCUMENTATION

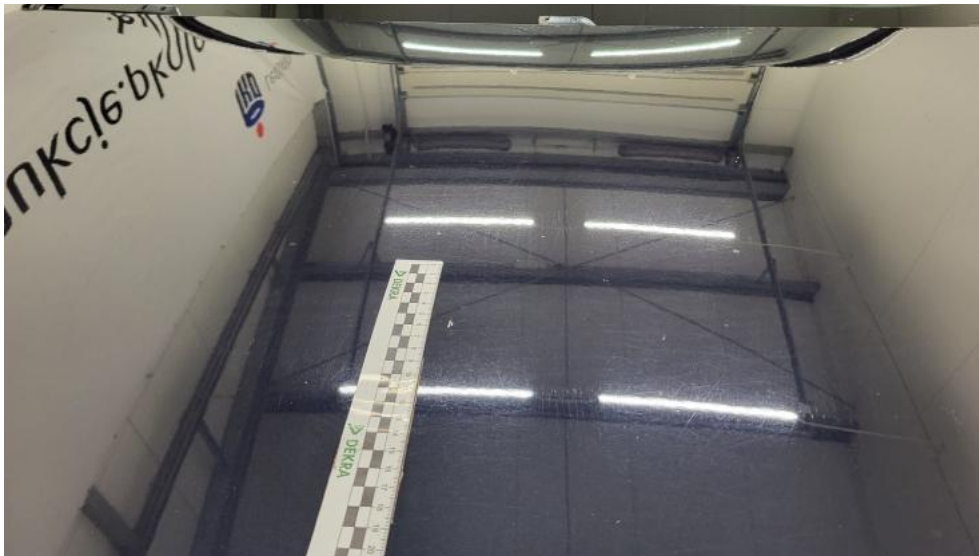

**Photo 43.**


Pokrywa komory silnika - Rysa/odprysk 2



**Photo 44.**

Pokrywa komory silnika() - Rysa/odprysk 3

PHOTOGRAPHIC DOCUMENTATION

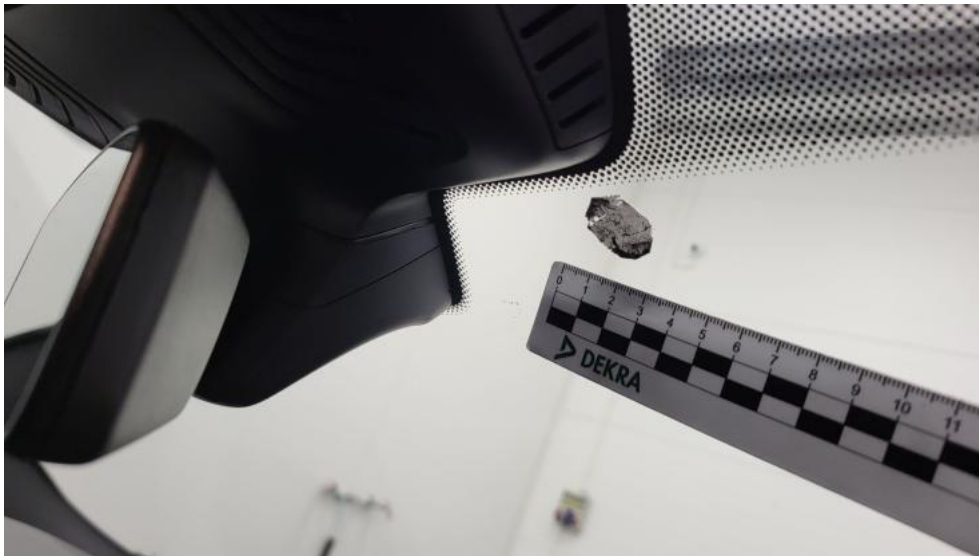

**Photo 45.**

Szyba czołowa - Inne 1



**Photo 46.**

Zderzak - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



**Photo 47.**

Zderzak - Rysa/odprysk 2



**Photo 48.**

Felga aluminiowa przednia P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



**Photo 49.**

Drzwi tylne P - Rysa/odprysk 1



**Photo 50.**

Słupek przedni P - Wgniecenie/odkształcenie 1



PHOTOGRAPHIC DOCUMENTATION



**Photo 51.**

Felga aluminiowa tylna P - Rysa/odprysk 1



**Photo 52.**

Zderzak tylny - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



**Photo 53.**

Zderzak tylny - Pęknięcie/rozerwanie 1



**Photo 54.**

Zderzak tylny - Inne 1

PHOTOGRAPHIC DOCUMENTATION



**Photo 55.**

Błotnik tylny L / Ściana boczna L - Wgniecenie/odkształcenie 1



**Photo 56.**

Drzwi przed L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



**Photo 57.**

Drzwi tylne L - Rysa/odprysk 1



**Photo 58.**

Lusterko zew L - Rysa/odprysk 1



PHOTOGRAPHIC DOCUMENTATION



**Photo 59.**

Słupki przedni L - Rysa/odprysk 1



**Photo 60.**

Felga Aluminiowa przednia L - Rysa/odprysk 1