

DEKRA's commission No. : PKOL(W)/LODZ/92511/26/10/02
commission/ damage No. : 23/029902
Date of commission: 02-10-2026

DEKRA Poland - Headquarters
02-673 Warszawa, ul. Konstruktorska 12A

Client :

PKO Leasing SA
Świętokrzyska 36
00-116 Warszawa

Expert:

Kacper Sosnowski (WSP)
DEKRA Polska - współpraca O/Warszawa
inż. Józef Orłowski
TU - Włocławek

NOTE:

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

Vehicle data

Group of objects (Eurotax)	jeeps
EC code (Eurotax)	0147744
Manufacturer	CUPRA
Model	Formentor 20-24
Type / version	Formentor 1.5 TSI DSG
Body type	hatchback
Number of doors / seats	5/5
Curb weight [kg]	1420
Gross vehicle weight [kg]	1980
Wheelbase 1/2	2679
Engine type	spark ignition
Pollution reduction system	GPF
Engine capacity [ccm]	1498
Engine Power [hp/kW]	150/110
Gearbox	automatic 7- gear
Registration /record No.	WZ123GT
VIN / serial number	VSSZZZKM7RR010615
Date of first registration	18-09-2023
Date of next. tech. test	18-09-2028
Year of manufacture	2023 (year has been verified with the manufacturer's base)
Readout [km]	128 810 (read)
Body color / type of coating	blue/METALIK

Tyres

axle	Wheel	Manufacturer, type	Size	Measured profile
Front	right	KUMHO, WINTERCRAFT WP72	245/40 19 98V	2,5 mm
	left	KUMHO, WINTERCRAFT WP72	245/40 19 98V	2,0 mm
back	right	KUMHO, WINTERCRAFT WP72	245/40 19 98V	4,5 mm
	left	KUMHO, WINTERCRAFT WP72	245/40 19 98V	5,0 mm

Standard equipment by Eurotax

1. Active Tyre pressure control
2. Adaptive Cruise Control
3. Airbag: other
4. Android Auto, Apple CarPlay, Other
5. Antilock-Brake-System (ABS)
6. Armrest (s) front, Storage facilities in general
7. Armrest (s) rear
8. Artificial leather upholstery, Textile upholstery
9. Automated High-beam assist
10. Automatic dimlight activation
11. Automatic limited slip differential
12. Automatic limited slip differential
13. Bluetooth interface
14. Bord communication: other, Hands-free system, mp3 Player, On board monitor, Radio, USB in, Voice control for audiosystem
15. Brake Assist
16. CUPRA CARE - 5 lat gwarancji CUPRA
17. Child seat fixation
18. Child seat fixation
19. Cornering Headlights, Fog lamps
20. DAB radio
21. Distance control
22. Door mirror(s) electrically adjustable in general, Door mirrors electrically foldable, Door mirrors heated
23. Driver airbag, Driver knee airbag, Head airbags front, Passenger airbag, Side airbag driver and passenger
24. Driver conditioning monitoring
25. Driver seat height adjustable, Lumbar adjust driver, Lumbar adjust passenger, Passenger seat height adjustable
26. Dywaniki welurowe z przodu i z tyłu
27. ESP (Electronical Stabilizing Program)
28. Electric parking brake
29. Exterior design: other
30. Exterior design: other
31. Exterior design: other
32. Exterior design: other
33. Exterior design: other
34. Exterior design: other
35. Exterior design: other
36. Exterior design: other
37. Exterior design: other, Roof railing
38. Extra power outlet
39. Follow me home
40. Funkcja automatyczna opóźnionego wyłączenia świateł Coming and Leaving Home
41. Heated seat driver, Heated seat passenger
42. Interior decoration: other
43. Interior lights: other accessories
44. Interior lights: other accessories
45. Interior lights: other accessories
46. Interior lights: other accessories
47. Interior lights: other accessories
48. Interior: other
49. Interior: other
50. Keyless go
51. LED Daytime running lights
52. LED front dim light
53. LED rear lights, Side indicators
54. Lane control assistant
55. Light Alloy wheels 18''
56. Luggage: other
57. Mirror: others
58. Multi functional steering wheel, Sports steering wheel, Steering wheel heated
59. On board monitor
60. Other
61. Other
62. Other
63. Other
64. Other
65. Other
66. Oświetlenie drzwi LED
67. Park Assistant, Park Distance Control front, Park Distance Control rear
68. Power windows front, Power windows rear
69. Półka na dokumenty pod fotelem kierowcy
70. Rain sensor
71. Rear seat-backs foldable in two separate parts
72. Rear spoiler
73. Rear view camera
74. Rear-view mirror autodimming
75. Seats: other
76. Selectable driveline characteristics
77. Servotronic
78. Speed limiter
79. Sport seats front
80. Steering wheel with gear-switches
81. Storage facilities in general
82. Traction control
83. Trizone automatic climate control
84. Uni-Lackierung
85. Zamek centralny ze zdalnym sterowaniem, dwa składane kluczyki, otwieranie drzwi bagażnika z pilota

Dealer's equipment (selected items)

1. Adaptive Cruise Control, Automated High-beam assist, Blind spot warning, Bord communication: other, Hands-free system, Interior lights: other accessories, Light Alloy wheels 18", mp3 Player, Navigation system, On board monitor, Radio, Traffic sign recognition, USB in, Voice control for navigation system -
 Oświetlenie ambientowe kokpitu LED z możliwością wybołu koloru
 Felgi aluminiowe 18 CUPRA MACHINED SPORT BLACK MATT / SILVER z ogumieniem 245/45 (PUK)
 Mapy Europy
 Oświetlenie Ambientowe kokpitu LED z możliwością wyboru koloru
 CUPRA CONNECT dla Navi System(Bezpieczeństwo i serwis 10 lat,zdalny dostęp i usł multimedialne 1rok)
 System Navi System Plus wyśw.10/3D/Radio MP3/WMA/Full Link/USB/rozbudowane rozpoznawanie mowy
 Pakiet wspomagania jazdy L dla samochodów z NaviSystem+
2. Diminished spare wheel -
3. Door mirror with memory, Driver seat electrically adjustable, Moulded sport seats -
 Fotele przednie kubelkowe
 Tapicerka materiałowa z ekoskórą z przeszyciem w kolorze miedzi
 Fotel kierowcy z pełną regulacją elektryczną oraz pamięcią ustawień
 Lusterka z pamięcią ustawień
4. Metalic paint -

Base value of the vehicle

Base value of the vehicle by Eurotax (net) -

Corrections

First registration

Mileage

Equipment

Tyres

Other

Zwiekszona grubość powłoki lakierniczej -
 Stwierdzone braki i uszkodzenia -


Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 10-2026 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 06-10-2026

DEKRA's expert:
Kacper Sosnowski (WSP)
inż. Józef Orłowski

Document issued electronically valid without signature.

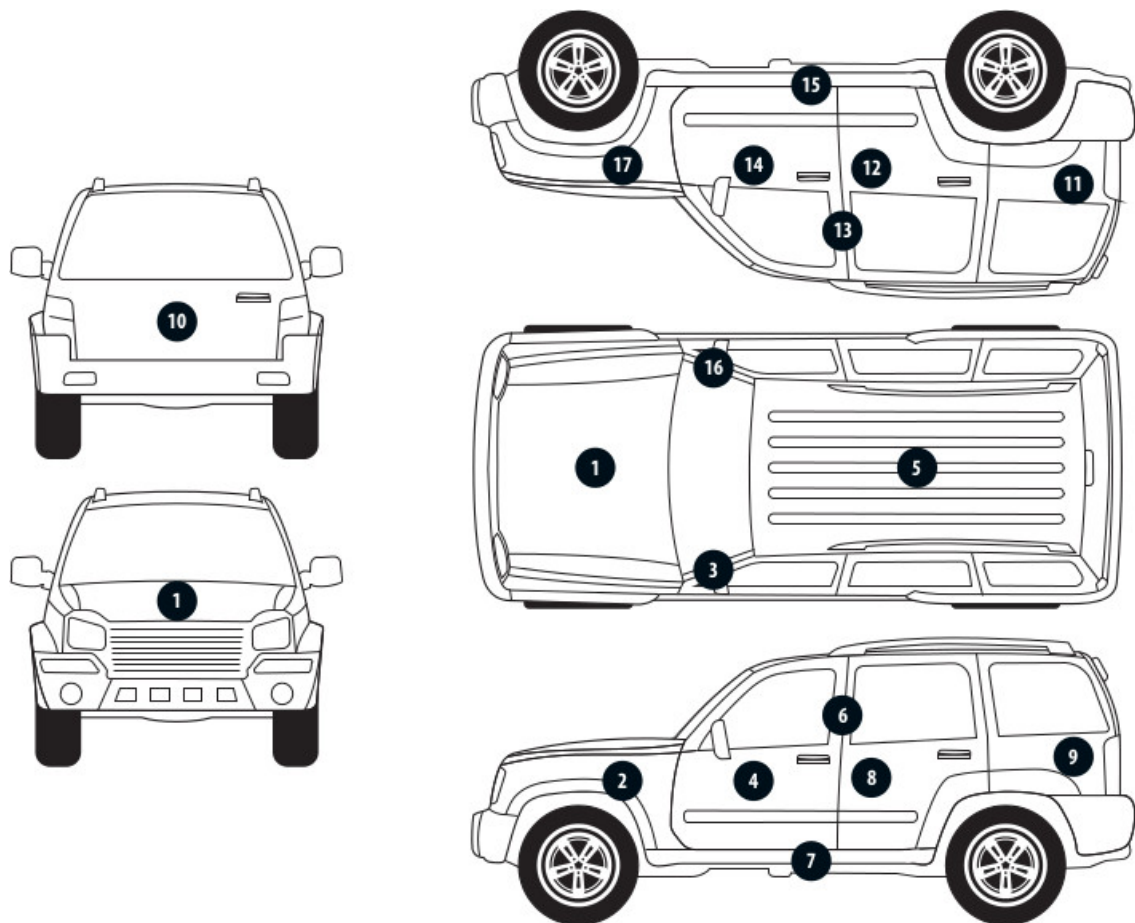Measurement of thickness of the vehicle lacquer coating


No. of controlled item	Controlled item	Measured range of thickness of the lacquer coat [µm]
1	Front cover	to 150
2	Left front fender	150 - 200
3	Left front pillar	150 - 200
4	Left front wall	150 - 200
5	Roof	150 - 200
6	Left middle pillar	to 150
7	Left side sill	to 150
8	Left rear wall	150 - 200
9	Left side wall	150 - 200
10	Cover/tailgate	to 150
11	Side right wall	150 - 200
12	Rear right door	150 - 200
13	Middle right pillar	to 150
14	Front right door	150 - 200
15	Right side sill	to 150
16	Right front pillar	150 - 200
17	Right front fender	150 - 200

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book was presented and its number is given below:
elektroniczna

Information concerning the origin of the vehicle

The vehicle purchased domestically from an authorized representative of the brand.

Additional comments on the car:

Not applicable.

Test drive

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below:
ograniczenia parkingowe

Checking of the correctness and / or construction of identification / serial numbers of the object:

Not tested

Verification of the accuracy of the object data, including year of production, and other.

Not conducted - adopted according to the documents presented and indicated sources.

Anti-theft protection

immobilizer

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.
- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation

Kluczyki

TAK

1

Expert comments - regarding valuation

Rysy na samochodzie. Informacja zleć wykonanie przeglądu. Informacja wymień baterie w kluczyku.
Wymagany przegląd od 10 dni.

PHOTOGRAPHIC DOCUMENTATION



Photo 1.

Przekątna przednia lewa



Photo 2.

Przód

PHOTOGRAPHIC DOCUMENTATION



Photo 3.

Przekątna przednia prawa



Photo 4.

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 5.
Bok prawy z tyłu



Photo 6.
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 7.

Tył



Photo 8.

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 9.

Bok lewy z tyłu



Photo 10.

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



Photo 11.
Próg lewy (widok od przodu)



Photo 12.
Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



Photo 13.
Spód pojazdu przód



Photo 14.
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



Photo 15.

Tarcza hamulcowa przednia prawa



Photo 16.

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



Photo 17.

Tarcza hamulcowa tylna lewa



Photo 18.

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



Photo 19.
Bagażnik



Photo 20.
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



Photo 21.
Komora silnika

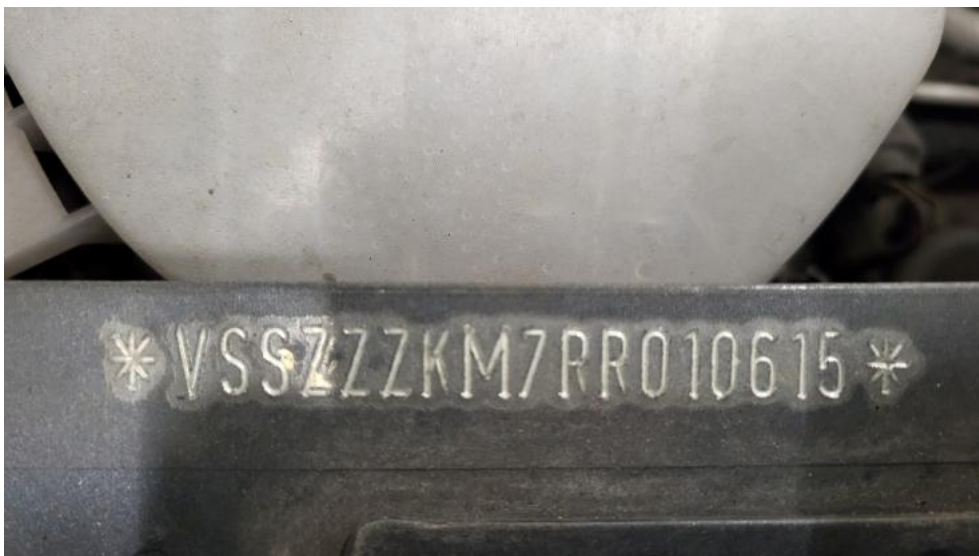


Photo 22.
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION



Photo 23.

Tabliczka znamionowa



Photo 24.

Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



Photo 25.

Zestaw wskaźników - serwis



Photo 26.

Widok przez otwarte drzwi przednie lewe

PHOTOGRAPHIC DOCUMENTATION



Photo 27.

Kierownica z lewej strony



Photo 28.

Widok przez otwarte drzwi tylne lewe

PHOTOGRAPHIC DOCUMENTATION



Photo 29.

Widok z tylnej kanapy na deskę rozdź.



Photo 30.

Konsola środkowa

PHOTOGRAPHIC DOCUMENTATION



Photo 31.
Tunel środkowy



Photo 32.
Kierownica (na wprost)

PHOTOGRAPHIC DOCUMENTATION



Photo 33.

Dowód rej. Str. 1

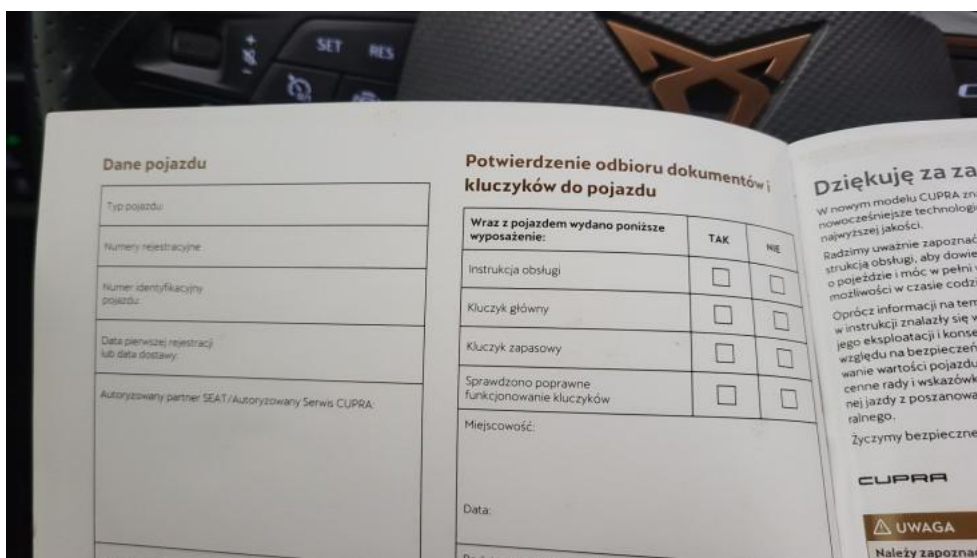


Photo 34.

Książka serwisowa – dane

PHOTOGRAPHIC DOCUMENTATION**Photo 35.**

Książka serwisowa – ostatni przegląd

**Photo 36.**

Dow. Rej. Str. 2

PHOTOGRAPHIC DOCUMENTATION



Photo 37.

Instrukcje



Photo 38.

Kluczyki

PHOTOGRAPHIC DOCUMENTATION



Photo 39.

Zdjęcie do protokołu



Photo 40.

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



Photo 41.
Zdjęcie do protokołu



Photo 42.
Pokrywa komory silnika - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 43.

Zderzak - Rysa/odprysk 1



Photo 44.

Zderzak przedni cz L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION

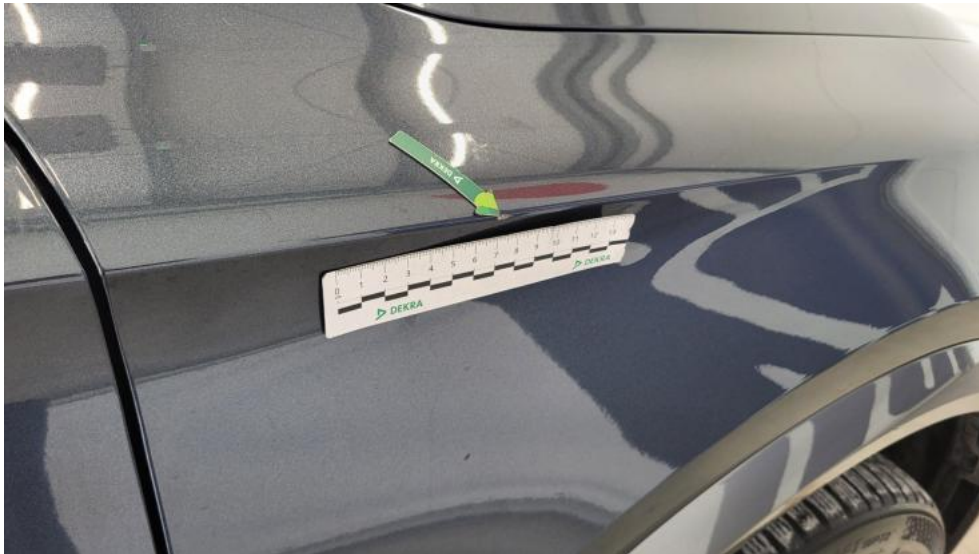


Photo 45.

Błotnik przedni P - zdjęcie pogładowe 1



Photo 46.

Błotnik przedni P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION

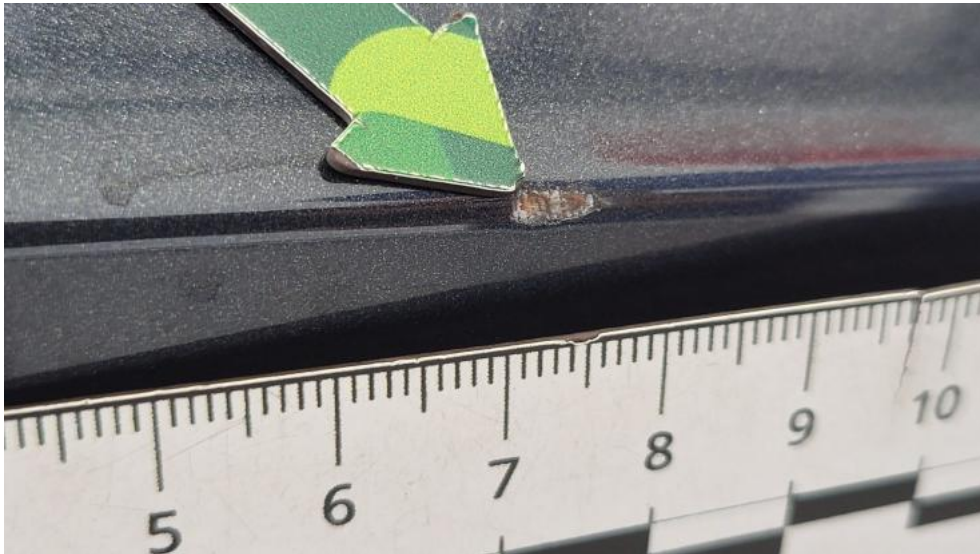


Photo 47.

Łotnik przedni P - Inne 1



Photo 48.

Felga aluminiowa przednia P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 49.

Listwa błotnika przedniego P - Rysa/odprysk 1



Photo 50.

Drzwi przednie P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 51.

Drzwi tylne P - Rysa/odprysk 1



Photo 52.

Drzwi tylne P - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 53.

Listwa drzwi przednich P - Rysa/odprysk 1



Photo 54.

Listwa drzwi tylnych P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 55.

Błotnik tylny P / Ściana boczna P - Wgniecenie/odkształcenie 1



Photo 56.

Felga aluminiowa tylna P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 57.

Listwa krawędzi błotnika tyl P - Rysa/odprysk 1



Photo 58.

Pokrywy bagażnika - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 59.

Zderzak tylny - Rysa/odprysk 1



Photo 60.

Dach - zdjęcie poglądowe 1

PHOTOGRAPHIC DOCUMENTATION

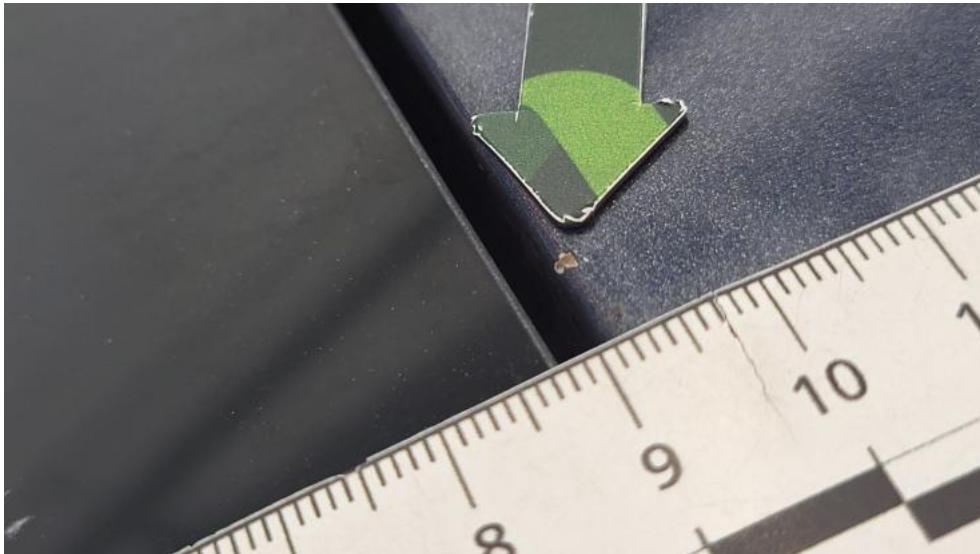


Photo 61.
Dach - Inne 1



Photo 62.
Listwa krawędzi błotnika tyl L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION

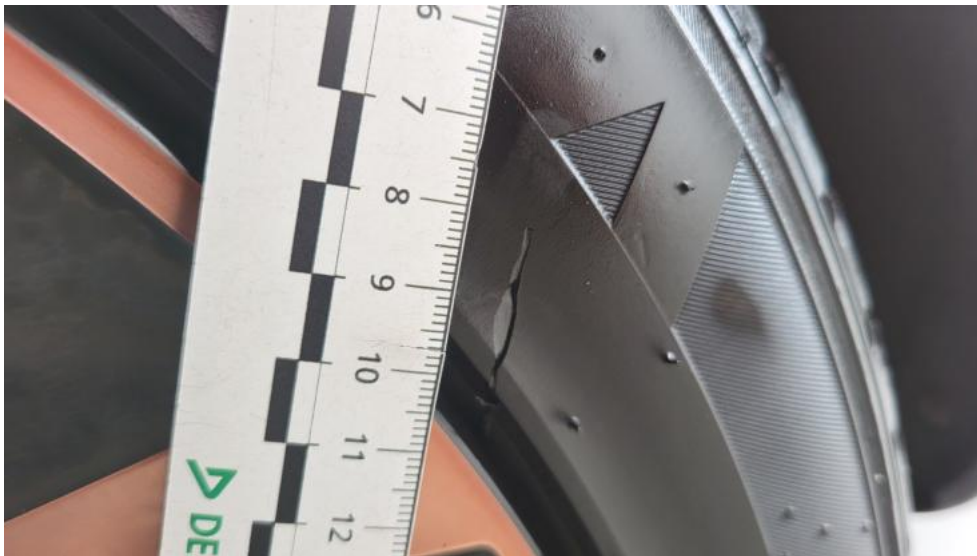


Photo 63.

Opona tylna L - Pęknięcie/rozerwanie 1



Photo 64.

Drzwi przed L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 65.

Drzwi przed L - Wgniecenie/odkształcenie 1



Photo 66.

Drzwi tylne L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 67.

Drzwi tylne L - Wgniecenie/odkształcenie 1



Photo 68.

Listwa drzwi przednich L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 69.

Felga Aluminiowa przednia L - Rysa/odprysk 1



Photo 70.

Fotel prz. lew. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 71.

Fotel prz. praw. - Inne 1



Photo 72.

Kanapa tyl. - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 73.

Tapicerka drzwi przednich P - Rysa/odprysk 1



Photo 74.

Uchwyt drzwi tyl P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



Photo 75.

Uszczelka drzwi przednich L - Rysa/odprysk 1



Photo 76.

Uszczelka drzwi tylnych L - Pęknięcie/rozerwanie 1

PHOTOGRAPHIC DOCUMENTATION



Photo 77.

Osłona p/słoneczna lewa - Inne 1

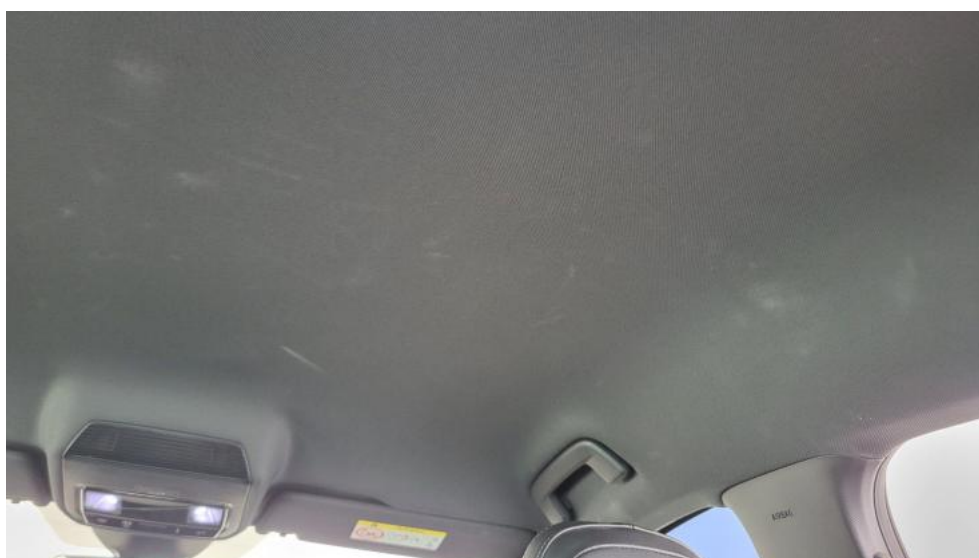


Photo 78.

Podsufitka - Inne 1

PHOTOGRAPHIC DOCUMENTATION



Photo 79.

Wykładzina(y) słupka przedniego L - Rysa/odprysk 1



Photo 80.

Wykładzina(y) słupka przedniego P - Inne 1