

DEKRA's commission No. : PKOL(W)/LODZ/81310/26/08/31  
commission/ damage No. : 21/041908  
Date of commission: 31-08-2026

**DEKRA Poland - Headquarters**  
02-673 Warszawa, ul. Konstruktorska 12A

**Client :**

PKO Leasing SA  
Świętokrzyska 36  
00-116 Warszawa

**Expert:**

**Kacper Sosnowski (WSP)**  
DEKRA Polska - współpraca O/Warszawa  
**mgr inż. Michał Świątek**  
DEKRA Polska - Centrala

**NOTE:**

Due to the use of the document it was removed from it any information relating to the value of the vehicle, the price of equipment, adjustments, etc..

**Vehicle data**

|                              |                                                            |
|------------------------------|------------------------------------------------------------|
| Group of objects (Eurotax)   | jeeps                                                      |
| EC code (Eurotax)            | 0146704                                                    |
| Manufacturer                 | LAND ROVER                                                 |
| Model                        | Range Rover Velar 20-23                                    |
| Type / version               | Velar 2.0 D200 mHEV R-Dynamic S                            |
| Body type                    | KOM                                                        |
| Number of doors / seats      | 5/5                                                        |
| Curb weight [kg]             | 2058                                                       |
| Gross vehicle weight [kg]    | 2590                                                       |
| Wheelbase 1/2                | 2874                                                       |
| Engine type                  | Automatic ignition                                         |
| Supercompression             | turbocompressor with intercooler                           |
| Pollution reduction system   | KSC                                                        |
| Emission standard            | EURO 6                                                     |
| Engine capacity [ccm]        | 1997                                                       |
| Engine Power [hp/kW]         | 204/150                                                    |
| Gearbox                      | automatic 8- gear                                          |
| Registration /record No.     | SK180VC                                                    |
| VIN / serial number          | SALYA2BN4MA310830                                          |
| Date of first registration   | 08-09-2021                                                 |
| Date of next. tech. test     | 08-09-2026                                                 |
| Year of manufacture          | 2021 (year has been verified with the manufacturer's base) |
| Readout [km]                 | 133 262 (read)                                             |
| Body color / type of coating | silver/double-layered, metallized                          |

**Tyres**

| axle  | Wheel | Manufacturer, type                                    | Size            | Measured profile |
|-------|-------|-------------------------------------------------------|-----------------|------------------|
| Front | right | Goodyear, EAGLE F1<br>ASYMMETRIC SUV AT XL<br>FP J LR | 255/50 R20 109W | 4,0 mm           |
|       | left  | Goodyear, EAGLE F1<br>ASYMMETRIC SUV AT XL<br>FP J LR | 255/50 R20 109W | 4,0 mm           |

|      |       |                                        |                 |        |
|------|-------|----------------------------------------|-----------------|--------|
| back | right | GOODYEAR, VECTOR<br>4SEASONS GEN-3 SUV | 255/50 R20 109W | 5,0 mm |
|      | left  | GOODYEAR, VECTOR<br>4SEASONS GEN-3 SUV | 255/50 R20 109W | 5,0 mm |

Standard equipment by Eurotax

- |                                                                                                                                                                                                                                                                                                       |                                                             |
|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------|
| 1. Accoustic windows                                                                                                                                                                                                                                                                                  | 29. Interior decoration: other                              |
| 2. Active Emergency Brake Assist                                                                                                                                                                                                                                                                      | 30. Interior: other                                         |
| 3. Alarm                                                                                                                                                                                                                                                                                              | 31. Interior: other                                         |
| 4. All season tyres                                                                                                                                                                                                                                                                                   | 32. Keyless go                                              |
| 5. Android Auto                                                                                                                                                                                                                                                                                       | 33. LED front dim light                                     |
| 6. Antilock-Brake-System (ABS)                                                                                                                                                                                                                                                                        | 34. Lane control assistant                                  |
| 7. Apple CarPlay                                                                                                                                                                                                                                                                                      | 35. Leather steering wheel                                  |
| 8. Armrest (s) rear, Driver seat electrically adjustable, Driver seat height adjustable, Driver seat with adjustable inclination, Lumbar adjust driver, Lumbar adjust passenger, Passenger seat electrically adjustable, Passenger seat height adjustable, Passenger seat with adjustable inclination | 36. Leather steering wheel                                  |
| 9. Automated High-beam assist                                                                                                                                                                                                                                                                         | 37. Metal finish                                            |
| 10. Bluetooth interface                                                                                                                                                                                                                                                                               | 38. Other                                                   |
| 11. Bord climate: other                                                                                                                                                                                                                                                                               | 39. Other                                                   |
| 12. Bord entertainment: other accessories                                                                                                                                                                                                                                                             | 40. Other                                                   |
| 13. Child seat fixation                                                                                                                                                                                                                                                                               | 41. Other                                                   |
| 14. Cruise control                                                                                                                                                                                                                                                                                    | 42. Other                                                   |
| 15. DAB radio                                                                                                                                                                                                                                                                                         | 43. Other                                                   |
| 16. Distribution of braking force electronically                                                                                                                                                                                                                                                      | 44. Other                                                   |
| 17. Distribution of braking force electronically                                                                                                                                                                                                                                                      | 45. Park Distance Control front, Park Distance Control rear |
| 18. Door mirror(s) electrically adjustable in general, Door mirrors heated                                                                                                                                                                                                                            | 46. Power steering                                          |
| 19. Door mirrors autodimming, Door mirrors electrically foldable, Floor lighting, Side indicators                                                                                                                                                                                                     | 47. Rain sensor                                             |
| 20. Dualzone automatic climate control                                                                                                                                                                                                                                                                | 48. Rear-view mirror autodimming                            |
| 21. ESP (Electronical Stabilizing Program)                                                                                                                                                                                                                                                            | 49. Roll over protection system                             |
| 22. Electric tailgate                                                                                                                                                                                                                                                                                 | 50. Soundsystem                                             |
| 23. Electronic controlled suspension                                                                                                                                                                                                                                                                  | 51. Steering wheel manually adjustabe                       |
| 24. Exterior design: other                                                                                                                                                                                                                                                                            | 52. Traction control                                        |
| 25. Exterior design: other                                                                                                                                                                                                                                                                            | 53. Traffic sign recognition                                |
| 26. Extra power outlet, USB in                                                                                                                                                                                                                                                                        | 54. Tyre pressure control (RDC)                             |
| 27. Hill descent control                                                                                                                                                                                                                                                                              | 55. {Kontrola stabilności przyczepy}                        |
| 28. Hill holder                                                                                                                                                                                                                                                                                       |                                                             |

Dealer's equipment (selected items)

- |                                                                                    |   |
|------------------------------------------------------------------------------------|---|
| 1. Diminished spare wheel .....                                                    | - |
| 2. Exterior design: other .....                                                    | - |
| 3. Exterior design: other .....                                                    | - |
| 4. Floor mat .....                                                                 | - |
| 5. Headlamp wash .....                                                             | - |
| 6. Interior: other, Leather upholstery .....                                       | - |
| 7. Light Alloy wheels 20'' .....                                                   | - |
| 8. Metallic paint .....                                                            | - |
| 9. On board monitor .....                                                          | - |
| 10. Steering wheel heated, Windscreen heating, Windscreen wash-nozzle heated ..... | - |
| Ogrzewana szyba przednia i dysze spryskiwaczy wycieraczek                          |   |
| Kierownica ogrzewana                                                               |   |
| 11. Tinted rear windows .....                                                      | - |
| 12. Towbar removable .....                                                         | - |

**Base value of the vehicle**

Base value of the vehicle by Eurotax (net) ..... -

**Corrections**First registrationMileageEquipmentTyresOther

Earlier repairs ..... -  
Necessary repairs ..... -  
Braki i uszkodzenia ..... -  
Aktualna sytuacja rynkowa ..... -


Above figure was estimated on the basis of price quotations of used cars on the Polish market Eurotax (database number 09-2026 POL) with regard to technical and market parameters affecting the value of the vehicle.

Basic print without information about the vehicle's value - duey to use of the document any information relating to the value of the vehicle, the price of equipment, adjustments, etc.. were removed

Date: 01-09-2026

DEKRA's expert:  
Kacper Sosnowski (WSP)  
mgr inż. Michał Świątek

**Document issued electronically valid without signature.**

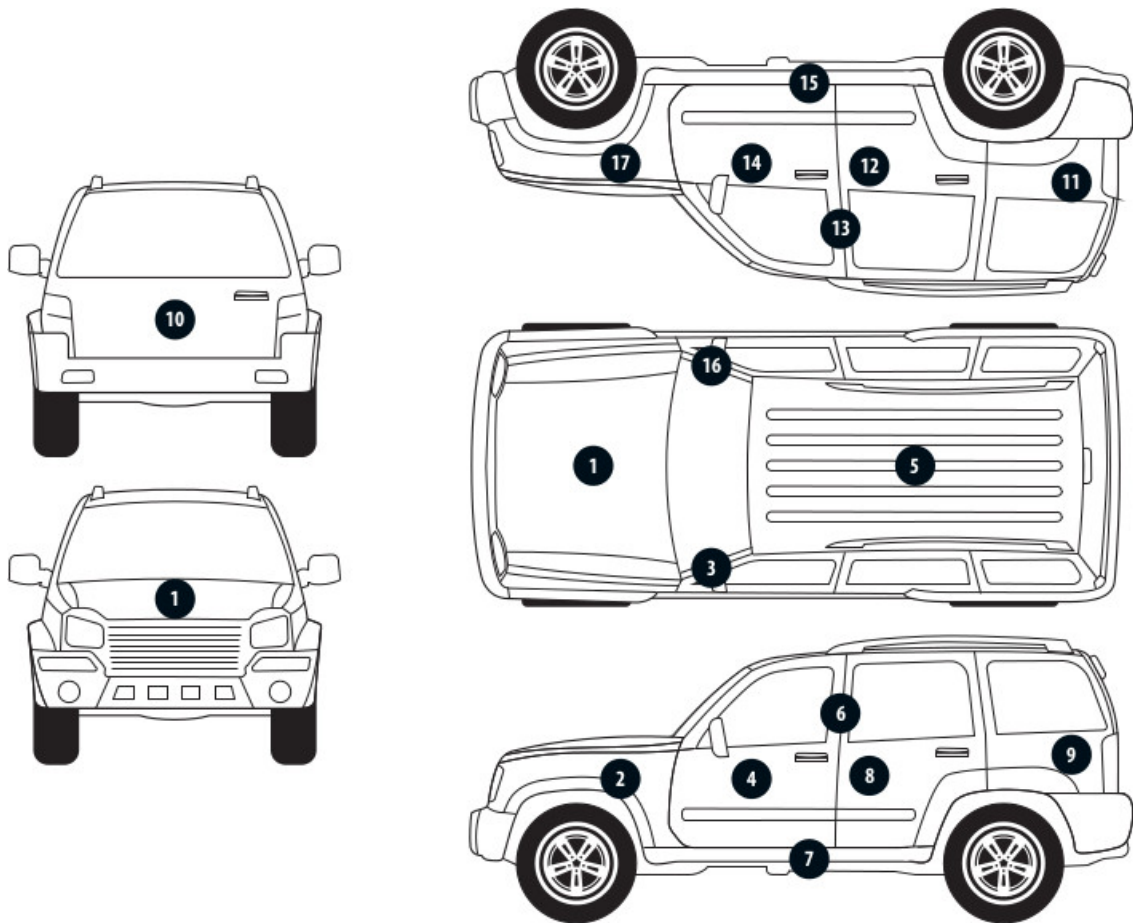Measurement of thickness of the vehicle lacquer coating


| No. of controlled item | Controlled item     | Measured range of thickness of the lacquer coat [ $\mu\text{m}$ ] |
|------------------------|---------------------|-------------------------------------------------------------------|
| 1                      | Front cover         | 150 - 200                                                         |
| 2                      | Left front fender   | to 150                                                            |
| 3                      | Left front pillar   | to 150                                                            |
| 4                      | Left front wall     | to 150                                                            |
| 5                      | Roof                | to 150                                                            |
| 6                      | Left middle pillar  | to 150                                                            |
| 7                      | Left side sill      | to 150                                                            |
| 8                      | Left rear wall      | to 150                                                            |
| 9                      | Left side wall      | to 150                                                            |
| 11                     | Side right wall     | to 150                                                            |
| 12                     | Rear right door     | to 150                                                            |
| 13                     | Middle right pillar | to 150                                                            |
| 14                     | Front right door    | to 150                                                            |
| 15                     | Right side sill     | to 150                                                            |
| 16                     | Right front pillar  | to 150                                                            |
| 17                     | Right front fender  | to 150                                                            |

Description of the technical condition

A detailed description of the technical condition contains in Description of the technical condition attached to following expertise.

General comments - regarding valuation**Vehicle documents**

During the inspection the registration proof of the vehicle was presented and its photo was taken and enclosed to the expertise.

During the inspection the service book of the vehicle was not provided.

**Information concerning the origin of the vehicle**

The vehicle purchased domestically from an authorized representative of the brand.

**Additional comments on the car:**

Not applicable.

**Test drive**

Test drive of the vehicle was conducted. Test drive in the full extent is not possible. Comment below:

.

**Checking of the correctness and / or construction of identification / serial numbers of the object:**

Not tested

**Verification of the accuracy of the object data, including year of production, and other.**

Not conducted - adopted according to the documents presented and indicated sources.

**Anti-theft protection**

immobiliser

- The read odometer status has not been verified with records in electronic equipment of the vehicle.
- This expertise is used exclusively to estimate the market value of the item pricing and can not be used for any purpose other than those mentioned above.
- An expert assumes no responsibility for hidden defects (legal and physical) and the possible consequences arising from the continuing use of the subject of valuation, and for the consequences of using the same valuation.
- The above pricing is not an expertise of the technical condition of the subject of valuation and as such can not be considered, in particular, can not be treated as a guarantee for the sales subject of the valuation for estimated value.
- This evaluation may not be published as whole in any document without consent of its executors and without their consent as to the form and contents of such publication.
- The evaluation has been carried out basing on delivered documentation and organoleptic examination of the assessed object. No diagnostic examination has been carried out, nor any workshop verification of the assessed object.
- This expertise has been issued basing on inspection of the assessed object in conditions ruling in its availability location.

Comments to the commission - regarding valuation**Kluczyki**

TAK

2

Expert comments - regarding valuation

Widoczne ślady użytkowania pojazdu: drobne rysy, odpryski, wgniecenia, zaplamienia.

Restrictive disclaimer - regarding valuation

- W Ocenie/Raporcie uwzględniono niesprawności, uszkodzenia, braki itp., które były możliwe do stwierdzenia organoleptycznego, w warunkach oględzin (z uwzględnieniem: stanu czystości pojazdu, warunków atmosferycznych, oświetlenia itd.) oraz bez weryfikacji serwisowej, bez dostępu do spodu pojazdu, bez specjalistycznego sprzętu diagnostycznego (w tym bez diagnostyki komputerowej), bez jazdy próbnej wykonanej w warunkach drogowych z obciążeniem.
- W ramach Oceny/Raportu nie weryfikowano odczytanego stanu drogomierza z zapisami w urządzeniach elektronicznych pojazdu.
- Rzeczoznawca nie bierze na siebie odpowiedzialności za wady ukryte (prawne i fizyczne) oraz ewentualne skutki wynikające z dalszego użytkowania przedmiotu oceny, a także za skutki wykorzystania samej oceny.
- Podane przedziały grubości powłoki lakierowej, dotyczą punktów pomiarowych. Nie mogą być traktowane jako gwarancja, że grubość powłoki lakierowej w innych punktach nie wykracza poza te przedziały.
- Zawarte w niniejszej Ocenie/Raporcie informacje (w tym dotyczące wyposażenia) służą jedynie ogólnym celom informacyjnym. Ocena/Raport nie może być zatem traktowana jako oferta w rozumieniu przepisów Kodeksu Cywilnego oraz opisu towaru ani zapewnienia w rozumieniu art. 4 Ustawy z dnia 27 lipca 2002 roku o szczególnych warunkach sprzedaży konsumenckiej.
- Niniejsza Ocena/Raport nie jest szczegółową oceną stanu technicznego.

Ocenę/Raport wykonano w kierunku ujawnienia uszkodzeń nieakceptowanych z punktu widzenia właściwego przewodnika zwrotu pojazdu lub innych ustaleń ze Zleceniodawcą. Tym samym Ocena/Raport może nie ujmować typowych zużyć i uszkodzeń eksploatacyjnych.

PHOTOGRAPHIC DOCUMENTATION



**Photo 1.**  
Przekątna przednia lewa



**Photo 2.**  
Przód

PHOTOGRAPHIC DOCUMENTATION



**Photo 3.**

Przekątna przednia prawa



**Photo 4.**

Bok prawy z przodu

PHOTOGRAPHIC DOCUMENTATION



**Photo 5.**  
Bok prawy z tyłu



**Photo 6.**  
Przekątna tylna prawa

PHOTOGRAPHIC DOCUMENTATION



**Photo 7.**

Tył



**Photo 8.**

Przekątna tylna lewa

PHOTOGRAPHIC DOCUMENTATION



**Photo 9.**

Bok lewy z tyłu



**Photo 10.**

Bok lewy z przodu

PHOTOGRAPHIC DOCUMENTATION



**Photo 11.**  
Próg lewy (widok od przodu)



**Photo 12.**  
Próg prawy (widok od przodu)

PHOTOGRAPHIC DOCUMENTATION



**Photo 13.**  
Spód pojazdu przód



**Photo 14.**  
Spód pojazdu tył

PHOTOGRAPHIC DOCUMENTATION



**Photo 15.**

Tarcza hamulcowa przednia prawa



**Photo 16.**

Tarcza hamulcowa tylna prawa

PHOTOGRAPHIC DOCUMENTATION



**Photo 17.**

Tarcza hamulcowa tylna lewa



**Photo 18.**

Tarcza hamulcowa przednia lewa

PHOTOGRAPHIC DOCUMENTATION



**Photo 19.**  
Bagażnik



**Photo 20.**  
Koło zapasowe

PHOTOGRAPHIC DOCUMENTATION



**Photo 21.**  
Komora silnika



**Photo 22.**  
Numer identyfikacyjny

PHOTOGRAPHIC DOCUMENTATION



**Photo 23.**  
Tabliczka znamionowa



**Photo 24.**  
Zestaw wskaźników - przebieg

PHOTOGRAPHIC DOCUMENTATION



**Photo 25.**

Zestaw wskaźników - serwis



**Photo 26.**

Widok przez otwarte drzwi przednie lewe

PHOTOGRAPHIC DOCUMENTATION



**Photo 27.**

Kierownica z lewej strony



**Photo 28.**

Widok przez otwarte drzwi tylne lewe

PHOTOGRAPHIC DOCUMENTATION



**Photo 29.**

Widok z tylnej kanapy na deskę rozdź.



**Photo 30.**

Konsola środkowa

PHOTOGRAPHIC DOCUMENTATION



**Photo 31.**  
Zdjęcie do protokołu



**Photo 32.**  
Tunel środkowy

PHOTOGRAPHIC DOCUMENTATION

**Photo 33.**  
Kierownica (na wprost)



**Photo 34.**  
Dowód rej. Str. 1

PHOTOGRAPHIC DOCUMENTATION



**Photo 35.**  
Dow. Rej. Str. 2



**Photo 36.**  
Kluczyki

PHOTOGRAPHIC DOCUMENTATION



**Photo 37.**  
Instrukcje



**Photo 38.**  
Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



**Photo 39.**

Zdjęcie do protokołu



**Photo 40.**

Zdjęcie do protokołu

PHOTOGRAPHIC DOCUMENTATION



**Photo 41.**

Pokrywa komory silnika - Rysa/odprysk 1



**Photo 42.**

Pokrywa komory silnika - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



**Photo 43.**


Szyba czołowa - zdjęcie poglądowe 1



**Photo 44.**

Szyba czołowa - zdjęcie poglądowe 2

PHOTOGRAPHIC DOCUMENTATION

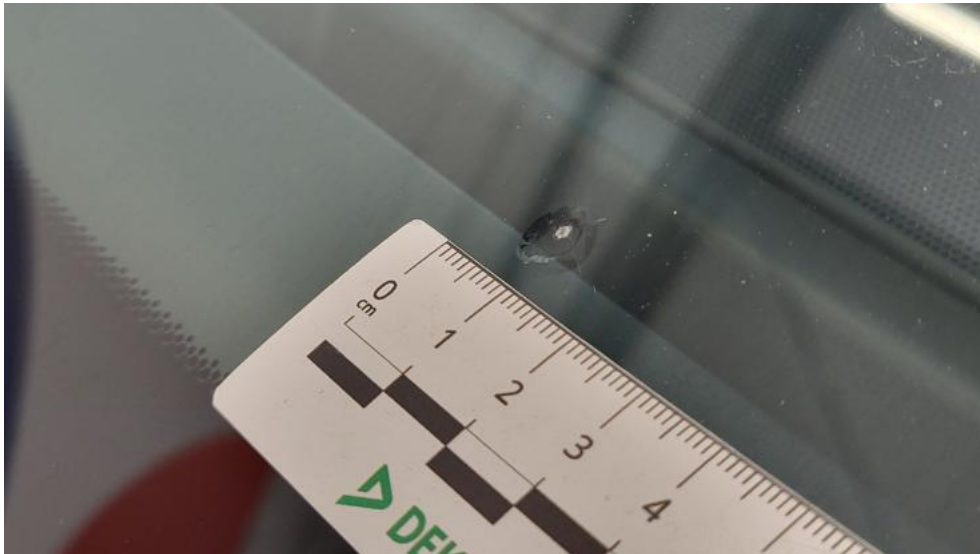

**Photo 45.**

Szyba czołowa - Pęknięcie/rozerwanie 1



**Photo 46.**

Szyba czołowa - Pęknięcie/rozerwanie 2

PHOTOGRAPHIC DOCUMENTATION



**Photo 47.**

Zderzak - Rysa/odprysk 1



**Photo 48.**

Zderzak - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



**Photo 49.**

Drzwi przednie P - zdjęcie poglądowe 1



**Photo 50.**

Drzwi przednie P - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



**Photo 51.**

Drzwi przednie P - Wgniecenie/odkształcenie 1



**Photo 52.**

Drzwi przednie P - Inne 1

PHOTOGRAPHIC DOCUMENTATION



**Photo 53.**

Drzwi tylne P - Rysa/odprysk 1



**Photo 54.**

Drzwi tylne P - Rysa/odprysk 2

PHOTOGRAPHIC DOCUMENTATION



**Photo 55.**


Pokrywy bagażnika - Inne 1



**Photo 56.**

Zderzak tylny - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION

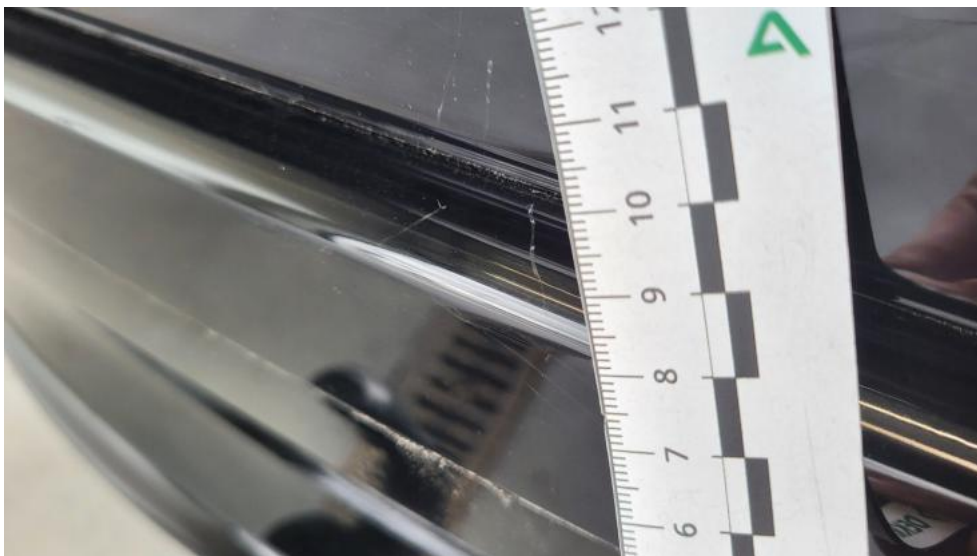

**Photo 57.**

Zderzak tylny cz dolna - Rysa/odprysk 1



**Photo 58.**

Felga aluminiowa tylna L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



**Photo 59.**

Drzwi przed L - zdjęcie poglądowe 1



**Photo 60.**


Drzwi przed L - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



**Photo 61.**

Drzwi przed L - Wgniecenie/odkształcenie 1

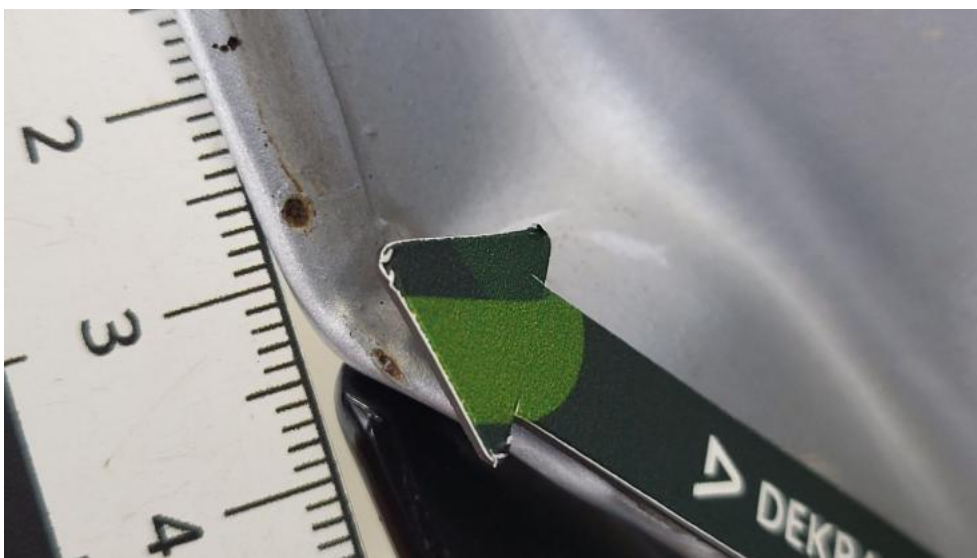

**Photo 62.**

Drzwi przed L - Inne 1

PHOTOGRAPHIC DOCUMENTATION



**Photo 63.**

Drzwi tylne L - Rysa/odprysk 1



**Photo 64.**


Drzwi tylne L - Wgniecenie/odkształcenie 1

PHOTOGRAPHIC DOCUMENTATION



**Photo 65.**

Drzwi tylne L - Wgniecenie/odkształcenie 2

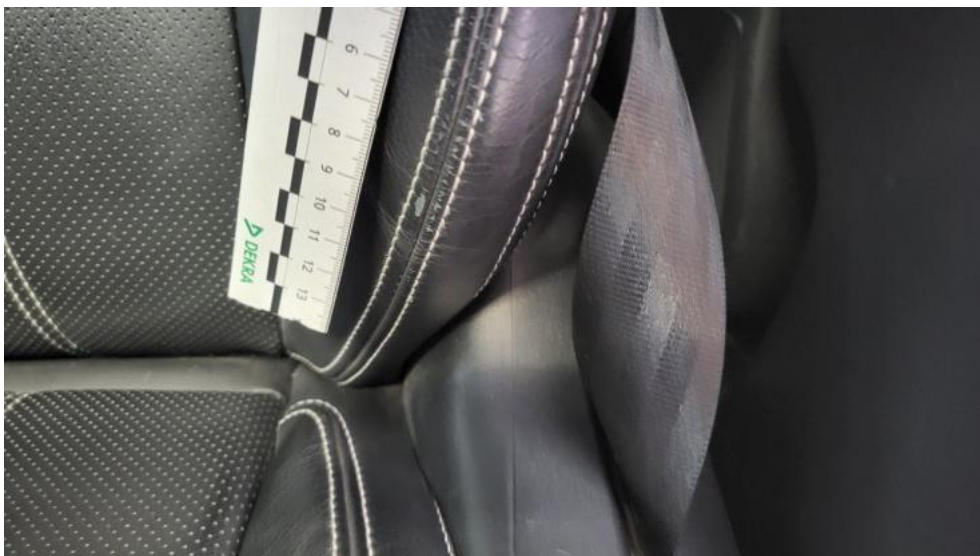

**Photo 66.**

Fotel prz. lew. - Rysa/odprysk 1

PHOTOGRAPHIC DOCUMENTATION



**Photo 67.**

Tapicerka drzwi tylnych L - Rysa/odprysk 1



**Photo 68.**

Wykładzina(y) słupka środkowego P - Rysa/odprysk 1